


Report

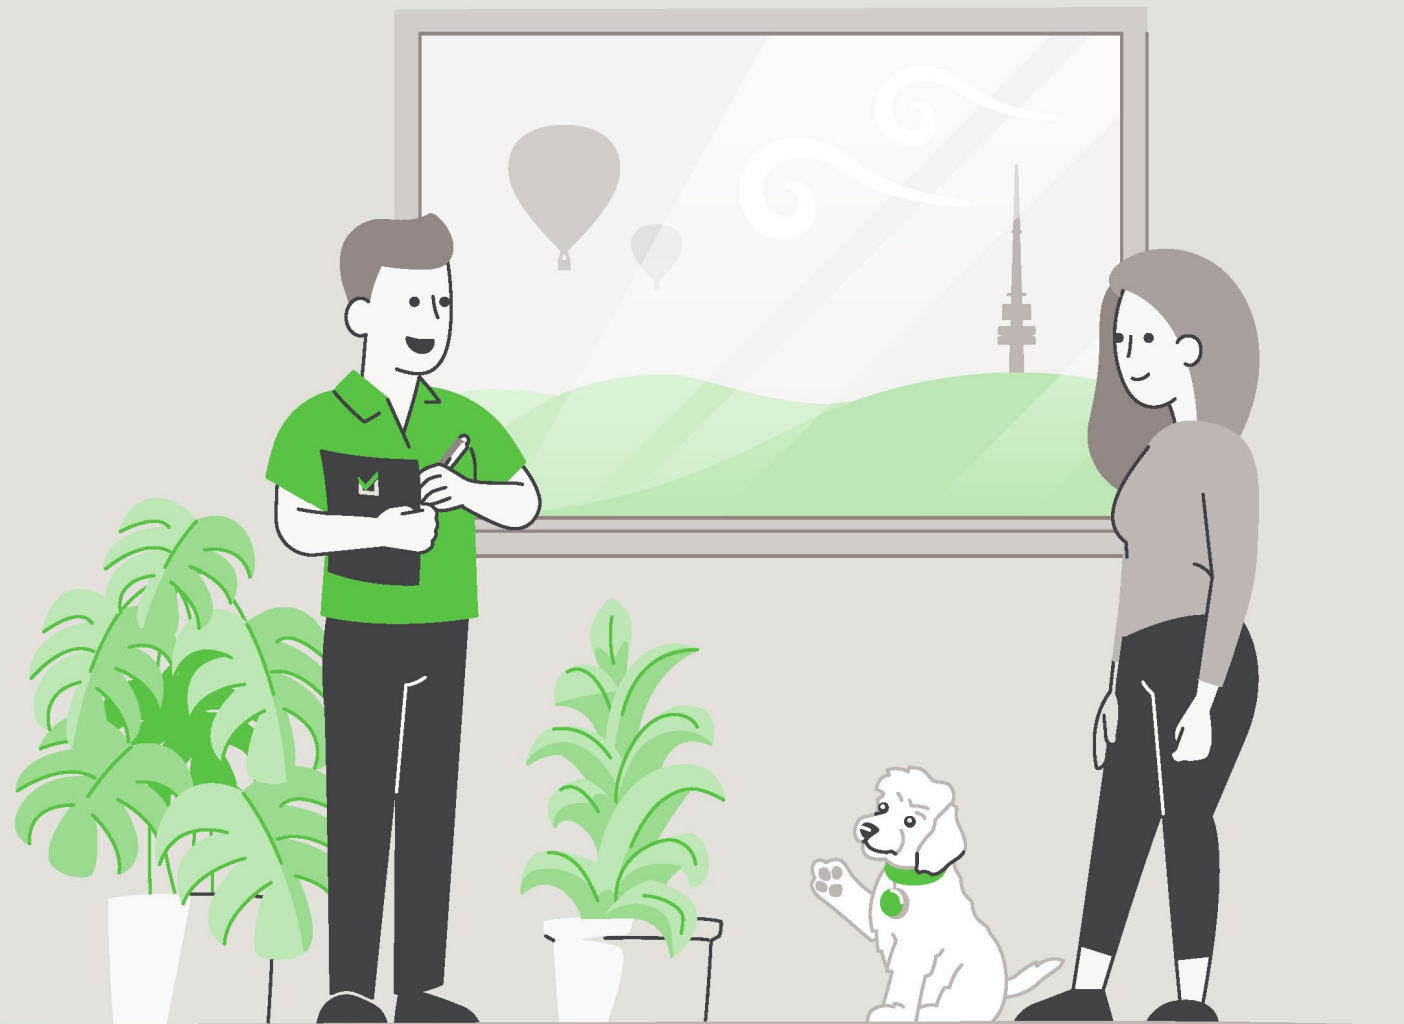

LIMITED LIABILITY TO A PURCHASER WITHIN THE AUSTRALIAN CAPITAL TERRITORY

This Report is made solely for the use and benefit of the Client. The Consultant is not liable for any reliance placed on this report by any third party. However, within the ACT only and in accordance with the Civil Law (Sale of Residential Property) Act 2003 and the Civil Law (Sale of Residential Property) Regulations 2004, a copy of the report must be attached to the Contract for Sale and may in certain circumstances be relied upon by the Purchaser of residential property.

The circumstances in which a Purchaser of residential property within the ACT may rely on this report in respect of the state of the property at the time of the inspection are as follows:

- (a)** The inspection was carried out no earlier than three months before the day the property was first advertised or offered for sale or listed by an agent; and
- (b)** The date on which the contract was entered into was not more than 180 days after the date of the inspection.
- (c)** The report is provided to the Purchaser prior to or at the time the Contract for Sale is entered into between the Purchaser and vendor.
- (d)** The service requested is the Standard Inspection Report.

Building Report



CONCLUSION AND SUMMARY

The purpose of the Inspection is to identify the major defects and safety hazards associated with the property at the time of the Inspection. The Inspection and reporting are limited to a visual assessment of the Building Members in accord with Appendix C AS4349.1-2007.

The overall condition of this building has been compared to similar constructed buildings of approximately the same age where those buildings have had a maintenance program implemented to ensure that the building members are still fit for purpose.

The incidence of Major Defects in this Residential Building as compared with similar Buildings is considered: **Low**

The incidence of Minor Defects in this Residential Building as compared with similar Buildings is considered: **Low**

The overall condition of this Residential Dwelling in the context of its age, type and general expectations of similar properties is: **Above Average**

Please Note: This is a general appraisal only and cannot be relied upon on its own – read the Report in its entirety.

This Summary is supplied to allow a quick and superficial overview of the Inspection results. This Summary is NOT the Report and cannot be relied upon on its own. This Summary must be read in conjunction with the full Report and not in isolation from the Report. If there should happen to be any discrepancy between anything in the Report and anything in this Summary, the information in the Report shall override that in this Summary.

PROPERTY STATISTICS

Building Report	Above Average
Compliance Report	Please read full compliance report section of the report
Pest Inspection	No active subterranean termites (live specimen) were found
Energy Efficiency Rating	1.5 Stars
Inspection Date	Thursday, May 7 th 2026
Name of Assessor	Ned Strickland
Reference Number	68121
Address of Property Inspected	97 Fitchett Street, Garran ACT 2605
Client	Hutchinson
Block and Section	Block 29 Section 8 GARRAN
Year original residence COU was issued	1972
Block size (approximately)	910m ²
House size (approximately)	Upper Level: 194.45m ² Lower Level: 67.00m ² Garage: 55.00m ² Total: 316.45m ²
Weather conditions at time of Inspection	Fine
Occupancy Status	Unoccupied (furnished/styled)

*The table above is to be used as a quick reference. Please read the full Report before reaching your conclusion regarding the condition of the Property.

Whilst every care has been taken to ensure the accuracy of the property house and block size, we accept no responsibility for any inaccuracies as supplying this information exceeds a standard building inspection under AS4349.1-2007.

PROPERTY CONSTRUCTION DETAILS

Flooring	Concrete and timber flooring
External walls	Double brick
Roof framing	Timber: Conventionally pitched roof framing
Roof cladding	Concrete roof tiles
Glazing	Single glazed windows
Cooktop	Electric cooktop
Oven	Electric oven
Dishwasher	Bosch

*Whilst every care has been taken to ensure the accuracy of the property construction details, we accept no responsibility for any inaccuracies of construction details or testing of appliances.

GENERAL ACCESS LIMITATIONS

Internal	At the time of inspection, the building was furnished. This allows for a limited inspection in areas not restricted by furnishings, stored goods, floor mats, etc.
External	No inspection was made to sections of the residence and/or structures built on the side boundary
Roof void	NOTE. Inspection around the eaves was restricted due to low pitch and clearance to allow bodily access in this area. This allows only for a limited visual inspection from a distance to be carried out. Other restrictions found in the roof void: Insulation on top of ceiling restricting visual inspection of the ceiling framing
Subfloor	The visual inspection of the subfloor framing was restricted in areas due to stored items restricting access and underfloor insulation installed.
On-top of roof	The inspection was restricted to visually looking from a 3.6m ladder lent against the gutter in several areas around the building
Garage	The inspection of the garage was restricted due to stored goods being kept in the area at the time of inspection

*Where access is noted as limited or restricted, it is recommended that access be gained to these areas as these areas may contain concealed defects.

DEFINITIONS

Good	The item is in the Inspector's opinion of an acceptable standard with no defects visible. Superficial defects will not be commented on
Fair	The item in the Inspector's opinion has some minor defects and requires minimal maintenance or repair
Poor	The item in the Inspector's opinion needs significant repair or replacement

ENTRANCE

Ceiling	Good
Walls	Minor cracking was noted above the door. This is caused through normal building movement and is not considered to be excessive cracking
Door and door hardware	Good
Floor coverings	Good

LOUNGE ROOM

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good

FAMILY ROOM

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good

KITCHEN/DINING ROOM

Ceiling	Good
Walls	Good
Floor coverings	Good
Kitchen cupboards	Fair/serviceable condition
Bench top	Fair/serviceable condition. There are some marks and signs of general wear
Splashback	The silicone joint between the bench top and the bottom of the splashback requires re-application. This is part of normal ongoing maintenance
Exhaust fan	The exhaust fan was operational at the time of inspection

HALLWAY

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Linen cupboard	Good

SEWING ROOM

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good

RUMPUS ROOM

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good

BEDROOM 1

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Wardrobe	Good

BEDROOM 2

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Wardrobe	Good

BEDROOM 3

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Wardrobe	Good

ENSUITE

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Shower screen	Good
Water leakage in shower area?	There was no water leakage detected
Floor and wall tiles in shower area	Good
Vanity/Basin	Good
Taps	Good
Toilet suite	Good
Exhaust fan	The exhaust fan was operational at the time of inspection

BATHROOM

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Shower screen	Good
Water leakage in shower area?	There was no water leakage detected
Floor and wall tiles in shower area	Good
Vanity/Basin	Good
Taps	Good
Bath	Good
Exhaust fan	The exhaust fan was operational at the time of inspection

TOILET

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Toilet suite	Good
Exhaust fan	The exhaust fan was operational at the time of inspection

LAUNDRY

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Several loose/drummy skirting tiles noted. Recommend repairs by a qualified tradesperson.
Laundry tub	Good
Splashback	Good
Exhaust fan	An exhaust fan is not installed; however, ventilation is provided to the room by opening the window

ROOF CAVITY

Construction	Good
--------------	------

SUBFLOOR

Subfloor soil conditions	The subfloor soil was generally dry at the time of inspection
Ventilation	Restricted due to the construction type of the house (brick cavity), with internal brick walls in the subfloor region minimising cross ventilation
Floor structure	Good
Access door to subfloor area	Good

EXTERIOR

Driveway and paths	Good. No major cracking noted
Roof covering	Good
Roof pointing	Good
Roof flashings	Good
Eaves	Good
Fascia	Good
Gutters	Good. The gutters appear to be in functional condition
External walls	Good. No major cracking noted
Windows	Good
Fences	Good
Gate	Good
Front Terrace	The handrails have been constructed lower than 1m in height. Although the handrails were compliant at the time of the initial construction, consideration should be given to raising the handrail height to 1m or above to eliminate the fall potential
Pergola	Good
Rear timber shed	The roof covering drains towards the neighbouring property and appears to be encroaching the boundary. Recommend rectification works
Retaining walls	Some minor cracking was found in the retaining walls. The walls are still retaining the ground behind the wall adequately. Apart from monitoring, no action is required. Recommend installing an approved handrail to the front stone retaining wall to prevent a fall in areas where the fall potential is greater than 1m in height

EXTERIOR – CONTINUED

Pool/Spa safety	As the location of the pool fence does not match the approved plans, recommend certifier assessment and approval to ensure there are no potential safety hazards
Site drainage	The site generally drains away from the perimeter of the building

EXTERNAL CHANGE ROOM

Structure	Good
Ceiling	Good
Walls	Various areas of minor cracking noted in the external walls. The cracking found was not of major structural significance
Door and door hardware	Good
Floor coverings	Good
Shower screen	Good
Floor and wall tiles in the shower area	Good
Vanity/basin	Good
Taps	Good

GARAGE

Slab	Good. No major cracking noted
Ceiling	Good
Walls	Various areas of minor cracking noted in the external walls. The cracking found was not of major structural significance
Garage door	Good
Is an auto opener installed on the roller door?	Yes
Access door	Good

DEFINITIONS

Above Average: The overall condition is above that consistent with dwellings of approximately the same age and construction. Most items and areas are well maintained and show a reasonable standard of workmanship when compared with buildings of similar age and construction.

Average: The overall condition is consistent with dwellings of approximately the same age and construction. There will be areas or items requiring some repair or maintenance.

Below Average: The Building and its parts show some significant defects and/or very poor non-tradesman like workmanship and/or long-term neglect and/or defects requiring major repairs or reconstruction of major building elements.

Client: The person or persons, for whom the Inspection Report was carried out or their Principal (i.e., the person or persons for whom the report is being obtained).

Building Consultant: A person, business or company who is qualified and experienced to undertake a pre-purchase inspection in accordance with Australian Standard AS 4349.1-2007 'Inspection of Buildings. Part 1: Pre-Purchase Inspections – Residential Buildings'. The consultant must also meet any Government licensing requirement, where applicable.

Building & Site: The inspection of the nominated residence together with relevant features including any car accommodation, detached laundry, ablution facilities and garden sheds, retaining walls more than 700 mm high, paths and driveways, steps, fencing, earth, embankments, surface water drainage and storm water run-off within 30 m of the building, but within the property boundaries. In the case of strata and company title properties, the inspection is limited to the interior and immediate exterior of the nominated residence and does not include inspection of common property.

Readily Accessible Areas: Areas which can be easily and safely inspected without injury to person or property, are up to 3.6 metres above ground or floor levels or accessible from a 3.6 metre ladder, in roof spaces where the minimum area of accessibility is not less than 600 mm high by 600 mm wide and subfloor spaces where the minimum area of accessibility is not less than 400 mm high by 600 mm wide, providing the spaces or areas permit entry. Or where these clearances are not available, areas within the consultant's unobstructed line of sight and within arm's length.

Structure: The loadbearing part of the building, comprising the Primary Elements.

Primary Elements: Those parts of the building providing the basic loadbearing capacity to the Structure, such as foundations, footings, floor framing, loadbearing walls, beams, or columns. The term 'Primary Elements' also includes other structural building elements including those that provide a level of personal protection such as handrails; floor-to-floor access such as stairways; and the structural flooring of the building such as floorboards.

Secondary Elements: Those parts of the building not providing loadbearing capacity to the Structure, or those non-essential elements which, in the main, perform a completion role around openings in Primary Elements and the building in general such as non-loadbearing walls, partitions, wall linings, ceilings, chimneys, flashings, windows, glazing or doors.

Finishing Elements: The fixtures, fittings and finishes applied or affixed to Primary Elements and Secondary Elements such as baths, water closets, vanity basins, kitchen cupboards, door furniture, window hardware, render, floor, and wall tiles, trim or paint. The term 'Finishing Elements' does not include furniture or soft floor coverings such as carpet and lino.

Major Defect: A defect of significant magnitude where rectification has to be carried out in order to avoid unsafe conditions, loss of utility or further deterioration of the property.

Minor Defect: A defect other than a Major Defect.

Safety Hazard: Any item that may constitute an immediate or imminent risk to life, health, or property. Occupational, health and safety or any other consequence of these hazards has not been assessed.

Tests: Where appropriate the carrying out of tests using the following procedures and instruments:

Dampness Tests means additional attention to the visual examination was given to those accessible areas which the consultant's experience has shown to be particularly susceptible to damp problems. Instrument testing using electronic moisture detecting meter of those areas and other visible accessible elements of construction showing evidence of dampness was performed.

Physical Tests means the following physical actions undertaken by the consultant: opening and shutting of doors, windows and draws; operation of taps; water testing of shower recesses; and the tapping of tiles and wall plaster.

IMPORTANT ADVICE

NB. In the case of strata and company title properties, the Inspection is limited to the interior and immediate exterior of the particular unit being inspected. The exterior above ground floor level is not inspected. The complete Inspection of other common property areas would be the subject of a Special-Purpose Inspection Report which is adequately specified.

Trees: Where trees are too close to the house this could affect the performance of the footing as the moisture levels change in the ground. A Geotechnical Inspection can determine the foundation material and provide advice on the best course of action with regards to the trees.

The Septic Tanks: Should be inspected by a licensed plumber.

Swimming Pools: Swimming Pools/Spas are not part of the Standard Building Report under AS4349.1-2007 and are not covered by this Report. We strongly recommend a pool expert should be consulted to examine the pool and the pool equipment and plumbing, as well as the requirements to meet the standard for pool fencing. Failure to conduct this Inspection and put into place the necessary recommendations could result in finds for non-compliance under the legislation.

Surface Water Drainage: The retention of water from surface run off could have an effect on the foundation material which in turn could affect the footings to the house. Best practice is to monitor the flow of surface water during rainfall and stormwater runoff and have the water directed away from the house or to storm water pipes by a licensed plumber/drainier.

Weep Holes: External brick (and stone) walls are a porous material that behave much like a sponge. During a rain event, the masonry wall absorbs water and actually stores it. The weep holes are designed for two purposes. 1. To provide an opening to allow water to drain out through the bottom of the wall. 2. To allow ventilating air to enter behind the wall to help dry the structure. If weep holes have been noted as being not installed, it is recommended to consult a builder on how to best rectify the problem.

Water Leaks from Roof: The inspector cannot, and does not, offer an opinion on whether the roof currently leaks or may be subject to future leaks. The only way to determine whether a roof is absolutely watertight is to make observations during prolonged rainfall.

Subfloor dampness: The presence of dampness is not always consistent as the prevailing and recent weather conditions at the time an inspection is carried out may affect the detection of damp problems. The absence of any dampness at the time of inspection does not necessarily mean the building will not experience some damp problems in other weather conditions. Likewise, whether or not services have been used for some time prior to an inspection being carried out will affect the detection of dampness.

Shower: Where a shower recess has been water tested, and no leakage was evident, this does not necessarily mean that the shower will not leak after prolonged use. Accordingly, to fully detect and assess a damp problem may require the monitoring of the building over a period of time.

SCOPE AND LIMITATIONS

Any person who relies upon the contents of this Report does so acknowledging that the following clauses, which define the Scope and Limitations of the Inspection, form an integral part of the Report.

1) This Report is not an all-encompassing Report dealing with the building from every aspect. It is a reasonable attempt to identify any obvious or significant defects apparent at the time of the Inspection. Whether or not a defect is considered significant or not, depends to a large extent upon the age and type of the building inspected. This Report is not a Certificate of Compliance with the requirements of any Act, Regulation, Ordinance or By-law. It is not a structural Report. Should you require any advice of a structural nature you should contact a structural engineer.

2) This is a visual Inspection only, limited to those areas and sections of the property fully accessible and visible to the Inspector on the date of Inspection. The Inspection DID NOT include breaking apart, dismantling, removing, or moving objects including, but not limited to, foliage, mouldings, roof insulation/sisalation, floor or wall coverings, sidings, ceilings, floors, furnishings, appliances, or personal possessions. The inspector CANNOT see inside walls, between floors, inside skillion roofing, behind stored goods in cupboards and other areas that are concealed or obstructed. The inspector DID NOT dig, gouge, force or perform any other invasive procedures. Visible timbers CANNOT be destructively probed or hit without the written permission of the property owner.

3) This Report does not and cannot make comment upon: Defects that may have been concealed; the assessment or detection of defects (including rising damp and leaks) which may be subject to the prevailing weather conditions; whether or not services have been used for some time prior to the Inspection and whether this will affect the detection of leaks or other defects (e.g. In the case of shower enclosures the absence of any dampness at the time of the inspection does not necessarily mean that the enclosure will not leak); the presence or absence of timber pests; gas-fittings; common property areas; environmental concerns; the proximity of the property to flight paths, railways, or busy traffic; noise levels; health and safety issues; heritage concerns; security concerns; fire protection; site drainage (apart from **surface** water drainage); swimming pools and spas (non-structural); detection and identification of illegal building work; detection and identification of illegal plumbing work; durability of exposed finishes; neighbourhood problems; document analysis; electrical installation; any matters that are solely regulated by statute; any area(s) or item(s) that could not be inspected by the consultant.

Accordingly, this Report is NOT a guarantee that defects and/or damage does not exist in any inaccessible or partly inaccessible areas or sections of the property.

NB. Such matters may, upon request, be covered under the terms of a 'Special-Purpose Property Report'.

4) Consumer Complaints Procedure: In the event of any dispute or claim arising out of, or relating to the Inspection or the Report, you must notify us as soon as possible of the dispute or claim by email, fax, or mail. You must allow us (which includes persons nominated by us) to visit the property (which visit must occur within twenty eight (28) days of your notification to us) and give us full access in order that we may fully investigate the complaint. You will be provided with a written response to your dispute or claim within twenty-eight (28) days of the date of the Inspection.

If you are not satisfied with our response, you must within twenty one (21) days of your receipt of our written response, refer the matter to a Mediator nominated by us from the Institute of Arbitrators and Mediators of Australia. The cost of the Mediator will be borne equally by both parties, and as agreed as part of the mediated settlement.

Should the dispute or claim not be resolved by mediation, then the dispute or claim will proceed to arbitration. The Institute of Arbitrators and Mediators of Australia will appoint an Arbitrator who will hear and resolve the dispute. The arbitration, subject to any directions of Arbitrator, will proceed in the following manner:

(a) The parties must submit all written submissions and evidence to the Arbitrator within twenty one (21) days of the appointment of the Arbitrator; and

(b) The arbitration will be held within twenty one (21) days of the Arbitrator receiving the written submissions.

The Arbitrator will make a decision determining the dispute or claim within twenty one (21) of the final day of the arbitration. The Arbitrator may, as part of his determination, determine what costs, if any, each of the parties are to pay and the time by which the parties must be paid any settlement or costs.

The decision of the Arbitrator is final and binding on both parties. Should the Arbitrator order either party to pay any settlement amount or costs to the other party but not specify a time for payment, then such payment shall be made within twenty one (21) days of the order.

NB. In the event that you do not comply with the above Complaints Procedure and commence litigation against us, then you agree to fully indemnify us against any awards, costs, legal fees, and expenses incurred by us in having your litigation set aside or adjourned to permit the foregoing Complaints Procedure to complete.

5) Asbestos Disclaimer: “No Inspection for Asbestos was carried out at the property, and no Report on the presence or absence of Asbestos is provided”.

Buildings built prior to 1982 may have wall and/or ceiling sheeting, and other products including roof sheeting that contains Asbestos. Even buildings built after this date, up until the early 90s, may contain some Asbestos. Sheeting should be fully sealed. If you are concerned, the building was built prior to 1990, or if asbestos is noted as present within the property, then you should seek advice from a qualified asbestos removal expert as to the amount and importance of the asbestos present and the cost of sealing or removal. Drilling, cutting, or removing sheeting or products containing Asbestos is a high risk to peoples’ health. You should seek advice from a qualified asbestos removal expert.

6) Mould (Mildew and non-wood decay fungi) Disclaimer: Mildew and non-wood decay fungi are commonly known as mould. However, mould and their spores may cause health problems or allergic reactions, such as asthma and dermatitis in some people. No Inspection for mould was carried out at the property, and no Report on the presence or absence of mould is provided. If mould is noted as present within the property, or if you notice mould and you are concerned as to the possible health risk resulting from its presence, then you should seek advice from your local Council, State or Commonwealth Government Health Department, or a qualified expert such as an Industry Hygienist.

7) Magnesite Flooring Disclaimer: No Inspection for Magnesite Flooring was carried out at the property, and no Report on the presence or absence of Magnesite Flooring is provided. You should ask the owner whether Magnesite Flooring is present and/or seek advice from a Structural Engineer.

8) Estimating Disclaimer: Any estimates provided in this Report are merely opinions of possible costs that could be encountered, based on the knowledge and experience of the inspector, and are not estimates in the sense of being a calculation of the likely costs to be incurred. The estimates are NOT a guarantee or quotation for work to be carried out. The actual cost is ultimately dependent upon the materials used, standard of work carried out, and what a contractor is prepared to do the work for. It is recommended in ALL instances that multiple independent quotes are sourced prior to any work being carried out. The inspector accepts no liability for any estimates provided throughout this Report.

9) Note: If the Client has any doubt about the purpose, scope, and acceptance criteria on which the Report was based please discuss your concerns with the Consultant on receipt of the Report. The Client acknowledges that, unless stated otherwise, the Client as a matter of urgency should implement any recommendation or advice given in this Report.

IMPORTANT DISCLAIMER

Disclaimer Liability: No Liability shall be accepted on an account of failure of the Report to notify any problems in the area(s) or section(s) of the subject property physically inaccessible for Inspection, or to which access for Inspection is denied by or to the Inspector (including but not limited to or any area(s) or section(s) so specified by the Report).

Disclaimer of Liability to Third Parties: Compensation will only be payable for losses arising in contract or tort sustained by the Client named on the front of this Report. Any third party acting or relying on this Report, in whole or in part, does so entirely at their own risk. However, if ordered by a Real Estate Agent or a Vendor for the purpose of auctioning a property, then the Inspection Report may be ordered up to seven (7) days prior to the auction, copies may be given out prior to the auction and the Report will have a life of 14 days during which time it may be transferred to the purchaser. Providing the purchaser agrees to the terms of this agreement, then they may rely on the Report subject to the terms and conditions of this agreement and the Report itself.

NB. In the ACT under the Civil Law (Sale of Residential Property) Act 2003 and Regulations, the Report resulting from this Inspection may be passed to the purchaser as part of the sale process, providing it is carried out no more than three months prior to listing and is not more than six months old.

Limited Liability to a Purchaser within the Australian Capital Territory only: Within the Australian Capital Territory (ACT) and in accordance with the ACT Civil Law (Sale of Residential Property) Act 2003 and Regulations, a copy of the Report may be attached to the Contract for Sale.

WARNING: The Purchaser is advised that this Report reflects the condition of the property existing at the time of the Inspection (Inspection Date) and may not reflect the current state. It is, therefore, very strongly recommended that you promptly arrange for another Inspection and Report in accordance with Australian Standard AS4349.1 to be carried out prior to the expiration of the 'Cooling off Period' and settlement.

This is not a Compliance Report strictly in accordance with Civil Law (Sale of Residential Property) Regulations: The Report may contain copies of any approved plans, building approvals, building permit and Certificates of Occupancy. However, any comments made by the person who prepared the Report as to whether or not, in the opinion of the Inspector, the structures on the land substantially comply with the approved plans (if any) are made on the basis of a cursory glance of the plans and not upon a detailed examination. Any opinion expressed as to whether or not any building approval or approval under the Land (Planning and Environment) Act, 1991, is based on the limited knowledge and belief, at the time, of the Inspector. The Purchaser is advised that a Special Purpose Report is available through the Inspector to advise more fully in respect to these matters. The structures may have been damaged by pests, storm, strong wind or fire or the Vendor may have carried out alterations and/or additions to the Property since the Inspection Date. The Report may no longer reflect the true condition of the Property. The structure(s) may no longer be in accordance with the attached plans etc. IT IS STRONGLY RECOMMENDED that, if the Purchaser has any concerns in respect to the compliance of the structures, a Special Purpose Report be obtained. Alternatively, the Purchaser should rely upon his, her or their own enquiries.

Contact the Inspector: Please feel free to contact the Inspector who carried out this Inspection. Often it is very difficult to fully explain situations, problems, access difficulties, building faults or their importance in a manner that is readily understandable by the reader. Should you have any difficulty in understanding anything contained within this Report, then you should immediately contact the Inspector and have the matter explained to you. If you have any questions at all, or require any clarification, then contact the Inspector prior to acting on this Report.

OTHER INSPECTIONS AND REPORTS REQUIRED

It is strongly recommended that the following Inspections and Reports be obtained prior to any decision to purchase the Property. Obtaining these Reports will better equip the purchaser to make an informed decision. Although appliances may be listed in the Report, they have not been tested as this is outside the scope of the standard Building Inspection. Other Inspections we recommend the purchaser obtains before making their decision are:

- Electrical Inspection,
- Plumbing Inspection,
- Structural (Engineer),
- Geotechnical Inspection,
- Drainage Inspection,
- Asbestos Inspection,
- Mould Inspection,
- Gas fitting Inspection,
- Appliances Inspection,
- Air-conditioning Inspection,
- Alarm/Intercom/Data Systems,
- Hydraulics Inspection,
- Mechanical Services,
- Hazards Inspection,
- Fire/Chimney Inspection,
- Estimating Report,
- Garage Door Mechanical,
- Durability exposed surfaces

SMOKE DETECTORS

The occupier/purchaser should satisfy themselves as to the working condition of the smoke detectors, if installed. It is highly recommended that suitable smoke detectors be installed in all residential properties. AS 3786 advises that smoke detectors are required for all buildings where people sleep. It is recommended that an electrician be consulted to advise on those installed or install these detectors.

CRACKING OF BUILDING ITEMS

Regardless of the type of crack(s), a Pre-Purchase Building Inspector carrying out a Pre-Purchase Inspection within the scope of a visual Inspection is unable to determine the expected consequences of the cracks.

Obtaining Information regarding the below all fall outside the scope of this Pre-Purchase Inspection:

- (a)** The nature of the foundation material on which the building is resting,
- (b)** The design of the footings,
- (c)** The site landscape,
- (d)** The history of the cracks and,
- (e)** Carrying out an invasive Inspection.

However, the information obtained from the five items above is valuable in determining the expected consequences of the cracking and any remedial work needed. Cracks that are small in width and length on the day of the Inspection may have the potential to develop over time into structural problems for the homeowner, resulting in major expensive rectification work being carried out. If cracks have been identified in the Report above, then a Structural Engineer is required to determine the significance of the cracking prior to a decision to purchase.

NOTICE TO THE PURCHASER (ACT ONLY)

(a) At the Exchange, and prior to the 'Cooling-off Period', you were given an Inspection Report on the property you intend on purchasing. This Report reflects the condition of the property existing at the time of the Inspection (Inspection Date) and may not reflect the current state. The structures may have been damaged by pests, storm, strong wind or fire or the vendor may have carried out alterations and/or additions to the property since the Inspection date. The Report may no longer reflect the true condition of the property. The structure(s) may no longer be in accordance with the attached plans etc. It is, therefore, very strongly recommended that you urgently arrange for another Inspection and Report in accordance with Australian Standard AS 4349.1 to be carried out prior to exchange, or prior to the expiration of any 'Cooling Off Period' and prior to settlement.

(b) If the Report indicated the presence of termite damage, or recommends any other Inspections or treatments, you should obtain copies of these Reports and any treatment proposals, certificates of treatment carried out, including details of all repairs including copies of quotations, invoices, and any other Reports. It is strongly recommended that you arrange for an Inspection and Report in accordance with AS 4349.3 to verify that the treatment has been successful and carried out in accordance with AS 3660.2, and a further building Inspection in accordance with AS 4349.1.

(c) If you fail to procure a further Inspection and Report as recommended in (a) and (b), or fail to obtain copies of other Reports, treatment proposals, certificates of treatment carried out, details of all repairs including copies of quotations, invoices and any other Reports as recommended in (b) above, then you agree that you have decided not to have a further Inspection and Report carried out, or to obtain copies of treatment proposals, certificates of treatment carried out, details of all repairs including copies of quotations, invoices and any other Reports and have relied upon your own enquires and the Report, knowing the possible consequences, and that the condition of the property, as stated in the Report, may have changed.

(d) You agree that the person carrying out the Inspection **and** the company, partnership or sole trader that employs that person will have no liability to you for any damage or loss you may suffer as a result of your entering the contract to purchase the property, or in connection with completing the purchase of the property as a result of your failure to heed the advice given in (a) and (b) and the warning contained in (c) above, and may use such failure in defense of any claim that you may later make against any of them.

NB. It is a condition of your right to rely upon the Report that you transmit by fax, post, or otherwise deliver the signed "Notice to the Purchaser" (ACT only) to the company, partnership or sole trader at the address detailed on the front of the Report not less than four (4) days prior to the date of settlement. If you fail to complete, sign, or deliver the Notice then it will be deemed that you did not rely upon the report in respect to your decision as to whether or not to purchase the property. This may seriously affect any rights to future compensation to which you may be entitled.

Please cross out the statement below that does not apply: - At the date of settlement, not more than 180 days will have elapsed since the Inspection date.

1. I/We have read and understood the 'Limited Liability to a Purchaser within the Australian Capital Territory only' clause of the Report, and this Notice to the Purchaser. I/We have not arranged for another inspection and report in respect of the property, and it is my/our intention to **rely upon the findings contained in the report**; or

2. I/We have **arranged for another Inspection of the Property and Report** to be carried out, which I/We will use in conjunction with this Report in deciding whether to proceed with the purchase of the property; or

3. I/We have read and understood the 'Limited Liability to a Purchaser within the Australian Capital Territory only' clause of the Report, and this Notice to the Purchaser. I/We have not arranged for another Inspection and Report in respect of the property and have **relied on my/our own enquiries in respect of the condition of the property** as at the date of settlement including any changes in the condition of the property that have taken place since the Inspection date stated in the Report

Timber Pest Report



SUMMARY SHEET

Property Address: 97 Fitchett Street, Garran ACT 2605
Client: Hutchinson
Inspection Date: Thursday, May 7th 2026
Inspection carried out by: Ned Strickland

This summary is supplied to allow a quick and superficial overview of the Inspection results. This summary is NOT the Report and cannot be relied upon on its own. This summary must be read in conjunction with the full Report and not in isolation from the Report. If there should happen to be any discrepancy between anything in the Report, and anything in this summary, the information in the Report shall override that in the summary. The Report is subject to conditions and limitations. Your attention is particularly drawn to the clauses, disclaimer of liability to third parties, limited liability to a purchaser with the Australian Capital Territory (ACT), and to the notice to the purchaser at the back of this Report.

1.0 ACCESS LIMITATIONS

There were access limitations to the inspection/report. Please refer to section 1.0 of the report.

2.0 TERMITE ACTIVITY

No active subterranean termites (live specimens) were found.

No visible evidence of subterranean termite workings or damage was found.

3.0 BORER ACTIVITY

Visible evidence of borers of seasoned timbers was found. Please refer to section 3.0 of the Pest Report for further information.

4.0 DECAY FUNGI

No evidence of damage caused by wood decay (rot) fungi was found.

For complete and accurate information, please refer to the attached 'Visual Timber Pest Report', which is prepared in accordance with AS 4349.3.

CONDITIONS OF THIS INSPECTION

Important Information:

Any person who relies upon the contents of this Report does so acknowledging that the following clauses, which define the scope and limitations of the Inspection, form an integral part of the Report.

This is a **Visual Inspection Only**, prepared in accordance with AS 4349.3, 'Inspection of Buildings Part 3: Timber Pest Inspections'. Visual Inspection was limited to those areas and sections of the property to which reasonable access (see definition) was both available and permitted on the date of Inspection.

The Inspection **did not** include breaking apart, dismantling, removing, or moving objects including but not limited to – foliage, mouldings, roof insulation/sisalation, floor or wall coverings, sidings, ceilings, floors, furnishings, appliances, or personal possessions.

The Inspector **cannot** see inside walls, between floors, inside skillion roofing, inside the eaves, behind stored goods in cupboards, or in any other areas that are concealed or obstructed.

The Inspector **did not** dig, gouge, force or perform any other invasive procedures. An invasive Inspection will not be performed unless a separate contract is entered into.

In an occupied property, it must be understood that furnishings or household items may be concealing evidence of Timber Pests, which may only be revealed when the items are moved or removed.

In the case of strata type properties, only the interior of the unit is inspected.

Scope of Report:

This Report only deals with the detection or non-detection of Timber Pest Attack and Conditions Conducive to Timber Pest Attack discernible at the time of inspection. The inspection was limited to the Readily Accessible Areas of the Building and Site (see note below) and was based on a visual examination of surface work (excluding furniture and stored items), and the carrying out of Tests. Note. With strata and company title properties, the inspection was limited to the interior and the immediate exterior of the particular residence inspected. Common property was not inspected.

Limitations:

The Client acknowledges:

(a) This Report does not include the inspection and assessment of matters outside the scope of the requested inspection and report.

(b) The inspection only covered the Readily Accessible Areas of the Building and Site. The inspection did not include areas which were inaccessible, not readily accessible or obstructed at the time of inspection. Obstructions are defined as any condition or physical limitation which inhibits or prevents inspection and may include – but are not limited to – roofing, fixed ceilings, wall linings, floor coverings, fixtures, fittings, furniture, clothes, stored articles/materials, thermal insulation, sarking, pipe/duct work, builder's debris, vegetation, pavements, or earth.

(c) The detection of dry wood termites may be extremely difficult due to the small size of the colonies. No warranty of absence of these termites is given.

(d) European House Borer (*Hylotrupes bajulus*) attack is difficult to detect in the early stages of infestation as the galleries of boring larvae rarely break through the affected timber surface. No warranty of absence of these borers is given. Regular inspections including the carrying out of appropriate tests are required to help monitor susceptible timbers.

(e) This is not a structural damage report. Neither is this a warranty as to the absence of Timber Pest Attack.

(f) If the inspection was limited to any particular type(s) of timber pest (e.g., subterranean termites), then this would be the subject of a Special-Purpose Inspection Report, which is adequately specified.

(g) This Report does not cover or deal with environmental risk assessment or biological risks not associated with Timber Pests (e.g., toxic Mould) or occupational, health or safety issues. Such advice may be the subject of a Special-Purpose Inspection Report which is adequately specified and must be undertaken by an appropriately qualified inspector. The choice of such inspector is a matter for the Client.

(h) This Report has been produced for the use of the Client. The Consultant or their firm or company are not liable for any reliance placed on this report by any third party, except as provided in the section Limited Liability To a Purchaser within the Australian Capital Territory.

Determining extent of Damage:

This is not a structural building report, and any inexpert opinion we provide on timber damage cannot be relied upon. This Report **will not** state the full extent of any Timber Pest damage. It will state Timber Pest Damage found as either 'slight', 'moderate', 'moderate to extensive', or 'extensive', and this information is not the opinion of an expert. If any evidence of Timber Pest activity and/or damage resulting from Timber Pest activity is reported, either in the structure(s) or the grounds of the property, then you must assume that there may be concealed structural damage within the building(s).

This concealed damage may only be found when wall linings, cladding or insulation are removed to reveal previously concealed timbers. In this case, an Invasive Timber Pest Inspection (for which a separate contract is required) is strongly recommended, and you should arrange for a qualified professional such as a builder, engineer, or architect to carry out a structural Inspection to determine the full extent of the damage, and the extent of repairs that may be required. You agree that neither we, nor the individual conducting the Inspection, are responsible or liable for the repair of any damage, whether disclosed by the Report or not.

Disclaimer of Liability:

No liability shall be accepted on account of failure of the Report to notify any termite activity and/or damage present at, or prior to, the date of the Report, in any area(s) or section(s) of the subject property physically inaccessible for Inspection, or to which access for Inspection is denied by, or to, the licensed Inspector (including, but not limited to, any area(s) or section(s) specified by the Report).

1.0 ACCESS LIMITATIONS

1.1 Area(s) inspected:

Only structures, fences &/or trees within 50m of the building but within the property boundaries were inspected.

1.2 Common area(s) not inspected:

No Inspection was made, and no Report will be submitted, of inaccessible area(s).

These include, but may not be limited to; cavity walls, concealed frame timbers, eaves, flat roofs, fully enclosed patios, inaccessible parts of the subfloors, inaccessible parts of the roof void, soil concealed by concrete floors, fireplace hearths, wall linings, landscaping, rubbish, floor coverings, furniture, pictures, appliances, stored items, insulation, and hollow blocks/posts etc.

1.3 Area(s) in which visual inspection was obstructed or restricted and why:

Ceiling framing timbers were concealed by insulation. The visual inspection of the subfloor framing was restricted due to underfloor insulation and stored items. Areas of the timber fence were concealed by vegetation. The inspection of the garage was restricted due to stored goods being kept in the area at the time of inspection. No inspection was made to sections of the residence and/or structures built on the side boundary.

NB. Please note that since a complete Inspection of the above area(s) was not possible, Timber Pest activity and/or damage may exist in these areas.

1.4 The property was furnished at the time of inspection.

Where a property is furnished at the time of Inspection, it must be understood that the furnishings and stored goods may be concealing evidence of Timber Pest activity. This evidence may be revealed when the property is vacated, and a further Inspection of the vacant property is strongly recommended if the house was furnished at the time of inspection.

1.5 Undetected timber pest risk assessment is considered Moderate.

NB. Where the risk is considered “Moderate” or “Moderate-High” or “High”, a further inspection is strongly recommended of areas that were not readily accessible, and of inaccessible or obstructed areas once access has been provided or the obstruction removed. This may require the moving, lifting or removal of obstructions such as floor coverings, furniture, stored items foliage and insulation. In some instances, it may also require the removal of ceiling and wall linings, and the cutting of traps and access holes. Seek further advice from your Consultant.

2.0 TERMITE ACTIVITY

2.1 No active (live) termites were present at the time of Inspection.

2.2 No visible evidence of subterranean termite workings and/or damage was found.

2.3 A termite nest was not found.

2.4 No evidence of timber damage caused by Termite attack was visible at the time of the Inspection.

NB. Where evidence of termite activity by the *Nasutitermes* or *Coptotermes* species was found in the grounds, the risk to buildings is very high. A treatment to eradicate the termites and to protect the building(s) should be carried out. Where the evidence of termite workings was found in the grounds or the building(s), then the risk of a further attack is very high.

2.5 Very important:

If live termites or any evidence of termite workings or damage was reported above, within the building(s) or in the grounds and fences, then it must be assumed that there may be concealed termite activity and/or timber damage. This concealed activity or damage may only be found when alterations are carried out, such as when wall linings, cladding or insulation are removed; or if you arrange for an invasive Inspection. We claim no expertise in structural engineering or building, and we strongly recommend that you have a qualified professional such as a builder, engineer, architect, or other qualified expert determine the full extent of the damage, if any. This may require an invasive Inspection. We take no responsibility for the repair of any damage, whether disclosed by this Report or not (see 'Terms and Limitations').

Where visual evidence of termite workings and/or damage is reported above, but no live termites were present at the time of Inspection, you must realise that it is possible that termites are still active in the immediate vicinity, and that the termites may continue to cause further damage. It is not possible, without further investigation and a number of Inspections over a period of time, to ascertain whether any infestation is active or inactive. Active termites may simply have not been present at the time of Inspection due to a prior disturbance or climatic conditions, or they may have been utilizing an alternative feeding source.

Continued, regular Inspections are essential. Unless written evidence of a termite protection program in accordance with 'AS 3660' with ongoing Inspections is provided, you must arrange for a treatment in accordance with 'AS 3660' to be carried out to reduce the risk of further attack.

2.6 Previous termite treatment: There were no signs of a termite treatment or evidence of a possible previous termite treatment, at the time of inspection.

NB. If there is evidence of drill holes in concrete or brickwork, bait stations or other signs of a possible previous treatment are reported, then the treatment was probably carried out because of an active termite attack. Extensive structural damage may exist in concealed areas. You should have an invasive Inspection carried out, and have a builder determine the full extent of any damage, and the estimated cost of repairs, as the damage may only be found when wall linings etc. are removed. Normally, if a termite treatment has been carried out, then a durable notice should be located in the metre box, indicating the type of termite shield system, treated zone or combination that has been installed.

2.7 Termite management: A durable notice (termite management notice) was not found during the inspection, indicating a barrier system has not been installed.

This firm can give no assurances with regard to work that may have been previously performed by other firms. You should obtain copies of all paperwork and make your own enquiries as to the quality of the treatment when it was carried out, and warranty information. In most cases, you should arrange for a treatment in accordance with "Australian Standard 3660" to be carried out to reduce the risk of further attack.

2.8 General remarks:

Where any current visible evidence of Timber Pest activity is found, it is strongly recommended that a more invasive Inspection be performed. Trees on and near the property up to a height of 2 metres, have been visually Inspected where possible and practicable, for evidence of Termite activity. It is very difficult to locate termite nests since they are underground, and evidence in trees is usually well concealed. Therefore, we strongly recommend that you arrange to have the medium to large eucalypt trees within a 50 metre radius of the property test drilled for evidence of termite nests.

3.0 BORER ACTIVITY

3.1 Lyctus borer workings was found in several timber bearers and joists in the roof framing timbers. The damage has been caused by Lyctus brunneus (powderpost beetle) and is not of structural concern. No repairs or treatment are required.

The **Lyctid Borer** - The most common lyctid borer in Australia is **Lyctus brunneus (powder post beetle)**. Attack usually takes place during the first six to twelve months of the service life of timber. However, the powder post beetle is not considered a significant pest of timber and treatment of infestation is not usually required. As only the sapwood of certain hardwoods is destroyed, larger-dimensional timbers (such as rafters, bearers, and joists) in a building are seldom weakened significantly to cause collapse. The **Anobiid Borer** There are many different species of Anobiid borer, the most frequently encountered being *Anobium punctatum* (furniture beetle) and *Calymmaderus incisus* (Queensland pine beetle). Attack mainly occurs to softwoods especially pine timbers such as floorboards that have been in service for at least ten years. Should any structural timbers be attacked by Anobiid borers it is often difficult to determine what extent the borer damage has weakened such timbers and replacement is often the only way of ensuring safety from collapse.

In the case of Anobiid borers, once an attack is initiated it is unlikely to cease or die out of its own accord without some sort of eradication treatment. Therefore, unless proof of treatment is provided, evidence of an attack must always be considered active. Although a chemical treatment is an option, replacement of infested timbers with non-susceptible, or treated timber, is the most effective method of treatment. Before any option is considered, competent advice (e.g., from a licensed building contractor) should be sought to determine the extent of any structural damage, and as to the need or otherwise for rectification or repair work.

Other Borers: A further (more invasive) investigation is strongly recommended to determine whether infestation is still active and to positively identify the borer species responsible for the attack. Always seek further advice from the Consultant.

Management Program: Wherever practical, remove any conditions conducive to attack (e.g., *Anobium* borer thrive in badly ventilated subfloor areas). Regular inspections are recommended at intervals not exceeding 12 months. Always seek further advice from the Consultant.

4.0 DECAY FUNGI

4.1 No evidence of damage caused by wood decay (rot) fungi was found.

NB. If any evidence of fungal decay or damage is reported, you should consult a building expert to determine the full extent of damage, and the estimated cost of repairs or timber.

General Description of Attack Decaying wood contains sufficient moisture to retain its original shape and may have sufficient strength to withstand normal loads. In contrast decayed wood is reduced both in moisture content and size as indicated by cracking either along or across the grain or fibres coming apart in a stringy manner. Decayed wood will have undergone considerable strength reduction.

Economic Significance Fungal decay can cause at one extreme, structural failure of the affected timber, and at the other purely superficial surface damage. The most critical determination is that of which timber is affected and decaying because decay will most likely spread (unless sources of moisture are quickly removed). Affected and decayed timber may warrant timber replacement, but the rot should not spread unless a new moisture source becomes available in that area.

Where evidence of decayed timber exists, competent advice (e.g., from a licensed or registered building contractor) should be sought to determine the extent of any structural damage, and as to the need or otherwise for rectification or repair work. It is important to correct any condition conducive to attack prior to replacing decayed wood.

Where evidence of decaying timber exists, competent advice (e.g., from a licensed or registered building contractor) should be sought to remove the condition(s) conducive to attack, and to determine the extent of any structural damage, and as to the need or otherwise for rectification or repair work.

Where the full extent of damage or the overall condition of the timber is undetermined a further inspection is strongly recommended by a competent person (e.g., from a licensed or registered building contractor). This may require monitoring of the timber over a period and include the assessment of conditions conducive to attack in different weather conditions (e.g., to determine the adequacy of existing drainage).

Management Program Remove any conditions conducive to attack (e.g., lack of ventilation or the presence of excessive moisture). Regular inspections are recommended at intervals not exceeding 12 months. Always seek further advice from the Consultant.

5.0 CONDITIONS THAT ARE CONDUCTIVE TO TIMBER PESTS

5.1 Water leaks: At the time of the inspection no leaks were found to be present.

Water leaks, especially in or into the subfloor, or against the external walls; increase the likelihood of termite attack. Leaking showers or leaks from other 'wet areas' also increase the likelihood of concealed termite attack. Hot water overflows should be plumbed away from the building.

NB. We claim no expertise in building, and if any leaks were reported, you should consult a plumber or other building expert to determine the full extent of damage, and the estimated cost of repairs.

5.2 Moisture/drainage: At the time of the inspection, the subfloor soil was generally dry.

Lack of Adequate Subfloor Ventilation Inadequate ventilation provides a condition suitable for timber pest infestation. For example, subterranean termites thrive in damp humid conditions typical of those provided in a poorly ventilated subfloor space. Where evidence of a lack of adequate ventilation has been identified in the report, the Client should seek competent advice (e.g., from a licensed or registered building contractor) regarding upgrading ventilation. The Presence of Excessive Moisture Ground levels around the building should be maintained in such a way to minimise water entering under the building. Also, the ground surface in subfloor areas should be kept graded to ensure that moisture does not pond or accumulate in any area. Where necessary, sub-surface drains should be installed and maintained to assist with drainage around and under the building. Likewise, the presence of excessive moisture can often be directly related to ventilation limitations and the resultant high humidity. Also, plumbing oversights and defects such as a leaking drain or tap will provide a microclimate conducive to timber pest attack. Where necessary, the Client should seek competent advice (e.g., from a licensed or registered plumbing contractor) to determine the adequacy of existing drainage and remove any conditions conducive to the presence of excessive moisture. The building may need to be monitored over a period of time to detect or confirm a damp problem. The presence of dampness (including moisture) is not always consistent as the prevailing and recent weather conditions at the time an inspection is carried out may affect the detection of damp problems. Importantly, precipitation at or near the time of inspection does not necessarily guarantee that a damp problem will automatically be evident due to such circumstances as prevailing wind conditions or intensity of rainfall. The absence of any dampness at the time of inspection does not necessarily mean the building will not experience some damp problems in other weather conditions. Likewise, whether services have been used for some time prior to an inspection being carried out will affect the detection of dampness.

5.3 Ventilation: Restricted, due to the cavity brick construction of the house with internal brick walls in the subfloor region minimising cross ventilation.

Lack of Adequate Subfloor Ventilation Inadequate ventilation provides a condition suitable for timber pest infestation. For example, subterranean termites thrive in damp humid conditions typical of those provided in a poorly ventilated subfloor space. Where evidence of a lack of adequate ventilation has been identified in the report, the Client should seek competent advice (e.g., from a licensed or registered building contractor) in regard to upgrading ventilation.

5.4 Hot water services and air conditioning units: There is no need for this work to be carried out.

Hot water services and air conditioning units which release water alongside or near to building walls should be piped to a drain (if not possible then several metres away from the building), as the resulting wet area is highly conducive to termites.

5.5 Slab edge exposure: The slab edge inspection zone does not apply to this property.

Where external concrete slab edges are not exposed, there is a high risk of concealed termite entry.

In some buildings built since July 1995, the edge of the slab forms part of the termite shield system. In these buildings an Inspection zone of at least 75mm should be maintained to permit detection of termite entry. The edge should not be concealed by render, tiles, cladding, flashings, adjoining structures, paving, soil, turf, or landscaping etc. Where this is the case, you should arrange to have the slab edge exposed for Inspection.

Concealed termite entry may already be taking place but could not be detected at the time of the Inspection. This may have resulted in concealed timber damage.

NB. A very high proportion of termite attacks are over the slab edge. Covering the slab edge makes concealed entry easy. This is particularly true of infill type slab construction. Termite activity and/or damage may be present in concealed timbers of the building. We strongly recommend frequent regular inspections in accordance with AS 3660.2.

5.6 Weep holes in external walls: Weep holes are not applicable to this property.

It is very important that soil, lawn, concrete paths, or pavers do not cover the weep holes. Sometimes, they have been covered during the rendering of the brick work. They should be clean and free flowing and covering the weep holes in part or in whole may allow undetected termite entry.

5.7 Termite shields: Inadequate, as ant capping is not continuous. This is typical for a home of this age.

Termite Shields (Ant Caps) should be in good order and condition, so termite workings are exposed and visible. This helps prevent termites from gaining undetected entry. Joints in the shielding should have been soldered during the installation. If it is observed that the joints in the shielding have not been soldered, then the shielding must be reported as inadequate. It may be possible for a builder to repair the shielding. If not, a chemical treated zone may need to be installed to deter termites from gaining concealed access to the building. Missing, damaged or poor shields increase the risk of termite infestation. If considered inadequate, a builder or other building expert should be consulted.

Other physical shield systems are not visible to inspection and no comment is made on such systems.

5.8 Bridging or breaching of termite barriers and inspection zones: No bridging or breaching was found.

“Bridging” is the spanning of a termite barrier or inspection zone so that subterranean termites are provided with passage over or around that barrier. “Breaching” is the making of a hole or gap in a termite barrier so that termites are provided with a passage through that barrier.

5.9 Other area(s) and/or situations that appear conducive to (may attract) subterranean termite infestation: Medium to large trees and stumps within a 50 metre radius of the property, due to the nesting conditions. The form work timbers in the subfloor region, as these timbers are in direct contact with the ground, allowing timber pests to gain direct access to the house structure. Several timber off cuts on the ground in the subfloor, due to the ideal food source.

6.0 OVERALL ASSESSMENT OF THE PROPERTY

6.1 Where evidence of live termites, termite damage or termite workings (mudding) was found in the building(s) then the risk of a further attack is extremely high.

Where evidence of live termites, termite damage or termite workings was found in the grounds but not in the building(s) then the risk to buildings must be reported as high to extremely high.

6.2 At the time of the Inspection, the degree of risk of subterranean termite infestation to the overall property was considered to be **Moderate to High**.

6.3 Subterranean Termite Treatment Recommendation: A management program in accordance with AS 3660-2000 to protect against subterranean termites is considered **not essential, but 6 to 12 monthly inspections are essential**.

6.4 Future Inspections: AS 3660.0-2000 recommends “regular competent Inspections should be carried out at least on an annual basis, but more frequent Inspections are strongly recommended”.

It goes on to inform that “regular Inspections will not prevent termite attack but may help in the detection of termite activity. Early detection will allow remedial treatment to be commenced sooner, and damage to be minimized”.

Due to the degree of risk of subterranean termite infestation noted above and all other findings of this Report; we strongly recommend that a full Inspection and written Report in accordance with AS 4349.3 or AS 3660.2-2000 is conducted at this property every 6 months, but no more than 12 months.

DEFINITIONS

Timber Pest Attack: Means Timber Pest Activity and/or Timber Pest Damage.

Timber Pest Activity: Means telltale signs associated with 'active' (live) and/or 'inactive' (absence of live) Timber Pests at the time of inspection.

Timber Pest Damage: Means noticeable impairments to the integrity of timber and other susceptible materials resulting from attack by Timber Pests.

Major Safety Hazard: Means any item that may constitute an immediate or imminent risk to life, health or property resulting directly from Timber Pest Attack. Occupational, health and safety or any other consequence of these hazards has not been assessed.

Conditions Conducive to Timber Pest Attack: Means noticeable building deficiencies or environmental factors that may contribute to the presence of Timber Pests.

Readily Accessible Areas: Means areas which can be easily and safely inspected without injury to person or property, are up to 3.6 metres above ground or floor levels, in roof spaces where the minimum area of accessibility is not less than 600 mm high by 600 mm wide and subfloor spaces where the minimum area of accessibility is not less than 400 mm high by 600 mm wide, providing the spaces or areas permit entry. The term 'readily accessible' also includes accessible subfloor areas on a sloping site where the minimum clearance is not less than 150 mm high, provided that the area is not more than 2 metres from a point with conforming clearance (i.e., 400 mm high by 600 mm wide); and areas at the eaves of accessible roof spaces that are within the consultant's unobstructed line of sight and within arm's length from a point with conforming clearance (i.e. 600 mm high by 600 mm wide).

Client: Means the person or persons for whom the Timber Pest Detection Report was carried out or their Principal (i.e., the person or persons for whom the report was being obtained).

Timber Pest Detection Consultant: Means a person who meets the minimum skills requirement set out in the current Australian Standard AS 4349.3 Inspections of Buildings. Part 3: Timber Pest Inspection Reports or state/territory legislation requirements beyond this Standard, where applicable.

Building and Site: Means the main building (or main buildings in the case of a building complex) and all timber structures (such as outbuildings, landscaping, retaining walls, fences, bridges, trees, and stumps with a diameter greater than 100 mm and timber embedded in soil) and the land within the property boundaries up to a distance of 50 metres from the main building(s).

Timber Pests: Means one or more of the following woods destroying agents which attack timber in service and affect its structural properties:

Chemical Delignification: The breakdown of timber through chemical action.

Fungal Decay: The microbiological degradation of timber caused by soft rot fungi and decay fungi, but does not include Mould, which is a type of fungus that does not structurally damage wood.

Wood Borers: Wood destroying insects belonging to the order 'Coleoptera' which commonly attack seasoned timber.

Termites: Wood destroying insects belonging to the order 'Isoptera' which commonly attack seasoned timber.

Tests: Means additional attention to the visual examination was given to those accessible areas which the consultant's experience has shown to be particularly susceptible to attack by Timber Pests. Instrument testing of those areas and other visible accessible timbers/materials/areas showing evidence of attack was performed.

Instrument Testing: Means where appropriate the carrying out of Tests using the following techniques and instruments:

- (a) Electronic moisture detecting meter - an instrument used for assessing the moisture content of building elements.
- (b) Stethoscope - an instrument used to hear sounds made by termites within building elements.
- (c) Probing - a technique where timber and other materials/areas are penetrated with a sharp instrument (e.g., bradawl or pocket knife), but does not include probing of decorative timbers or finishes, or the drilling of timber and trees; and
- (d) Sounding - a technique where timber is tapped with a solid object.

IMPORTANT MAINTENANCE ADVICE REGARDING INTEGRATED PEST MANAGEMENT FOR PROTECTING AGAINST TIMBER PESTS

You should read and understand the following important information. It will help explain what is involved in a Timber Pest Inspection, the difficulties faced by a Timber Pest Inspector, and why it is not possible to guarantee that a property is free of Timber Pests. It also details important information about what you can do to help protect your property from Timber Pests. This information forms an integral part of the Report. Any structure can be attacked by Timber Pests. Periodic maintenance should include measures to minimise possibilities of infestation in and around a property. Factors which may lead to infestation from Timber Pests include situations where the edge of the concrete slab is covered by soil or garden debris, filled areas, areas with less than 400mm clearance, foam insulation at foundations, earth/wood contact, damp areas, leaking pipes, etc.; form-work timbers, scrap timber, tree stumps, mulch, tree branches touching the structure, wood rot, etc. Gardens, pathways, or turf abutting or concealing the edge of a concrete slab will allow for concealed entry by timber pests any timber in contact with soil such as form-work, scrap timbers or stumps must be removed from under and around the buildings and any leaks repaired. You should endeavor to ensure such conditions DO NOT occur around your property. We further advise that you engage a professional pest control firm to provide a termite management program in accord with AS 3660 to minimise the risk of termite attack. There is no way of preventing termite attack. Even AS 3660 advises that "the provision of a complete termite barrier will impede and discourage termite entry into a building. It cannot prevent termite attack. Termites can still bridge or breach barriers, but they can be detected more readily during routine inspections."

Reasonable access:

Unless specified in writing, the inspection only covered the Readily Accessible Areas of the Building and Site.

The inspection did not include areas which were inaccessible, not readily accessible or obstructed at the time of inspection. Areas which are not normally accessible were not inspected and include - but not limited to – inside walls, the interior of a flat roof or beneath a suspended floor filled with earth.

Building Interior, the Consultant did not move or remove any ceilings, wall coverings, flooring, floor coverings (including carpeting), furnishing, equipment, appliances, pictures, or other household goods. In an occupied property, furnishings or household items may be concealing evidence of timber pest attack which may only be revealed when the items are moved or removed.

Building Exterior, Roof Exterior and Site, the Consultant did not move or remove any obstructions such as wall cladding, awnings, trellis, earth, plants, bushes, foliage, stored materials, debris, or rubbish. Due to the 'secretive' nature of timber pests, it is possible that hidden damage may exist in concealed areas, e.g., wall framing. Damage may only be found when the obstruction is removed. In the case of buildings constructed on concrete slabs, if the edge of the slab or any weep hole or vent at the base of external walls is concealed by pavements, gardens, lawns, or landscaping then it is possible for termites to gain undetected entry into the building. The building of gardens or planting of shrubs close to the perimeter of the building can promote and conceal termite entry points. The storage of cellulose materials such as building materials and firewood near the ground or building may encourage termite activity.

Roof Space Obstructions such as roofing, stored articles, thermal insulation, sarking, and pipe/duct work may be concealing evidence of timber pest attack which may only be revealed when the obstructions are moved or removed. Also, bodily access should be provided to the interior of all accessible roof spaces. In accordance with Australian Standard ASS 4349 the minimum requirement is a 400mm by 500 mm access manhole.

Subfloor Space Subfloor areas should be kept free from all vegetation (including tree stumps) and other cellulose material which may encourage timber pest activity. Also, storage of materials in subfloor areas is not recommended as it reduces ventilation and makes inspection difficult. Obstructions may be concealing evidence of timber pest attack which may only be revealed when the obstructions are moved or removed. Bodily access should be provided to all accessible subfloor areas with the minimum requirement being a 500 mm x 400 mm access manhole. In the case of suspended floors, if the clearance between the ground and structural components is less than 400 mm, then the ground should be excavated to provide the required clearance, subject to maintaining adequate drainage and support to footings. If the subfloor has been sprayed for subterranean termites or if the area is susceptible to mould growth, appropriate health precautions must be followed before entering the area. Also, special care should be taken not to disturb the treated soil. Always seek further advice from the Consultant.

A further inspection is strongly recommended of those areas that were not readily accessible and of inaccessible or obstructed areas once access has been provided or the obstruction removed. This will involve a separate visit to the site, permission from the owner of the property and additional cost.

Unless stated otherwise, any recommendation or advice given in this Report should be implemented as a matter of urgency.

A more invasive physical inspection is available and recommended:

As detailed above, there are many limitations to this visual inspection only. With the permission of the owner of the premises we WILL perform a more invasive physical inspection that involves moving or lifting insulation, stored items, furniture, or foliage during the inspection. We WILL physically touch, tap, test and when necessary, force/gouge suspected accessible timbers. We WILL gain access to areas, where physically possible and considered practical and necessary, by way of cutting traps and access holes.

This style of Report is available by ordering with several days' notice. Inspection time for this style of Report will be greater than for a VISUAL INSPECTION.

It involves disruption in the case of an occupied property, and some permanent marking is likely. You must arrange for the written permission of the owner who must acknowledge all the above information and confirm that our firm will not be held liable for any damage caused to the property.

A price is available on request.

Concrete slab homes:

Homes constructed on concrete slabs pose special problems with respect to termite attack. If the edge of the slab is concealed by concrete paths, patios, pavers, garden beds, lawns, foliage, etc. then it is possible for termites to affect concealed entry into the property, and they can then cause extensive damage to concealed framing timbers. Even the most experienced Inspector may be unable to detect their presence due to concealment by wall linings. Only when the termites attack timbers in the roof void, which may in turn be concealed by insulation, can their presence be detected. Where termite damage is in the roof, it should be expected that concealed framing timbers will be extensively damaged. With a concrete slab home, it is imperative that you expose the edge of the slab and ensure that foliage and garden beds do not cover the slab edge. Weep holes must be kept free of obstructions.

It is strongly recommended that you have a Termite Inspection in accordance with AS 3660.2 carried out every 6 to 12 months.

Subterranean termites:

No property is safe from termites. General Description of Attack Timber hollowed beneath; some cracking at the surface of timber; earthen channels present; or pale faecal spots present.

Important note:

As a delay may exist between the time of an attack and the appearance of telltale signs associated with the attack, it is possible that termite activity and damage exists though not discernible at the time of inspection.

Treatment After discovery of an active infestation, it is imperative that the species of termite is accurately identified before costly (and sometimes unnecessary or inappropriate) methods of treatment are initiated. Only economically important species which are known to attack timber structures should be treated.

In the case of economically important species, it is important that the termite workings are not further disturbed until the proposed method of control has been determined by a licensed pest control operator. Premature attempts to repair or replace infested timber may cause the termites to withdraw from the area temporarily, thereby hindering effective treatment. Any repair or replacement of infested timber should be carried out after the appropriate treatment has been completed.

Where evidence of active termites is detected within a building or within 50 metres of any building, it must always be assumed that the termites may also be active in areas of the property not inspected. Accordingly, where the termites are known to be of economic significance, a further (more invasive) inspection is strongly recommended of areas which were inaccessible, not readily accessible or obstructed at the time of inspection.

Termite Workings and Damage Where evidence of damage to building timbers exists, competent advice (e.g. from a licensed or registered building contractor) should be obtained to determine the extent of any structural damage and as to the need or otherwise for rectification or repair work.

Where evidence of inactive termites is located within the building, it is possible that termites are still active in areas of the property not inspected and they may continue to cause damage. A furthermore invasive inspection is strongly recommended of areas which were inaccessible, not readily accessible or obstructed at the time of inspection.

Where evidence of an inactive termite infestation exists, it is not possible, without benefit of further investigation and inspections over a period, to ascertain whether any infestation is active or inactive. Continued, regular, inspections are essential.

Where evidence of termite attack exists to any trees or tree stumps a more conclusive search should be undertaken. This may require the tree or stump to be drilled to determine the existence of a termite nest. In addition, the soundness and stability of any standing trees identified as being affected by termite attack should be confirmed. Always seek further advice from the Consultant.

Previous Treatments Where evidence of a possible termite treatment was located, the Client should obtain and keep on file all relevant documents pertaining to the extent of the treatment, any service warranties and advice in regard to the building owner's obligation to maintain the treatment and/or barrier. If evidence of a previous treatment of termite infestation is noted, and appropriate documentation is not available, the Client must assume that the termite infestation may still be active in areas of the property not inspected. Accordingly, a re-treatment may be required. Always seek further advice from the Consultant.

Frequency of Future Inspections Australian Standard AS 3660 recognises that regular inspections will not prevent termite attack but may help in the detection of termite activity. Early detection will allow remedial treatment to be commenced sooner and damage to be minimised.

Inspections at intervals not exceeding twelve (12) months are recommended. Where the termite risk is high or the building type susceptible to termite attack, more frequent inspections (3-6 months) should be undertaken.

Risk management options:

To help protect against financial loss, it is essential that the building owner immediately control or rectify any evidence of destructive timber pest activity or damage identified in this inspection report. The Client should further investigate any high-risk area where access was not gained. It is strongly advised that appropriate steps be taken to remove, rectify or monitor any evidence of conditions conducive to timber pest attack.

To help minimise the risk of any future loss, the Client should consider whether the following options to further protect their investment against timber pest infestation are appropriate for their circumstances:

Undertake thorough regular inspections at intervals not exceeding twelve months or more frequent inspections where the risk of timber pest attack is high, or the building type is susceptible to attack. To further reduce the risk of subterranean termite attacks, implement a management program in accordance with Australian Standard AS 3660. This may include the installation of a monitoring and/or baiting system, or chemical and/or physical barrier. However, AS 3660 stresses that subterranean termites can bridge, or breach barrier systems and inspection zones and that thorough regular inspection of the building are necessary.

CONTACT THE INSPECTOR

Please feel free to contact the Inspector who carried out this inspection. Often it is very difficult to fully explain situations, problems, access difficulties or timber pest activity and/or damage in a manner that is readily understandable by the reader. Should you have any difficulty in understanding anything contained within this Report, then you should immediately contact the Inspector and have the matter explained to you.

If you have any questions at all or require any clarification, then contact the Inspector prior to acting on this Report.

NOTICE TO THE PURCHASER

(a) Prior to or on Exchange, and prior to the commencement of the 'Cooling-off Period', you were given an Inspection Report on the Property you intend on purchasing ("the Report"). The Purchaser is advised that this Report reflects the condition of the property existing at the time of the Inspection (Inspection Date) and may not reflect the current state. Timber Pests, particularly Termites, may have gained entry to the property since the Inspection Date. Termites can, in a relatively short period, cause significant damage to both structural and non-structural timbers within and around the buildings of the Property.

Termites (white ants) may be difficult to detect and much of the damage caused may not be readily visible. If damage exists, then it may cost thousands of dollars to repair.

It is, therefore, very strongly recommended that you urgently arrange for another Inspection and Report in accordance with AS4349.3 to be carried out prior to exchange, or prior to the expiration of any 'Cooling off Period', and prior to settlement.

(b) If the Report indicated the presence of Termites, termite damage or recommends any treatments or other Inspections and Reports, you should obtain copies of the treatment proposal, any certificates of treatments carried out, details of all repairs including copies of quotations, invoices, and any other Reports.

It is strongly recommended that you arrange for an Inspection and Report in accordance with AS 4349.3 to verify that the treatment has been successful and carried out in accordance with AS 3660.2 and a further building Inspection in accordance with AS 4349.1.

(c) If you fail to procure a further Inspection and report as recommended in (a) and (b), or fail to obtain copies of the treatment proposal, certificates of treatment carried out, details of all repairs including copies of quotations, invoices and any other reports as recommended in (b) above, then it will be deemed that you have decided not to have a further Inspection and report carried out, or to obtain copies of certificates of treatments carried out, details of all repairs including copies of quotations, invoices and any other reports.

It will be deemed that you have relied upon your own enquiries and the report, knowing the possible consequences and that the condition of the property, as stated in the report, may have changed.

(d) The person carrying out the Inspection and the company, partnership or sole trader that employs that person will have no liability to you for any damage or loss you may suffer as a result of your entering the contract to purchase the property or in connection with completing the purchase of the property as a result of your failure to heed the advice given in (a) and (b) and the warning contained in (c) above, and may use such failure in defense of any claim that you may later make against any of them.

Compliance Report



COMPLIANCE REPORT

This is a Compliance Report regarding any unapproved structures or alterations. ACT Property Inspections have accessed the attached Building File from ACT Planning and Land Authority (ACTPLA) and hold no responsibility for any inaccuracies in the Building File supplied by ACTPLA. The Compliance report is based solely upon the information available from the Building File which does not contain information regarding Plumbing or Electrical work that has taken place since the original construction. Information regarding the Plumbing and Electrical is available upon application from ACTPLA. Since we are not Plumbers or Electricians, we are unable to comment on those works. If structures have been noted as requiring approval, a Certifier should be engaged to assess if the structure will comply with the relevant ACT legislation. Owners must be aware that unapproved structures may not comply and may require significant repair, design change or possible removal.

Property Address: 97 Fitchett Street, Garran ACT 2605
Block & Section: Block 29 Section 8 GARRAN
Inspection Date: Thursday, May 7th 2026

APPROVAL STATUS

Description	Plan number	Certificate of occupancy date	Approval status
Brick Residence	13330+/A+/B+/C+/D	05/07/1972	Approved.
Brick Addition to Residence	13330/E	27/09/1977	Approved.
Fibreglass Swimming Pool	13330/F	20/01/1980	Approved. Note: The pool fence has been altered. Further approval is required. Please see below.
Retaining wall and external change room	13330/G	-	A Certificate of Occupancy has not been awarded for this work. Final approval is still required.
Brick Two Storey Extension	13330/H	-	A Certificate of Occupancy has not been awarded for this work. Final approval is still required.
Superseded	13330/A	-	Superseded.
Amendments and Extensions	13330/J	-	A Certificate of Occupancy has not been awarded for this work. Final approval is still required.
Amendments to Proposed Additions	13330/K	-	A Certificate of Occupancy has not been awarded for this work. Final approval is still required.
Pergola	13330/L	-	A Certificate of Occupancy has not been awarded for this work. Final approval is still required.
Installation of Solid Fuel Appliance	B20215391/A	19/07/2022	Approved.
Pool Fence (previously approved under plan 13330/F)	-	-	The pool safety barrier fence no longer matches the approved plans and requires certification prior to a Certificate of Occupancy and Use being issued.

Description	Plan number	Certificate of occupancy date	Approval status
Front stone retaining wall	-	-	This structure is unapproved as the wall is higher than 1.2m and has been constructed forward of the building line. Building and Development approval is required.
Left side metal structure	-	-	This structure has been built inside a service easement. Should access be required to the easement by the service provider, this structure may need to be removed at the owner's expense.
Rear timber storage shed	-	-	This structure is exempt from approval.

APPROVAL STATUS - CONTINUED

Note: As a Pool/Spa has been installed it will require one of the following: Exemption Certificate, Compliance Certificate, Swimming Pool Disclosure Statement or Certificate of Occupancy for the pool/spa and safety barrier that is not older than 5 years.

Addendum 11/05/2026: We have been advised that an approval for Additions and Alterations to the residence, is in progress

ACTPLA COMMENTS

- No Certificate of Occupancy issued for 13330/G – Application, Permits & Footings Inspections only
- No Certificate of Occupancy for plan 13330/H & Amendments/J+/K – Applications, Permits only & Pre-sheet Inspection only
- No Certificate of Occupancy for 13330/L – Application, Permit & Final Inspection only
- Page 3/3 missing from Plan B20215391/A

SURVEY REPORT

Survey Report completed by	Date Survey report was completed	Comments
K. F. Michniewicz	Wednesday, 21 August 1968	There are no apparent encroachments upon this land or by this property on adjoining lands or street.

Conveyancing File



CONVEYANCING BUILDING FILE INDEX

SUBURB: **GARRAN** SECTION: **8** BLOCK: **29** UNIT: **N/A** EX GOV: **NO**

COU ISSUED Y/N	PLAN NUMBER	FOLIO NO.	DESCRIPTION OF WORK	AMEND	DETAILS	PERMIT NUMBER	COU PLAN NO. & DATE
Y	13330	2	BRICK RESIDENCE				
		5				13330	
Y	13330/A	6		Y			
Y	13330/B	7		Y			
Y	13330/C	10		Y			
Y	13330/D	12		Y			
		67					13330+/A/B/C/D 05/07/1972
Y	13330/E	71	BRICK ADDITION TO RESIDENCE				
		74				13330/E	
		94					13330/E 27/09/1977
Y	13330/F	96	FIBREGLASS SWIMMING POOL				
		98				13330/F	
		104					13330/F 20/01/1980
N	13330/G	105	BRICK TOILET & SHOWER				
		108				13330/G	
		110	FOOTINGS INSPECTION – 05/11/1980				
		112	FOOTINGS INSPECTION – 14/11/1980				
N	13330/H	113	BRICK VENEER TWO STOREY EXTENSION				
		115				13330/H	
NA	13330/I	118	SUPERSEDED				
N	13330/J	120	AMENDMENTS AND EXTENSIONS	Y			
N	13330/K	123	AMENDMENTS TO PROPOSED ADDITIONS	Y			
		128				13330/H/K	
		131	(COMPLETION)			13330/G	
		-	PRESHEET INSPECTION – 18/05/1981				

N	13330/L	-	PERGOLA				
		-				13330/L	
		-	FINAL INSPECTIONM – 08/01/1985				
Y	B20215391/A	-	INSTALLATION OF SOLID FUEL APPLIANCE			B20215391/A	
		-					B20215391/A 19/07/2022

For any incomplete approvals please email acbuildingconveyance@act.gov.au for further information on how to complete.

Drainage Plan Number: 11115

Survey: Y (1)

Comments: NO COU ISSUED FOR 13330/G – APPLICATION, PERMITS & FOOTINGS INSPECTIONS ONLY

NO COU ISSUED FOR PLAN 13330/H & AMENDMENTS /J+/K – APPLICATIONS, PERMITS ONLY & PRESHEET INSPECTION ONLY

NO COU ISSUED FOR 13330/L – APPLICATION, PERMIT & FINAL INSPECTION ONLY

PAGE 3/3 MISSING FROM PLAN B20215391/A

CONVEYANCING PART 2

No information is provided in respect of electrical, drainage or sewer matters and or to the location of overhead power lines or underground cables in relation to the building.

	<u>Yes</u>	<u>No</u>
1. (a) Is this a government or ex government house?	<input type="checkbox"/>	<input checked="" type="checkbox"/>
(b) If yes, is there a building file with approvals on it?	<input type="checkbox"/>	<input type="checkbox"/>
2. Is there any record of incomplete building work on the building file? If yes - file copies attached	<input checked="" type="checkbox"/>	<input type="checkbox"/>
3. Are there any records on the building file of current (within 5 years) housing Indemnity insurance policies for building work? If yes - file copies attached	<input type="checkbox"/>	<input checked="" type="checkbox"/>
4. Are there any records on the building file showing building applications still being processed? (Current within 3 years) If yes - file copies attached	<input type="checkbox"/>	<input checked="" type="checkbox"/>
5. Are there any records on the building file in relation to loose-fill asbestos insulation?	<input type="checkbox"/>	<input checked="" type="checkbox"/>

If available, copies of the following documents are provided:

• Certificate/s of Occupancy and Use	<input checked="" type="checkbox"/>	<input type="checkbox"/>
• Survey Certificates	<input checked="" type="checkbox"/>	<input type="checkbox"/>
• Unit Plan/Unit Entitlements (if property is unit titled)	<input type="checkbox"/>	<input checked="" type="checkbox"/>
• Approved Building Plans	<input checked="" type="checkbox"/>	<input type="checkbox"/>
• Ex- government Building Plans*	<input type="checkbox"/>	<input checked="" type="checkbox"/>

If requested:

• Drainage Plan(s)	<input checked="" type="checkbox"/>	<input type="checkbox"/>
--------------------	-------------------------------------	--------------------------

ASBESTOS

The ACT Government is not able to guarantee the accuracy of the information in this report.

You should make your own enquiries and obtain reports (from a licensed Asbestos Assessor) in relation to the presence of loose fill asbestos insulation (and other forms of asbestos) on the premises. For more information go to the Asbestos Awareness Website –

www.asbestos.act.gov.au

Please note: Development Approval plans will not be included in this report (We do not receive Development Approval Plans unless they are part of a Building Approval in which case they become Building Approval Plans), if development approval was granted you can request copies of the Development Approval plans from ACEPDcustomerservices@act.gov.au.

Please Note: Building approvals that have been generated via eDevelopment will be issued with a project number prefixed by the letter B. Initial building approval documentation will be identified with project number B20XXXX only but will be referenced as B20XXXX/A on the Certificate of Occupancy and Use. Any amendments to the original approval will be issued with the project number and an alphanumeric digit. The first amendment will be identified as B20XXXX/B, the second amendment B20XXXX/C etc. Not all eDevelopment plans will be stamped with the plan number.

***Ex Government plans:** Plans are typical and not specific to each residence. There may be slight changes to the layout or window locations that were not required to be approved.

Search officer comments (if any?)

Search officer initials: Ashleigh

Cost of application: \$ 144.79

Date completed:

09/02/2026

AUSTRALIAN CAPITAL TERRITORY
Building Ordinance 1964 (as amended)

Nº 7693

67

CERTIFICATE AS TO FITNESS FOR OCCUPANCY AND USE

Plan Number(s) 13330 & 13330/A1B/C/D.	Permit Holder A. A. SMITH.
	Lessee A. I. KENNER.

I certify that a

BRICK RESIDENCE

on Block 29 of Section 8 at GARRAN.

is fit for occupancy and use.

5, 7, 7E

S. P. White
Deputy Proper Authority

198317/1....


Building Branch
Department of the Interior
BL1/8 (1971)

OFFICE COPY Page 43 of 99


White - original
Pink - office copy
Green - information copy
Gold - information copy

S/S


PROPOSED BRICK RESIDENCE AT
 BLOCK 29, SECTION 8, GARRAN,
 FOR:
 MR. & MRS. A.I. KENNER.

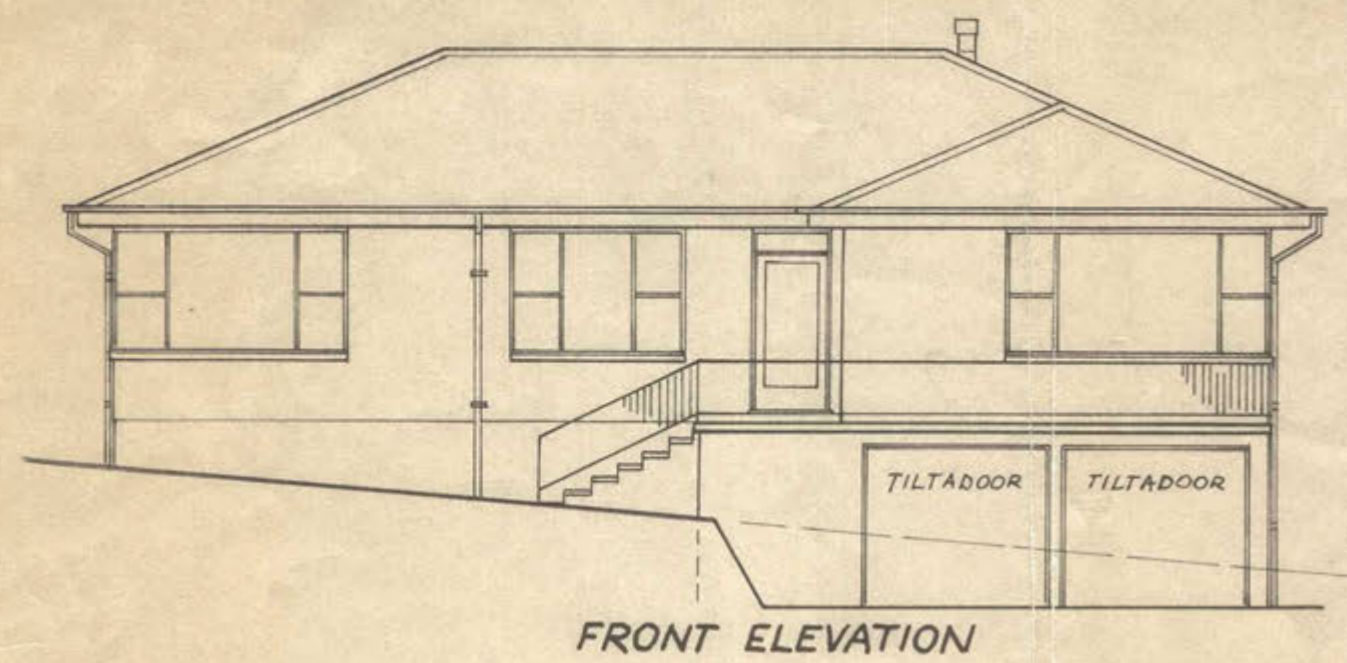


FRONT ELEVATION

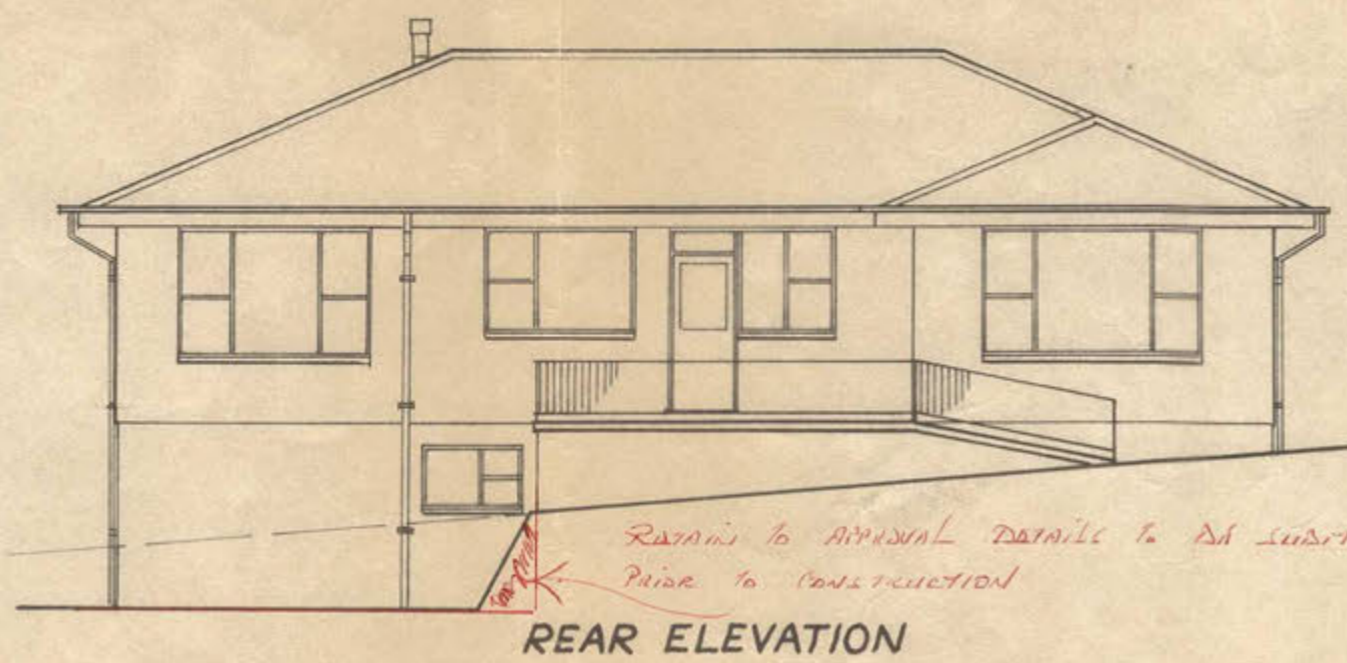


REAR ELEVATION

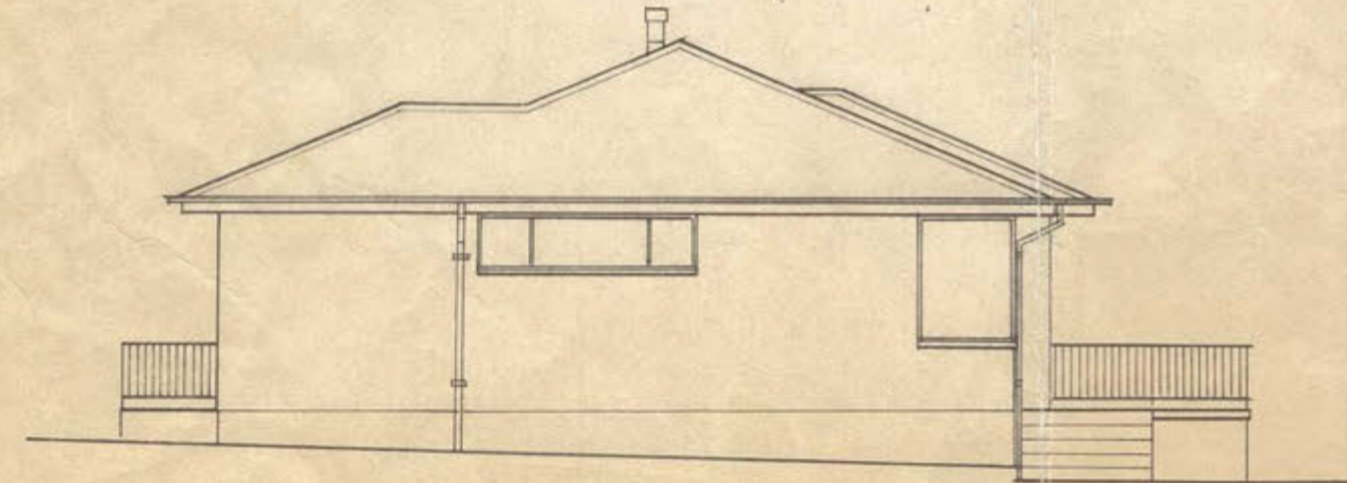


SIDE ELEVATION

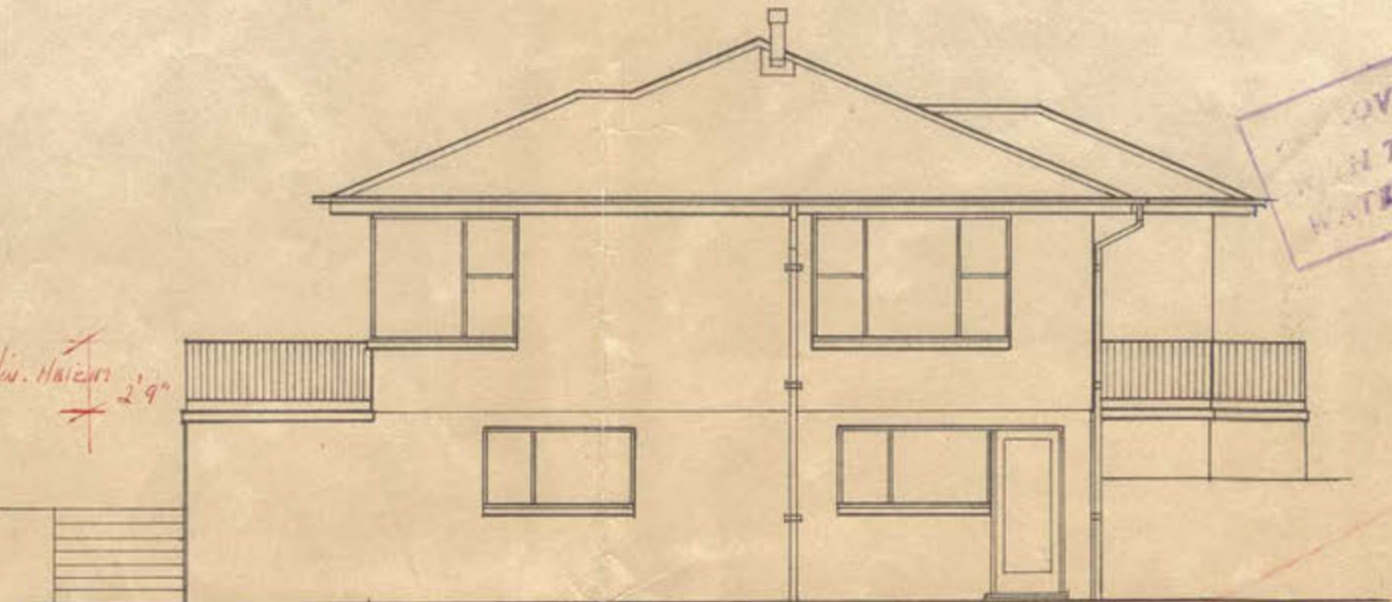

SIDE ELEVATION

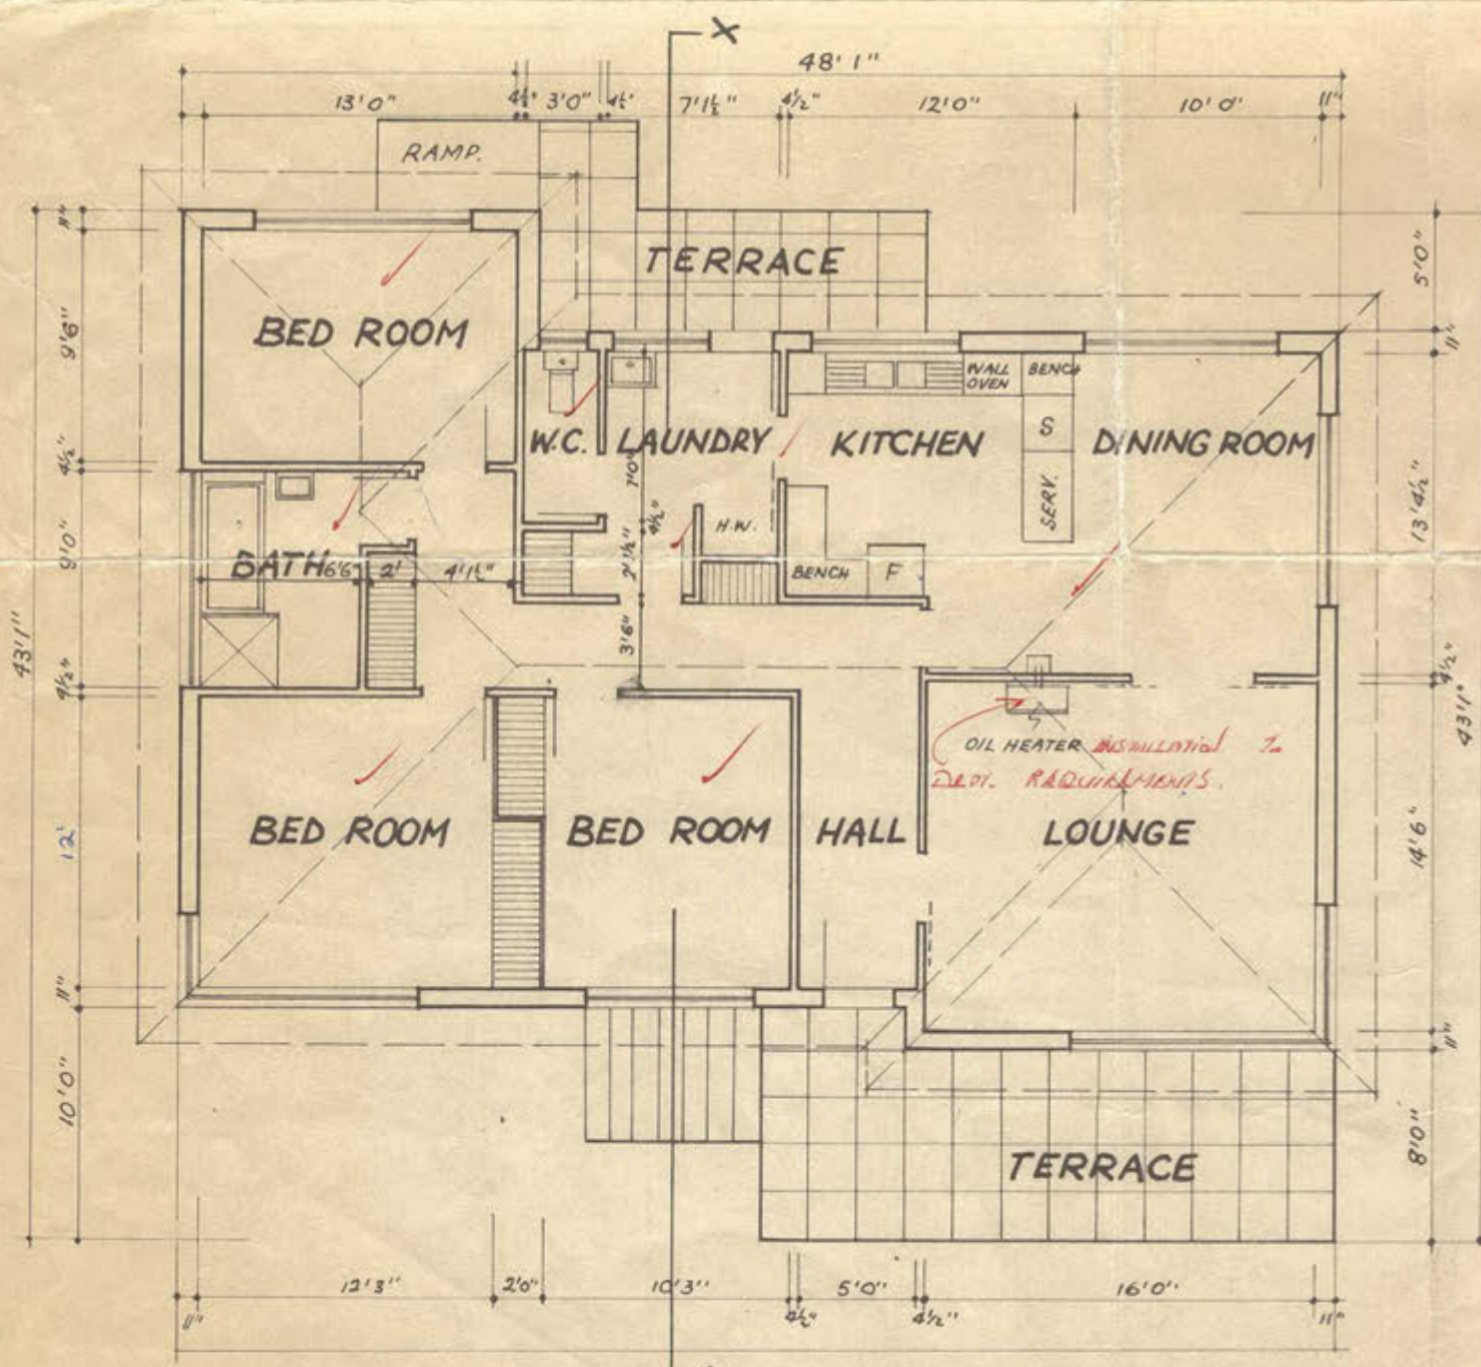

GROUND FLOOR PLAN - SCALE 1/8" = 1'0"

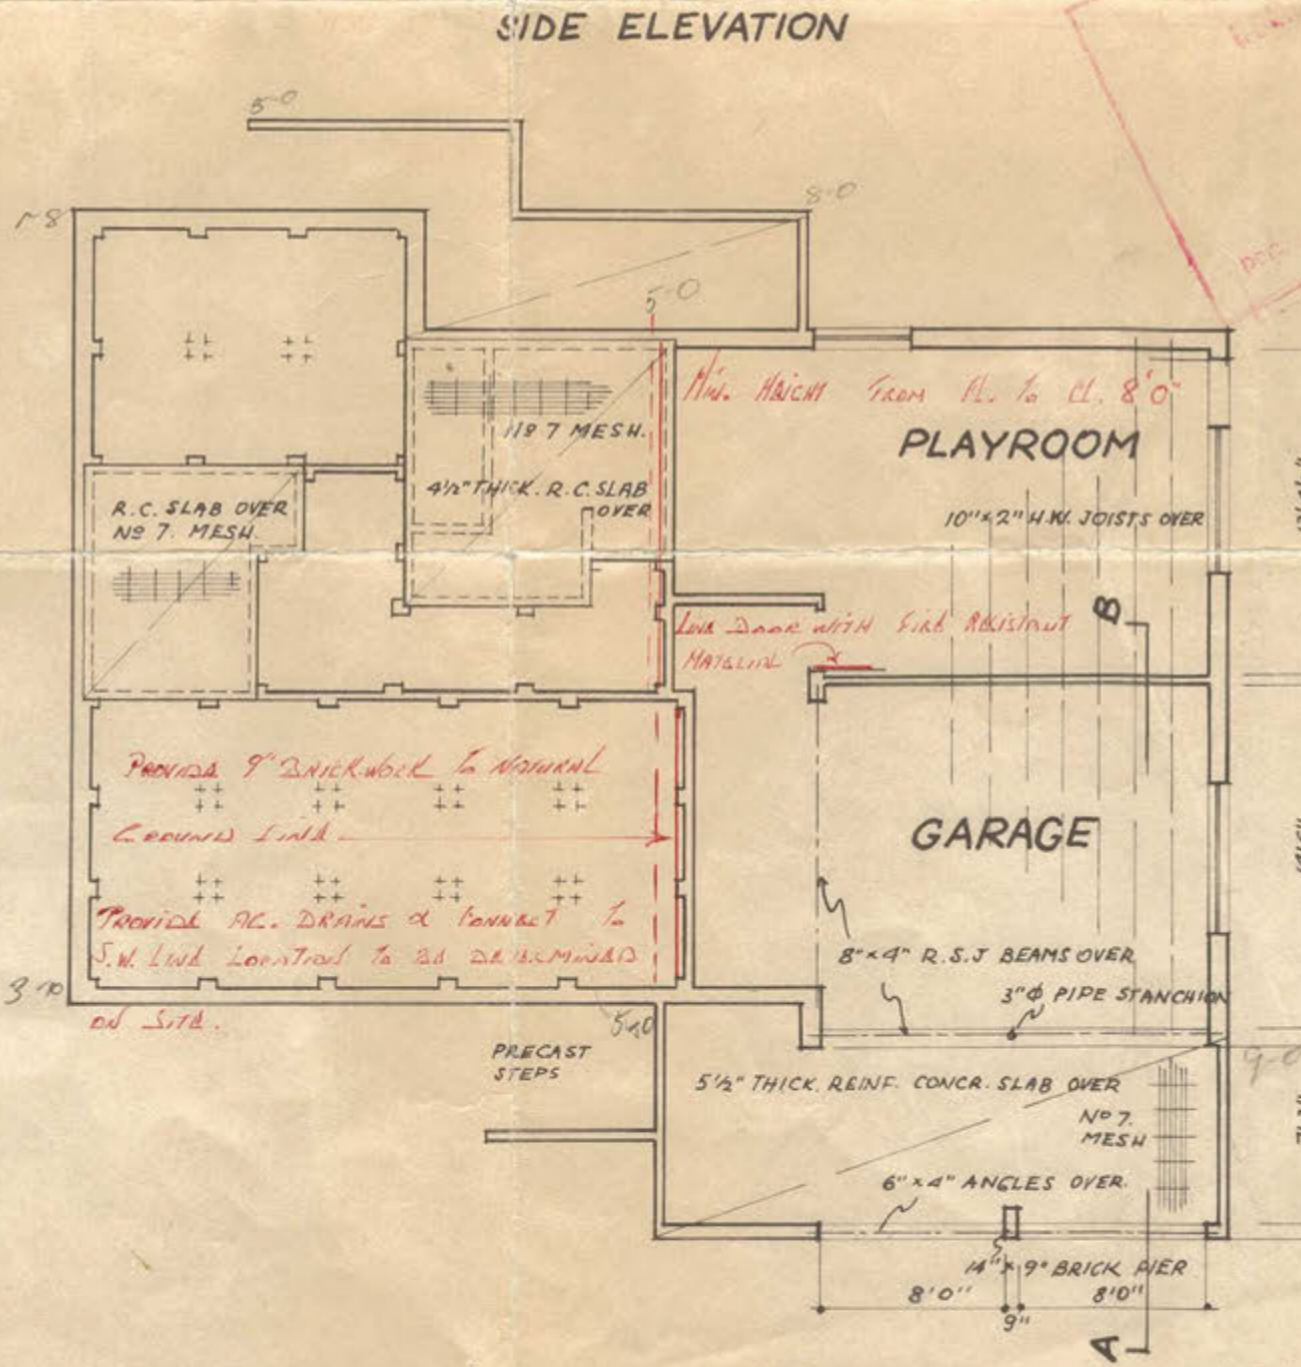


BASEMENT PLAN

APPROVED SUBJECT TO COMPLIANCE
 WITH THE CANBERRA SEWERAGE AND
 WATER SUPPLY REGULATIONS.

SITE PLAN
 SCALE 1" = 40'

BUILDING TO BE CONSTRUCTED IN
 ACCORDANCE WITH THE CANBERRA
 BUILDING REGULATIONS AND S.A.
 CODES OR AS DIRECTED

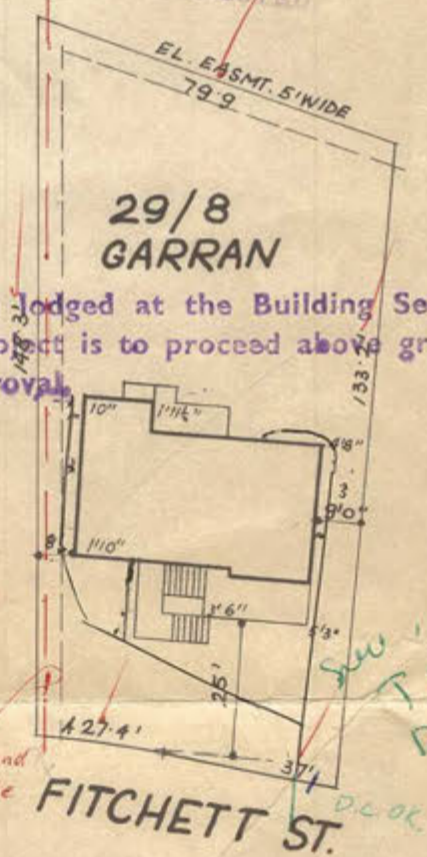


A check survey is to be lodged at the Building Section
 and no work on this project is to proceed above ground
 level without prior approval.



SECTION A-B

TILED ROOF, 22 1/2° PITCH.

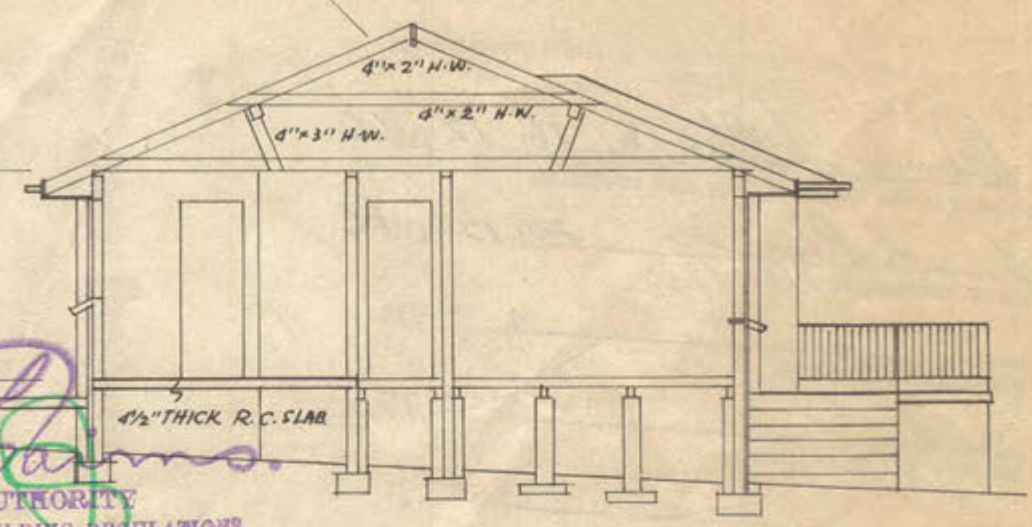


SECTION X-X

APPROVED
 PROPER AUTHORITY
 CANBERRA BUILDING REGULATIONS
 6 JAN 1967

13330R
S.B.

PROPOSED RETAINING WALLS AT
BLOCK 29, SECTION 8, GARRAN,
FOR:

MR. & MRS. A. I. KENNER

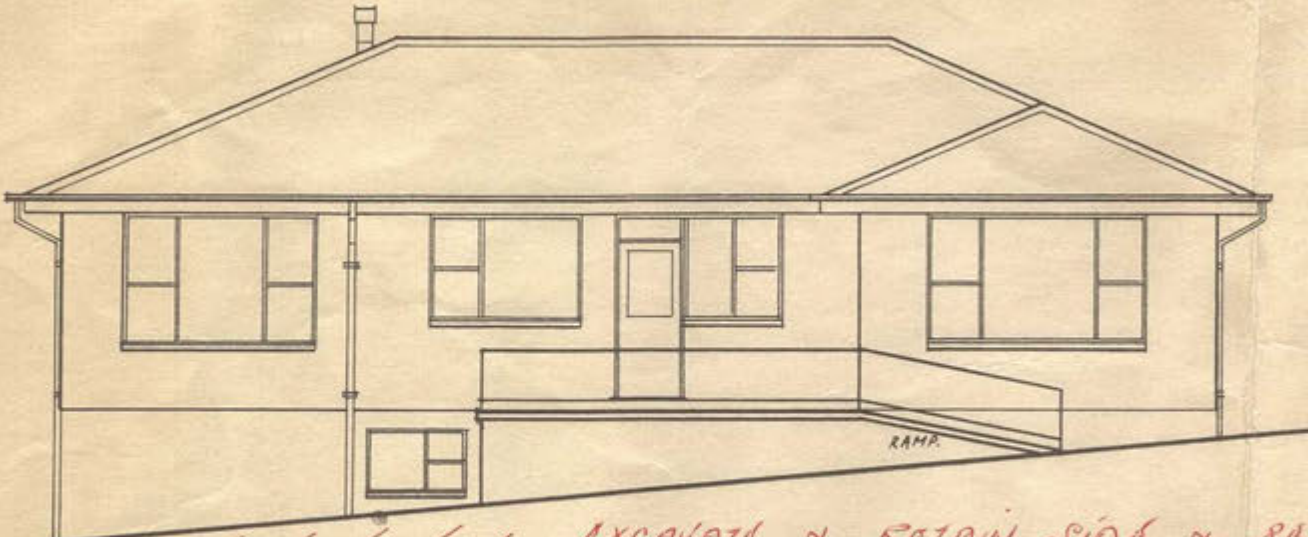


EXCAVATE & RETAIN SIDE & REAR
AS PER DETAIL.

REAR ELEVATION

Handwritten notes in red ink: '... WILL BE ... TO BE ...'

DEPARTMENT OF WORKS
DEPARTMENTAL RECORDS INDICATE THAT PORTION OF THE EXISTING SANITARY DRAINAGE SERVICE WILL BE UNDER THE PROPOSED STRUCTURE. AN APPROVED SANITARY DRAINAGE PLAN SHOWING WHAT ACTION IS TO BE TAKEN TO PROTECT OR RELOCATE DRAINS UNDER THE PROPOSED STRUCTURE, AND ANY OTHER ACTIONS OR ADDITIONS TO SEWER DRAINAGE NECESSARY MUST BE OBTAINED AND FORM PART OF THE WORK CONNECTED WITH THIS PROJECT.

SECTION OF RETAINING WALL

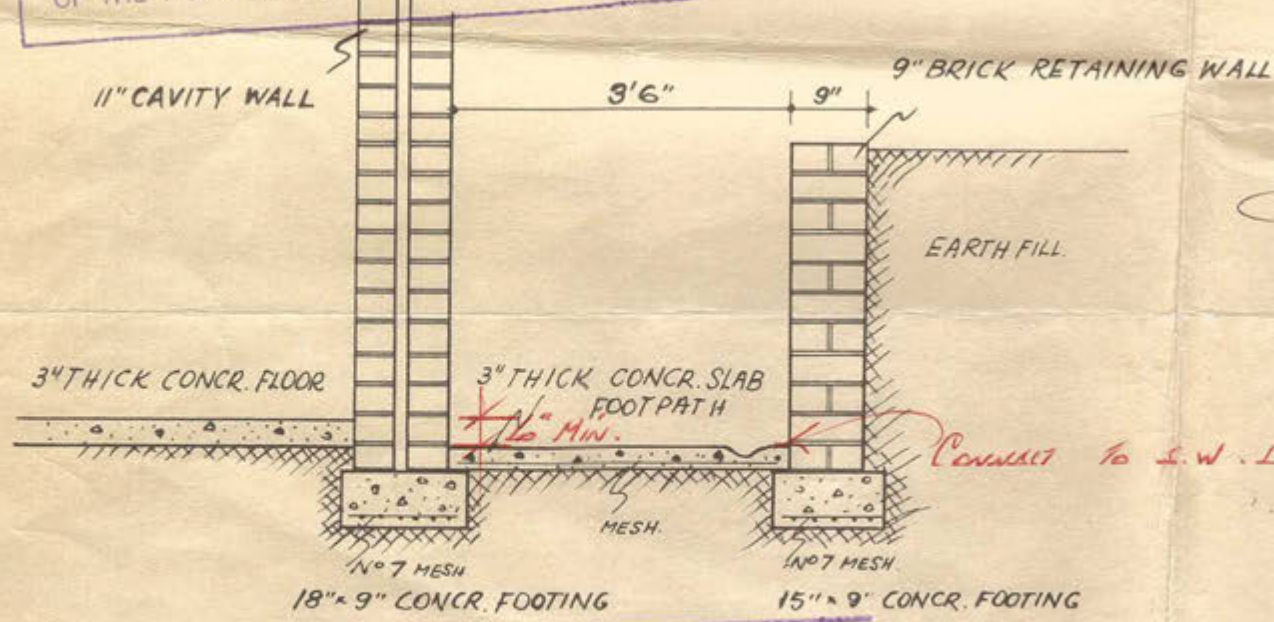


APPROVED SUBJECT TO COMPLIANCE WITH THE CANBERRA SEWERAGE AND WATER SUPPLY REGULATIONS.

T. J. Brooks (Developer)
For and on behalf of

SITE PLAN
SCALE 1"=40'

3/3/67

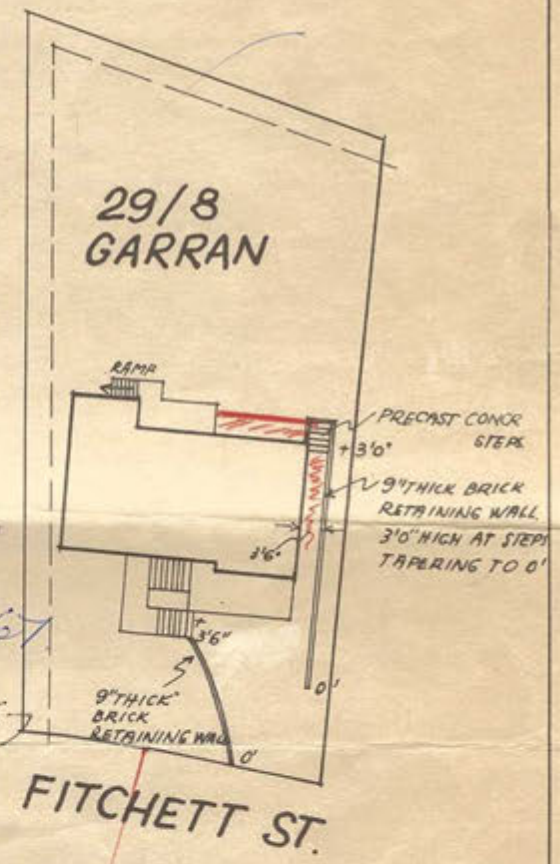


ENGINEER FOR WATER SUPPLY AND SEWERAGE 13/3/1967
CHIEF ELECTRICAL ENGINEER 8/3/1967
STRUCTURAL ENGINEER 1/19
ARCHITECT AND ENGINEER APPROVED 1/3/1967
SENIOR TECHNICAL OFFICER BUILDING REGULATIONS
23 MAR 1967

No higher than level of backfill.

ANDS BRANCH DEPT. OF PUBLIC WORKS
 CANBERRA BUILDING REGULATIONS AND BY-LAWS
 PLAN No. B/S **13330/B**

AMENDED PLAN OF BASEMENT & FUTURE FLAT 29/8 GARRAN
 MR & MRS. A. I. KENNER.

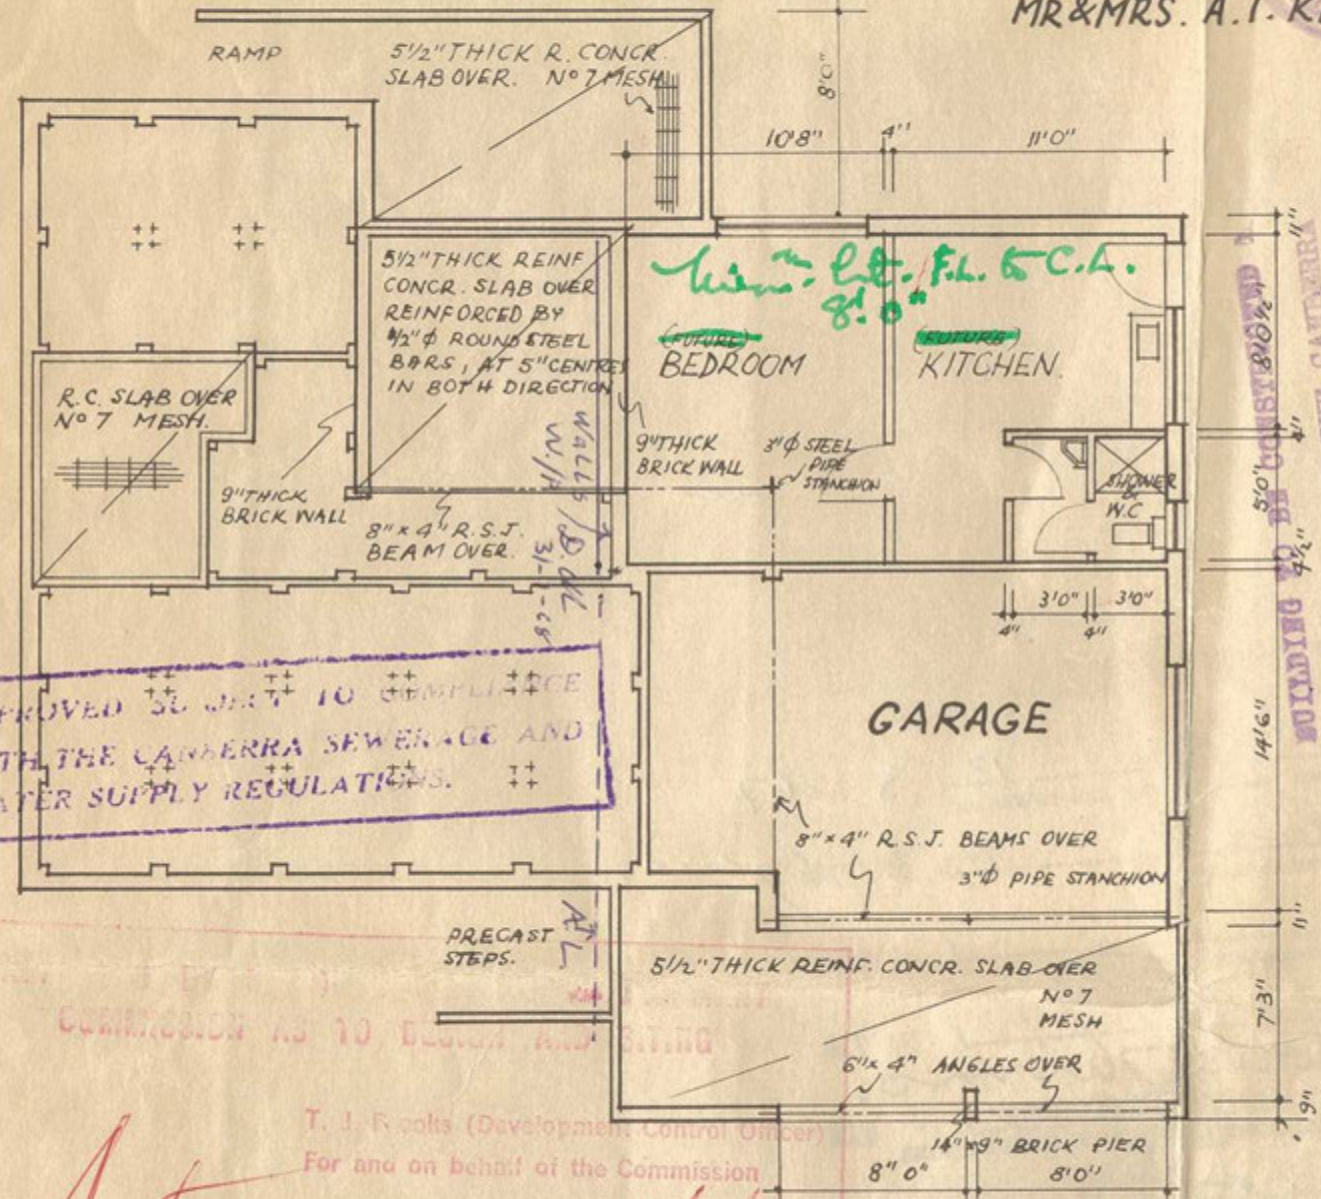

APPROVED SUBJECT TO COMPLIANCE WITH THE CANBERRA SEWERAGE AND WATER SUPPLY REGULATIONS.

per: *[Signature]* T. J. Rodds (Development Control Officer)
 For and on behalf of the Commission
 Date: 13/3/67

BUILDING TO BE CONSTRUCTED IN ACCORDANCE WITH THE CANBERRA BUILDING REGULATIONS AND BY-LAWS OR AS DIRECTED

51/2

PROPOSED ALTERATION TO RETAINING WALLS AND FOOTPATH WIDTH.

BLOCK 29. SECTION 8. GARRAN. FOR MR + MRS. A.I. KENNER.

RECEIVED AND RECOMMENDED FOR APPROVAL.



+ W. J. Shillaber 6/8/68
 CIVIL ENGINEER
 FOR WATER SUPPLY AND SEWERAGE
W. J. Rowe 7/8/68
 CIVIL ENGINEER
A. J. Anderson 13/8/68 (See Mr. Upton's note 12.8.68)
 CIVIL ENGINEER
Shaughnessy Morris 3/9/68
 ARCHITECT AND VALUER
M. Upton 26/8/68
 SENIOR TECHNICAL OFFICER



BUILDING TO BE CONSTRUCTED IN ACCORDANCE WITH THE CANBERRA BUILDING REGULATIONS AND S.A.A. CODES OR AS DIRECTED.

APPROVED [Signature]
 PROPER AUTHORITY
 UNDER CANBERRA BUILDING REGULATIONS
 3 SEP 1968 [Signature]

SECTION OF RETAINING WALL.

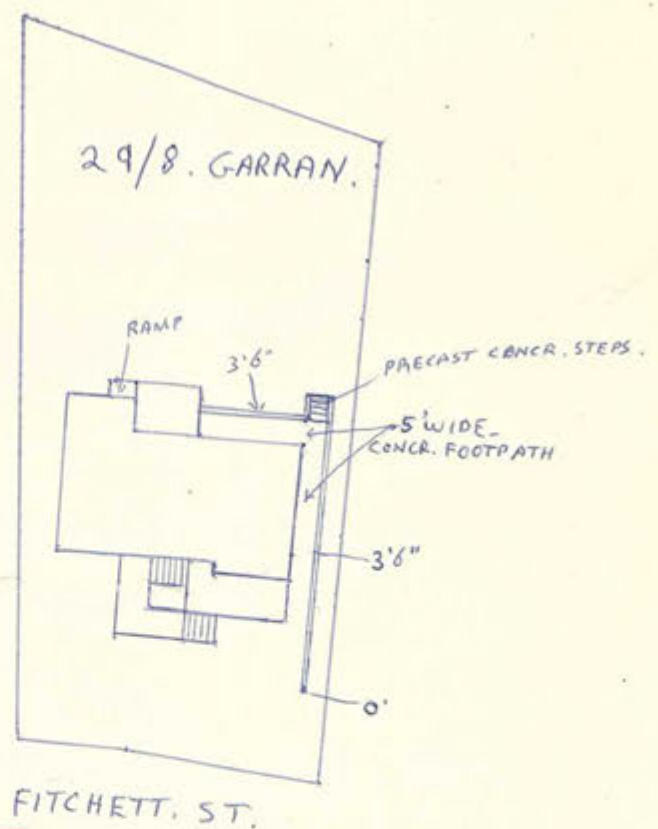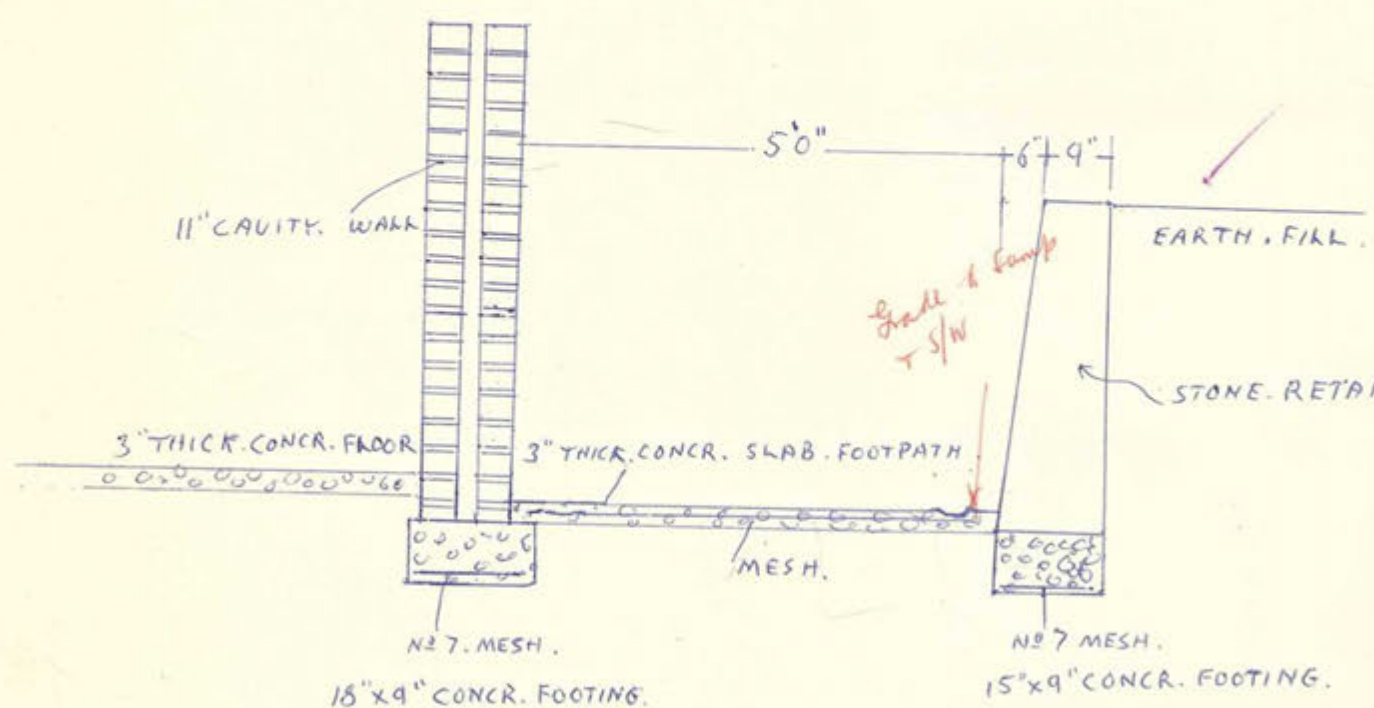

Approval GRANTED as to External Design and Siting
[Signature]
 Delegate
 NATIONAL CAPITAL DEVELOPMENT COMMISSION
 Date 15 JUL 1968

94

Department of the Capital Territory
Building Section

Australian Capital Territory
Building Ordinance 1972-74
(Part V)

CERTIFICATE OF FITNESS
(CLASS 7 AND X OCCUPANCY ONLY)

BL1/8(9/75)

It is hereby certified that the building consisting of Brick Addition to Residence

..... situated on

Block <u>29</u>	Section <u>8</u>	Division <u>Garran</u>
or situated at		

for which plans and specifications were approved and a Building Permit issued under the provisions of the Building Ordinance 1972, is fit for use and/or occupation.

Approved plan no.

13330/E

Type of construction*

Class of occupancy*

Number of storeys

Permit no.

25419/A

Name of permit holder

J Masgrave

*As defined in the Building Manual
A.C.T.



No

Page 49 of 99

1120





[Signature] 27/9/77
Deputy Building Controller

PLAN No. 13330/E
 Received Building Section
 16 SEP 1974 5/3
 Dept. of the Capital Territory

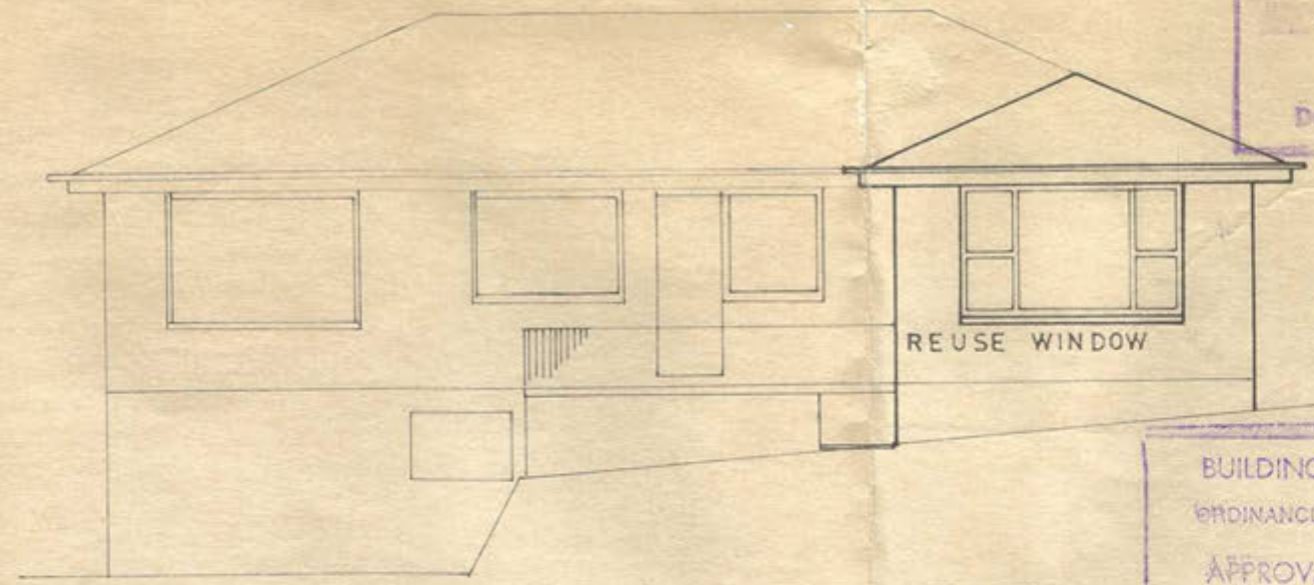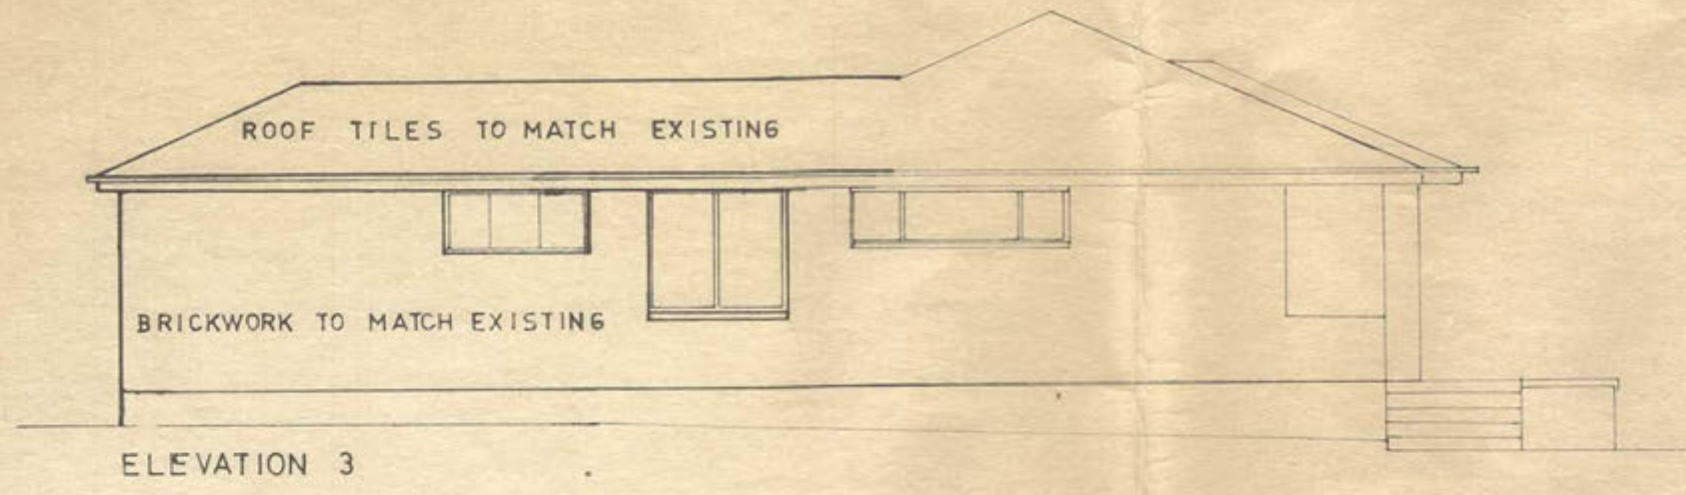

BUILDINGS (DESIGN AND SITING)
 ORDINANCE 1934 AS AMENDED
 APPROVAL GRANTED 19 SEP 1974
 DELEGATE *J. Moore*
 NATIONAL CAPITAL
 DEVELOPMENT COMMISSION

Calculating to the construction of the building with the Building Materials Act, 1934. All materials and equipment to be used in the construction of the building shall be of the best quality and shall be approved by the Building Materials Board. Applications to use natural stone or other materials shall be lodged with the Building Materials Board in accordance with Land Services Section 133(1).

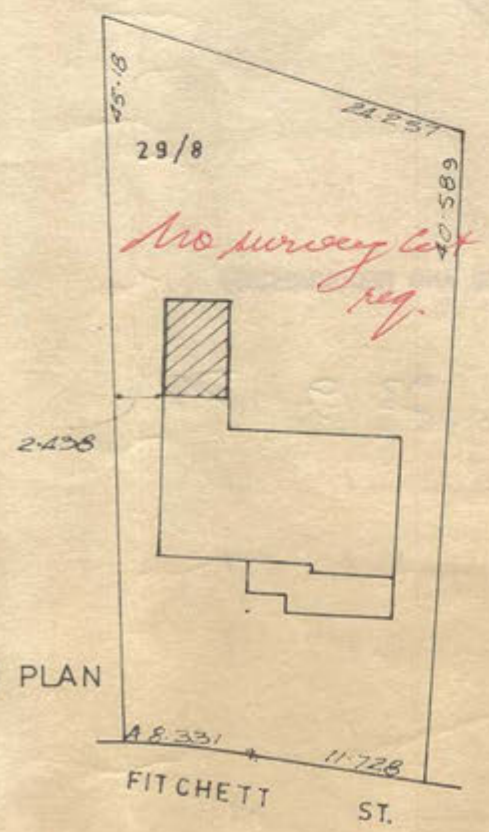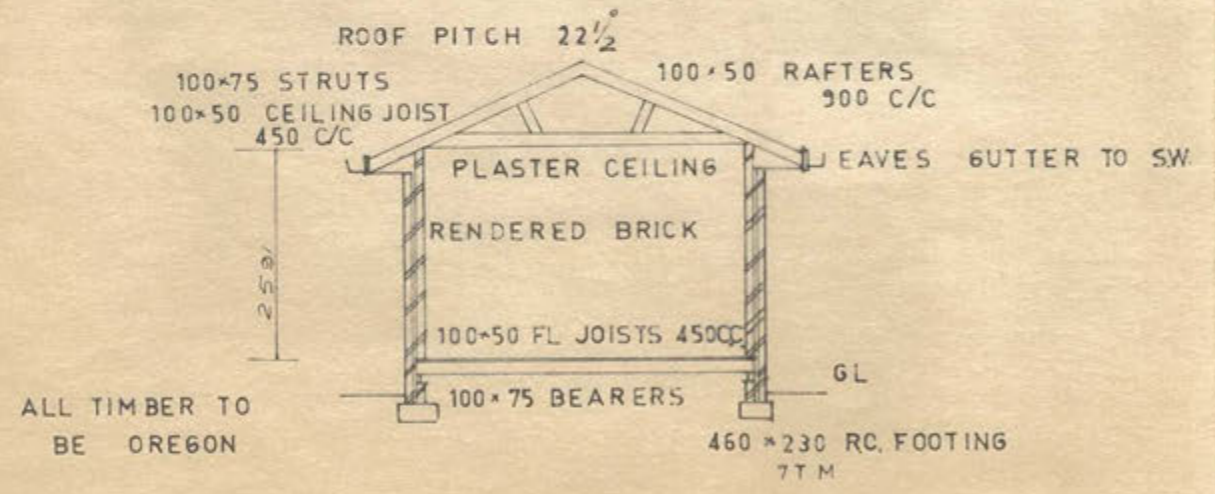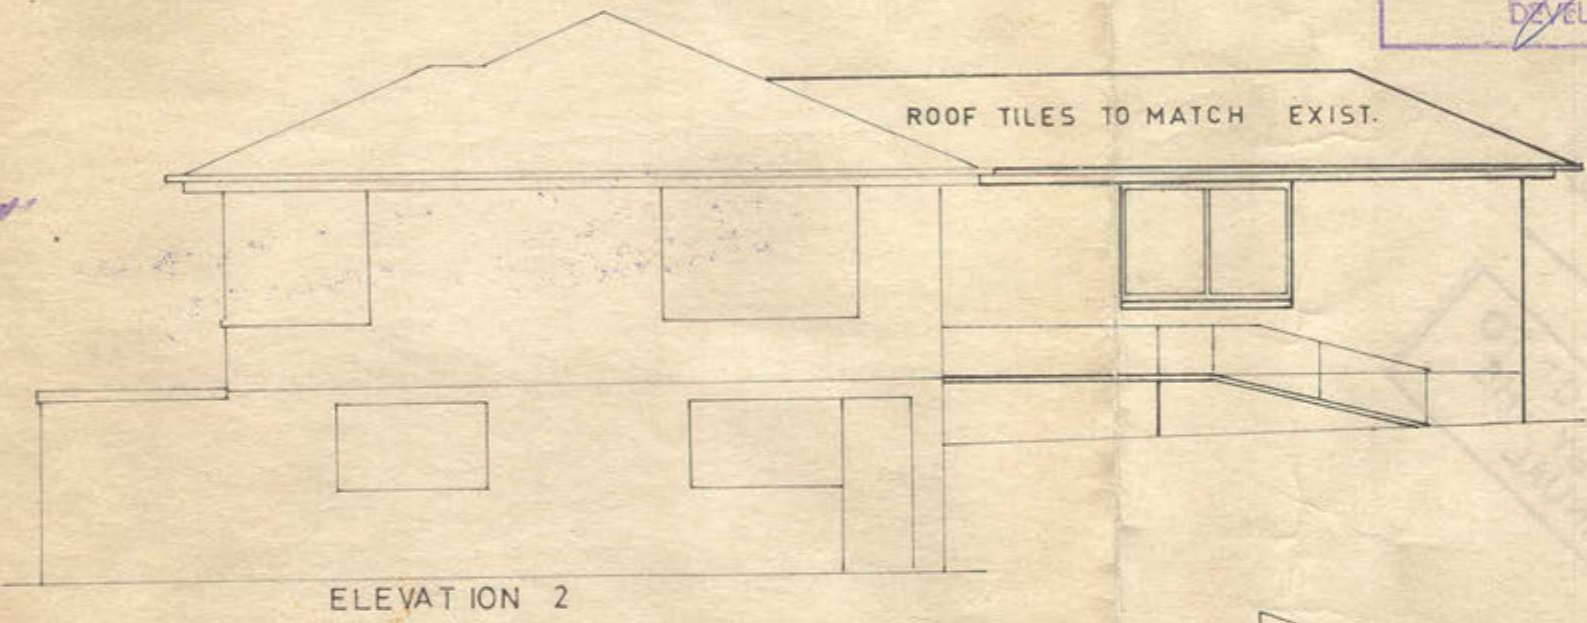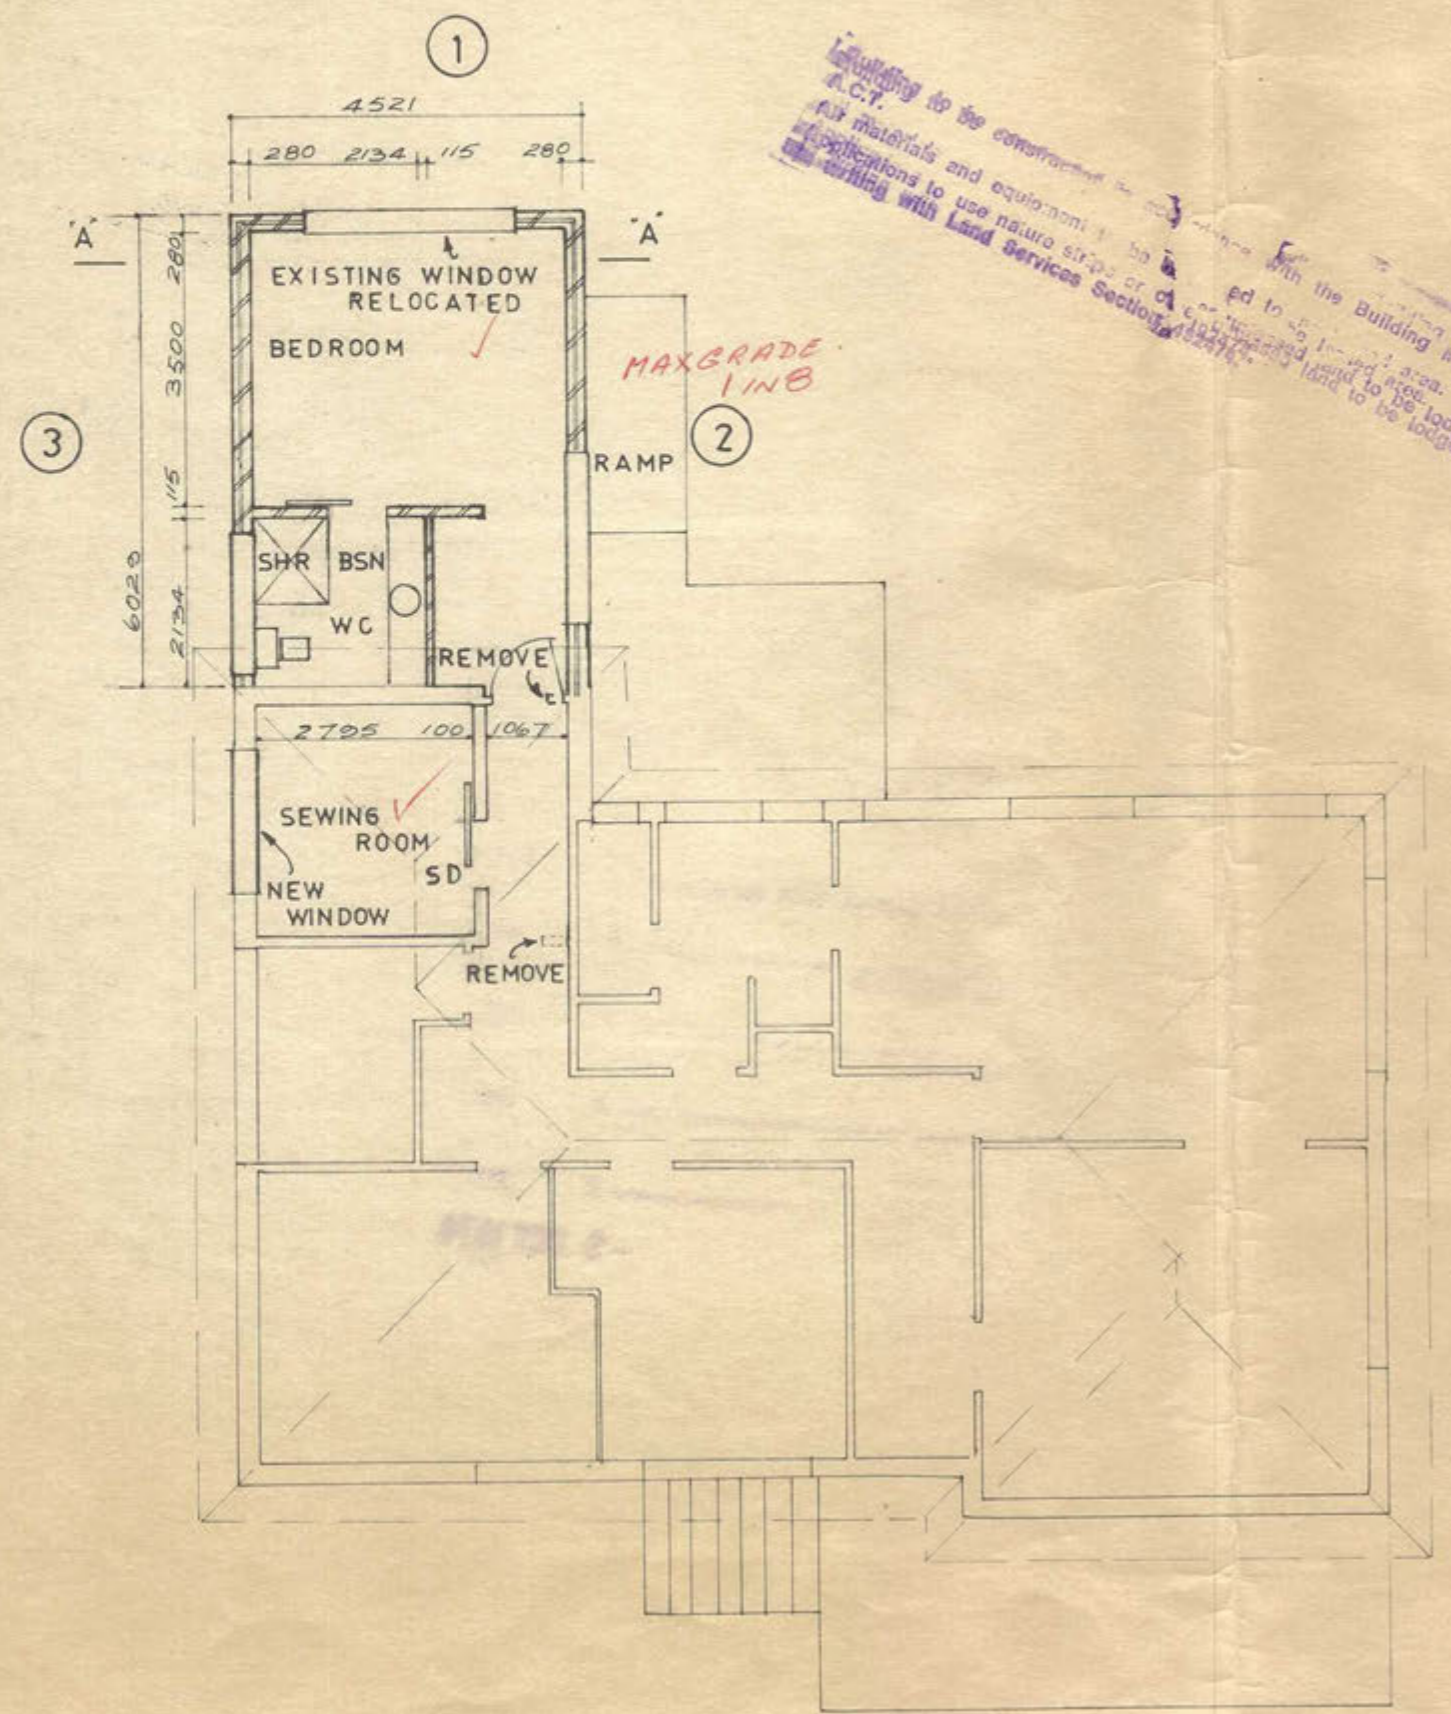

PROPOSED EXTENSIONS.
 FOR: MR & MRS. A.I. KENNER.
 BLOCK 29. SECTION 8. GARRAN.

SCALES. 1:100 1:500

AREA: 27.26 M² C/S.T.

G. MOORE & N. SMITH
 J555.

PLANS/FILE No. 13330/E
Received Building Section
16 SEP 1974 3B
Dept. of the Capital Territory

SPECIFICATION

FOR: MR & MRS A. KENNER

BLOCK: 29 SECTION: B

SUBURB: GARRAN

GENERAL:

COMPLY WITH PLANS, DETAILS, SPECIFICATIONS AND SCHEDULES. IN THE EVENT OF DISCREPANCIES, FIGURED DIMENSION TAKE PRESEDENCE OVER THIS SPECIFICATION.

SUPPLY AND FIX TO THE TRUE EXTENT OF THE DRAWINGS AND SPECIFICATIONS ALSO THOSE ITEMS WHICH MAY NOT BE SHOWN ON THE DRAWINGS OR SPECIFICATIONS AND ARE OBVIOUSLY NECESSARY TO PROPERLY COMPLETE THE BUILDING.

COMPLY WITH THE REQUIREMENTS OF ANY RELEVANT CODE WHICH MAY BE ISSUED BY THE STANDARD ASSOCIATION OF AUSTRALIA.

1. CARPENTERS AND JOINERS:

1.1 TIMBERS

USE ONLY TIMBERS WHICH ARE THE BEST QUALITY OF THEIR RESPECTIVE KINDS, SOUND AND WELL-SEASONED, FREE FROM SAP, SHAKES, LARGE OR LOOSE KNOTS AND OTHER DEFECTS. MAKE USUAL ALLOWANCE FOR MATCHING AS ALL JOINERY TIMBERS ARE STANDARD STOCK MILLING. SAW SCATLINGS SQUARE TO THE SIZE SPECIFIED. MAKE JOINERY NOMINAL WITH FAIR TRADE ALLOWANCE FOR WORKING EXCEPTING WHERE FINISHED SIZE IS SPECIFIED.

1.2 GENERALLY

FRAME TRIM AND FINISH THE WHOLE OF THE CARPENTER'S AND JOINER'S WORK THROUGH OUT IN A WORKMANLIKE MANNER. PROVIDE AND FIX IRONMONGERY. GROVE, TONGUE, REBATE, HOUSE, BEAD, MITRE, SCRIBE AND TREAT AND DO ALL INCIDENTALS.

DO ALL CARPENTERS AND JOINERS WORK TO THE INTENSIONS OF THE DRAWINGS THOUGH NOT SPECIALLY MENTIONED. PRIME ALL JOINERY BEFORE LEAVING WORKSHOP AND WROT FINISH ALL TIMBER EXPOSED TO VIEW.



 
UFI POOLS

COOL POOLS OF CANBERRA

TECHNICAL DATA

"NERITINE" 10.33 m. X 4.27 m.
DSC/SEC. PERM.


SCALE OF PLAN & SECTIONS:

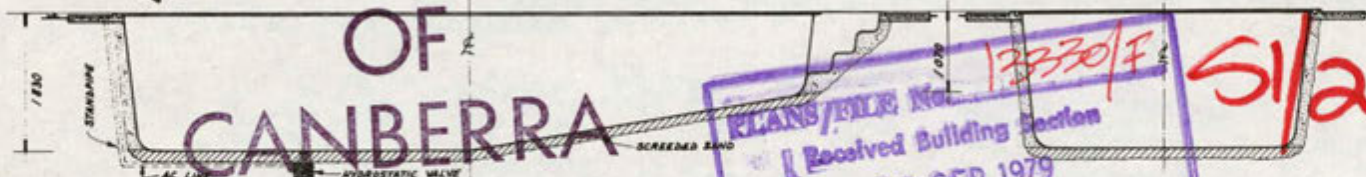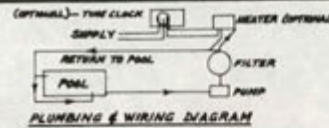


LONGITUDINAL SECTION

GROSS SECTION


PLANS/FILE No. 13330/F
Received Building Section
25 SEP 1979
Dept. of the Capital Territory

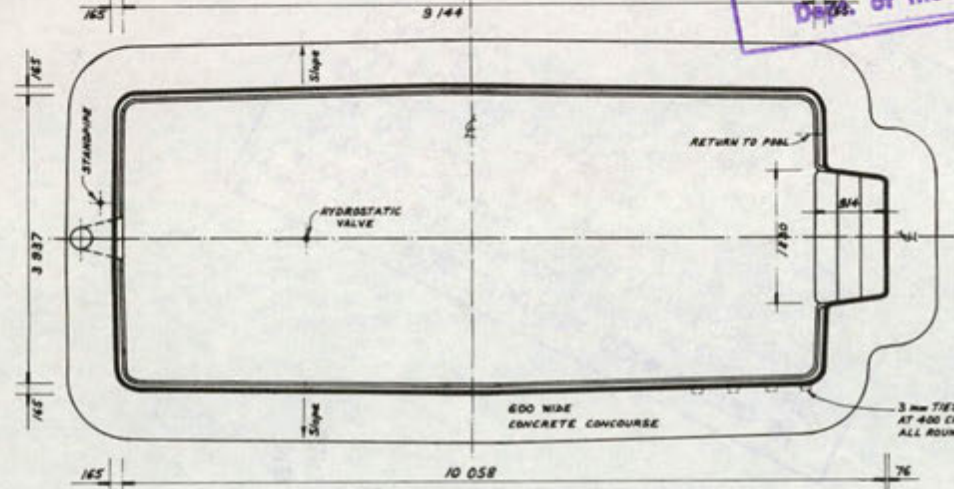

POOL PLAN

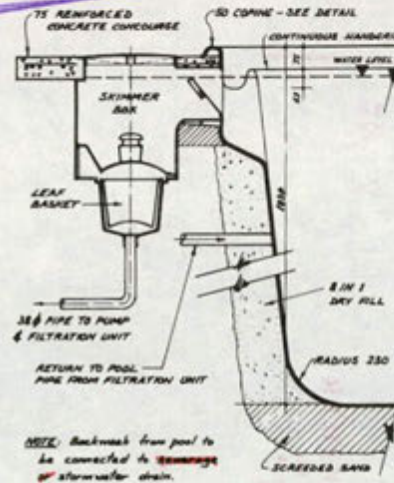

SKIMMER BOX DETAIL

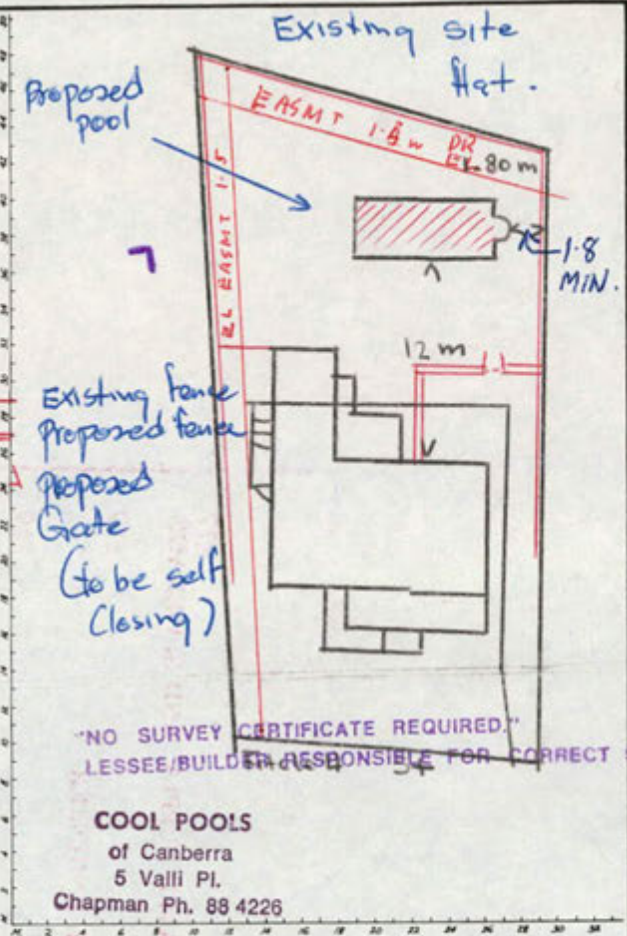

Existing fence
Proposed fence
Proposed Gate
(to be self closing)

"NO SURVEY CERTIFICATE REQUIRED."
LESSEE/BUILDER RESPONSIBLE FOR CORRECT SITING

COOL POOLS
of Canberra
5 Valli Pl.
Chapman Ph. 88 4226

BLOCK PLAN 29/8


NOTE: THIS POOL-TYPE HAS BEEN EXAMINED AND REPORTED - ORIGINAL AVAILABLE ON REQUEST.
E.J. PERRY M.E., M.I.C.E., M.A.S.T.E. CONSULTING ENGINEER.

SPECIFICATION:
GENERAL: THE BUILDER SHALL COMPLY WITH THE REQUIREMENTS OF ALL RELEVANT LOCAL GOVERNMENT AUTHORITIES.
EXCAVATION: EXCAVATE FOR POOL SHELL ALLOWING MIN. 150mm FOR THICKNESS OF SAND & GROUT. PLACE AND COMPACT SAND BASE TO PROVIDE AN EVEN SUPPORT FOR THE SHELL, AND WATER SAND AROUND SHELL WHERE INDICATED.
DRAINAGE: FOR ALL SWIMMING POOLS AN AGRICULTURAL DRAIN MUST BE BUILT FROM THE LOWEST POINT TO AN OUTLET OPEN TO THE ATMOSPHERE OR TO STANDPIPE. A HYDROSTATIC VALVE IS TO BE FITTED TO RELIEVE THE POOL OF HYDROSTATIC PRESSURE.
MANUFACTURE: TO MINIMUM REQUIREMENTS OF S.A.A. CODE 1838 - 1975.
CONCRETOR: CONCRETE SHALL HAVE MIN. COMPRESSIVE STRENGTH OF


15 MP. & SLUMP BUILD A CONCRETE THE BEAM 600 x 75 MIN. SIZE AROUND SHELL UNDER COPING. REINFORCE WITH FEZ FABRIC. FINISH CONCRETE AROUND POOL TO WOOD FLOAT SURFACE. CLEAN UP AREA AROUND POOL AND LEAVE AREA IN A TIDY CONDITION.
FILTER INSTALLATION: INSTALL A MODEL (SEE DETAIL) SKIMMER BOX AND MINIMUM 2M² DIATOMACEOUS EARTH FILTER. CONNECT WITH 38mm Ø HIGH PRESSURE PVC PIPES AND FITTINGS TO ALL SUCTION AND RETURN LINES.
ADDENDA:
INSTALLATION: TO MINIMUM REQUIREMENTS OF S.A.A. CODE 1838 - 1975.



RIBS FORMED ON VERTICAL WALLS AND UNDER STEPS

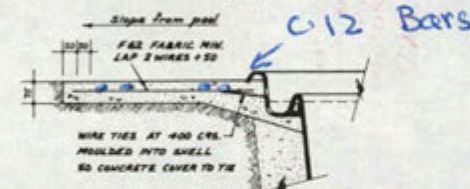

REINFORCEMENT & COPING DETAIL

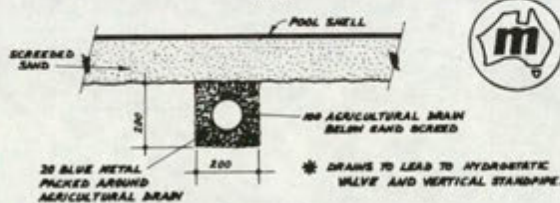

TYPICAL AGRICULTURAL DRAIN

PROPOSED FIBREGLASS SWIMMING POOL
For: Mr. Mrs. Andy Kenner.
97 Fittlett St Garrahan.

MANUFACTURED BY
UNITED FIBREGLASS INDUSTRIES PTY. LTD.
HEAD OFFICE & FACTORY: 1 Princes Highway, YALLAH, N.S.W., 2530.
CORRESPONDENCE TO: P.O. Box 26, DAPTO, N.S.W., 2530.

DISTRIBUTED BY: Cool Pools of Canberra.
BUILDER: Mr. D. Terpstra c/o Cool Pools.

Date: 24/9/79
Scale: 1:500
Drawing No: 844
Drawn: WK
UNITED FIBREGLASS INDUSTRIES Engineering Division.

105

PLANS/FILE No. 28
 Received Building Section 3
 20 MAR 1980
 Dept. of the Capital Territory

Department of the Capital Territory
Building Section

Form 4
 Australian Capital Territory
 Building Ordinance 1972
 Regulation 21
 12270380204059

1500NO REC'D

APPLICATION FOR APPROVAL OF PLANS AND SPECIFICATIONS
 BL 1/6 (4/77)

Name of Applicant <i>G. MOORE / M SMITH</i>	Address <i>PO BOX 453 Kingston ACT 2601</i>
--	--

Name of lessee / owner of parcel of land <i>A. I. KEMMER</i>	Address (Show P.O. Box No. if any) <i>c/o ABOVE</i>
---	--

Description of the building work <i>Retaining Wall EXT. change room</i>			
Description of land on which the building work is to be carried out.	Block <i>29</i>	Section <i>8</i>	Division <i>Garron</i>
To be specified in accordance with the appropriate classification in the Building Manual.	Type of Construction <i>BRICK</i>	Cost <i>\$ 2500.00</i>	
	Class of occupancy <i>(10)</i>	Total floor area where applicable. <i>6 sqm.</i>	

This application is for

(Please tick appropriate box)

New work Amendment to approved plan Amendment to plan not yet approved Details

I hereby apply for approval of the attached plans and specifications.

..... *[Signature]* *29/3/80*
 Signature of Applicant Date

To be completed if application made otherwise than by the lessee/owner, his solicitor or architect.

I hereby authorise the abovenamed applicant of the address indicated to make this application on my behalf.

+ *[Signature]*
 Signature of lessee/owner Date

"NO SURVEY CERTIFICATE REQUIRED"

FOR OFFICE USE ONLY	Area	Plans Numbered <i>13330/6</i>	Building Covenant \$
	Valuation \$	Plans	<input checked="" type="checkbox"/> Approved <i>C</i> <input type="checkbox"/> Not Approved
	Total Fees Payable <i>\$15.00</i> <i>[Signature]</i> Deputy Building Controller Date	
	Receipt/Docket No.		

PERMIT TO CARRY OUT BUILDING WORK

BL1/9 (1/78)

Permit No. 130445	Date of Issue 24 10 80	Block 129	Section 118	Suburb GARRAN
----------------------	---------------------------	--------------	----------------	------------------

THIS PERMIT WILL LAPSE

15 months after date of issue unless otherwise extended by the Building Controller. Application for extension must be made before permit lapses and extension fee paid otherwise a new permit is necessary and full permit fee payable. If work is not commenced no refund is payable unless permit is surrendered before it lapses.

ISSUED TO:

Permit Holder Details

Initials A I	Surname KENNER	OB
-----------------	-------------------	----

Address
97 Fitchett St
Garran ACT 2605

Nominee (if applicable)

Initials	Surname
----------	---------

CLASS OF BUILDERS LICENCE

NA

Plan No.

113330G

Register Folio No.

|||||

Cost \$

250000

Type of Building Construction

||

Description of Work

Back outlet a shower

Class of Occupancy

|

ENDORSEMENTS Under Section 36 Inspections - Each stage specified overleaf which applies to the building work must be inspected before proceeding beyond that stage. Stages may be grouped as indicated overleaf.

EXCLUDING INSPECTION STAGES 1 & 2
GROUPING OF INSPECTIONS NOT PERMITTED

NO BUILDERS LICENCE REQUIRED

"NO SURVEY CERTIFICATE REQUIRED."
LESSEE/BUILDER RESPONSIBLE FOR CORRECT SITING

The building work shall be carried out in accordance with the approved plans, the Building Manual A.C.T., the notations made on the plans and subject to the provisions of the Building Ordinance 1972. The approval of plans or the grant of a building permit does not affect the operation of any other law in the Territory nor does it authorise the use of the land contrary to a provision, covenant or condition of the Crown Lease.

S J Reichenow
Deputy Building Controller



Permit No.	Date of Issue	Block	Section	Suburb
66936	27 1884	29	18	GARRAN

THIS PERMIT WILL LAPSE

15 months after date of issue unless otherwise extended by the Building Controller. Application for extension must be made before permit lapses and extension fee paid otherwise a new permit is necessary and full permit fee payable. If work is not commenced no refund is payable unless permit is surrendered before it lapses.

ISSUED TO:

Permit Holder Details

Initials	Surname
A.I	KENNER

OIB

Address

97 FITCHETT ST
GARRAN 2605

Nominee (if applicable)

Initials	Surname

CLASS OF BUILDERS LICENCE

N/A

Plan No.

133806

Register Folio No.

Cost \$

1000

Code No.

Description of Work

FINISH TOILET BLOCK + SHOWER.

Type of Building Construction

Class of Occupancy

ENDORSEMENTS Under Section 36 Inspections—Each stage specified overleaf which applies to the building work must be inspected before proceeding beyond that stage. Stages may be groups as indicated overleaf.

NO BUILDERS LICENCE REQUIRED

NO SURVEY CERTIFICATE REQUIRED."

LESSEE/BUILDER RESPONSIBLE FOR CORRECT SITING


NOT TO BE USED OR OCCUPIED
UNTIL A CERTIFICATE AS TO FIT-
NESS FOR OCCUPANCY AND USE
FOR THIS STRUCTURE IS ISSUED.

The building work shall be carried out in accordance with the approved plans, the Building Manual A.C.T., the notations made on the plans and subject to the provisions of the Building Ordinance 1972. The approval of plans or the grant of a building permit does not affect the operation of any other law in the Territory nor does it authorise the use of the land contrary to a provision, covenant or condition of the Crown Lease.


S. J. Reichened
Deputy Building Controller

PLANS/FILE No. **133206**
 Received Building Section
 28 MAR 1980
 Dept. of the Capital Territory


5/2.

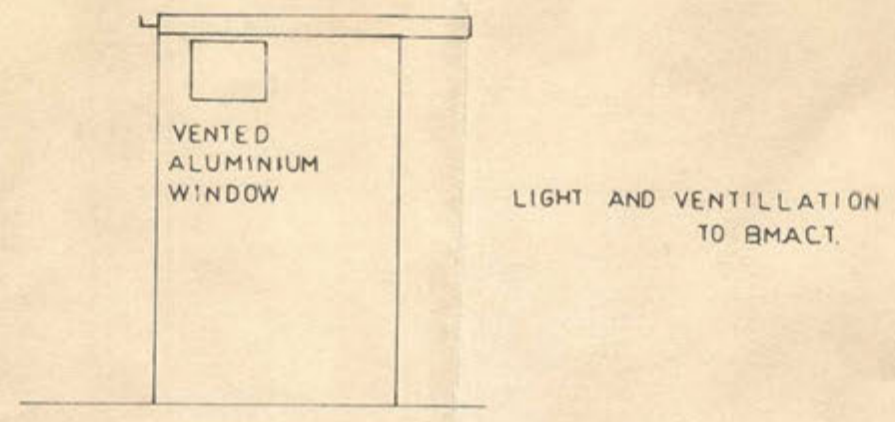


ELEVATION 'A'

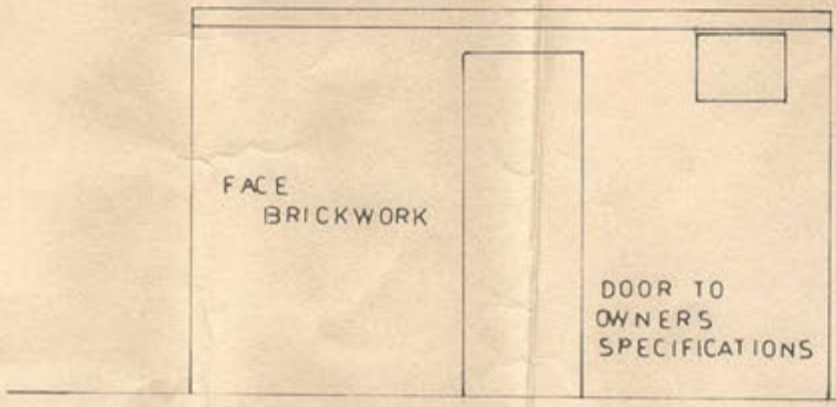

ELEVATION 'C'

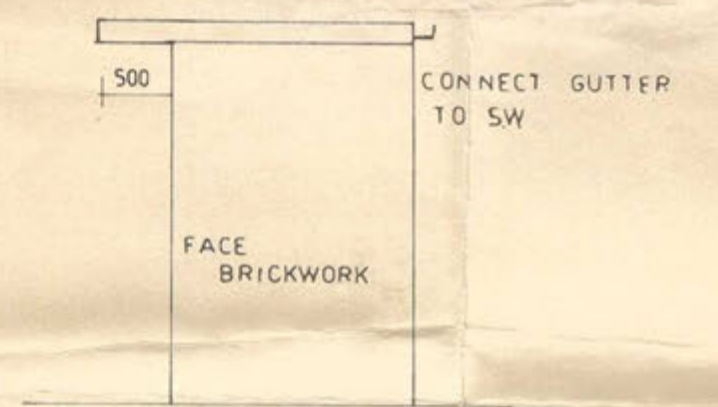

ELEVATION 'B'

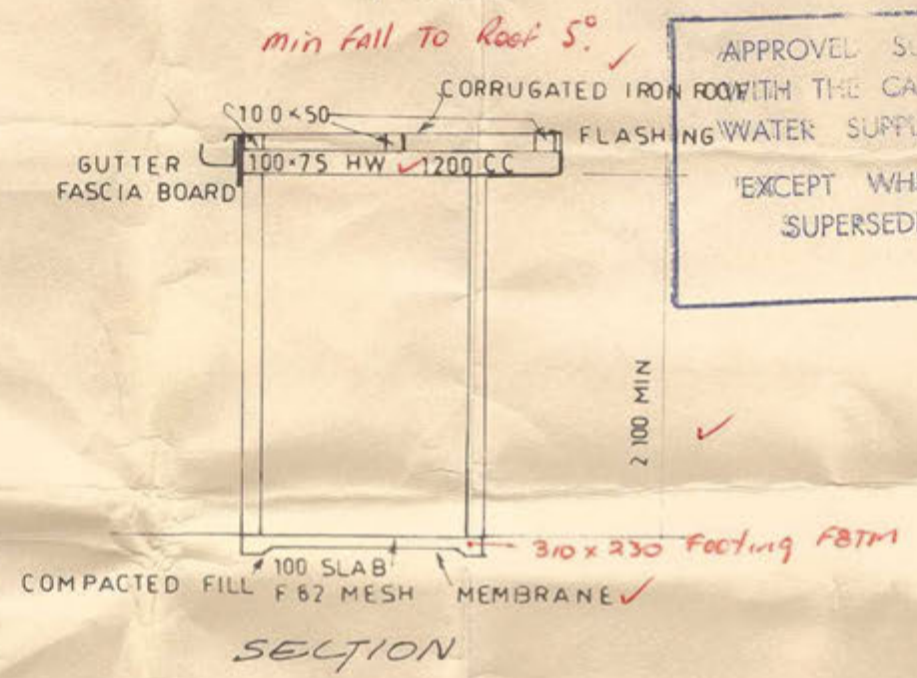


SECTION

APPROVAL SUBJECT TO COMPLIANCE WITH THE GAMBERRA SEWERAGE AND WATER SUPPLY REGULATIONS. EXCEPT WHERE SUBJECT TO AND SUPERSEDED BY THE BUILDING MANUAL

FOOTINGS TO BE TAKEN DOWN TO SOLID GROUND

DEPTH OF FILL UNDER SLAB NOT TO EXCEED 400 mm

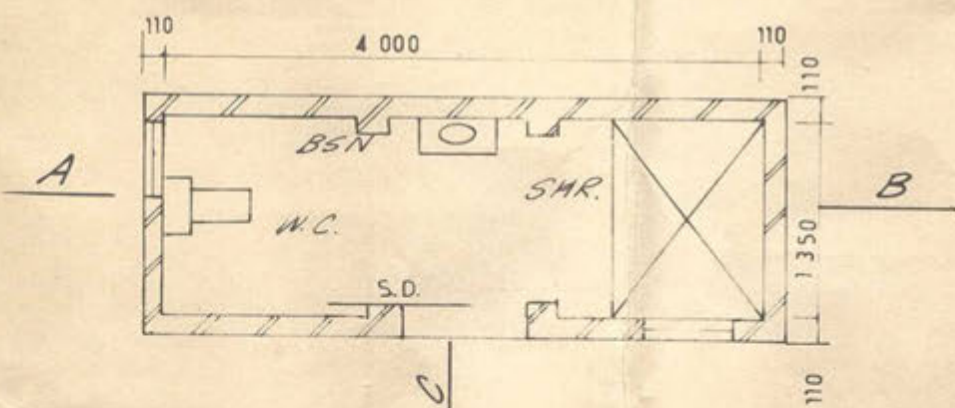


FLOOR PLAN

REGULATIONS EXAMINED AND APPROVED FOR APPROVAL BY
[Signature] 11/4/80
 ENGINEER FOR WATER SUPPLY AND SEWERAGE
 CHIEF ELECTRICAL ENGINEER 1/19
[Signature] 16/4/1980
 STRUCTURAL ENGINEER
 SENIOR TECHNICAL OFFICER 1/19

BUILDING WORK SHALL BE CONSTRUCTED IN ACCORDANCE WITH THE APPROVED PLANS THE BUILDING MANUAL ACT, THE NOTATIONS MADE ON THE PLANS AND ANY MATTERS SPECIFIED ON THE BUILDING PERMIT. THE APPROVAL OF PLANS OR THE GRANT OF A BUILDING PERMIT DOES NOT AFFECT THE OPERATION OF ANY OTHER LAW IN THE TERRITORY, NOR DOES IT AUTHORISE THE USE OF THE LAND CONTRARY TO A PROVISION, COVENANT OR CONDITION THEREIN.
 MODIFICATION NOT ALLOWED

BUILDINGS (DESIGN AND CONSTRUCTION) ORDINANCE 1934 AS AMENDED
 APPROVAL GRANTED
 10 APR 1980
[Signature]
 ELECTRICIAN
 CAPITAL TERRITORY COMMISSION

"NO SURVEY CERTIFICATE REQUIRED."
 LESSEE/BUILDER RESPONSIBLE FOR CORRECT BITING

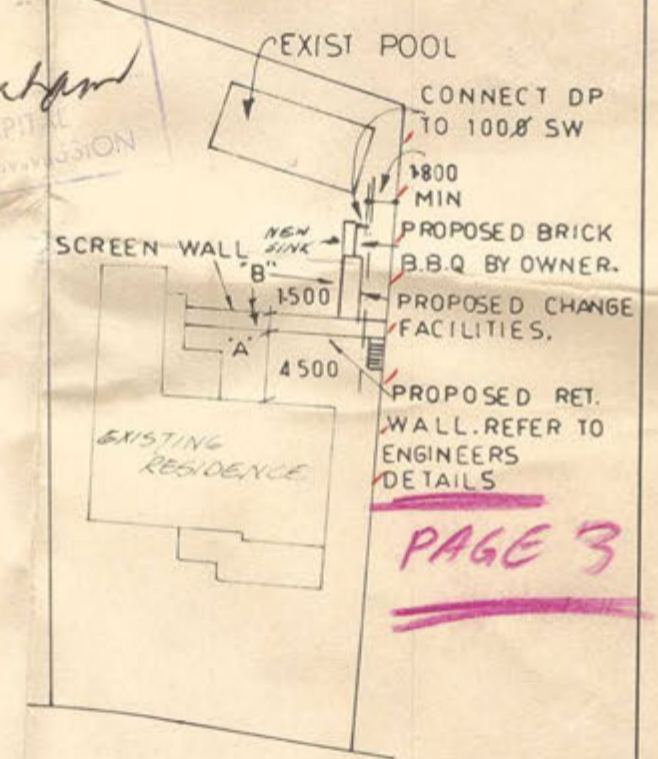

SITE PLAN


PAGE 3

ALL WORK TO CONFORM TO BMACT AND RELEVANT SAA CODES
 THIS PLAN TO BE READ IN CONJUNCTION WITH ENGINEERING DETAILS FOR SCREEN WALL AND RETAINING WALL.

APPROVED FOR CONSTRUCTION BY THE HOLDER OF A CLASS "C" LICENCE.
 CLASS OF OCCUPANCY: RESIDENCE I
 OUTBUILDINGS X
[Signature] 17-4-80
 DEPUTY BUILDING CONTROLLER

PROPOSED ADDITIONS:
 MR & MRS A.I. KENNER
 BLOCK: 29, SECTION: 8 GARRAN
 DESIGN: MOORE & SMITH PTY LTD
 PLUMBING & DRAINAGE CONSULTANTS. PH 804 226.
 SCALES: 1:500
 1:50
 DWG. NO. D451/MS1

TRANSIT No. 13330/2
Received Building Section
28 MAR 1980
Dept. of the Capital Territory

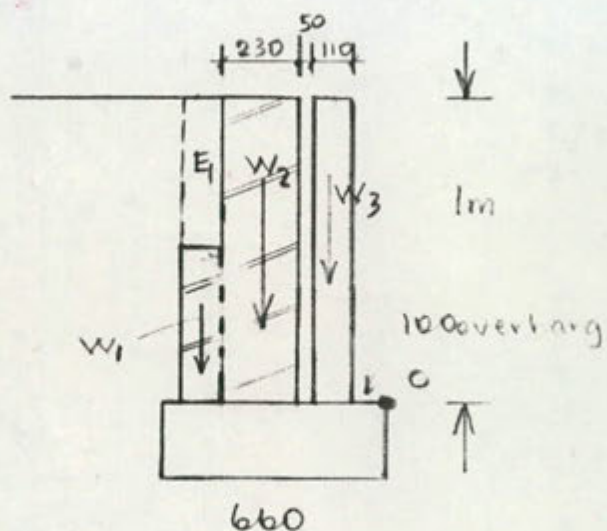

Backfill - Sand

$$\gamma = 20 \text{ kN/m}^3, \phi = 35^\circ$$

$$K_a = \frac{1 - \sin 35^\circ}{1 + \sin 35^\circ} = 0.271$$

$$P_a = K_a \gamma H = 0.271 \times 20 \times 1 = 5.420 \text{ kPa}$$

$$P = \frac{1}{2} P_a H = \frac{1}{2} \times 5.420 \times 1 = 2.710 \text{ kN/m}$$

Overturning Moment $M_o = 2.710 \times \frac{1}{3} = 0.903 \text{ kNm/m}$

Resisting Moment (about O)

$W_1 = 2.1 \times 0.5 \times 1 = 1.05 \times 0.555 = 0.58$	
$W_2 = 4.2 \times 1 \times 1 = 4.2 \times 0.375 = 1.58$	
$E_1 = 2.3 \times 0.5 \times 1 = 1.15 \times 0.555 = 0.64$	
$W_3 = 2.1 \times 1 \times 1 = 2.1 \times 0.155 = 0.33$	
$\Sigma 8.5 \text{ kN}$	$\Sigma 3.12 \text{ kNm/m}$

F. of S (Overturning) $= \frac{M_r}{M_o} = \frac{3.12}{0.903} = 3.46 > 2$

F. of S (Sliding) $= \frac{0.555 \times 8.5}{2.7} = 1.73 > 1.5$

Pressure on footing

Location of Resultant force $= \frac{3.12 - 0.903}{8.5} = 260 \text{ mm}$

$e = \frac{660}{2} - 260 = 70 \text{ mm}$ $\frac{660}{6} = 110 \text{ mm}$


falls within middle third

$P_1 = \frac{V}{bd} \left(1 + \frac{6e}{d}\right) = \frac{8.5}{0.66 \times 1.0} \left(1 + \frac{6 \times 0.070}{0.66}\right) = 21 \text{ kPa}$

$P_2 = \frac{V}{bd} \left(1 - \frac{6e}{d}\right) = \frac{8.5}{0.66 \times 1.0} \left(1 - \frac{6 \times 0.070}{0.66}\right) = 4.7 \text{ kPa}$

28 MAR 1980
Dept. of the Capital Territory

Footing
(designed
for house
loading
as below)

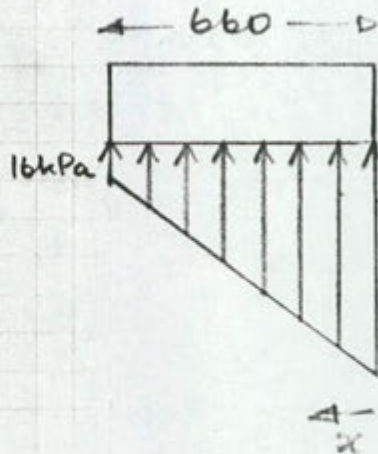

$$q = 164 - 224x$$

$$Q = 164x - \frac{224x^2}{2}$$


$$M = \frac{164x^2}{2} - \frac{224x^3}{6}$$

when $x = 0.66$
 $M = 25 \text{ kNm}$

L.F.
 $A_{st} = \frac{25 \times 18}{0.9 \times 0.9 \times 250 \times 450}$
 $= 493 \text{ mm}^2/\text{m}$

USE F81 mesh $A_{st} = 503 \text{ mm}^2/\text{m}$

Future House loading - 2 storey

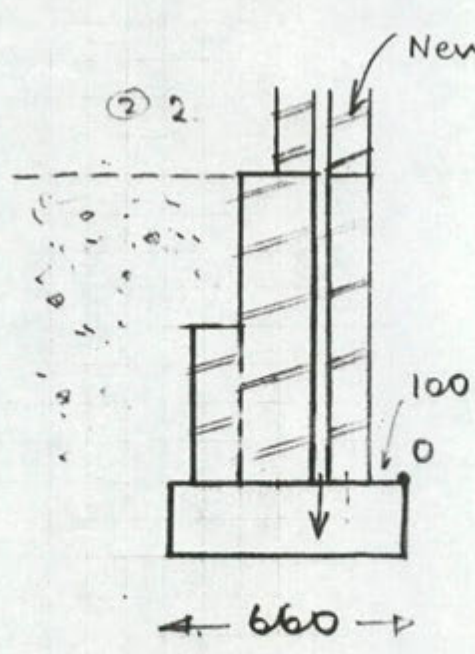

Additional M_r , about 0.

$$51 \times (100 + 110 + 25) = 11.99 \text{ kNm}$$

$$\frac{85}{3.12}$$

$R_y = 59.5 \text{ kN}$ $M = 15.11 \text{ kNm}$


$$\bar{x} = \frac{15.11 - 0.903}{59.5} = 240 \text{ mm}$$

$$e = \frac{660}{2} - 240 = 90, \text{ in middle } \frac{1}{3}$$

$$p_{toe} = \frac{V}{bd} \left(1 + \frac{6e}{d}\right) = \frac{59.5}{0.66 \times 1.0} \left(1 + \frac{6 \times 0.09}{0.66}\right) = 164 \text{ kPa}$$


$$p_{heel} = \frac{V}{bd} \left(1 - \frac{6e}{d}\right) = 16 \text{ kPa}$$

Handwritten signature or initials in red ink.

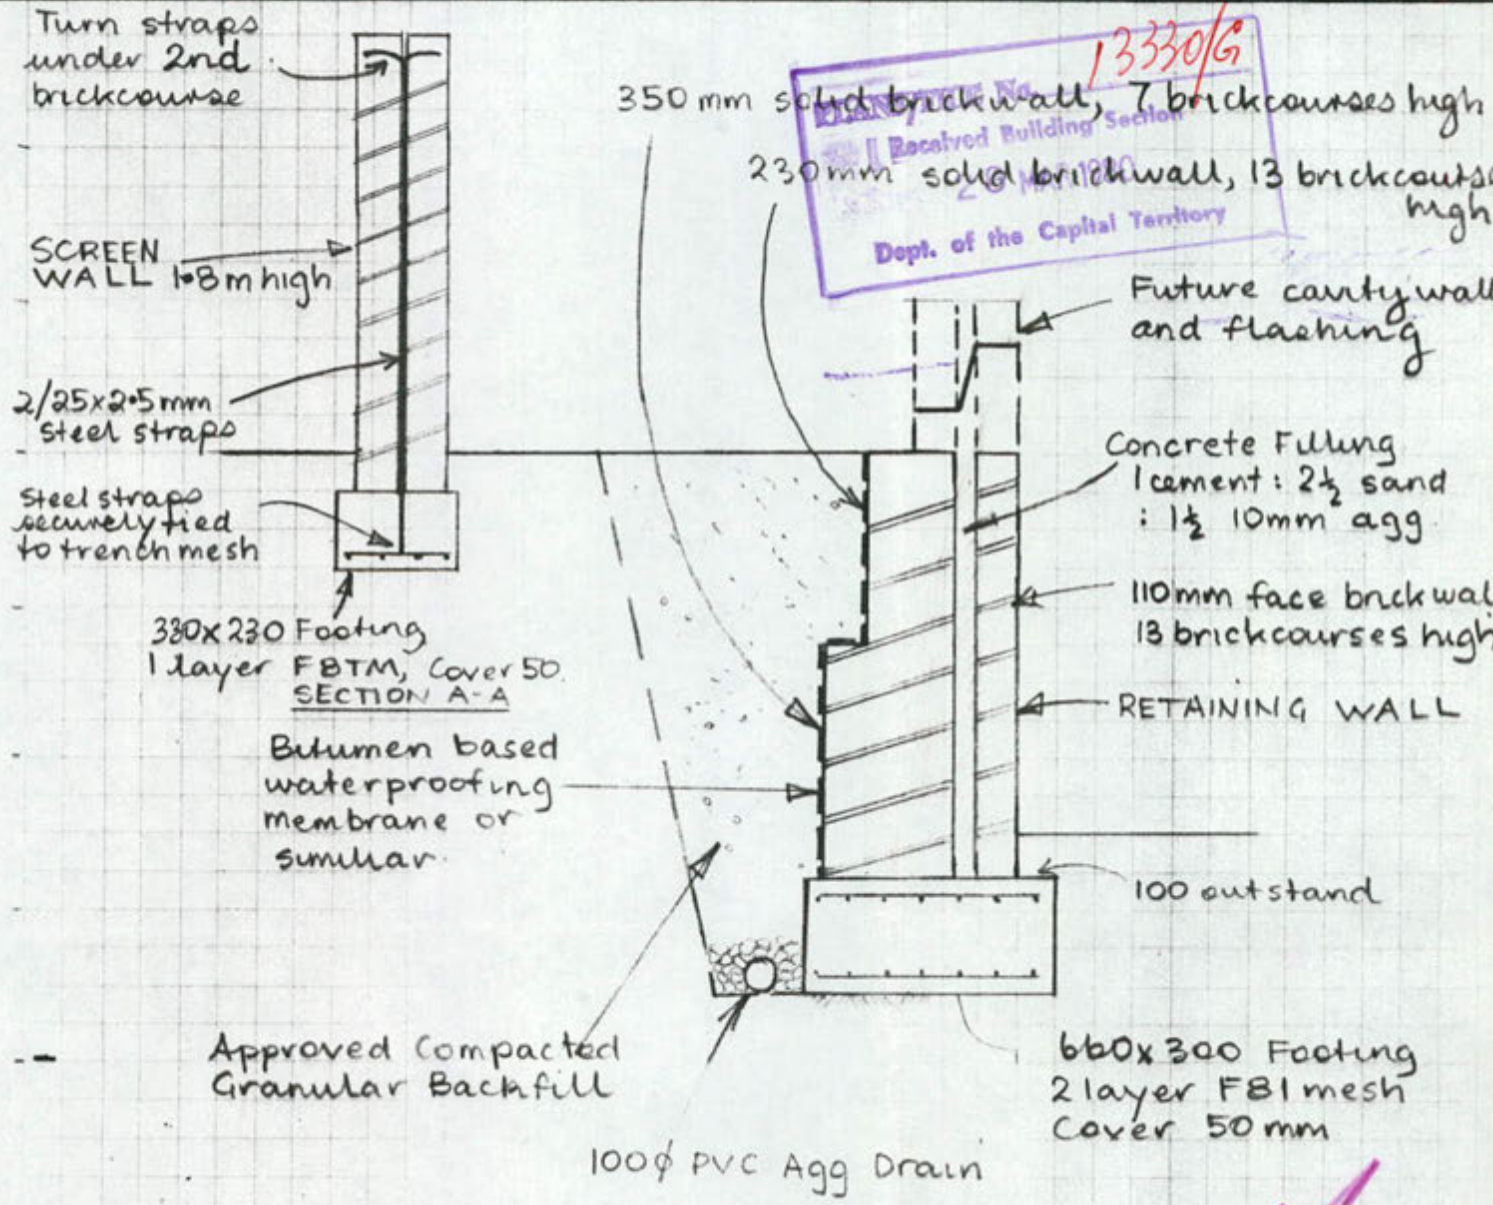

13330/G
Received Building Section
Dept. of the Capital Territory

Wh
16/4/80

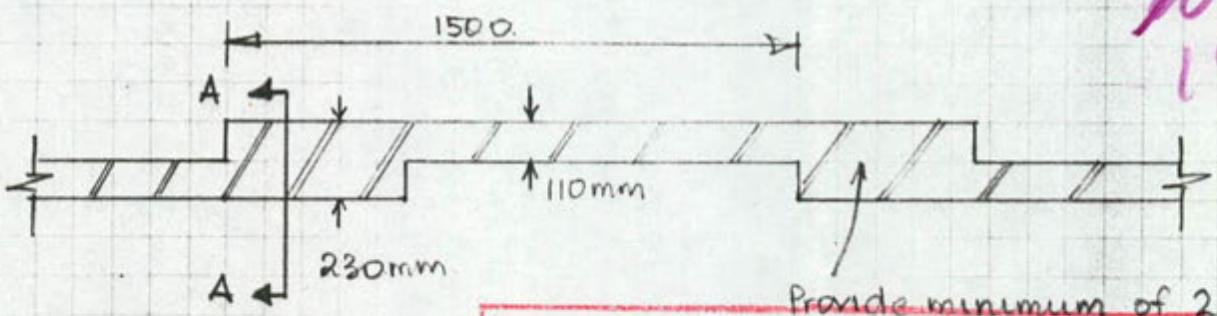

Provide minimum of 2 brick length overlap 470mm

APPROVED FOR CONSTRUCTION BY THE HOLDER OF A CLASS " " LICENCE

PLAN AS SHOWN WALL RESIDENCE I
OUTBUILDINGS X

M. J. J. J.

Scale 1:20


SCREEN WALL and RETAINING WALL

Block 29 Section 8 Carran.

SCREEN WALL CALCULATIONS


1/3

Block 29 Section 8 GARRAN DE LEUW CATER OF AUSTRALIA PTY. LTD
P.O. Box 815, Canberra City A.C.T. 2601

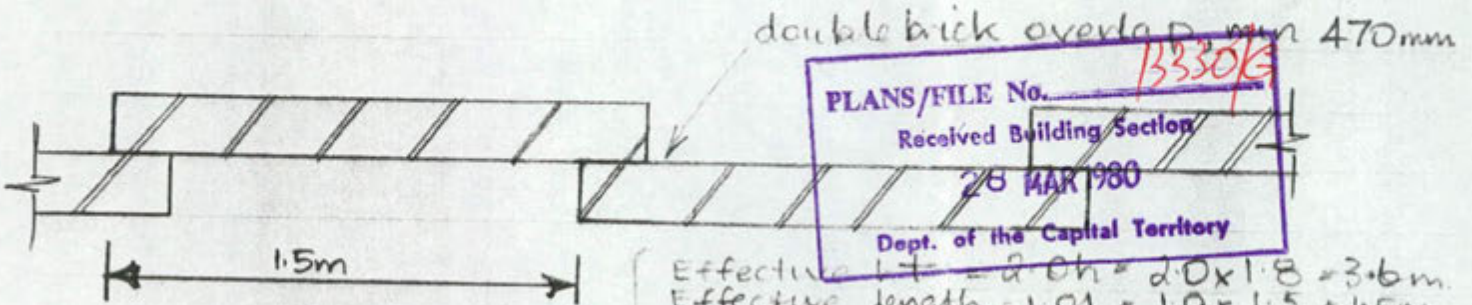


PLANS/FILE No. 13330/3
Received Building Section
26 MAR 1980
Dept. of the Capital Territory

Effective height = $2.0h = 2.0 \times 1.8 = 3.6m$
Effective length = $1.0L = 1.0 \times 1.5 = 1.5m$
Effective thickness = $1.4t = 1.4 \times 110 = 154mm$
Slenderness Ratio = $\frac{1.5}{0.154} = 10 < 27 OK$

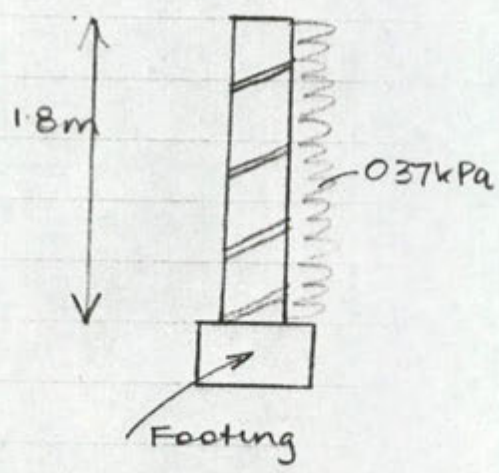

Wind $V = 38 m/s$ multiplier = 0.65
 $V' = 0.65 \times 38 = 24.7 m/s$
 $q_3 = 0.6 \times (24.7)^2 \times 10^{-3} = 0.37 kPa$
 $C_D = 1.2$
Area = $1.8 \times 1.5 = 2.7$
 $F = C_D A q_3 = 1.2 \times 2.7 \times 0.37 = 1.2 kN$
 $M = 1.2 \times 0.9 = 1.08 kNm$

Bending - consider brick panel

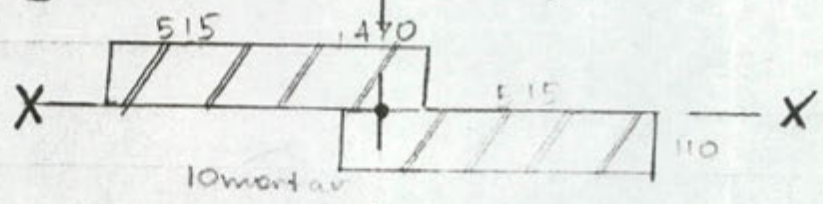

$I_{xx} = 2 \left(\frac{110^3 \times 985}{12} + 985 \times 110 \times 60^2 \right)$
 $= 9.99 \times 10^8 mm^4$
 $Z_{xx} = 8.68 \times 10^6 mm^3$

$f_b = \frac{M}{Z_{xx}} = 124 kPa$

Dead weight

Area wall = $(515 \times 2 + 470 \times 2) \times 1.8 = 3.55 m^2$
Dead load = $2.1 kN/m^2 \therefore W_D = 2.1 \times 3.55 = 7.45 kN$

20/74

Screen Wall Calculation
Block 29 Section B Garran


DE LEUW CATHOR OF AUSTRALIA PTY. LTD
P.O. Box 815, Canberra City A.C.T. 2601

$$\text{Area base} = 2 \left[(515 + 470) \times 110 \right] = 216,700 \text{ mm}^2$$

$$f_c = \frac{W_D}{A_b} = \frac{745 \text{ kN}}{216,700 \text{ mm}^2} = 34 \text{ kPa}$$

PERMIT No. 1333/S/G
 Received Building Section
 28 MAR 1980
 Dept. of The Capital Territory

$$f_t = f_{bt} - f_c = 124 - 34 = 90 \text{ kPa}$$

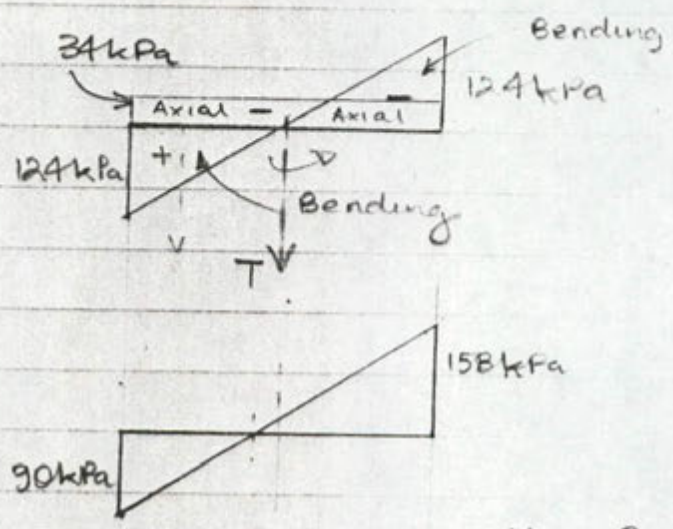

$$F_t = 124 \times 110 \times 985 = 13.4 \text{ kN}$$

$$M = 13.4 \times 110 = 0.49 \text{ kNm}$$

$$e = \frac{M}{W_D} = \frac{0.49}{7.45} = 65 \text{ mm}$$

Use 2 / 2.6mm x 25mm (12 Gauge) iron straps
Area = 65mm²

$$F_b = 140 \text{ MPa}$$

$$P_L = 140 \times 65 = 9 \text{ kN} \times 2 = 18 \text{ kN}$$

Footing 300 x 230

$$M = 0.49 \text{ kNm}$$

$$W_D = 7.45 \text{ kN}$$

$$W_F = 1.3 \times 230 \times 1 \times 24 \text{ kN/m}^3 = 1.66 \text{ kN}$$

$$e = \frac{M}{W_D + W_F} = \frac{0.49}{7.45 + 1.66} = 53 \text{ mm}$$


Handwritten signature/initials

Screen Wall Calculation 29/8 Ciarran

loaded length = $3 \left(\frac{L}{2} - e \right) = 3(150 - 53)$ 13330/9
291 mm

Pactual = $\frac{2 \times 9.11}{291 \times 1000} = 62 \text{ kPa}$ ok ✓

USE : FBTM. trench mesh in footing

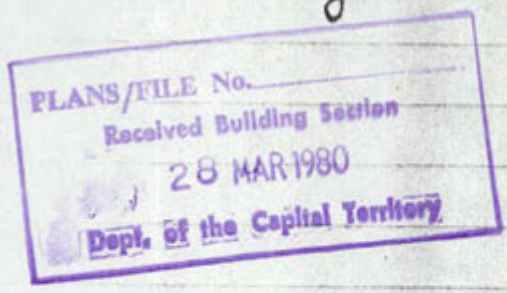

DE LEUW CATHER OF AUSTRALIA PTY. LTD.
P.O. Box 815, Canberra City A.C.T. 2601

Made: AC 20/12/79.

[Handwritten signature]
17/11



113
17/11

APPLICATION FOR APPROVAL OF PLANS

17 NOV 1980
BL 1/6 (2/79)
Dept. of the Capital Territory

12171180Z#1077
Cash Register imprint. 7500NO REC

Name of Applicant MOORE & SMITH P/L Shop 1, Molonglo Ma., FYSHWICK A.C.T. 2609 PH. (062) 80 5226	Address MOORE & SMITH P/L Shop 1, Molonglo Ma., FYSHWICK A.C.T. 2609 Postcode: PH. (062) 80 5226
---	--

Name of lessee /owner of parcel of land <i>A. G. I. Kennan.</i>	Address (Show P.O.Box No. if any) <i>elo</i> MOORE & SMITH P/L Shop 1, Molonglo Mail FYSHWICK A.C.T. 2609 Postcode PH. (062) 80 5226
--	--

Description of the building work.
BRICK - 2 STOREY EXTENSION

Description of land on which the building work is to be carried out.	Block <i>29</i>	Section <i>8</i>	Division <i>601-101</i>
--	--------------------	---------------------	----------------------------

To be specified in accordance with the appropriate classification in the Building Manual.	Type of Construction <i>BRICK.</i>	Cost <i>\$15,000</i> 65,000
	Class of occupancy	Total floor area where applicable <i>63 SQM.</i>

This application is for:

(Please tick (✓) appropriate box)

New work Amendment to approved plan Amendment to plan not yet approved Details

I hereby apply for approval of the attached plans.

[Signature] *17/11/80*
Signature of Applicant Date

To be completed if application made otherwise than by the lessee /owner, his solicitor or architect.	I hereby authorise the abovenamed applicant of the address indicated to make this application on my behalf. <i>X [Signature]</i> <i>1/1</i> Signature of lessee /owner Date
--	--

FOR OFFICE USE ONLY	<input checked="" type="checkbox"/> New work	Plans Numbered <i>30/H</i>	Class of licence required: <i>B</i>
	<input type="checkbox"/> Amendment to approved plan	Area	Valuation <i>\$15,000</i>
	<input type="checkbox"/> Amendment to plan not yet approved	Total fees payable	
	<input type="checkbox"/> Details	Plans <input checked="" type="checkbox"/> Approved <input type="checkbox"/> Not Approved	
Notify applicant: New permit required Endorse exist. permit.	Permit fee required:	<i>[Signature]</i> <i>25 NOV 1980</i> Deputy Building Controller Date	

NO SURVEY CERTIFICATE REQUIRED FOR CONVEYANCING
LESSEE/BUILDER RESPONSIBLE FOR CONVEYANCING



115

Permit No.	Date of Issue	Block	Section	Suburb
1314619	28 11 80	29	118	GARRAN

THIS PERMIT WILL LAPSE

15 months after date of issue unless otherwise extended by the Building Controller. Application for extension must be made before permit lapses and extension fee paid otherwise a new permit is necessary and full permit fee payable. If work is not commenced no refund is payable unless permit is surrendered before it lapses.

ISSUED TO:

Permit Holder Details

Initials	Surname	
F	SCHINZINGER	S342

Address

30 Natdeo Cres
 O'Connell ACT 2601

Nominee (if applicable)

Initials	Surname

CLASS OF BUILDERS LICENCE

10

Plan No.

11333041

Register Folio No.

1171417

Cost \$

115000

Code No.

Description of Work

Type of Building Construction

11

Brick Venee - 2 storey Extent
 Residence

Class of Occupancy

1

ENDORSEMENTS Under Section 36 Inspections - Each stage specified overleaf which applies to the building work must be inspection before proceeding beyond that stage. Stages may be groups as indicated overleaf.

"NO SURVEY CERTIFICATE REQUIRED."
 LESSEE/BUILDER RESPONSIBLE FOR CORRECT SITING

The building work shall be carried out in accordance with the approved plans, the Building Manual A.C.T., the notations made on the plans and subject to the provisions of the Building Ordinance 1972. The approval of plans or the grant of a building permit does not affect the operation of any other law in the Territory nor does it authorise the use of the land contrary to a provision, covenant or condition of the Crown Lease.

APPROVED FOR CONSTRUCTION BY THE HOLDER OF A CLASS "B" LICENCE.
 CLASS OF OCCUPANCY: RESIDENCE I
 OUTBUILDINGS X
 25 NOV 1980
 DEPUTY BUILDING CONTROLLER



"FULL SPECIFICATIONS WILL BE REQUIRED TO BE SUBMITTED IF PERMIT IS APPLIED FOR BY OWNER-BUILDER".

PLANS/TITLE No. 13330/H
 Received Building Section
 17 NOV 1980
 Dept. of the Capital Territory


BUILDINGS DESIGN APPROVAL
 APPROVAL DATED 20 NOV 1980
 DELEGATE R. PALAN
 NATIONAL CAPITAL DEVELOPMENT COMMISSION

PLANS AND SPECIFICATIONS EXAMINED AND RECOMMENDED FOR APPROVAL BY
 ENGINEER FOR WATER SUPPLY AND SEWERAGE
 CHIEF ELECTRICAL ENGINEER
 STRUCTURAL ENGINEER

DEPARTMENTAL RECORDS INDICATE THAT PORTION OF THE EXISTING SANITARY DRAINAGE SERVICE WILL BE UNDER THE PROPOSED STRUCTURE. ACTION IS TO BE TAKEN TO BRICKWORK TO MATCH EXISTING WITH THE CANBERRA SEWERAGE AND WATER SUPPLY REGULATIONS.

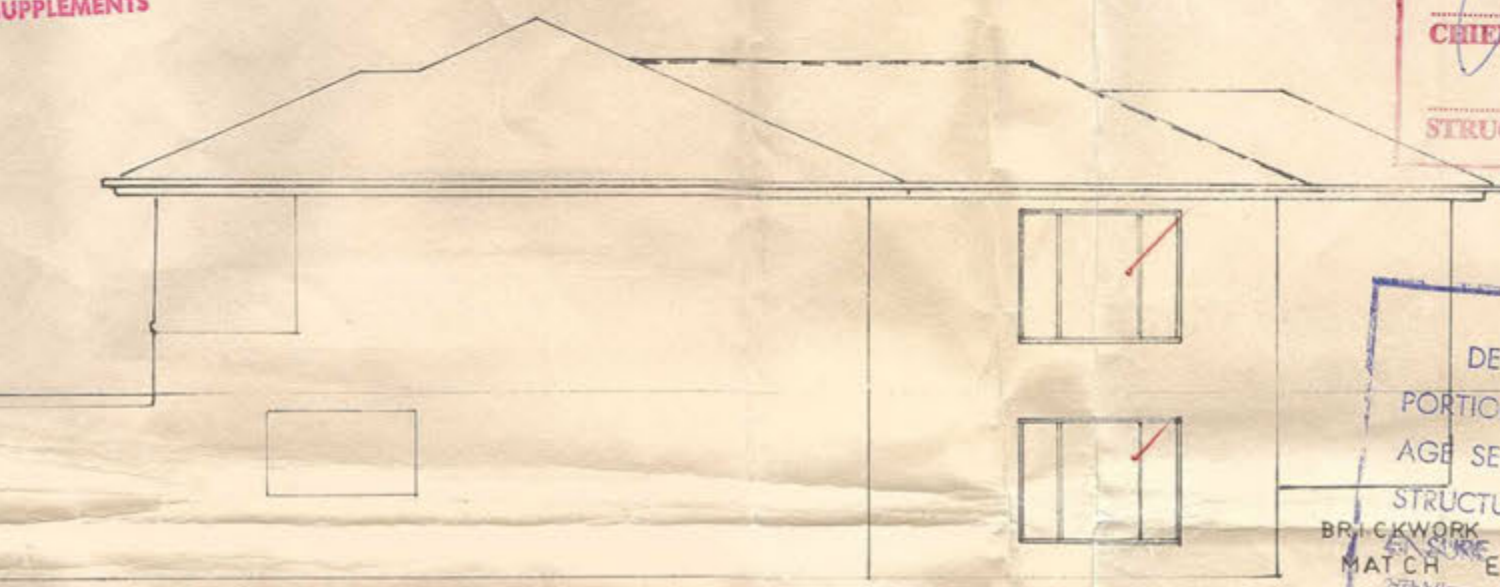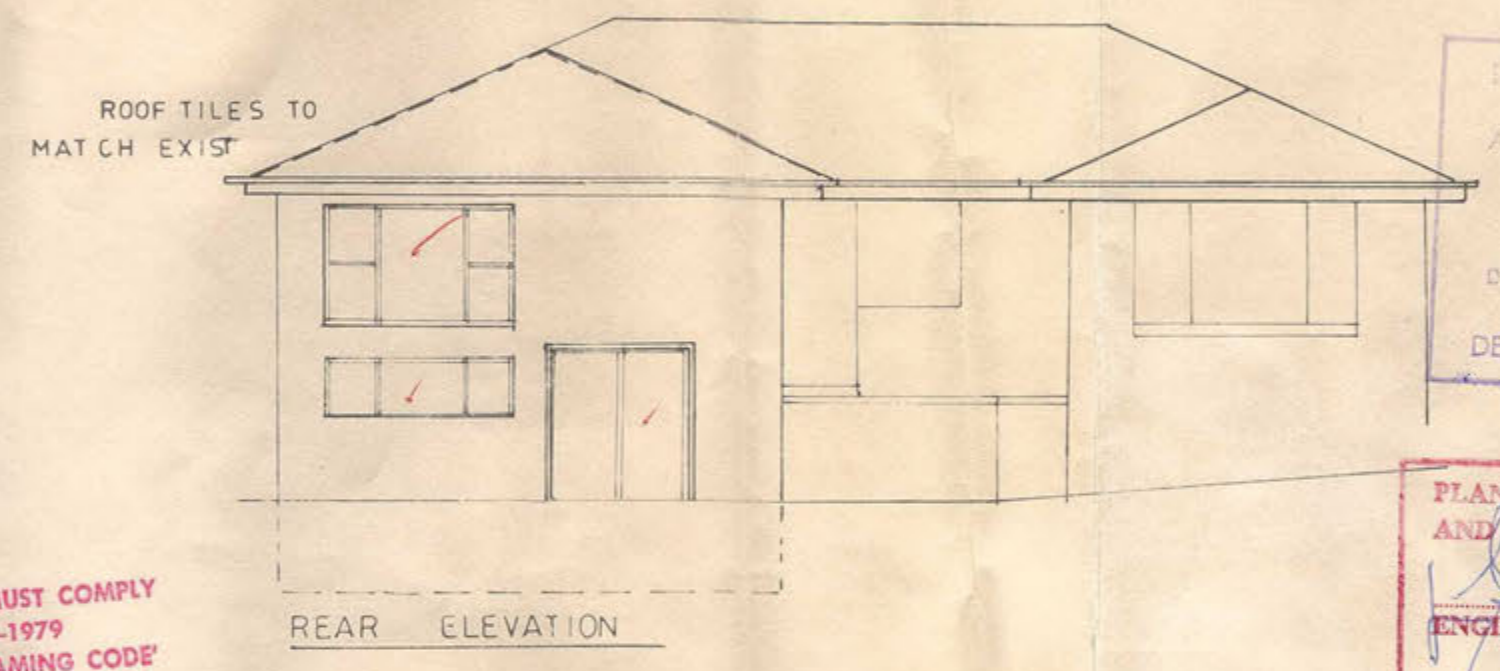



THIS SET CONTAINS 15 SHEETS NUMBERED 1/5 TO 15/5 INCLUSIVE AND SHOULD REMAIN INTACT.

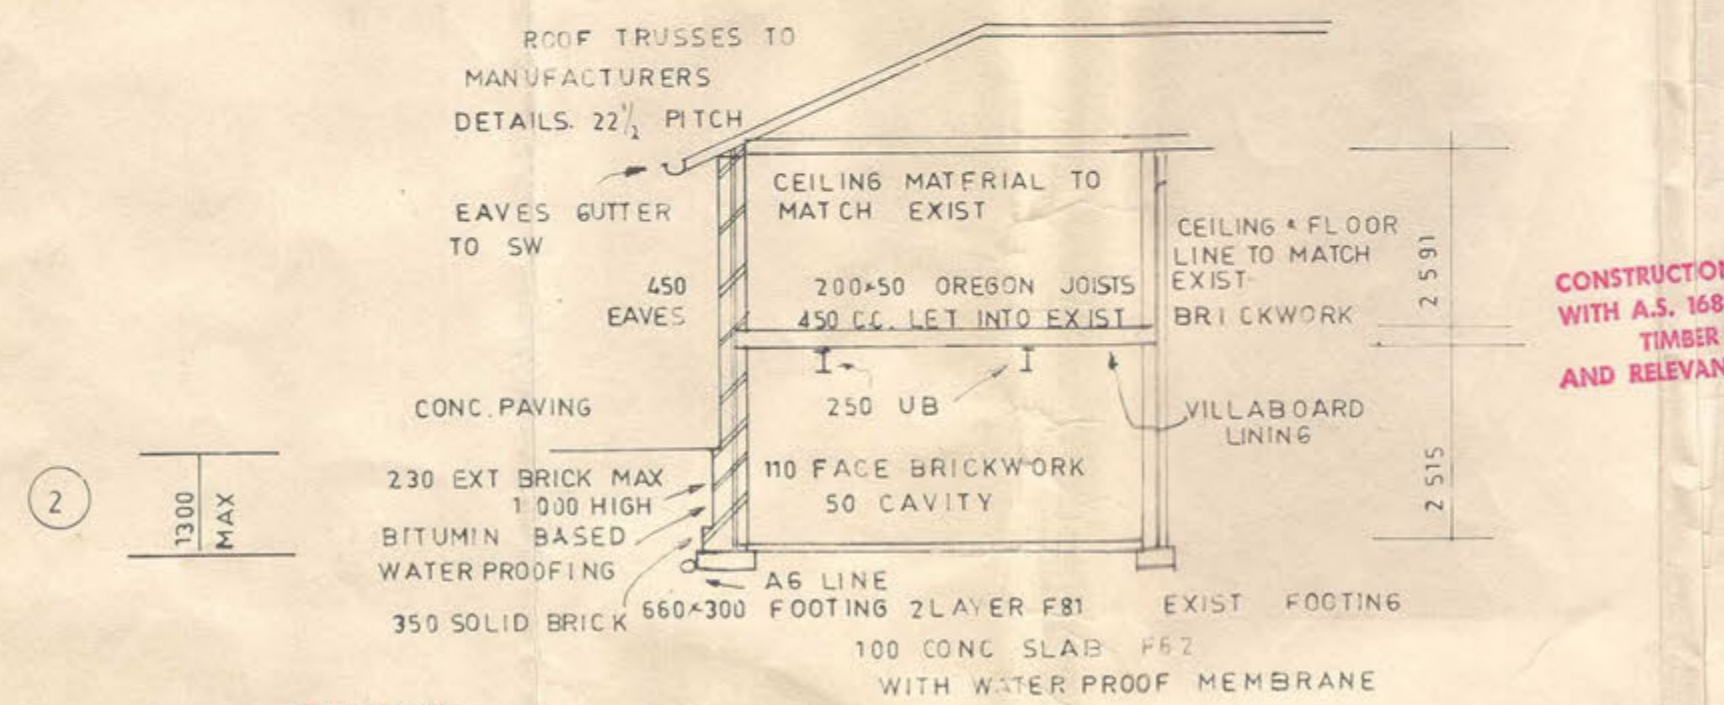

CONSTRUCTION MUST COMPLY WITH A.S. 1684.—1979
 TIMBER FRAMING CODE AND RELEVANT SUPPLEMENTS

SUBMIT DETAILS FOR APPROVAL PRIOR TO CONSTRUCTION

DEPTH OF FILL UNDER SLAB NOT TO EXCEED 400 mm
 FOOTINGS TO BE TAKEN DOWN TO SOLID GROUND

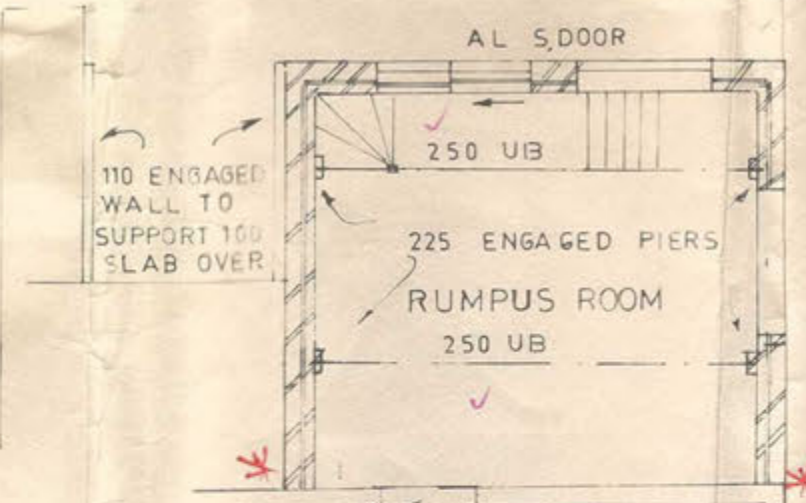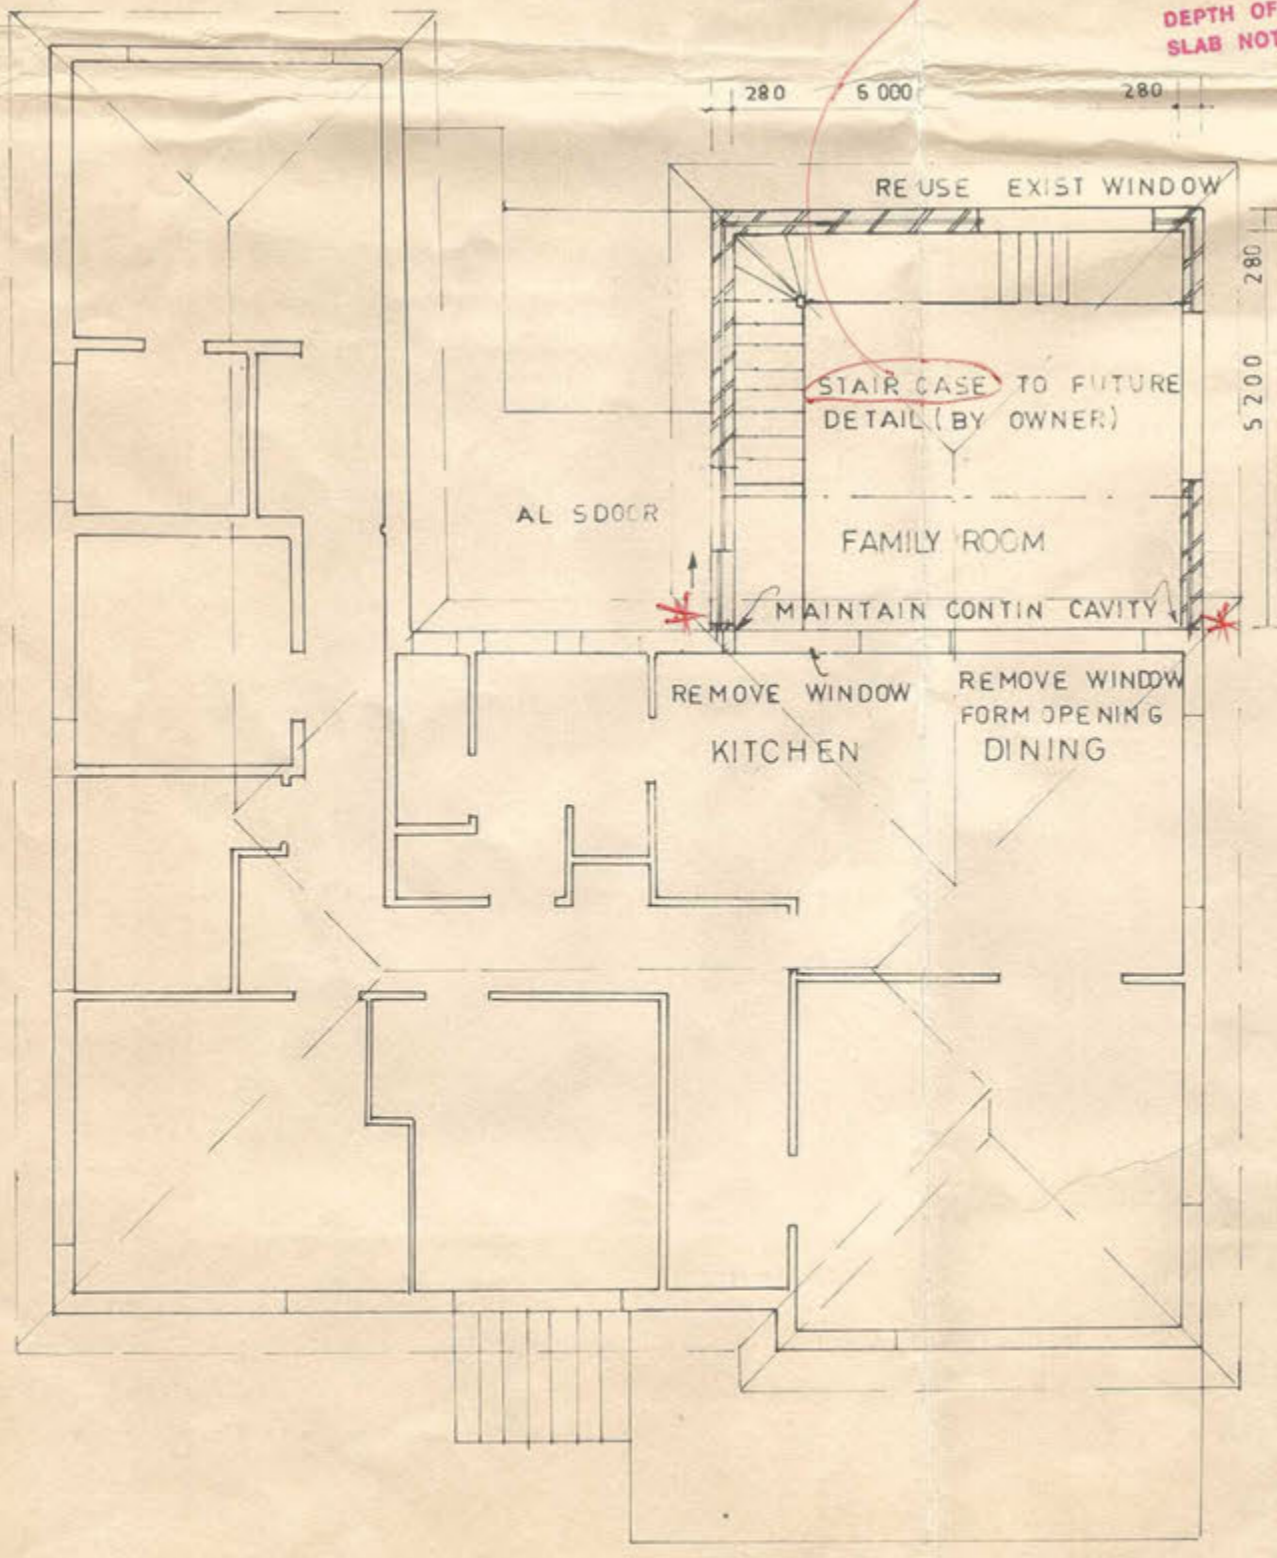

* MAINTAIN CAVITY
 LIGHT & VENTILATION TO COMPLY WITH PART 50 OF THE BUILDING MANUAL ACT,

APPROVED IN RESPECT OF NOMINATED AMENDMENTS No's 1 ONLY. ANY OTHER VARIATIONS TO THE ORIGINALLY APPROVED PLAN ARE NOT APPROVED.


- AMENDMENTS
- 1 SITING FOR EXTENSION ALTERED
 - 2 HEIGHT OF RETAINING WALL DETERMINED

NO SURVEY CERTIFICATE REQUIRED LESSEE/BUILDER RESPONSIBLE FOR CORRECT SITING

SITE PLAN LEVELS

UPPER LEVEL	0.0
GL 'A' & 'B'	-4.031
LOWER FL. 'A' & 'B'	-5.331
GL 'C'	-5.381

SITE PLAN

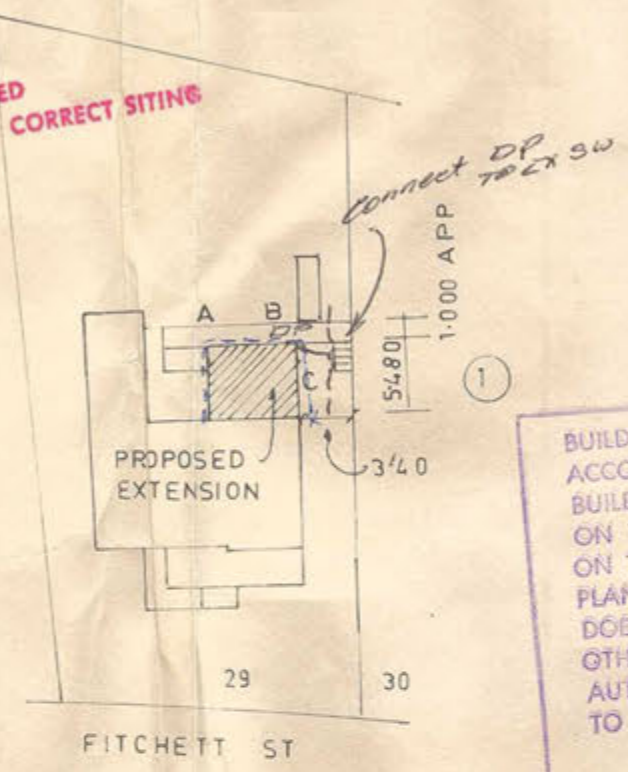

BUILDING WORK SHALL BE CONSTRUCTED IN ACCORDANCE WITH THE APPROVED PLANS THE BUILDING MANUAL ACT, THE NOTATIONS MADE ON THE PLANS AND ANY MATTERS SPECIFIED ON THE BUILDING PERMIT. THE APPROVAL OF PLANS OR THE GRANT OF A BUILDING PERMIT DOES NOT AFFECT THE OPERATION OF ANY OTHER LAW IN THE TERRITORY, NOR DOES IT AUTHORISE THE USE OF THE LAND CONTRARY TO A PROVISION, COVENANT OR CONDITION OF LEASE.
 MODIFICATIONS IF APPLICABLE

ALL WORK TO CONFORM TO BMACT AND RELEVANT S.A.A. CODES

TC 3

TITLE
 PROPOSED AMENDMENT AND EXTENSION
 MR & MRS. A.I. KENNER
 29 B GARRAN ACT
 SCALES 1:100 1:500

DESIGNED
 MOORE & SMITH PLUMBING & DRAINAGE CONSULTANTS
 Unit 1, Melonglo Mall, Fyshwick, Telaphorta 805 226.

SCALE
 1/5

PLAN UPPER LEVEL

PLAN LOWER LEVEL



Department of the Capital Territory

POST OFFICE BOX 154, CANBERRA CITY, ACT 2601

BUILDING SECTION

North Building, Civic Offices,
London Circuit, 491355

120
3/3

PLANS/FILE No. _____
Received Building
31 MAR 1981
Dept. of the Capital Territory

APPLICATION FOR APPROVAL OF PLANS

BL 1/6 (7/80)


Name of Applicant MOORE & SMITH P/L Shop 1, Molonglo Mall FYSHWICK A.C.T. 2609 PH. (062) 80 5226		Address MOORE & SMITH P/L Shop 1, Molonglo Mall FYSHWICK A.C.T. 2609 PH. (062) 80 5226 Postcode	
Name of lessee / owner of parcel of land <i>MARSH A.I. KENNEDY</i>		Address (show P.O. Box No. if any) MOORE & SMITH P/L Shop 1, Molonglo Mall FYSHWICK A.C.T. 2609 Postcode PH. (062) 80 5226	
Description of the building work <i>PROPOSED AMENDMENTS + EXTENSIONS</i>			
Description of land on which the building work is to be carried out	Block <i>29</i>	Section <i>8</i>	Division (Suburb) <i>GREEN.</i>
To be specified in accordance with the appropriate classification in the Building Manual.	Type of construction <i>(N/A for Class I or X buildings)</i>		Cost
	Class of occupancy		Total floor area where applicable
This application is for: (please tick appropriate box) <input type="checkbox"/> New work <input type="checkbox"/> Amendment to approved plan <input checked="" type="checkbox"/> Amendment to plan not yet approved <input type="checkbox"/> Details			
I hereby apply for approval of the attached plans, and request that approved plans be - <input checked="" type="checkbox"/> posted to the applicant's address <input type="checkbox"/> held at the counter for collection (telephone advice will be given when ready for collection)		<i>Cherie Ellison</i> 31.3.81 signature of applicant date	
To be completed if application made otherwise than by the lessee / owner, his solicitor or architect.		I hereby authorise the abovenamed applicant of the address indicated to make this application on my behalf <i>A. Kennedy</i> 31.3.81 signature of lessee / owner date	

FOR OFFICE USE ONLY	<input type="checkbox"/> New work <input checked="" type="checkbox"/> Amendment to approved plan <input type="checkbox"/> Amendment to plan not yet approved <input type="checkbox"/> Details	Plans numbered <i>13330/5</i>	Class of licence required
	Notify applicant new permit required endorse existing permit Permit fee required	AMENDED IN RESPECT OF NOMINATED AREA ONLY. ANY OTHER AMENDMENTS No's 3-6 VARIATIONS TO THE ORIGINALLY APPROVED PLANS NOT APPROVED.	Valuation
		Total fees payable <i>N/A.</i>	Plans <input checked="" type="checkbox"/> Approved <input type="checkbox"/> Not approved
			<i>Mulhew</i> 14.5.81 Deputy Building Controller date



SPECIFICATIONS (DIMIN. OF PARTS)

- 5 - ROOF TRUSSES
 RAFTERS: 150 x 50 450 C/C
 C. JOISTS: 150 x 50
~~PROPS: 150 x 50~~
 RIDGE: 200 x 38
 W. PLATES: 100 x 50
 FACIA B. 185 x 32
- CEILING TO MATCH EXIST.
 OREGON FACIA BOARD
 HARDWOOD: REMAINING PARTS.
- 3 - STAIRCASE
 TO BE DONE IN ACCORDANCE WITH THE B.M.A.C.T.



S1/2

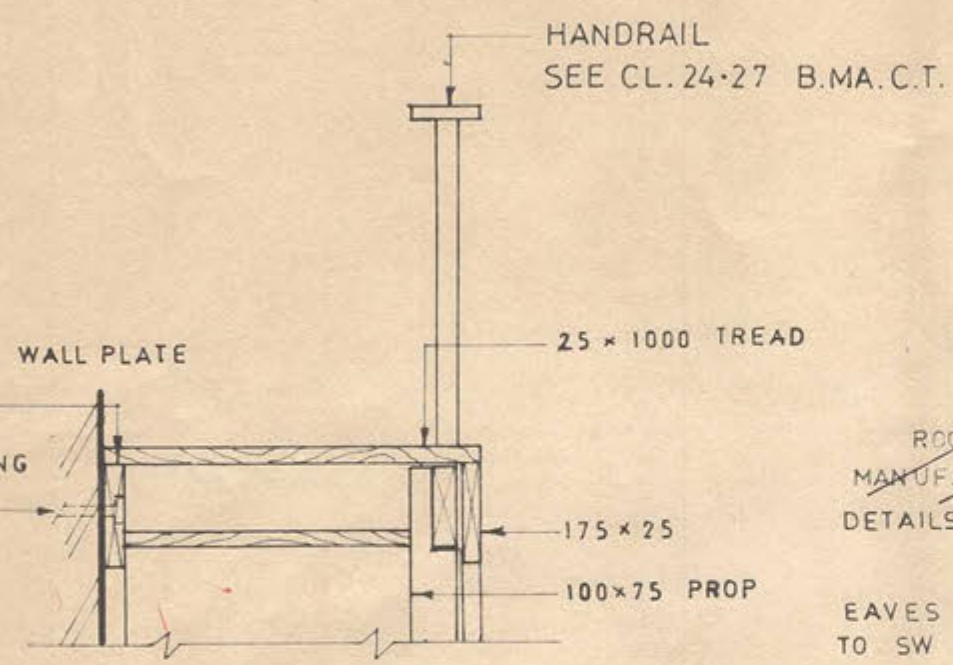


SECTION THROUGH STAIRS 1:2.0

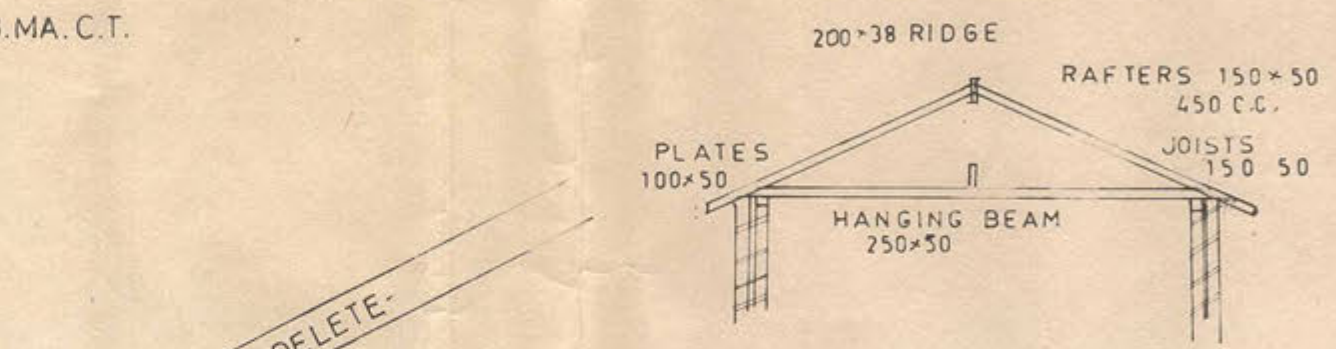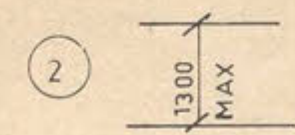



ROOF TILES TO MATCH EXIST

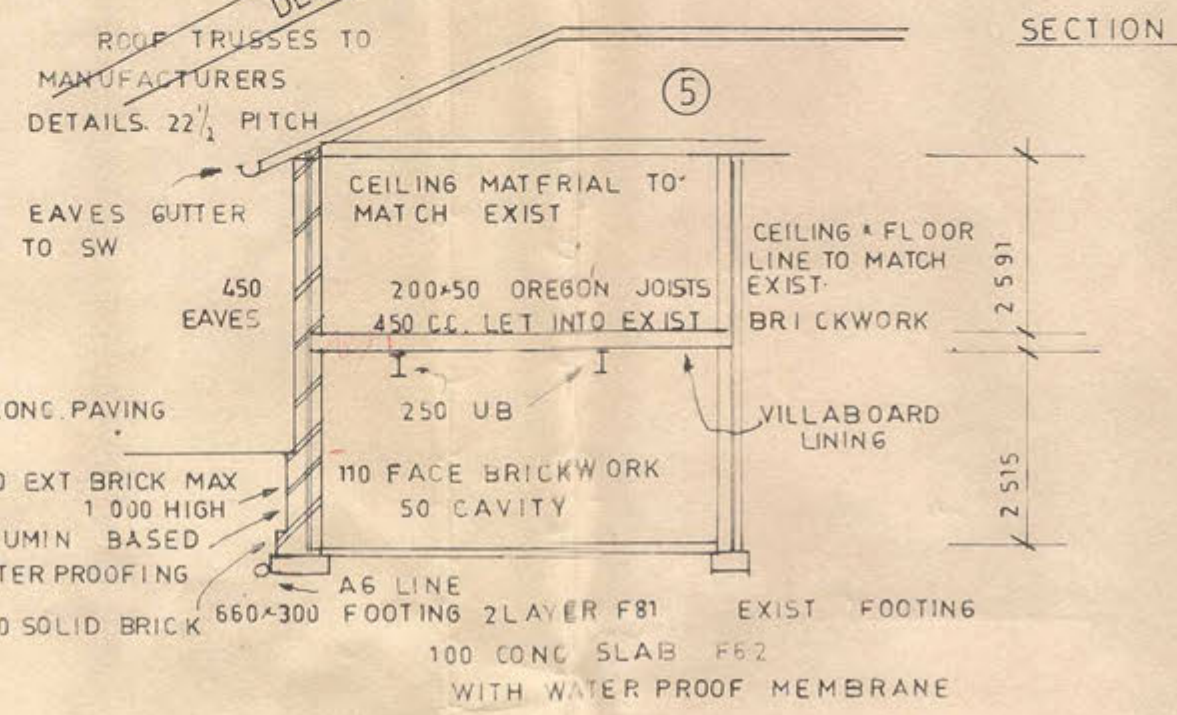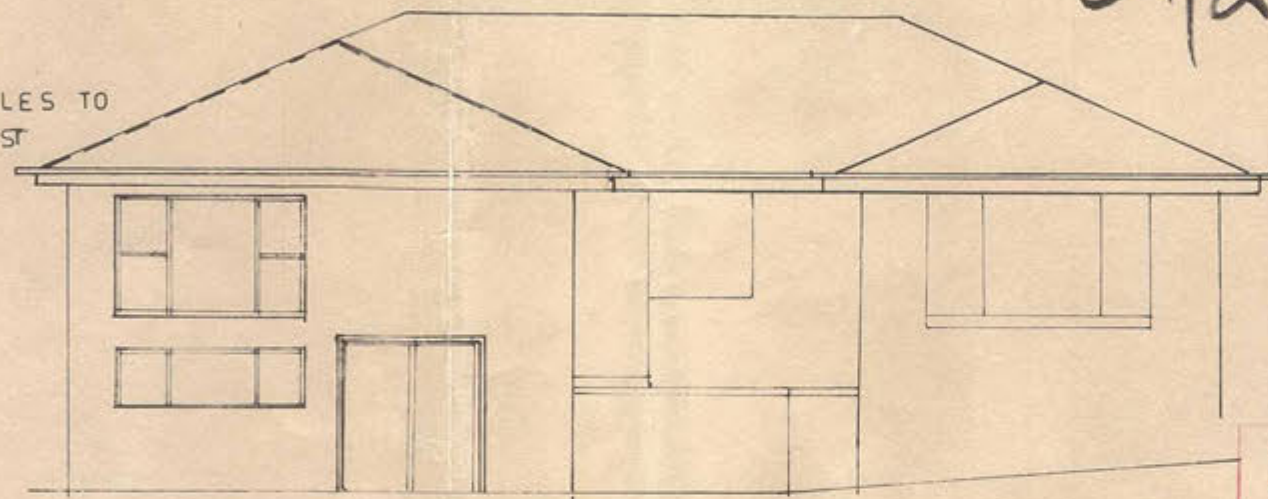

STEPS & HANDRAIL TO COMPLY WITH PART 34 OF THE BUILDING MANUAL ACT

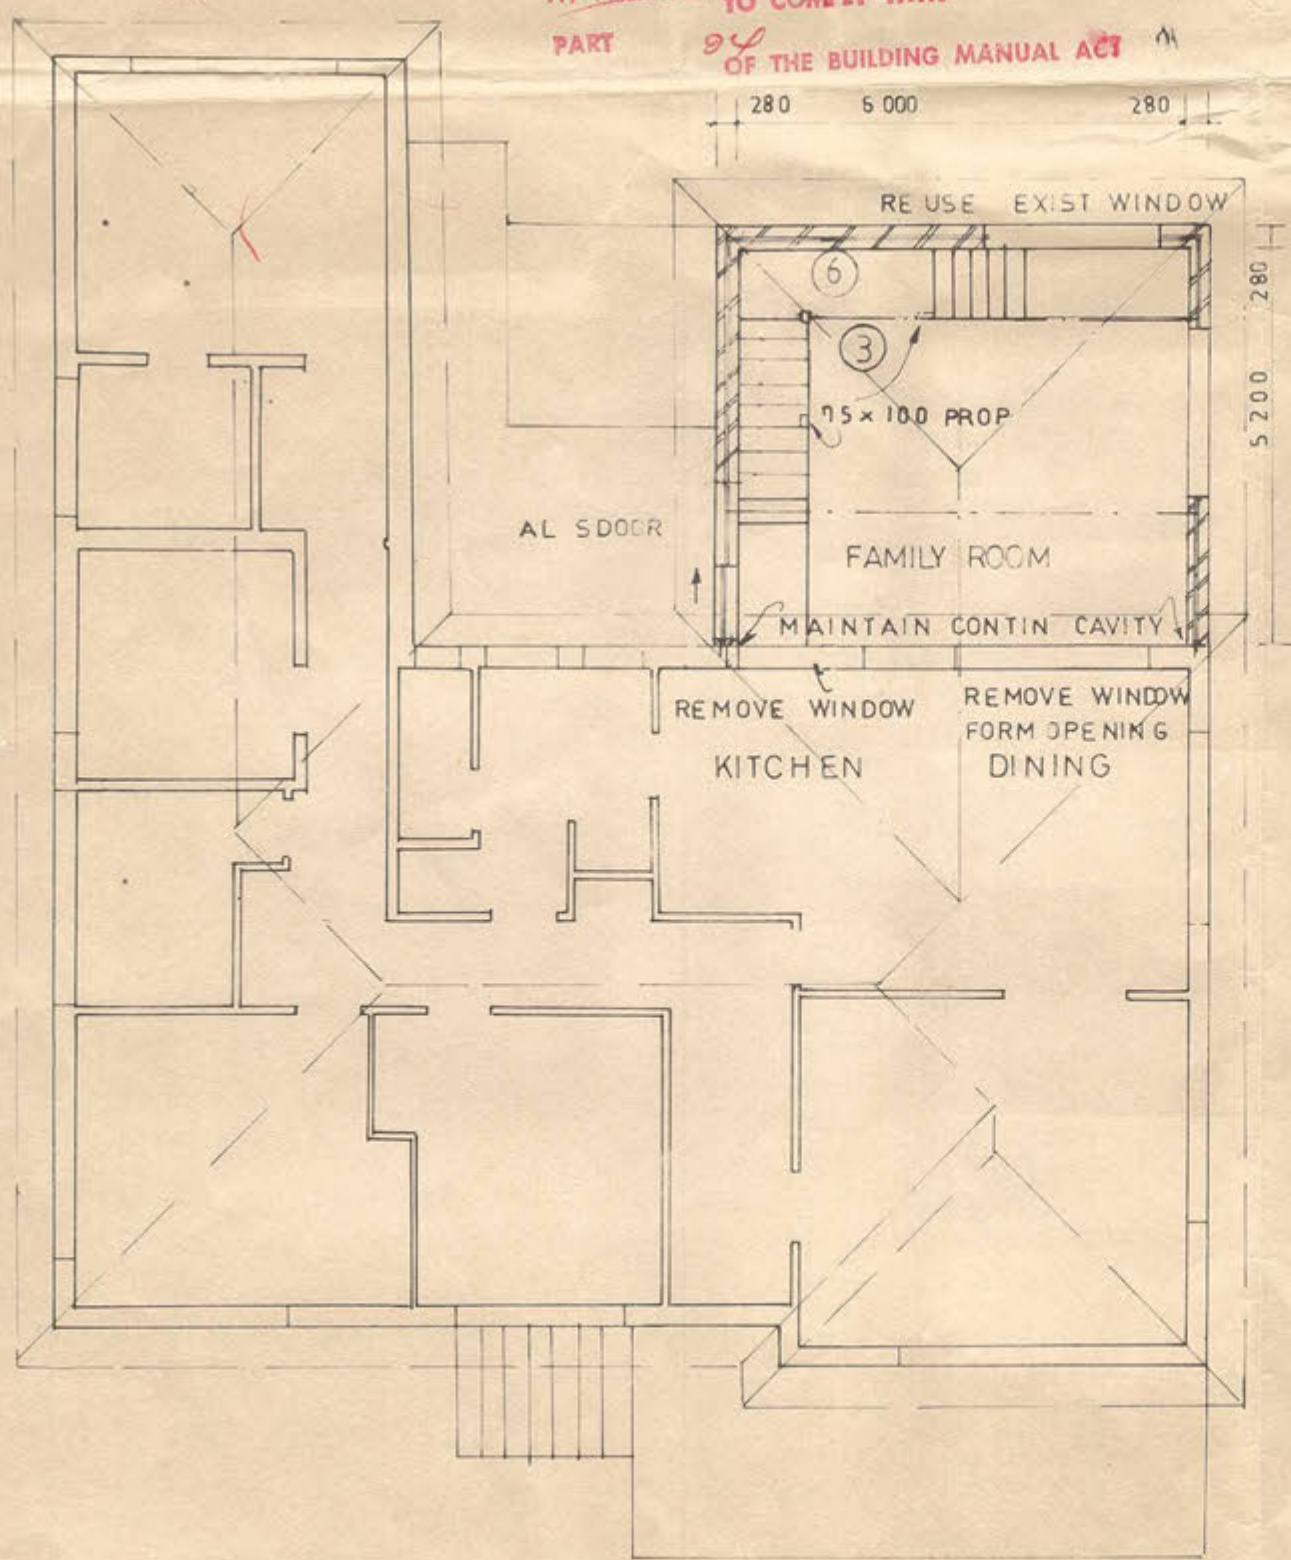

PLAN UPPER LEVEL

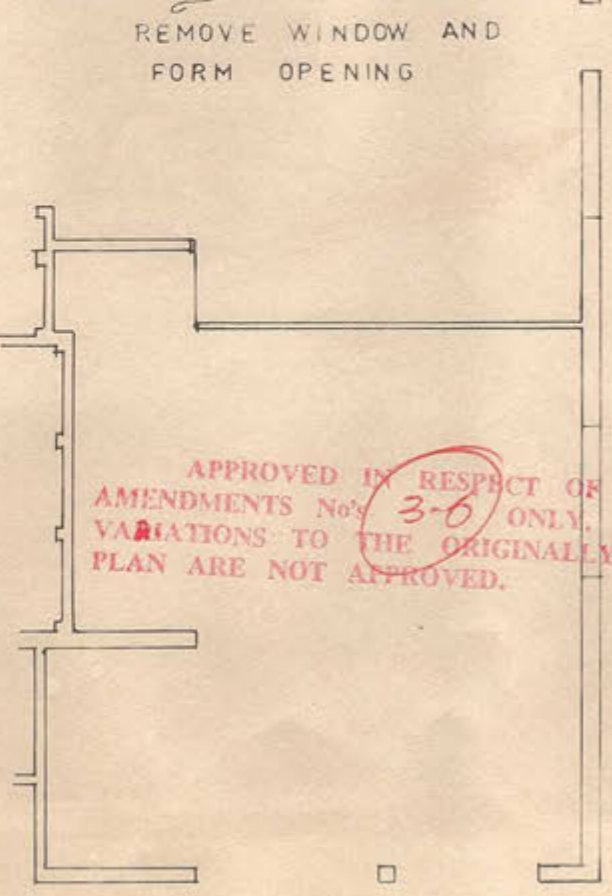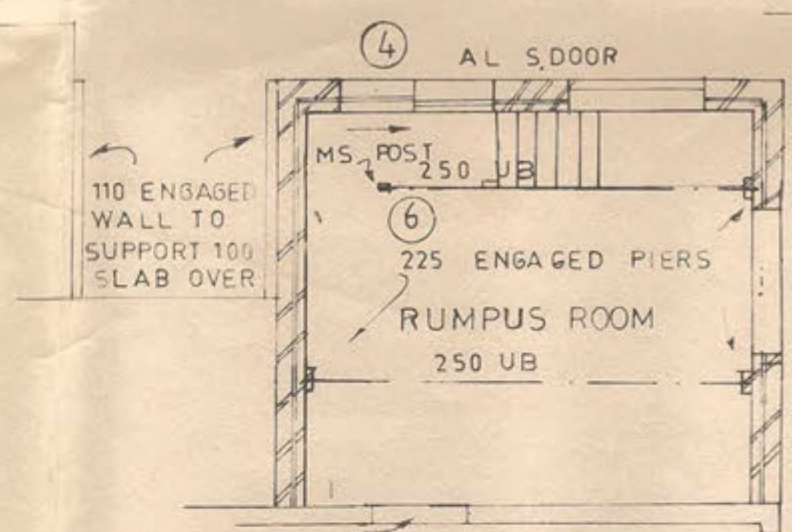

PLAN LOWER LEVEL


BUILDING WORK SHALL BE CONSTRUCTED IN ACCORDANCE WITH THE APPROVED PLANS THE BUILDING MANUAL ACT, THE NOTATIONS MADE ON THE PLANS AND ANY MATTERS SPECIFIED ON THE BUILDING PERMIT. THE APPROVAL OF PLANS OR THE GRANT OF A BUILDING PERMIT DOES NOT AFFECT THE OPERATION OF ANY OTHER LAW IN THE TERRITORY, NOR DOES IT AUTHORISE THE USE OF THE LAND CONTRARY TO A PROVISION, COVENANT OR CONDITION OF LEASE.

MODIFICATIONS IF APPLICABLE

SITE PLAN LEVELS

UPPER LEVEL	0.0
GL A & B	-4.031
LOWER FL. A & B	-5.331
GL C	-5.381

SITE PLAN

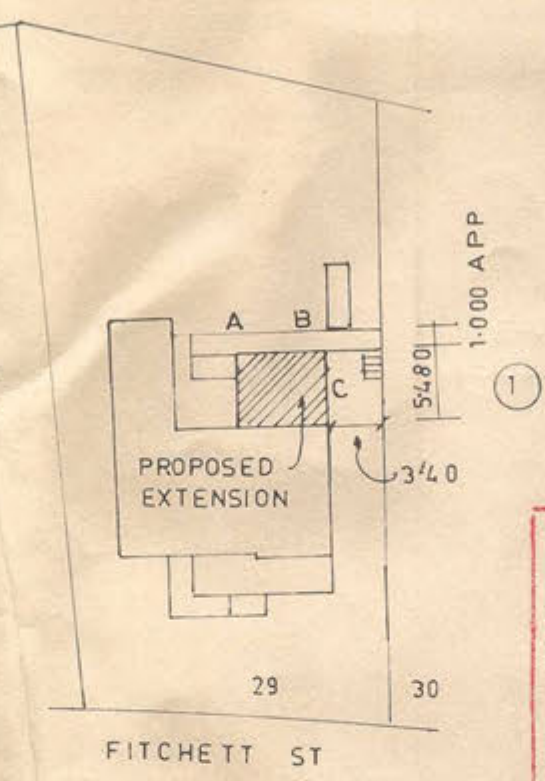

BUILDINGS (DESIGN AND SITING) ORDINANCE 1964 AS AMENDED APPROVAL GRANTED
 13 MAY 1981
 DELEGATE NATIONAL CAPITAL DEVELOPMENT COMMISSION

APPROVED FOR CONSTRUCTION BY THE HOLDER OF A CLASS "I" LICENCE.
 CLASS OF OCCUPANCY: RESIDENCE I
 OUTBUILDINGS X
 14 MAY 1981
 DEPUTY BUILDING CONTROLLER

ALL WORK TO CONFORM TO BMACT AND RELAVENT S.A.A. CODES

TITLE	PROPOSED AMENDMENT AND EXTENSION
	MR & MRS. A.I. KENNER
	29 8 GARRAN ACT
SCALES	1:100 1:500

DESIGNED
 MOORE & SMITH PLUMBING & DRAINAGE CONSULTANTS
 Unit 1, Melongio Mall, Eyswick Telephone 805 226

- AMENDMENTS
- 1 SITING FOR EXTENSION ALTERED
 - 2 HEIGHT OF RETAINING WALL DETERMINED
- ADDITIONAL AMENDMENTS (FEB 81)
- 3 DETAIL OF STEPS
 - 4 RELOCATION OF AL. SLIDING DR.
 - 5 ROOF DETAILS & SPECIFICATIONS.

6 DETAILS OF SUPPORT OF U.B.



Department of the Capital Territory
POST OFFICE BOX 158, CANBERRA CITY, ACT 2601

BUILDING SECTION
North Building, Civic Offices,
London Circuit, 491655

Received Building Section
20 OCT 1981
Dept. of the Capital Territory

123

12201081Z=0090

ISSUED BY

APPLICATION FOR APPROVAL OF PLANS

BL 1/6(2/81)

Cash Register Imprint

Name of Applicant MOORE & SMITH P/L Shop 1, Molonglo Mall FYSHWICK A.C.T. 2609 PH. (062) 80 5226	Address MOORE & SMITH P/L Shop 1, Molonglo Mall FYSHWICK A.C.T. 2609 PH. (062) 80 5226	Postcode
Name of lessee / owner of parcel of land <i>Mr & Mrs A. I. Kerner</i>	Address (shown on Box No. of plan) MOORE & SMITH P/L Shop 1, Molonglo Mall FYSHWICK A.C.T. 2609 PH. (062) 80 5226	Postcode

Description of the building work
Amendments to proposed additions

Description of land on which the building work is to be carried out	Block <i>29</i>	Section <i>B</i>	Division (Suburb) <i>Canberra</i>
---	--------------------	---------------------	--------------------------------------

To be specified in accordance with the appropriate classification in the Building Manual.	Type of construction <i>(N/A for Class I or X buildings)</i>	Cost <i>\$2,000</i>
	Class of occupancy	Total floor area where applicable

This application is for:
(please tick appropriate box)

New work
 Amendment to approved plan
 Amendment to plan not yet approved
 Details

I hereby apply for approval of the attached plans, and request that approved plans be -

posted to the applicant's address
 held at the counter for collection (telephone advice will be given when ready for collection)

Cherie Edlin 14.10.79
signature of applicant date

To be completed if application made otherwise than by the lessee / owner, his solicitor or architect.

I hereby authorise the abovenamed applicant of the address indicated to make this application on my behalf

A. I. Kerner 14.10.79
signature of lessee / owner date

FOR OFFICE USE ONLY	<input type="checkbox"/> New work <input checked="" type="checkbox"/> Amendment to approved plan <input type="checkbox"/> Amendment to plan not yet approved <input type="checkbox"/> Details	Plans numbered <i>13330/K</i>	Class of licence required
		Area <i>1-9</i>	Valuation <i>\$15,000</i>
		Total fees payable <i>NOT APPLICABLE</i>	
	Notify applicant <input type="checkbox"/> new permit required <input type="checkbox"/> endorse existing permit Permit fee required	Plans <input checked="" type="checkbox"/> Approved <input type="checkbox"/> Not approved <i>Cherie Edlin</i> 19.11.79 Deputy Building Controller date	

APPROVED IN RESPECT OF NOMINATED AMENDMENTS No. 1-9 ONLY. ANY OTHER VARIATIONS TO THE ORIGINALLY APPROVED PLAN ARE NOT APPROVED.



Building Ordinance 1972 PERMIT TO CARRY OUT BUILDING WORK

Part (III)

BL 1/9 (8/83)

28

Permit No.	Date of Issue	Block	Section	Suburb
166866	23 884	29		8 GARRAN

THIS PERMIT WILL LAPSE

115 months after date of issue unless otherwise extended by the Building Controller. Application for extension must be made before permit lapses and extension fee paid otherwise a new permit is necessary and full permit fee payable. If work is not commenced no refund is payable unless permit is surrendered before it lapses.

ISSUED TO:

Permit Holder Details

Initials	Surname
F	SCHINZINGER S32

Address

30 NARDOO CRES
O'CONNOR 2601

Nominee (if applicable)

Initials	Surname

CLASS OF BUILDERS LICENCE

B

Plan No.

13330HK

Register Folio No.

0747

Cost \$

1000

Code No.

Description of Work

Type of Building Construction

COMPLETION OF 2 STOREY EXTENSION TO RESIDENCE

Class of Occupancy

ENDORSEMENTS Under Section 36

Inspections—Each stage specified overleaf which applies to the building work must be inspected before proceeding beyond that stage. Stages may be groups as indicated overleaf.

NO SURVEY CERTIFICATE REQUIRED.

LESSEE/BUILDER RESPONSIBLE FOR CORRECT SITING

The building work shall be carried out in accordance with the approved plans, the Building Manual A.C.T., the notations made on the plans and subject to the provisions of the Building Ordinance 1972. The approval of plans or the grant of a building permit does not affect the operation of any other law in the Territory nor does it authorise the use of the land contrary to a provision, covenant or condition of the Crown Lease.

[Signature]


512

SPECIFICATIONS 13334 PARTS


- 5 - ROOF TRUSSES
- RAFTERS: 150 x 50 450 C/C
- C JOISTS: 150 x 50
- PROPS: 150 x 50
- RIDGE: 200 x 38
- W. PLATES: 100 x 50
- FACIA B: 185 x 32

CEILING TO MATCH EXIST.
OREGON FACIA BOARD
HARDWOOD: REMAINING PARTS.


- 3 - STAIRCASE
TO BE DONE IN ACCORDANCE
WITH THE B.M.A.C.T.

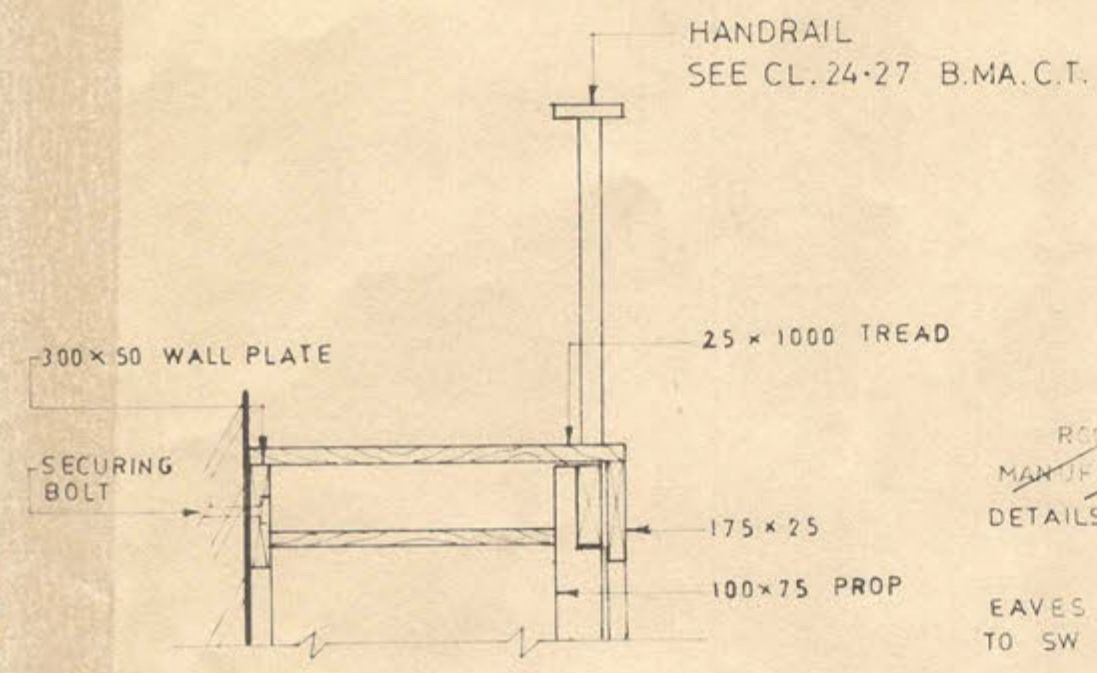


SECTION THROUGH STAIRS 1:2.0

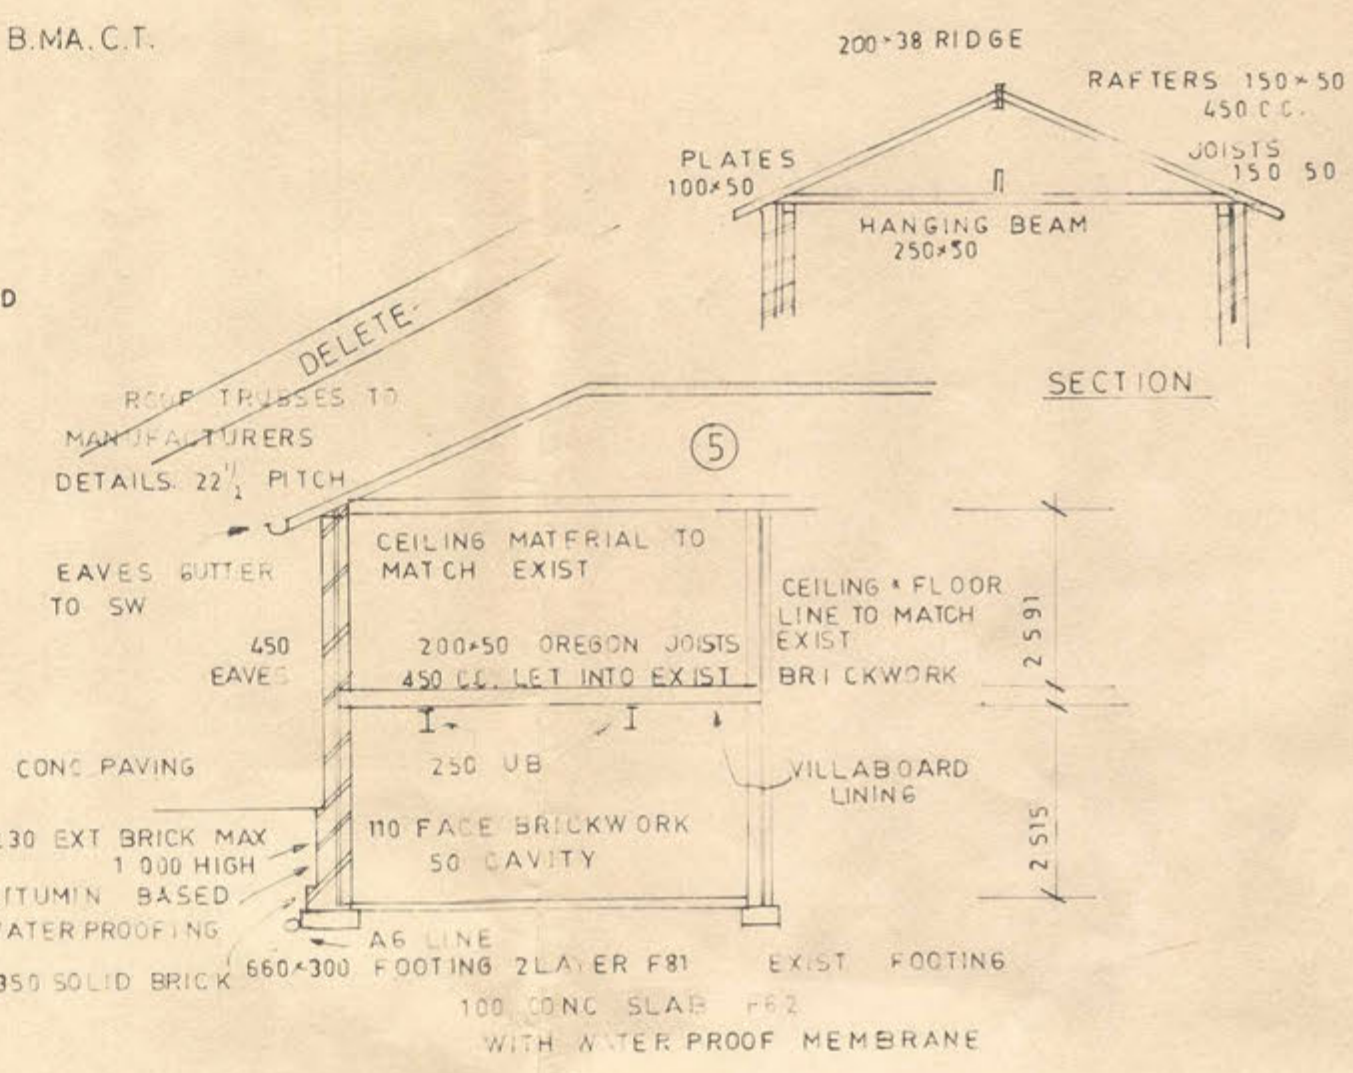

SECTION

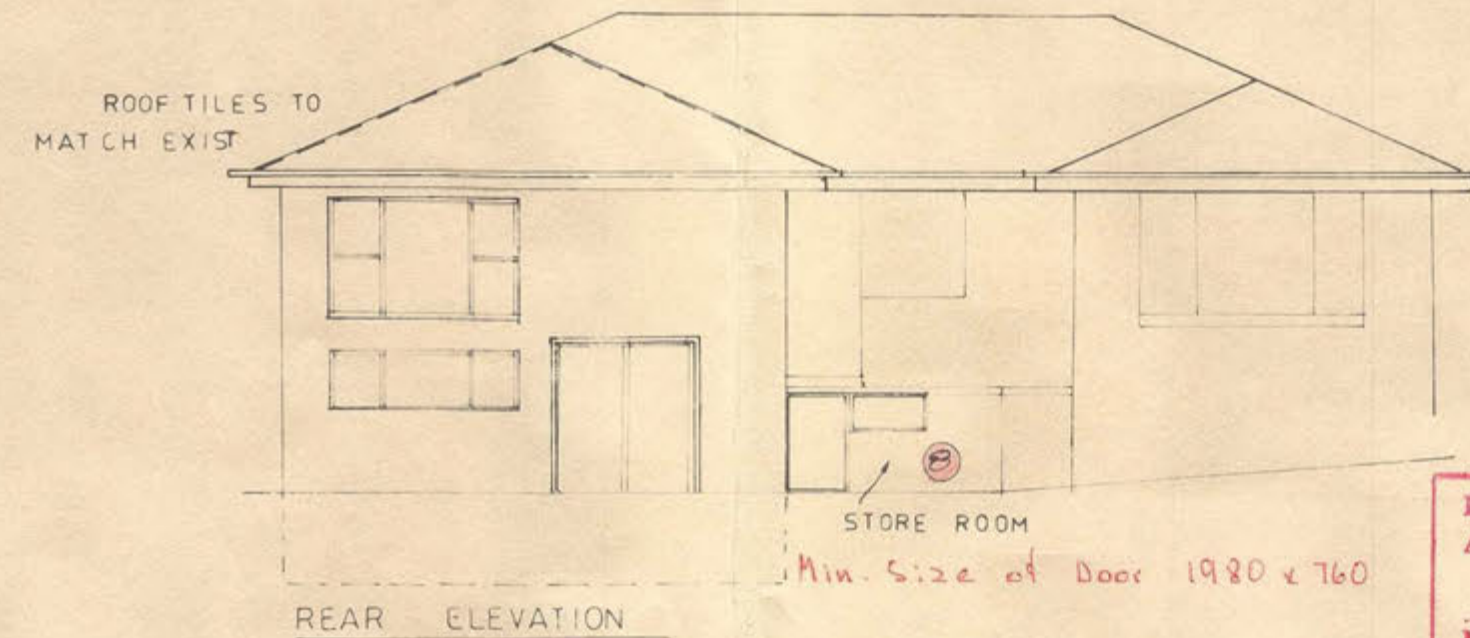


REAR ELEVATION

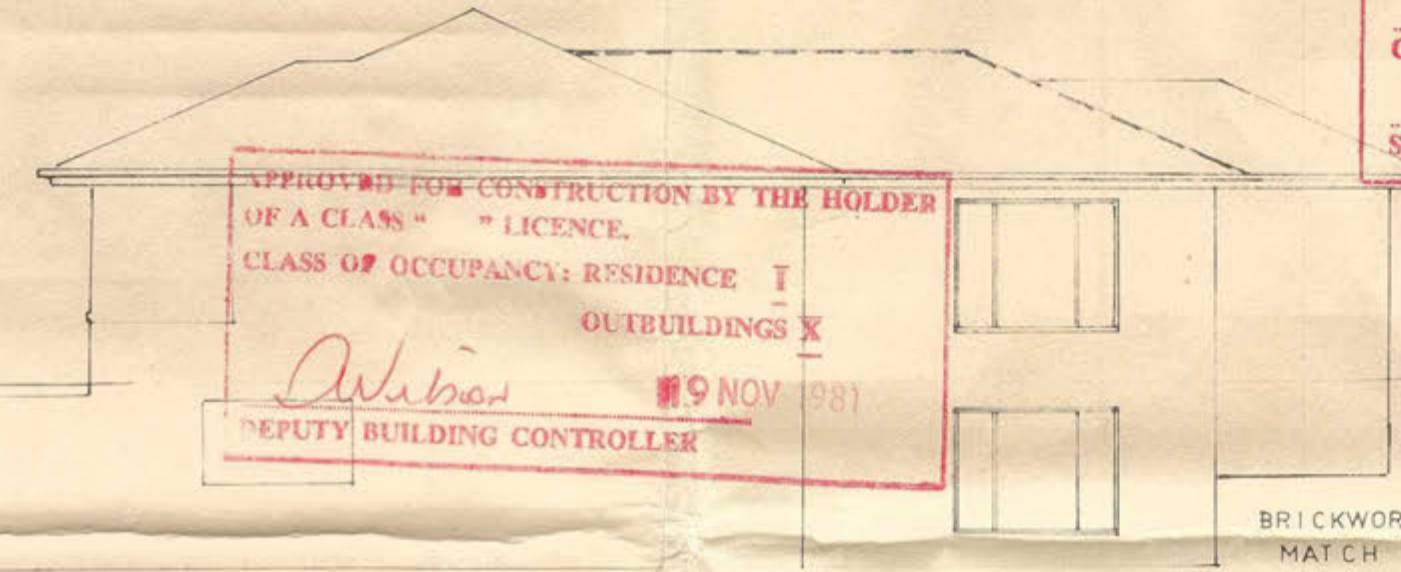


SIDE ELEVATION

APPROVED FOR CONSTRUCTION BY THE HOLDER
OF A CLASS " " LICENCE.
CLASS OF OCCUPANCY: RESIDENCE I
OUTBUILDINGS X
19 NOV 1981
DEPUTY BUILDING CONTROLLER

PLANS AND SPECIFICATIONS EXAMINED
AND RECOMMENDED FOR APPROVAL BY
ENGINEER FOR WATER SUPPLY AND SEWERAGE / /19
CHIEF ELECTRICAL ENGINEER / /19
STRUCTURAL ENGINEER / /19

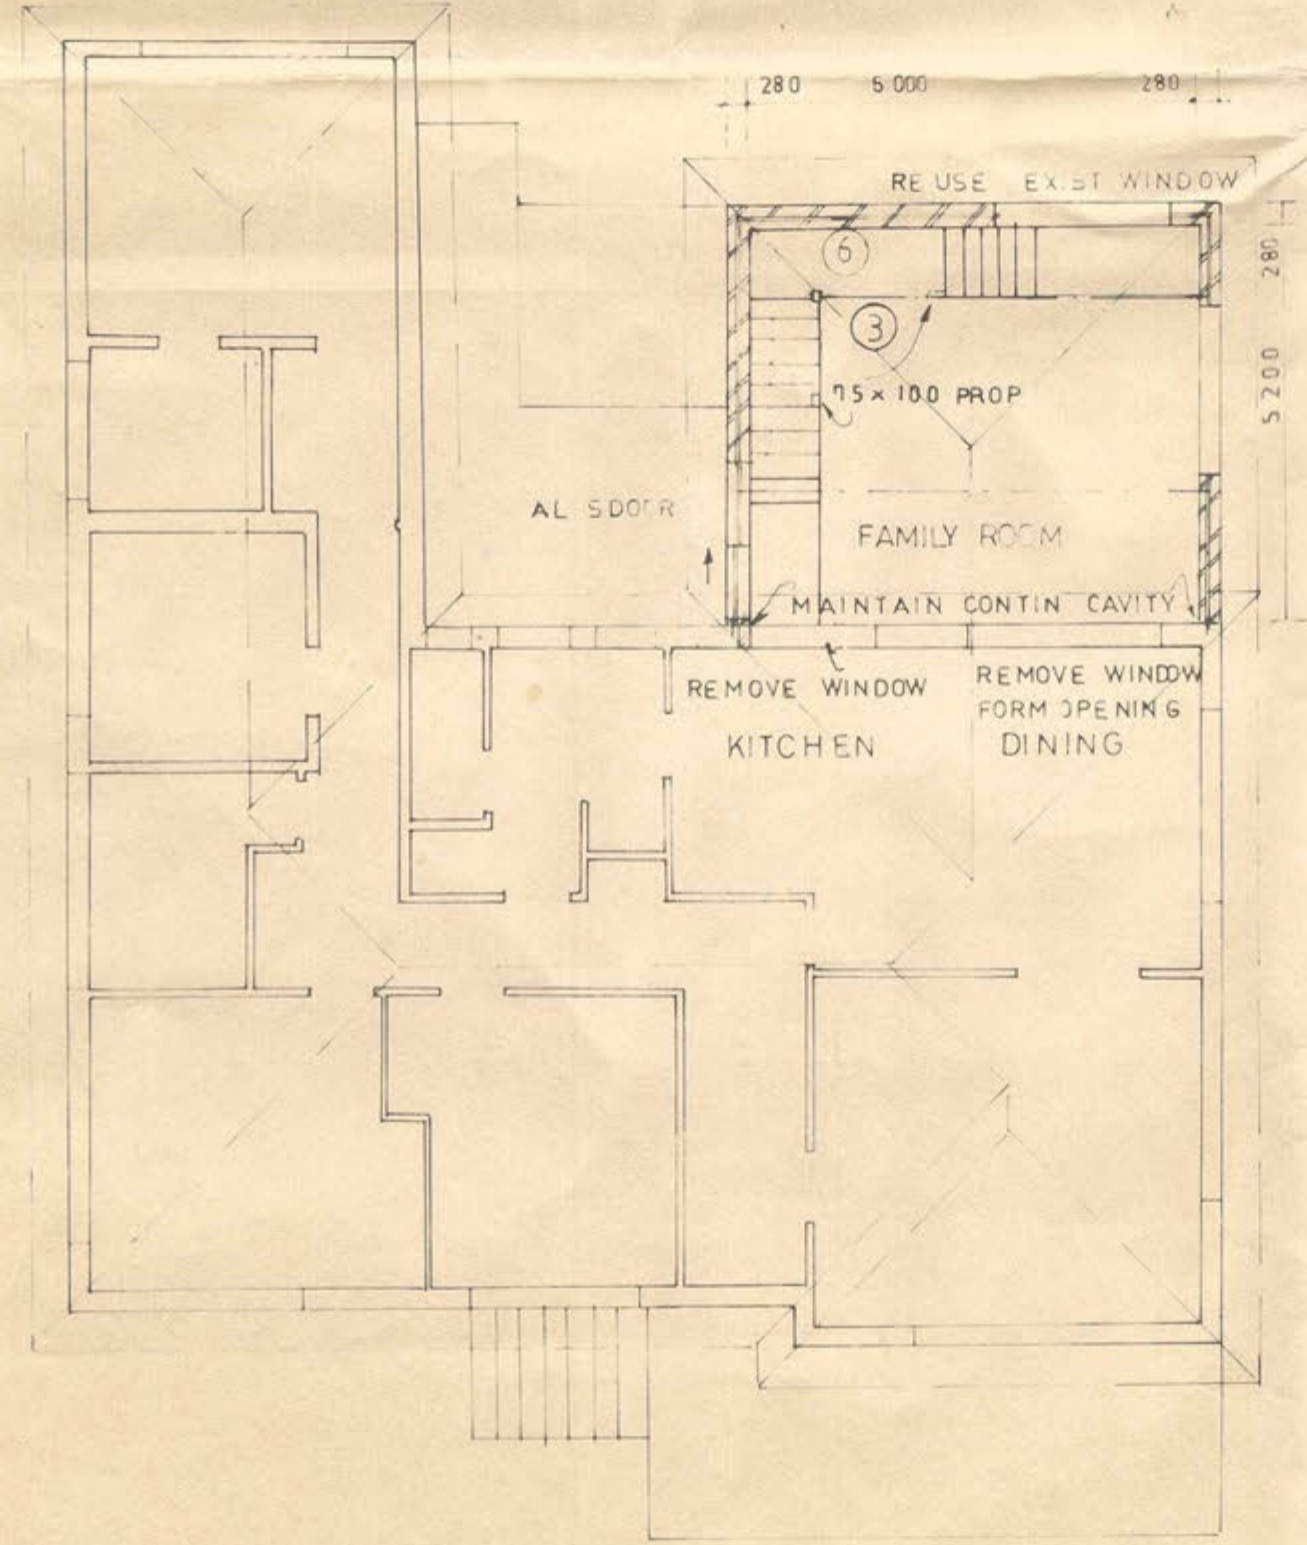

PLAN UPPER LEVEL

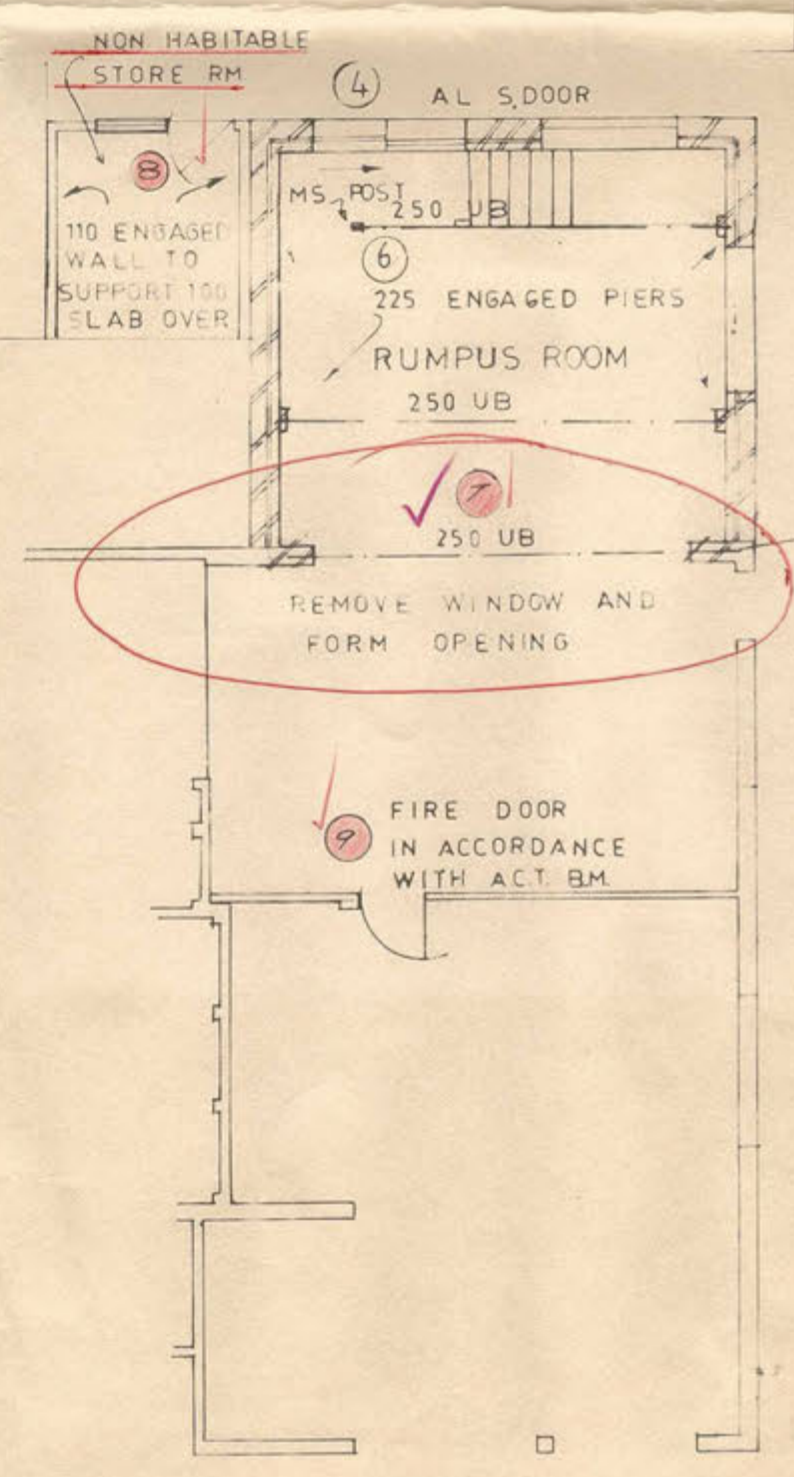


PLAN LOWER LEVEL

BUILDINGS (DESIGN AND SITING)
ORDINANCE 1984 AS AMENDED
APPROVAL GRANTED IN RESPECT OF NOMINATED
AMENDMENTS ONLY
29 OCT 1981
DELEGATE
NATIONAL CAPITAL
DEVELOPMENT COMMISSION

SITE PLAN LEVELS
UPPER LEVEL 0.0
GL A & B -4.031
LOWER FL A & B -5.331
GL C -5.381

SITE PLAN

APPROVED IN RESPECT OF NOMINATED
AMENDMENTS No's (1-9) ONLY. ANY OTHER
VARIATIONS TO THE ORIGINALLY APPROVED
PLAN ARE NOT APPROVED.

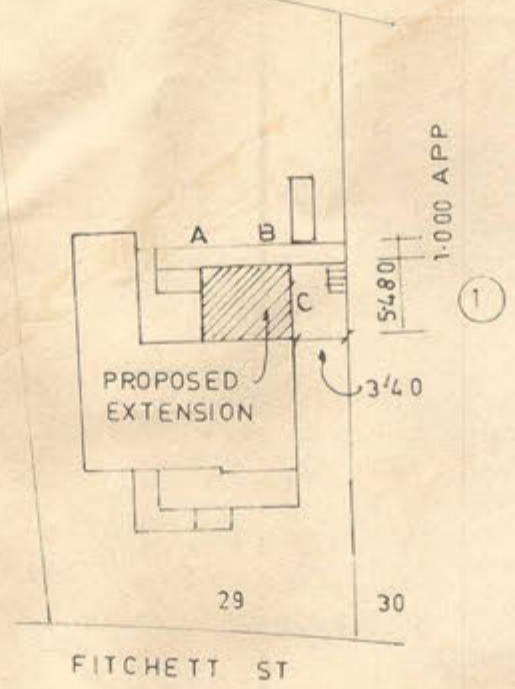

ALL WORK TO CONFORM WITH BM ACT &
RELEVANT SSA CODES

TC 3

TITLE
PROPOSED AMENDMENT AND EXTENSION
MR & MRS. A.I. KENNER
29 8 GARRAN ACT
SCALES 1:100 1:500

AMENDMENTS 13/10/81
7 DELETE LOAD BEARING WALL
8 NON HABITABLE STORE ROOM
9 FIRE DOOR IN ACCORDANCE
WITH BM ACT.
BUILDING WORK SHALL BE CONSTRUCTED IN
ACCORDANCE WITH THE APPROVED PLANS THE
BUILDING MANUAL ACT, THE NOTATIONS MADE
ON THE PLANS AND ANY MATTERS SPECIFIED
ON THE BUILDING PERMIT. THE APPROVAL OF
PLANS OR THE GRANT OF A BUILDING PERMIT
DOES NOT AFFECT THE OPERATION OF ANY
OTHER LAW IN THE TERRITORY, NOR DOES IT
AUTHORISE THE USE OF THE LAND CONTRARY
TO A PROVISION, COVENANT OR CONDITION
OF LEASE.
MONEY PAID IS APPLICABLE

DESIGNED
MOORE & SMITH PLU
PLUMBING & DRAINAGE CONSULTANTS
Unit 1, Melbourne Mall, Fishwick
Telaphona 805 226.

SCALE

- AMENDMENTS
- SITING FOR EXTENSION ALTERED
 - HEIGHT OF RETAINING WALL DETERMINED
- ADDITIONAL AMENDMENTS (FEB 81)
- DETAIL OF STEPS
 - RELOCATION OF AL SLIDING DR.
 - ROOF DETAILS & SPECIFICATIONS


- 6 DETAILS OF SUPPORT OF U.B.

APPROVED IN RESPECT OF NOMINATED AMENDMENTS No's 1-9 ONLY. ANY OTHER VARIATIONS TO THE ORIGINALLY APPROVED PLAN ARE NOT APPROVED.


PLANS/FILE No. 13330/K
 Received Building Section
 20 OCT 1981
 Dept. of the Capital Territory

- AMENDMENTS 13 10 81
- 1 WINDOW RELOCATED
 - 2 SHOWER AND WC REVERSED
 - 3 EXTEND BBQ AREA
 - 4 100 x 50 HW JOIST @ 450 cc
 - 5 150 x 50 HW BEAM
 - 6 50 Ø PIPE TO TAKE BEAM

LIGHT & VENTILATION TO ACT. BM

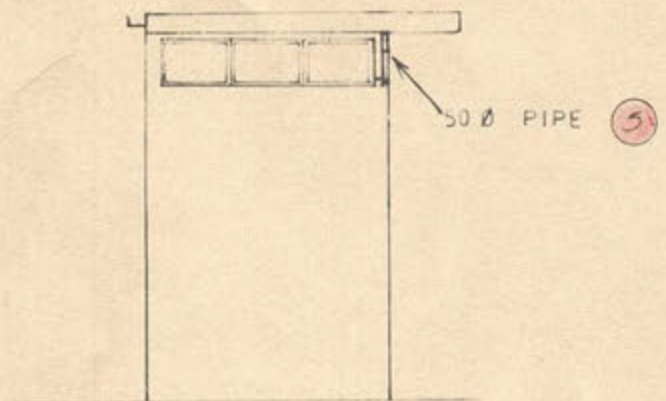


ELEVATION 'A'

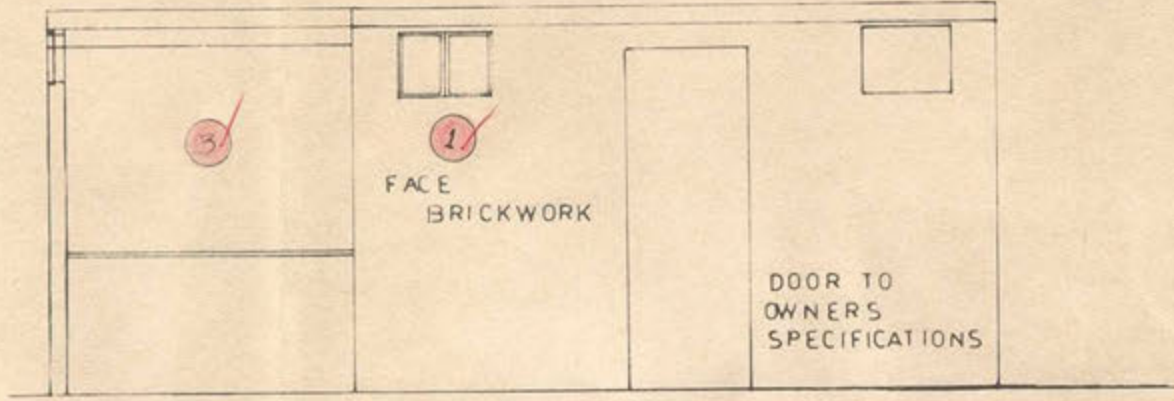


ELEVATION 'C'

APPROVED FOR CONSTRUCTION BY THE HOLDER OF A CLASS " " LICENCE.
 CLASS OF OCCUPANCY: RESIDENCE I
 OUTBUILDINGS X
Wilson
 19 NOV 1981
 DEPUTY BUILDING CONTROLLER

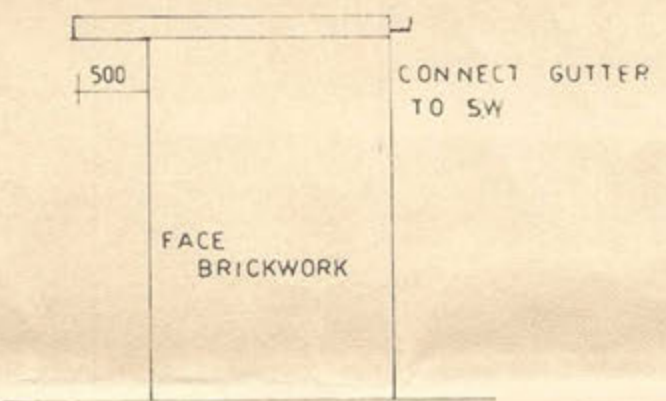


ELEVATION 'B'

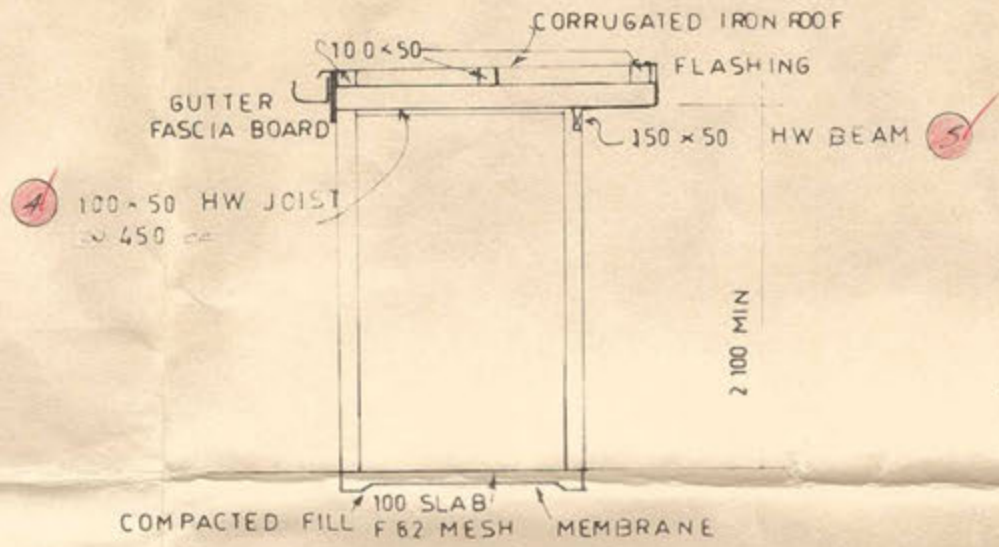


SECTION

BUILDINGS (DESIGN AND SITING) ORDINANCE 1964 AS AMENDED
 APPROVAL GRANTED IN RESPECT OF NOMINATED AMENDMENTS ONLY
 29 OCT 1981
 DELEGATE *M. Stubbs*
 NATIONAL CAPITAL DEVELOPMENT COMMISSION

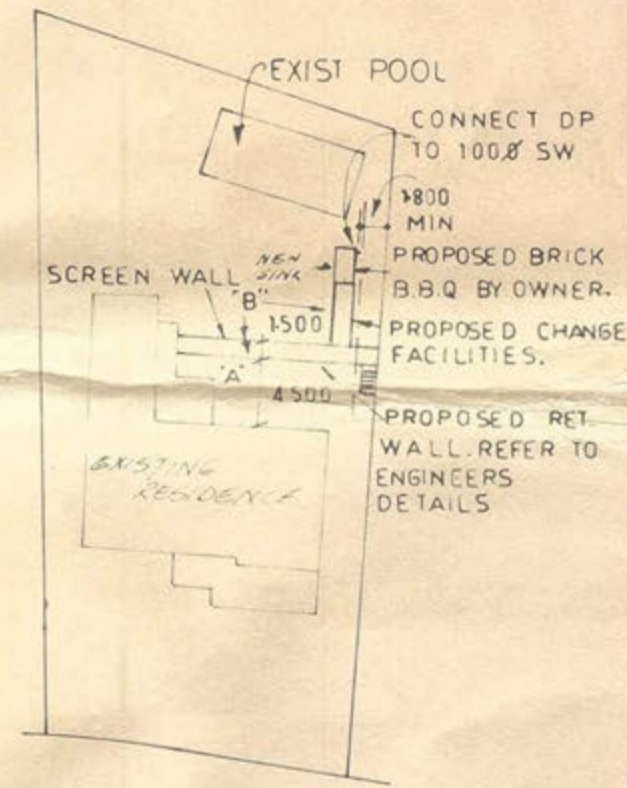

SITE PLAN

RL 'A' 0.00
 RL 'B' 1.00

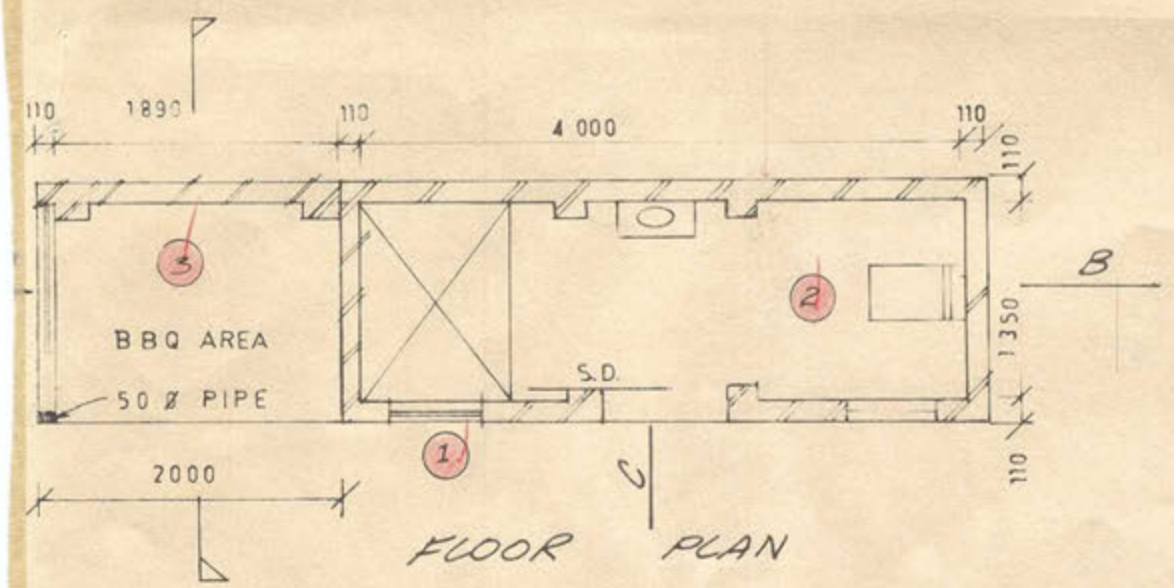

FLOOR PLAN

ALL WORK TO CONFORM TO BMACT AND RELAVENT SAA CODES
 THIS PLAN TO BE READ IN CONJUNCTION WITH ENGINEERING DETAILS FOR SCREEN WALL AND RETAINING WALL.

AMENDED PLAN 13 10 81
 PROPOSED ADDITIONS:
 MR & MRS A.I. KENNER
 BLOCK: 29, SECTION: 8, GARRAM
 DESIGN: MOORE & SMITH PTY LTD
 PLUMBING & DRAINAGE CONSULTANTS. PH 805 226.
 SCALES: 1:500
 1:50
 DWG. No. D45/MS1



Department of the Capital Territory
 POST OFFICE BOX 158, CANBERRA CITY, ACT 2601
 BUILDING SECTION
 North Building, Civic Offices,
 London Circuit, 491355



APPLICATION FOR APPROVAL OF PLANS

BL 1/6(2/81)

Cash Register Imprint			
Name of Applicant F. Schinzinget	Address 30 Nardoo Creek Connor Phone 479036 Postcode 2601		
Name of lessee / owner of parcel of land A.I. Kennet	Address (show P.O. Box No. if any) 97 Fitchett St., Gattan Phone 814405 Postcode 2605		
Description of the building work Pergola			
Description of land on which the building work is to be carried out	Block 29	Section 8	Division (Suburb) Gattan
To be specified in accordance with the appropriate classification in the Building Manual.	Type of construction <i>(N/A for Class I or X buildings)</i>		Cost 900,-
	Class of occupancy -		Total floor area where applicable -
This application is for: (please tick appropriate box)			
<input checked="" type="checkbox"/> New work <input type="checkbox"/> Amendment to approved plan <input type="checkbox"/> Amendment to plan not yet approved <input type="checkbox"/> Details			
<i>I hereby apply for approval of the attached plans, and request that approved plans be -</i> <input type="checkbox"/> posted to the applicant's address <input type="checkbox"/> held at the counter for collection (telephone advice will be given when ready for collection)			
To be completed if application made otherwise than by the lessee / owner, his solicitor or architect.		<i>I hereby authorise the abovenamed applicant of the address indicated to make this application on my behalf</i> signature of lessee / owner date 17 9 84	

FOR OFFICE USE ONLY	<input checked="" type="checkbox"/> New work <input type="checkbox"/> Amendment to approved plan <input type="checkbox"/> Amendment to plan not yet approved <input type="checkbox"/> Details <input checked="" type="checkbox"/> Notify applicant <input checked="" type="checkbox"/> new permit required <input type="checkbox"/> endorse existing permit <input type="checkbox"/> Permit fee required	Plans numbered 13330/L Area Total fees payable 15-00 Plans <input checked="" type="checkbox"/> Approved <input type="checkbox"/> Not approved Deputy Building Controller date OCT. 11 1984	Class of licence required C Valuation
	NO SURVEY CERTIFICATE REQUIRED. LEASER/BUILDER RESPONSIBLE FOR CORRECT SITING		
	Page 76 of 99		



Building Ordinance 1972 PERMIT TO CARRY OUT BUILDING WORK

Part (III)

BL 1/9 (3/84)

Permit No.	Date of Issue	Block	Section	Suburb
68237	171084	129	113	Gaman

THIS PERMIT WILL LAPSE

15 months after date of issue unless otherwise extended by the Building Controller. Application for extension must be made before permit lapses and extension fee paid otherwise a new permit is necessary and full permit fee payable. If work is not commenced no refund is payable unless permit is surrendered before it lapses.

ISSUED TO:

Permit Holder Details

Initials	Surname
F	Schinzinger S.342

Address

30 Nardoo Crescent,
O'Connor 2601

Telephone: H B

Nominee (if applicable)

Initials	Surname

CLASS OF BUILDERS LICENCE

13

Plan No.

1133302

Register Folio No.

10747

Cost \$

900

Code No.

Description of Work

Pergola

Type of Building Construction

11

Class of Occupancy

1

ENDORSEMENTS Under Section 36

Inspections—Each stage specified overleaf which applies to the building work must be inspected before proceeding beyond that stage. Stages may be groups as indicated overleaf.

"NO SURVEY CERTIFICATE REQUIRED."
 LESSEES/BUILDER RESPONSIBLE FOR CORRECT SITING

The building work shall be carried out in accordance with the approved plans, the A.C.T. Building Manual the notations made on the plans and subject to the provisions of the Building Ordinance 1972. The approval of plans or the grant of a building permit does not affect the operation of any other law in the Territory nor does it authorise the use of the land contrary to a provision, covenant or condition of the Crown Lease.

[Signature]
 Deputy Building Controller



INSPECTION RECORD

No. 127456

Permit Holder: *F. SCHINZINGER*

Block: *29*

Section: *8*

Suburb: *GARRAN*

Stage:

PERGOLA FINAL

A brief inspection of parts of the construction on this site has indicated that:

Work may proceed to next stage
 may not proceed to next stage

The following matters appear to require your attention

Please arrange access

Please rebook this inspection stage when rectified

Posted

Left on site

P. Davis 8.1.85
Building Inspector



Certificate of Occupancy and Use

Certificate No.: **B20215391C1**

Access Canberra Land, Planning and Building Services

ABN 16 479 763 216
8 Darling Street Mitchell
GPO Box 158 ACT 2601
www.act.gov.au/accesscbr

This Certificate is issued in accordance with Section 69 (2) of the Building Act 2004.

The building work listed on this certificate has been completed substantially in accordance with the prescribed requirements and is considered fit for occupation and use.

Unit	Block	Section	Division (Suburb)	District	Jurisdiction
	29	8	GARRAN	WODEN VALLEY	Australian Capital Territory

Plans
B20215391/A

Building Works

Class of Occupancy	Nature of Work	Project Item Description	Other Description	Type Of Const.	Unit	BCN ID	Builder
10b	Other	DA EXEMPT- SEE DESCRIPTION	installation of solid burning fuel appliance	NA		B20215391N1	THINK MAKE ENJOY PTY LTD

Comments

Important Note:

The issue, under this Part, of a certificate in respect of a building or portion of a building does not affect the liability of a person to comply with the provisions of a law of the territory (including this Act) relating to the building or portion of the building.

Issued by: Sian OSullivan

Issued on: 19/07/2022

Delegate of the ACT Construction Occupations Registrar.

ACTmapi

Site Plan
Garran
Block 29
Section 8

Notes:

97 Fitchett St



BUILDING APPROVAL
issued under s 28 of the
Building Act 2004

Issue date 26/10/2021.....

Stephen S Kolano

[Signature]
Certifier signature

BCA Occupancy Class:

.....10b.....

BCA Type of Construction:

N/A.....

1: 500




21-Oct-2021

Page 1 of 1

DISCLAIMER

The map is a user generated static output from an Internet mapping site and is for reference only. Data layers that appear on this map may or may not be accurate, current or otherwise reliable.



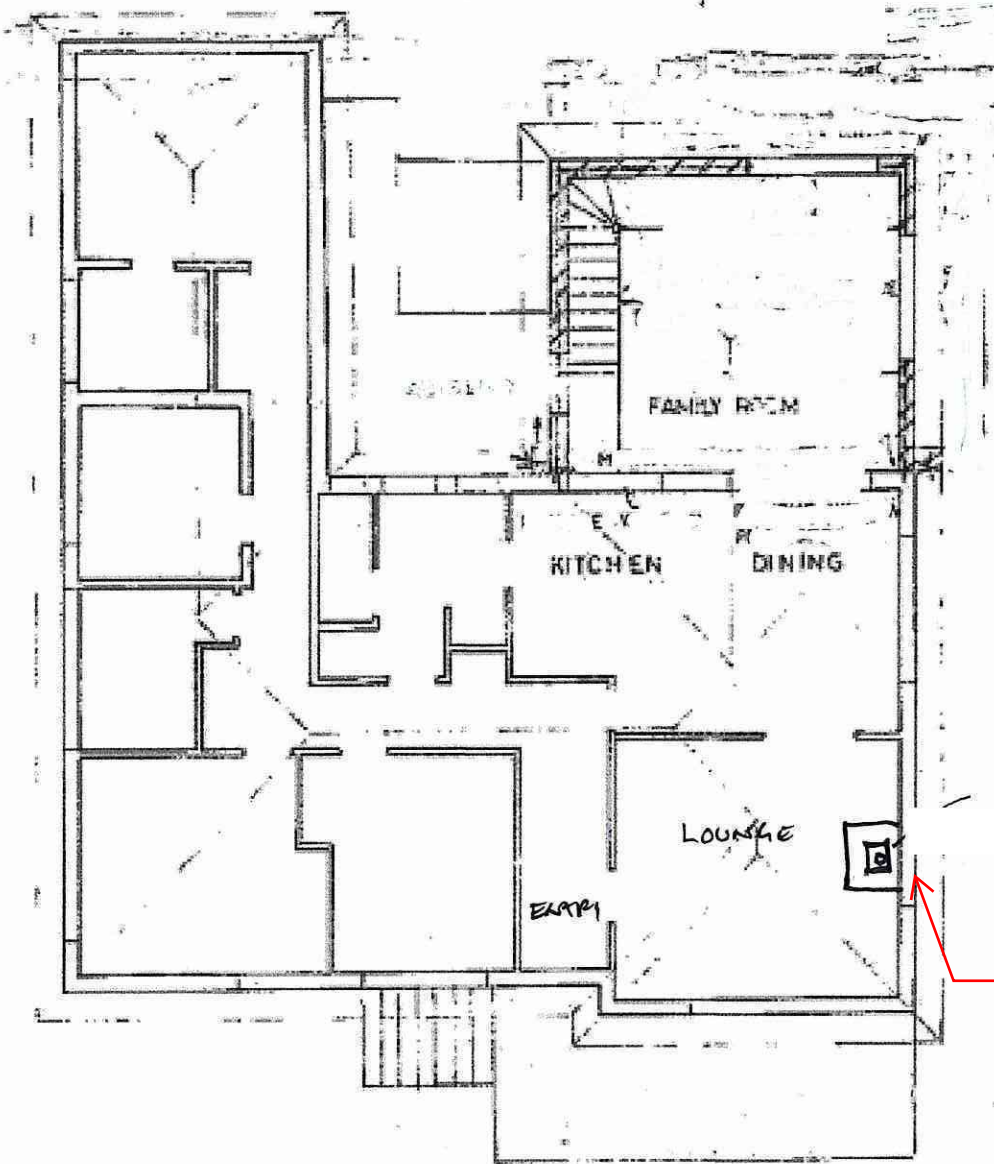

AUSCERT
 BUILDING CERTIFIERS
 ACT LIC# 2017963

BUILDING APPROVAL
 issued under s 28 of the
Building Act 2004

Issue date26/10/2021.....

Stephen S Kolano

 Certifier signature

Location of solid burning fuel appliance

FLOOR PLAN
 scale 1:100

SITE PLAN
 scale NTS

FOR CONSTRUCTION

Think Make Enjoy

Copyright © Think Make Enjoy 2021

CLIENT HUTCHISON
 ADDRESS 97 FITCHETT ST GARRAN

FIRE PLACE

BLOCK	29	SEC.	8	SCALE	1:100@A3
DRAWING No.	A01	DATE	15.10.21	REVISION	0'

PLAN OF SANITARY DRAINAGE
FOR

Owner *MR. & MRS. A. I. KENNER.*

LOT 29

SECTION B.

DISTRICT *GARRAN.*

A.C.T.

REFERENCE

G.T. Gully Trap.

D.T. Disconnecter Trap.

G.I.T. Grease Interceptor Trap.

C.I.P. Cast Iron Pipe.

S.P.D. Stoneware Pipe Drain.

I.C. Inspection Chamber.

I.O. Inspection Opening.

E.V. Educt Vent.

S.V.P. Soil Vent Pipe.

V.P. Ventilating Pipe.

T.I.T. Triple Interceptor Trap.

Scale — 40 feet = 1 inch


All work to be executed in accordance with the Canberra Sewerage and Water Supply Regulations. This plan to be read in conjunction with the approved architectural plans and specifications.

NOTES:—Drains to be laid shown in blue lines. Existing drains shown in green lines.

AMENDED DESIGN

FIXTURES

- No. 1. Water Closet.
- .. 2. Bath.
- .. 3. Shower.
- .. 4. Lav. Basin.
- .. 5. Sink.
- .. 6. Trough.
- .. 7. ~~Washing Machine.~~

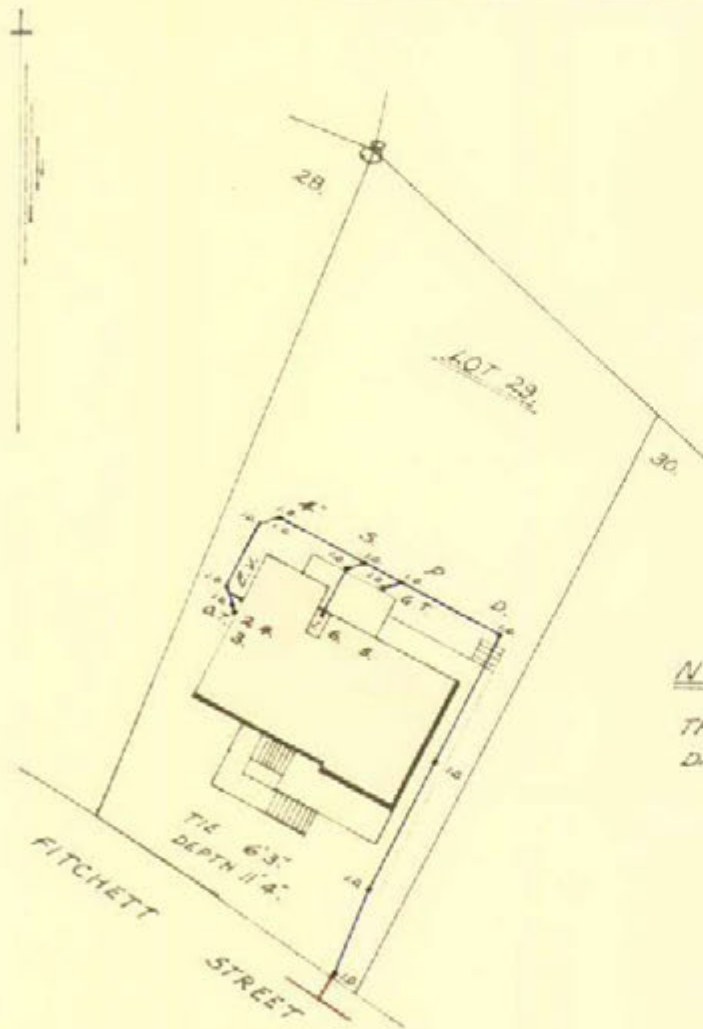

NOTE

THIS PLAN SUPERSEDES ORIGINAL PLAN DATED 28/2/1967.

INCHES

PLAN OF SANITARY DRAINAGE

DRAINAGE PLAN No 111/5/A

OWNER MR. & MRS. A.I. KENNER

BLOCK 29 SECTION B GARRAN A.C.T.

REFERENCE

DT. Disconnector Trap	SPD Stoneware Pipe Drain	I.C. Inspection Chamber	FT. Floor Trap
EV. Eject Vent	CIP Cast Iron Pipe	MH Man Hole	SVP Soil Vent Pipe
GT. Gully Trap	IO Inspection Opening	VP Ventilating Pipe	VR Vertical Riser


NOTE: All work to be executed in accordance with Canberra Sewerage & Water Supply Regulations

SCALE METRIC 1:500

FIXTURES

- 1 WATER CLOSET
- 2 BATH
- 3 BASIN
- 4 SHOWER
- 5 SINK
- 6 TROUGHS

ADDITIONAL WORK.

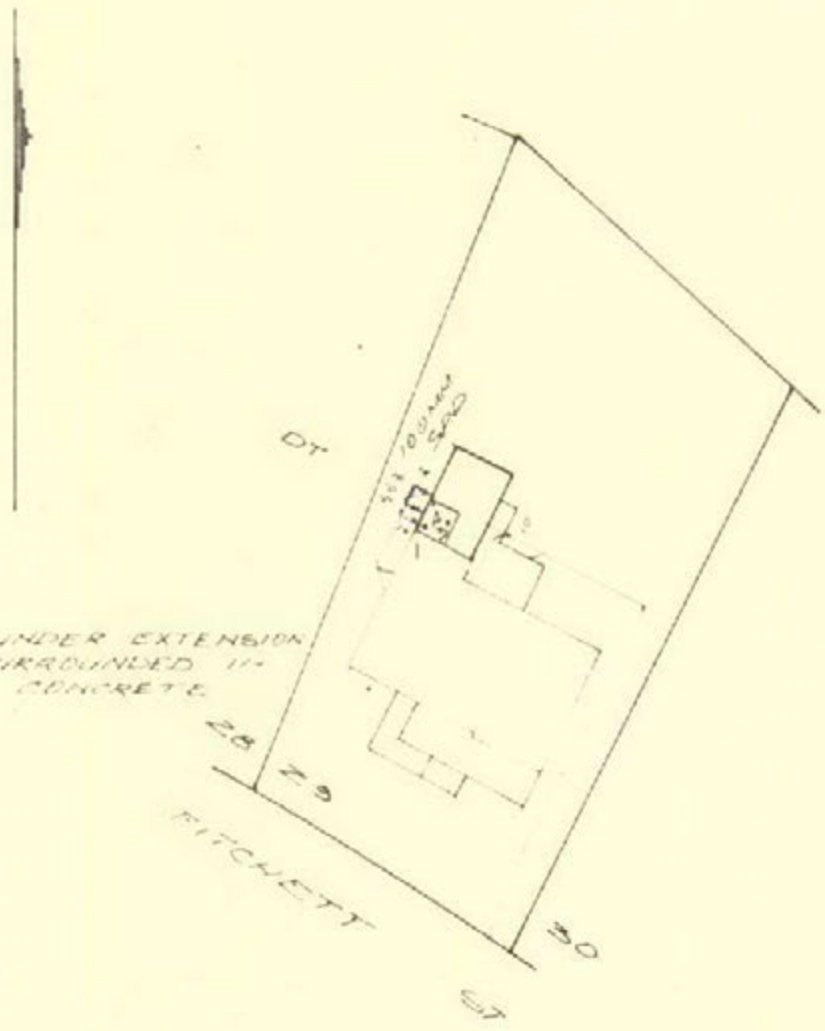

DRAINS UNDER EXTENSION TO BE SURROUNDED 100MM CONCRETE

 
NOTES DRAINS TO BE LAID ARE SHOWN IN BLUE LINES THIS PLAN TO BE READ IN CONJUNCTION WITH APPROVED ARCHITECTURAL PLANS AND SPECIFICATIONS
 DRAINS TO BE DELETED SHOWN BY RED X EXISTING DRAINS SHOWN IN GREEN LINES
 POSITION OF BRANCH TO BE LOCATED BEFORE ANY WORK IS COMMENCED

Designed by G MOORE & N SMITH Phone 95 9236 Plumbing & Drainage Consultants

H. Hillaber 18.10.74
 SEWERAGE ENGINEER

DRAWN *G Moore*

REF J 555



PLAN OF SANITARY DRAINAGE

DRAINAGE PLAN No 11115/C

OWNER MR + MRS A.I KENNER.

BLOCK 29 SECTION B GARRAN.

ACT

—REFERENCES—

D.T	Disconnect Trap	V.C.P	Vitrified Clay Pipe	I.C	Inspection Chamber	FT	Floor Trap
E.V	Educt Vent	C.I.P	Cast Iron Pipe	M.H.	Man Hole	S.V.P.	Soil Vent Pipe
G.T	Gully Trap	I.O	Inspection Opening	V.P.	Ventilating Pipe	VR	Vertical Riser
J.U	Jump Up	F.P	Fixed Point	E.I	Expansion Joint		

NOTE: All work to be executed in accordance with Canberra Sewerage & Water Supply Regulations


—SCALE METRIC 1:500—

ADDITIONAL WORK.
AMENDED PLAN.



—FIXTURES—

	NO	OFF
1. WATER CLOSET	(1)	
2. BATH	()	
3. BASIN	(1)	
4. SHOWER	(1)	
5. SINK	(1)	
6. TROUGHS	()	

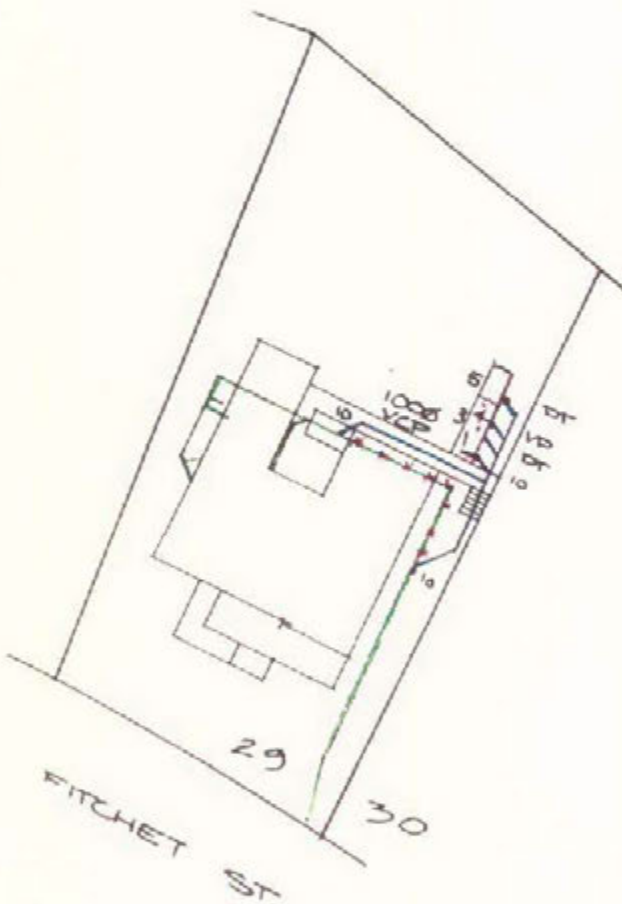

J. BURKE 25292
 PLUMBER.....
 J. BURKE 48997.
 DRAINER.....
 DRAIN INSP. 24-10-80
 FINAL INSP. 7-12-95 A.A.
 METER NO. EXISTING.....
 COMPLETION. 11/12/95

NOTES: INSPECTION OPENINGS TO BE PROVIDED AT THE TIE POSITION. ON EACH W.C. OR SLOP HOPPER BRANCH. AT INTERVALS OF NOT MORE THAN 30 METRES SPACED EQUIDISTANT WHERE POSSIBLE IMMEDIATELY UPSTREAM AND DOWNSTREAM OF JUMP-UPS
 DRAINS TO BE LAID ARE SHOWN IN BLUE LINES. THIS PLAN TO BE READ IN CONIUNCTION WITH APPROVED ARCHITECTURAL PLANS AND SPECIFICATIONS
 DRAINS TO BE DELETED SHOWN BY RED X EXISTING DRAINS SHOWN IN GREEN LINES
 POSITION OF BRANCH TO BE LOCATED BEFORE ANY WORK IS COMMENCED.
 UNPLASTICISED POLYVINYL CHLORIDE PIPE DRAINS (UPVC) INCLUDING STACKS TO BE CONSTRUCTION IN ACCORDANCE WITH AS CA67 1972 AS CA69 1972 AS 2032 1977 AND CANBERRA CODES OF PRACTICE VITRIFIED CLAY PIPES (V.C.P.) TO BE INSTALLED IN ACCORDANCE WITH AS 1693 AND AS A164

Designed by GEOFF MOORE DESIGN P.L. 806294
Plumbing & Drainage Consultants

DRAWN 6/11/86

REF B71

Bloughan
 SEWERAGE ENGINEER 13-2-86

GENERAL NOTES

- EXISTING SEWER LINES TO BE LOCATED ON SITE PRIOR TO COMMENCEMENT OF WORK.
- ALL PLUMBING AND DRAINAGE TO BE INSTALLED IN ACCORDANCE WITH AS3500.
- ALL WORK TO BE CARRIED OUT IN ACCORDANCE WITH THE CANBERRA SEWERAGE AND WATER SUPPLY REGULATIONS.
- THIS PLAN TO BE READ IN CONJUNCTION WITH APPROVED ARCHITECTURAL PLANS AND SPECIFICATIONS.
- INSPECTION SHAFT AT PROPERTY BOUNDARY TO BE IN ACCORDANCE WITH PLUMBING NOTE No3.
- ORG LEVELS TO BE IN ACCORDANCE WITH AS3500.2.2 CLAUSE 4.6.6.6 & 4.6.6.7 & PLUMBING NOTE 22.
- UNPLASTICISED POLYVINYL CHLORIDE PIPE DRAINS (UPVC) TO BE CONSTRUCTED IN ACCORDANCE WITH AS2032 AND THE CANBERRA SEWERAGE AND WATER SUPPLY REGULATIONS.
- TEMPERED HOT WATER REQUIRED AT ALL ABLUTION FIXTURES.
- PLUMBING AND DRAINAGE TO CONFORM TO ACTPLA PLUMBING NOTES 22 AND 23.

DOWN PIPE NOTES

- DOWNPIPES MUST BE SECURELY FIXED TO WALLS.
- THE SPACING BETWEEN DOWNPIPES MUST NOT MORE THAN 12 M.
- DOWNPIPES MUST BE FIXED AS CLOSE AS POSSIBLE TO VALLEY GITTERS AND, IF THE DOWNPIPE IS MORE THAN 1.2M FROM VALLEY, PROVISION FOR OVERFLOW MUST BE MADE.
- WHERE HIGH-FRONTED GUTTERS ARE INSTALLED, PROVISION MUST BE MADE TO AVOID ANY OVERFLOW FROM FLOWING BACK INTO ROOF OR BUILDING STRUCTURE BY INSTALLING SLOTTED GUTTERS OR THE LIKE.
- DOWNPIPES MUST-
 - BE COMPATIBLE WITH OTHER ROOFING MATERIALS USED IN THE ROOFING SYSTEM IN ACCORDANCE WITH 3.5.3(C) OF THE B.C.A
 - BE SELECTED IN ACCORDANCE WITH APPROPRIATE EAVES GUTTER SECTION AS SHOWN IN TABLE 3.5.2.2 OF THE B.C.A.

LEGEND

- SEWER MAIN
- STORMWATER MAIN
- WATER MAIN
- SEWER LINES
- EXISTING SEWER LINES
- VENT PIPE
- STORMWATER LINES
- SUB SOIL DRAINAGE
- DOMESTIC WATER
- NON-POTABLE WATER
- TRADEWASTE
- 90Ø AG LINE WITH FILTER SOCK CONNECTION TO STORMWATER DRAINAGE
- YS YARD SUMP. EXACT LOCATION TO BE DETERMINED ON SITE BY LANDSCAPE CONTRACTOR
- STREET HYDRANT
- STOP COCK
- WATER METER

REFERENCE

- AAV AIR ADMITTANCE VALVE
- BT BUCKET TRAP
- CO CLEAR OUT
- CWR/D
- DT DISCONNECTOR TRAP
- FBBV FIRE BRIGADE BOOSTER
- FHR FIRE HOSE REEL
- FW FLOOR WASTE
- GIT
- GT GRATED TRENCH
- HDPE
- HYD HYDRANT
- IO INSPECTION OPENING
- IS INSPECTION SHAFT
- O/F OVERFLOW
- ORG OVERFLOW RELIEF GULLY
- PP PROVISIONAL POINT
- SC STOP COCK
- SMH SEWER MANHOLE
- SPP SEWER PROVISIONAL POINT
- ST SILT TRAP
- SVP SOIL VENT PIPE
- TD TUNDISH
- TG TEST GATE
- TTD TRAPPED TUNDISH
- TWPP TRADEWASTE PROVISIONAL POINT
- TWVP TRADEWASTE VENT PIPE
- UPVC UNPLASTICISED POLYVINYL CHLORIDE
- VP VENT PIPE
- WM WATER METER
- WS WASTE STACK

FIXTURE TABLE

1	WC	0
2	BATH	0
3	BASIN	0
4	SHOWER	0
5	KITCHEN SINK	0
6	LAUNDRY TROUGH	1



DRAINAGE PLAN
NUMBER: 11115

BLOCK 29 SECTION 8
GARRAN ACT

PLAN OF SANITARY DRAINAGE
DESIGNED TO AS3500



[Signature]
17-4-2026

PLUMBING PLAN APPROVED
APPROVED BY _____
REG. NUMBER _____
DATE _____

WORK AS EXECUTED	A.WARD 0409249974 PO BOX 4311 HAWKER ACT 2614	NEW WORKS FITCHETT STREET GARRAN ACT	DESIGNED BY _____	TITLE HYDRAULIC SERVICES	SCALE 1:200@A3
	7.4.2026	OLI MCGREADY Page 86 of 99	DRAWN BY _____ AUTHORISED _____ DATE 7.4.2026	JOB NO. H01	DRAWING NO. 742026
A WAE	DATE CHECKED	SEWER TIE AS PER INFORMATION PROVIDED BY ACTPLA D:8.3'=1.9M T:11.4'=3.5m	CLIENT		

Energy Efficiency Rating



UNDERSTANDING YOUR ENERGY EFFICIENCY RATING (EER)

An energy efficiency rating (EER) is a rating used to identify the energy efficiency of homes in the ACT.

The Civil Law (Sale of Residential Property) Act 2003 requires all homes being sold in the ACT to carry an energy efficiency rating (EER). This enables owners and buyers to compare a home's passive energy performance characteristics with others for sale in the Territory.

In the ACT, established homes are assessed using 1st generation software, and can achieve **0 to 6 stars** in the rating scheme.

Houses with a higher EER are more cost and energy efficient, use less energy for heating and cooling, generate lower greenhouse gas emissions, and are more comfortable.

What information is taken into account when assessing my homes energy efficiency?

- Layout of the home
- Construction of its roof, walls, windows, and floor
- Wall, floor, and ceiling insulations
- Orientation of windows and shading of the sun's path and local breezes
- Influence of the local climate
- Air leakages

What information is not applicable when assessing my homes energy efficiency?

- Heating and cooling
- Hot water systems
- Lighting systems and appliances
- Solar panels

How can I improve my energy efficiency rating?

Your energy efficiency report will include a list of design options (unless it's already achieved the maximum rating of 6 stars). This will outline the improvements that can be made to gain additional points and increase the overall star rating of your home.

When I built my home, I was provided with a 10-star energy rating. Why has this decreased?


The ACT Government has two software systems in place to generate energy efficiency ratings:

1. Established homes: An on site assessment using 1st generation software. A maximum of 6 stars can be achieved.
2. Brand new homes: A computer based assessment using 2nd generation software. A maximum of 10 stars can be achieved.

If you hold an energy efficiency rating that exceeds 6 stars, it is a 2nd generation EER and would have been provided when your home was brand new.

When assessing a home's energy efficiency for the purpose of sale, property inspection companies are required to use 1st generation software, which will achieve a maximum of 6 stars.

FirstRate Report

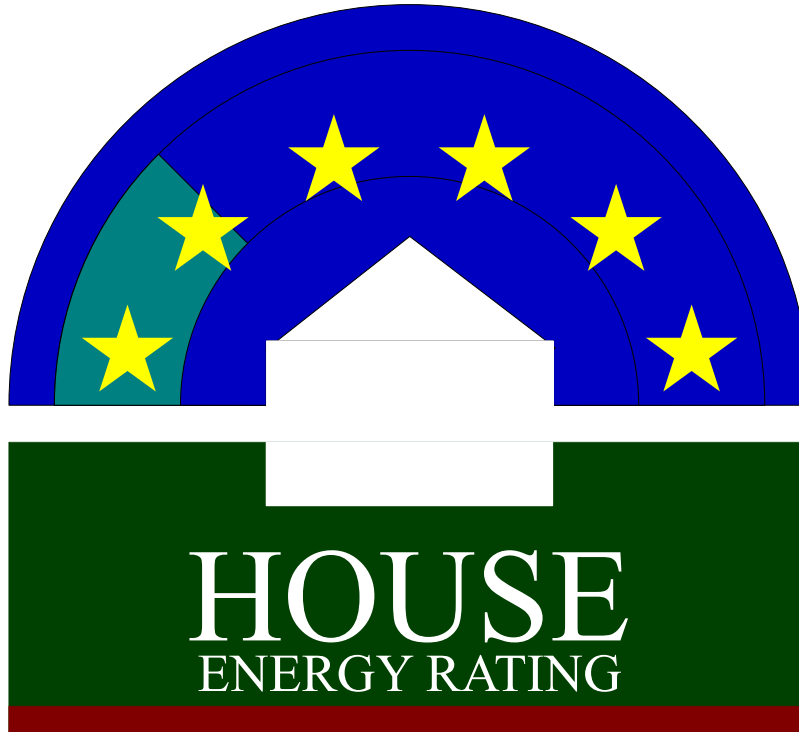

YOUR HOUSE ENERGY RATING IS: ★ ☆
in Climate: 24

1.5 STARS

SCORE: -52 POINTS


Name: Hutchinson

Ref No: 68121

House Title: Block 29 Section 8 GARRAN

Date: 07-05-2021

Address: 97 Fitchett Street, Garran ACT 2605

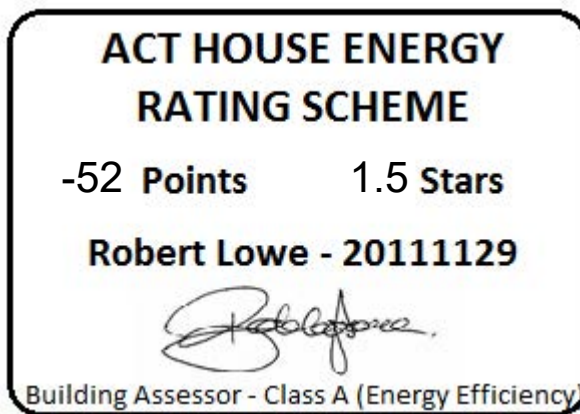

This rating only applies to the floor plan, construction details, orientation and climate as submitted and included in the attached Rating Summary. Changes to any of these could affect the rating.

IMPROVING YOUR RATING

The table below shows the current rating of your house and its potential for improvement.

Star Rating	POOR			AVERAGE				GOOD			V. GOOD	
	0 Star	★	★★	★★★	★★★★	★★★★★	★★★★★★	★★★★★★★	★★★★★★★★	★★★★★★★★★		
Point Score	-71	-70	-46	-45	-26	-25	-11	-10	4	5	16	17
Current	-52											
Potential	25											

Incorporating these design options will add the additional points required to achieve the potential rating shown in the table. Each point represents about a 1% change in energy efficiency. This list is only a guide to the range of options that could be used.

Design options

Additional points

Change added wall insulation	R 1.5	21
Change added floor insulation	R 2	7
Change glass to Double Glazing	100 %	10
Change frame to Aluminium-Improved		11
Change curtain to Heavy Drapes & Pelmet		19
Add northerly blinds	100 %	2
Seal Exhaust fans		2
Seal Internal Doors		1
Seal Gaps & Cracks		4

ORIENTATION

Orientation is one of the key factors which influences energy efficiency. This dwelling will achieve different scores and star ratings for different orientations.

Current Rating	-52	★☆☆
-----------------------	------------	------------

Largest windows in the dwelling;

Direction : North East

Area : 11 m²

The table below shows the total score for the dwelling when these windows face the direction indicated.

Note that obstructions overshadowing windows have been removed from all windows in these ratings to allow better comparisons to be made between orientations.

ORIENTATION	POINT SCORE	STAR RATING
1. North East	-51	★☆☆
2. East	-51	★☆☆
3. South East	-54	★☆☆
4. South	-55	★☆☆
5. South West	-55	★☆☆
6. West	-53	★☆☆
7. North West	-54	★☆☆
8. North	-51	★☆☆

FirstRate Mode
Climate: 24

RATING SUMMARY for: Block 29 Section 8 GARRAN, 97 Fitchett Street, Garran ACT 2605,

Assessor's Name:

Net Conditioned Floor Area: 158.3 m²

				Points		
Feature				Winter	Summer	Total
CEILING				3	1	5
Surface Area:	0	Insulation:	5			
WALL				-23	5	-18
Surface Area:	-10	Insulation:	-22	Mass:	14	
FLOOR				-3	-1	-4
Surface Area:	0	Insulation:	-4	Mass:	0	
AIR LEAKAGE (Percentage of score shown for each element)				1	0	1
Fire Place	0 %	Vented Skylights	0 %			
Fixed Vents	0 %	Windows	21 %			
Exhaust Fans	17 %	Doors	12 %			
Down Lights	0 %	Gaps (around frames)	49 %			
DESIGN FEATURES				0	1	1
Cross Ventilation	1					
ROOF GLAZING				0	-3	-3
Winter Gain	2	Winter Loss	-2			
WINDOWS				-27	-11	-37
Window Direction	Area		Point Scores			
	m2	%NCFA	Winter* Loss	Winter Gain	Summer Gain	Total
NE	13	8%	-18	17	-4	-5
SE	9	6%	-14	4	-2	-12
SW	10	6%	-16	5	-2	-13
NW	11	7%	-15	10	-2	-8
Total	43	27%	-63	36	-11	-37

* Air movement over glazing can significantly increase winter heat losses. SEAV recommends heating/cooling duct outlets be positioned to avoid air movement across glass or use deflectors to direct air away from glass.

The contribution of heavyweight materials to the window score is -2 points

			Winter	Summer	Total
RATING	★ ★	SCORE	-48	-9	-52*

* includes 4 points from Area Adjustment

Detailed House Data

House Details

ClientName Hutchinson
 HouseTitle Block 29 Section 8 GARRAN
 StreetAddress 97 Fitchett Street, Garran ACT 2605
 FileCreated 07-05-2021

Climate Details

State
 Town Canberra
 Postcode 2600
 Zone 24

Floor Details

ID	Construction	Sub Floor	Upper	Shared	Foil	Carpet	Ins RValue	Area
1	Timber	Enclosed	No	No	No	No	R0.0	60.9m ²
2	Timber	Enclosed	No	No	No	Float Timb	R0.0	24.5m ²
3	Timber	Enclosed	No	No	No	Tiles	R0.0	4.0m ²
4	Timber	Enclosed	No	No	No	Vinyl	R0.0	27.0m ²
5	Timber	Enclosed	No	No	No	Float Timb	R2.0	15.0m ²
6	Timber	Enclosed	No	No	No	Carp	R2.0	30.0m ²
7	Timber	Enclosed	No	No	No	Carp	R0.0	15.0m ²

Wall Details

ID	Construction	Shared	Ins RValue	Length	Height
1	Brick Cavity	No	R0.0	67.1m	2.4m

Ceiling Details

ID	Construction	Shared	Foil	Ins RValue	Area
1	Attic - Vented	No	No	R3.5	176.4m ²

Window Details

ID	Dir	Height	Width	Utility	Glass	Frame	Curtain	Blind	Fixed & Adj Eave	Fixed Eave	Head to Eave
1	SW	1.3m	3.1m	No	SG	ALSTD	CW	Yes	1.3m	0.5m	0.0m
2	SW	1.3m	2.1m	No	SG	ALSTD	CW	Yes	1.3m	0.5m	0.0m
3	SW	1.3m	2.6m	No	SG	ALSTD	CW	Yes	1.3m	0.5m	0.0m
4	NW	1.3m	1.1m	No	SG	ALSTD	CW	Yes	1.3m	0.5m	0.0m
5	NW	0.6m	2.6m	Yes	SG	ALSTD	NC	No	0.5m	0.5m	0.0m
6	NW	1.3m	1.9m	No	SG	ALSTD	CW	No	0.5m	0.5m	0.0m
7	NW	0.6m	1.8m	No	SG	ALSTD	NC	No	0.5m	0.5m	0.0m
8	NE	1.3m	2.6m	No	SG	ALSTD	CW	No	0.5m	0.5m	0.0m
9	SE	1.3m	1.9m	No	SG	ALSTD	CW	No	0.5m	0.5m	0.0m
10	NE	0.9m	0.7m	Yes	SG	ALSTD	NC	No	0.0m	0.0m	0.0m
11	NE	0.9m	1.1m	Yes	SG	ALSTD	NC	No	0.5m	0.5m	0.0m
12	NW	2.0m	2.1m	No	SG	ALSTD	CW	No	0.5m	0.5m	0.0m
13	NE	1.2m	3.0m	No	SG	ALSTD	CW	No	0.5m	0.5m	0.0m
14	SE	1.2m	2.1m	No	SG	ALSTD	CW	No	0.5m	0.5m	0.0m
15	SE	1.2m	2.1m	No	SG	ALSTD	CW	No	0.5m	0.5m	0.0m
16	SE	1.3m	1.4m	No	SG	ALSTD	CW	No	0.5m	0.5m	0.0m
17	NE	2.1m	2.1m	No	SG	ALSTD	CW	No	0.0m	0.0m	0.0m

Window Shading Details

<u>ID</u>	<u>Dir</u>	<u>Height</u>	<u>Width</u>	<u>Obst Height</u>	<u>Obst Dist</u>	<u>Obst Width</u>	<u>Obst Offset</u>	<u>LShape Left Fin</u>	<u>LShape Left Off</u>	<u>LShape Right Fin</u>	<u>LShape Right Off</u>
10	NE	0.9m	1.1m	0.0m	0.0m	0.0m	0.0m	0.0m	0.0m	4.0m	1.0m
11	NW	2.0m	2.1m	2.5m	4.5m	5.7m	-0.1m	4.5m	0.0m	0.0m	0.0m

Sky Light Details

<u>ID</u>	<u>Dir</u>	<u>Tilt</u>	<u>Type</u>	<u>Shade</u>	<u>Utility</u>	<u>Width</u>	<u>Length</u>
1	NE	15 degrees	Single Clear	No	No	0.6m	0.8m
2	NE	15 degrees	Single Clear	No	No	1.0m	1.0m

Zoning Details

Is there Cross Flow Ventilation ? Good

Air Leakage Details

Location Suburban
 Is there More than One Storey ? No
 Is the Entry open to the Living Area ? No
 Area of Heavyweight Mass 0m²
 Area of Lightweight Mass 0m²

	<u>Sealed</u>	<u>UnSealed</u>
Chimneys	0	0
Vents	0	0
Fans	0	1
Downlights	0	0
Skylights	0	0
Utility Doors	0	3
External Doors	0	0

Unflued Gas Heaters 0
 Percentage of Windows Sealed 98%
 Windows - Average Gap Small
 External Doors - Average Gap Small
 Gaps & Cracks Sealed No

Insurance Certificates & Tax Invoice




If a home was built before 1990 it may contain dangerous asbestos material

Identify where asbestos materials might be. Five common places are:



- 1.** Exterior
roof sheeting, gutters, downpipes,
ridge capping, eaves, cladding,
electrical switchboards

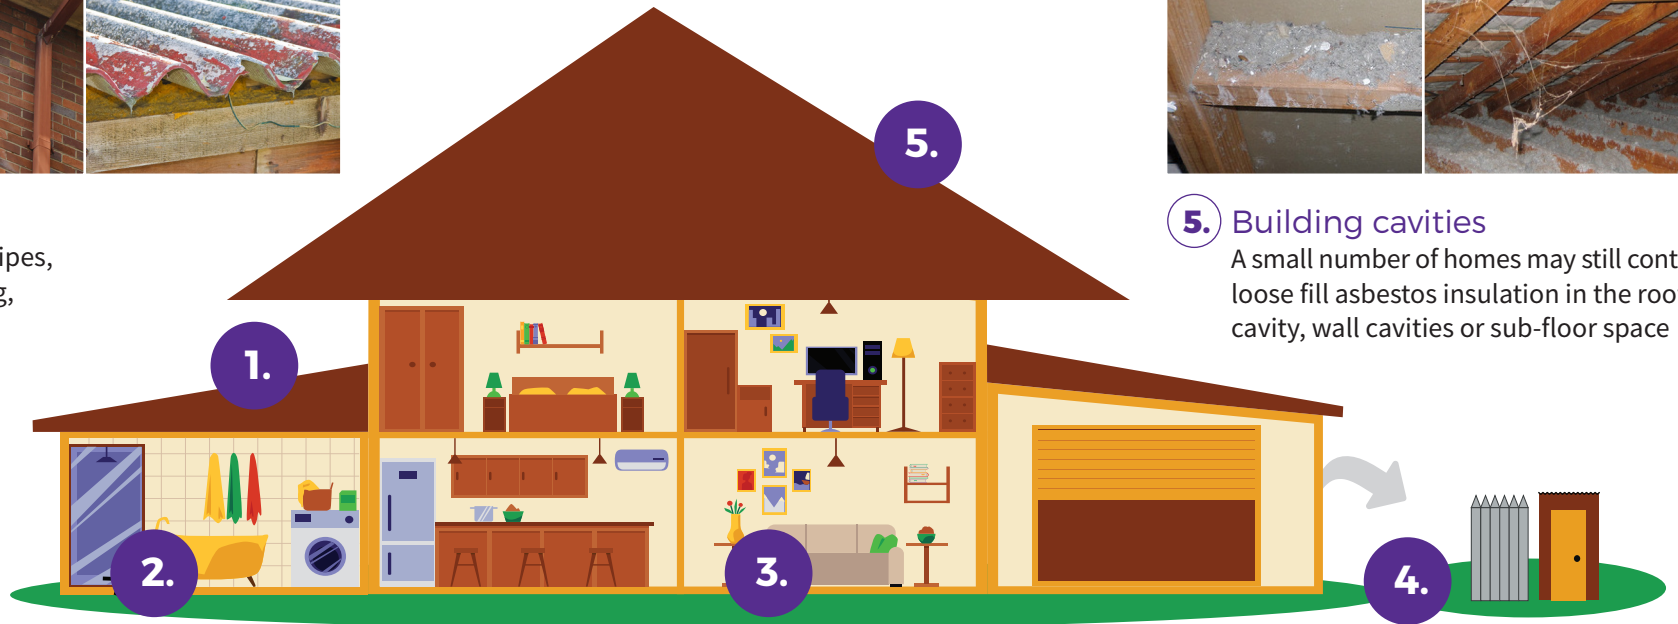

- 5.** Building cavities
A small number of homes may still contain
loose fill asbestos insulation in the roof
cavity, wall cavities or sub-floor space



- 2.** Wet areas - bathroom, laundry and kitchen
wall and ceiling panels, vinyl floor tiles, backing for wall tiles
and splashbacks, hot water pipe insulation



- 3.** Internal areas
wall and ceiling panels, carpet underlay,
textured panels, insulation in domestic
heaters



- 4.** Backyard
fences, sheds, garages, carports, dog kennels, buried or
dumped waste, letterboxes, swimming pools

If a home was built before 1990 it may contain dangerous asbestos material

Assess the risk

A licensed asbestos assessor can help identify asbestos in your home and its condition.

Asbestos materials become dangerous when:



Broken or in poor
condition



Damaged
accidentally



Disturbed during
renovation or repairs



Loose fill asbestos
insulation



Manage asbestos safely

- Monitor the condition of asbestos in your home
- Inform tradespeople of locations of asbestos in your home
- Avoid disturbing or damaging asbestos if working on your home
- Engage a licensed asbestos removalist to remove asbestos

If you suspect your home contains loose fill asbestos insulation, contact Access Canberra

TO WHOM THIS MAY CONCERN

9th March 2026

Certificate of Currency

Dear Sir or Madam,

We, the undersigned Insurance Brokers acting on behalf of the Insured, hereby certify that the following described insurance is in force at this date.

TYPE OF INSURANCE: Professional Indemnity Insurance

INSURED: ACT Property Inspections Pty Ltd.

ADDRESS OF INSURED: Unit 1/33 Atree Court, Phillip ACT 2606, Australia.

POLICY NUMBER: B0507OE2600060

PERIOD: From: 30th March 2026 to: 30th March 2027
At 4pm Local Standard Time at the Principal Address of the Insured.

LIMIT OF LIABILITY: AUD 5,000,000 in the annual aggregate inclusive of costs and expenses plus one reinstatement.

INSURERS: 100% Lloyd's of London

This letter is provided as a matter of information only and confers no rights on the holder. Our duties in relation to this insurance are to our client and we accept no duty of care or responsibility to you or any other third party and any liability to you or a third party is excluded. This letter does not amend, extend, or alter the coverage afforded by the policy, nor does it purport to set out all of the policy terms, conditions and exclusions. The policy terms, conditions, limits, and exclusions may alter after the date of this document or the insurance may terminate or be cancelled, and the limits shown may be reduced to pay claims. We have no obligation to advise you of any changes which may be made to the policy or to advise you of their cancellation or termination.

Issued on behalf of Price Forbes & Partners



Adam Power
Executive Director



**ACT
PROPERTY
INSPECTIONS**

TAX INVOICE

Heidi Hutchison & Michael Hutchison
97 Fitchett St
GARRAN ACT 2605
AUSTRALIA

Invoice Date
6 May 2026

Invoice Number
INV-68121A

ACT Property Inspections
(02) 6232 4540
Unit 1, 33 Altree Ct
PHILLIP ACT 2606
ABN: 33 600 397 466

Description	Quantity	Unit Price	GST	Amount AUD
ACTPLA Fees - No GST	1.00	186.70	GST Free	186.70
Property Report	1.00	1,475.73	10%	1,475.73
Energy Efficiency Report (Complimentary)	1.00	0.00		0.00
Deferred Payment (Complimentary)	1.00	0.00		0.00
			Subtotal	1,662.43
			TOTAL GST 10%	147.57
			TOTAL AUD	1,810.00

Due Date: 2 Nov 2026

Payment terms – Deferred payment account. This account should be paid in full within 14 days on the earlier of:

- (a) Settlement of the property
- (b) If the Property has not been listed for sale within 3 months of the Property Inspection Date
- (c) If the property is no longer listed for sale
- (d) 180 days after the Property Inspection Date

Please pay within the payment terms to avoid the Deferred Payment Fee. Note: all bank/legal fees incurred in obtaining payment will be the customer's responsibility

Payment Options

Pexa : please quote the invoice number as the reference

Direct Deposit : BSB: 012084 Account Number: 194679655

Account Name: ACT Property Inspections Pty Ltd

Please reference your name and invoice number

Cheques : please make payable to ACT Property Inspections Pty Ltd

[View and pay online now](#)