

Schedule

Land	The unexpired term of the Lease	Unit	UP No.	Block	Section	Division/District
				12	101	Narrabundah
		and known as 70 Tallara Parkway, Narrabundah				
Seller	Full name	Jane Sara Marks & Craig Robert Watkins				
	ACN/ABN					
	Address	70 Tallara Parkway, Narrabundah, ACT 2604				
Seller Solicitor	Firm	Ammitoj Singh Legal				
	Email	ammitoj@aslegal.net.au				
	Phone	02 8622 4688	Ref AS:2026/196			
	DX/Address	GPO Box 1581, Canberra ACT 2601				
Stakeholder	Name	Hive Property Canberra Trust Account				
Seller Agent	Firm	Hive Property Canberra				
	Email	leanne@hiveproperty.co				
	Phone	(02) 6182 1802	Ref Leanne Palmer			
	DX/Address	level 1/4 Campion Street, Deakin, ACT 2600				
Restriction on Transfer	Mark as applicable	☒ Nil ☐ section 370 ☐ section 280 ☐ section 306 ☐ section 351				
Land Rent	Mark one	☒ Non-Land Rent Lease ☐ Land Rent Lease				
Occupancy	Mark one	☒ Vacant possession ☐ Subject to tenancy				
Breach of covenant or unit articles	Description (Insert other breaches)	As disclosed in the Required Documents and				
Goods	Description	Fixed Floor coverings, light fittings, window treatments, dishwasher, garden shed as inspected				
Date for Registration of Units Plan						
Date for Completion		On or before 30 days from the date of this contract				
Electronic Transaction?		☐ No ☒ Yes, using Nominated ELN: PEXA				
Land Tax to be adjusted?		☐ No ☒ Yes				
Residential Withholding Tax	New residential premises?		☒ No		☐ Yes	
	Potential residential land?		☒ No		☐ Yes	
	Buyer required to make a withholding payment?		☒ No		☐ Yes (insert details on p.3)	
Foreign Resident Withholding Tax	Relevant Price more than \$750,000.00?		☐ No		☐ Yes	
	Clearance Certificates attached for all the Sellers?		☐ No		☒ Yes	

An agent may only complete the details in this black box and exchange this contract. See page 3 for more information.

Buyer	Full name					
	ACN/ABN					
	Address					
Buyer Solicitor	Firm					
	Email					
	Phone		Ref			
	DX/Address					
Price	Price	(GST inclusive unless otherwise specified)				
	Less deposit	(10% of Price)				
	Balance	☐ Deposit by Instalments (clause 52 applies)				
Date of this Contract						

Co-Ownership	Mark one (show shares)	☐ Joint tenants ☐ Tenants in common in the following shares:
---------------------	------------------------	--

Read This Before Signing: Before signing this Contract you should ensure that you understand your rights and obligations. You should read the important notes on page 3. You should get advice from your solicitor.

Seller signature	Buyer signature
Seller witness name and signature	Buyer witness name and signature

Seller Disclosure Documents

The following marked documents are attached and form part of this Contract. The Buyer acknowledges that by execution of this Contract the Buyer certifies in writing that the Buyer received the marked documents prior to entering into this Contract.

- ☐ Crown lease of the Land (including variations)
- ☐ Current certified extract from the land titles register showing all registered interests affecting the Property
- ☒ Deposited Plan for the Land
- ☐ Energy Efficiency Rating Statement
- ☐ Encumbrances shown on the land titles register (excluding any mortgage or other encumbrance to be discharged)
- ☐ If there is an encumbrance not shown on the land titles register — a statement about the encumbrance complying with the Civil Law (Sale of Residential Property) Regulations
- ☒ Lease Conveyancing Inquiry Documents for the Property
- ☒ Building Conveyancing Inquiry Document (except if:
 - the Property is a Class A Unit
 - the residence on the Property has not previously been occupied or sold as a dwelling; or
 - this Contract is an “off-the-plan purchase”)
- ☒ Building and Compliance Inspection Report(s) (except if section 9(2)(a)(ii) or section 9(2)(a)(iii) of the Sale of Residential Property Act applies).
- ☒ Pest information (except if the property is a Class A Unit or is a residence that has never been occupied): Pest Inspection Report(s).
- ☐ Regulated Swimming Pool documentation required under section 9 (1)(ja) of the Sale of Residential Property Act (on and from 1 May 2024).

If the Property is off-the-plan:

- ☐ Proposed plan
- ☐ Inclusions list

If the Property is a Unit where the Units Plan is not registered:

- ☐ Inclusions list
- ☐ Disclosure Statement

If the Property is a Unit where the Units Plan is registered:

- ☐ Units Plan concerning the Property
- ☐ Current certified extract from the land titles register showing all registered interests affecting the Common Property
- ☐ Unit Title Certificate
- ☐ Registered variations to rules of the Owners Corporation
- ☐ (If the Unit is an Adaptable Housing Dwelling) drawings and plans demonstrating compliance with Australian Standard AS 4299-1995 (Adaptable Housing) as in force from time to time
- ☐ (If the Owners Corporation is a party to a Building Management Statement) Building Management Statement

If the Property is a Lot that is part of a Community Title Scheme:

- ☐ Section 67 Statement, as first or top sheet
- ☐ Community Title Master Plan
- ☐ Community Title Management Statement

If the Property is a Lot that will form part of a Community Title Scheme:

- ☐ Proposed Community Title Master Plan or sketch plan
- ☐ Proposed Community Title Management Statement

GST

- ☒ Not applicable
- ☐ Input taxed supply of residential premises
- ☐ Taxable supply (including new residential premises)
- ☐ GST-free supply of going concern
- ☐ Margin scheme applies

Tenancy

- ☐ Tenancy Agreement
- ☒ No written Tenancy Agreement exists

Invoices

- ☒ Building and Compliance Inspection Report
- ☐ Pest Inspection Report

Asbestos

- ☒ Asbestos Advice
- ☐ Current Asbestos Assessment Report

Damages for delay in Completion – applicable interest rate and legal costs and disbursements amount (see clause 22)

Interest rate if the defaulting party is the Seller	% per annum
Interest rate if the defaulting party is the Buyer	% per annum
Amount to be applied towards legal costs and disbursements incurred by the party not at fault	\$ (GST inclusive)

Tenancy Summary

Premises		Expiry date	
Tenant name		Rent	
Commencement date		Rent review date	
Term		Rent review mechanism	

Managing Agent Details for Owners Corporation or Community Title Scheme (if no managing agent, secretary)

Name		Phone	
Address			

RW Amount

(residential withholding payment) — further details

The supplier will frequently be the Seller. However, sometimes further information will be required as to which entity is liable for GST (eg if the Seller is part of a GST group, where the GST representative has the GST liability). If more than one supplier, provide details for each supplier.

Supplier	Name			
	ABN		Phone	
	Business address			
	Email			
Residential Withholding Tax	Supplier's portion of the RW Amount:			\$
	RW Percentage:			%
	RW Amount (ie the amount that the Buyer is required to pay to the ATO):			\$
	Is any of the consideration not expressed as an amount in money?	☐ No ☐ Yes		
	If 'Yes', the GST inclusive market value of the non-monetary consideration:			\$
	Other details (including those required by regulation or the ATO forms):			

Cooling Off Period

(for residential property only)

- 1 The Buyer may rescind this Contract at any time before 5pm on the 5th Business Day after the day this Contract is made except if any circumstance in paragraph 2 applies.
- 2 There is no cooling off period if:
 - the Buyer is a corporation; or
 - the Property is sold by tender; or
 - the Property is sold by auction; or
 - before signing this Contract, the Buyer gives the Seller a certificate in the form required by the Sale of Residential Property Act signed by the Buyer Solicitor; or
 - this Contract is made on the same day the Property was offered for sale by auction but passed in and the Buyer was recorded in the bidders record as a bidder or a person for whom a bidder was bidding.
- 3 A Buyer exercising the cooling off right by rescinding this Contract forfeits 0.25% of the Price. The Seller is entitled to recover the amount forfeited from the Deposit and the Buyer is entitled to a refund of any balance.

Warnings

- 1 The Lease may be affected by the *Residential Tenancies Act 1997* (ACT) or the *Leases (Commercial & Retail) Act 2001* (ACT).
- 2 If a consent to transfer is required by law, see clause 4 as to the obligations of the parties.
- 3 As some risks associated with the Property pass from the Seller to Buyer on the Date of this Contract, (except if the Property is a Unit) the Buyer should take out insurance on the Property on the Date of this Contract.
- 4 The Buyer will usually have to pay stamp duty on the purchase of the Land. The Buyer may incur penalties if the Buyer does not pay the stamp duty within the required time.
- 5 There are serious risks to a Buyer releasing the Deposit before Completion. The Buyer should take legal advice before agreeing to release the Deposit.
- 6 The Buyer should consider the application of the Territory Plan and other planning and heritage issues before signing this Contract.
- 7 If the Lease is a concessional lease then restrictions on transfer and other dealings may apply.

Disputes

If there is a dispute, the Law Society encourages the use of informal procedures such as negotiation, independent expert appraisal or mediation to resolve the dispute.

Exchange of Contract

- 1 An Agent, authorised by the Seller, may:
 - insert:
 - the name and address of, and contact details for, the Buyer;
 - the name and address of, and contact details for, the Buyer Solicitor;
 - the Price;
 - the Date of this Contract,
 - insert in, or delete from, the Goods; and
 - exchange this Contract.
- 2 An Agent must not otherwise insert, delete or amend this Contract.
- 3 **The Agent must not exchange this Contract unless expressly authorised by the Seller or (if a solicitor is acting for the Seller) by the Seller or the Seller Solicitor.**

The Seller agrees to sell and the Buyer agrees to buy the Property for the Price on these terms:

1. Definitions and Interpretation

- 1.1 Definitions appear in the Schedule and as follows:

Affecting Interests means any mortgage, encumbrance, lease, lien, charge, notice, order, caveat, writ, or other interest;

Adaptable Housing Dwelling has the meaning in the Sale of Residential Property Act;

Agent has the meaning in the Sale of Residential Property Act;

ATO means the Australian Taxation Office, and includes the Commissioner for Taxation;

Balance of the Price means the Price less the Deposit;

Breach of Covenant means:

- a Development not approved under the Planning Act including a development for which design and siting approval has not been obtained;
- a breach of the Building and Development Provision;

- a breach of any obligation of the Seller in a registered restrictive covenant affecting the Lease;
- a breach of any other term of the Lease;
- a breach of the articles of the Owners Corporation (if the Property is a Unit); or
- an Unapproved Structure;

Building Act means the *Building Act 2004* (ACT);

Building and Development Provision has the meaning in the Planning Act;

Building Conveyancing Inquiry Document has the meaning in the Sale of Residential Property Act;

Building and Compliance Inspection Report has the meaning in the Sale of Residential Property Act;

Building Management Statement has the meaning in the Land Titles Act;

Business Day means any day other than a Saturday, Sunday, public holiday or bank holiday in the Australian Capital Territory;

Class A Unit has the meaning in the Sale of Residential Property Act;

Common Property for a Unit has the meaning in the Unit Titles Act;

Common Property for a Lot that forms part of a Community Title Scheme has the meaning in the Community Title Act;

Community Title Act means the *Community Title Act 2001* (ACT);

Community Title Body Corporate means the entity referred to as such in the Community Title Act;

Community Title Management Statement has the meaning in the Community Title Act;

Community Title Master Plan has the meaning in the Community Title Act;

Community Title Scheme has the meaning in the Community Title Act;

Completion means the time at which this Contract is completed and **Completed** has a corresponding meaning;

Compliance Certificate means a certificate issued for the Lease under section 296 of the *Planning and Development Act 2007*, Division 10.12.2 of the Planning Act or under section 28 of the *City Area Leases Act 1936* or under section 180 of the Land Act;

Covenant includes a restrictive covenant;

Default Notice means a notice in accordance with clause 18.5 and clause 18.6

Default Rules has the meaning in the Unit Titles Management Act;

Deposit means the deposit forming part of the Price;

Developer in respect of a Lot has the meaning in the Community Title Act;

Developer Control Period has the meaning in the Unit Titles Management Act;

Development has the meaning in the Planning Act;

Development Statement has the meaning in the Unit Titles Act;

Disclosure Statement has the meaning in the Property Act;

Disclosure Update Notice has the meaning in section 260(2) of the Property Act;

Encumbrance has the meaning in the Sale of Residential Property Act but excludes a mortgage;

Energy Efficiency Rating Statement has the meaning in the Sale of Residential Property Act;

Excluded Change has the meaning in section 259A(4) of the Property Act;

General Fund Contribution has the meaning in section 78(1) of the Unit Titles Management Act;

GST has the meaning in the *A New Tax System (Goods and Services Tax) Act 1999* (Cth);

GST Rate means the prevailing rate of GST specified as a percentage;

Improvements means the buildings, structures and fixtures erected on and forming part of the Land;

Income includes the rents and profits derived from the Property;

Land Act means the *Land (Planning & Environment) Act 1991* (ACT);

Land Charges means rates, land rent, land tax and other taxes and outgoings of a periodic nature in respect of the Property;

Land Rent Act means the *Land Rent Act 2008* (ACT);

Land Rent Lease means a Lease that is subject to the Land Rent Act;

Land Titles Act means the *Land Titles Act 1925* (ACT);

Lease means the lease of the Land having the meaning in the Planning Act;

Lease Conveyancing Inquiry Document has the meaning in the Sale of Residential Property Act;

Legislation Act means the *Legislation Act 2001*;

Liability of the Owners Corporation means any actual or contingent liability of the Owners Corporation attributable to the Unit on a Unit Entitlement basis (other than normal operating expenses) or expenditure to be made by the Owners Corporation to fulfil its obligations under the Unit Titles Management Act;

Lot has the meaning in the Community Title Act;

Non-Land Rent Lease means a Lease that is not subject to the Land Rent Act;

Notice to Complete means a notice in accordance with clause 18.1 and clause 18.2 requiring a party to complete;

Owners Corporation means the Owners Corporation for the Unit constituted or to be constituted under the Unit Titles Management Act following registration of the Units Plan;

Pest Inspection Report has the meaning in the Sale of Residential Property Act;

Pest Treatment Certificate has the meaning in the Sale of Residential Property Act;

Planning Act means the *Planning Act 2023* (ACT);

Planning and Land Authority has the meaning in the Legislation Act;

Prescribed Building has the meaning in the Building Act;

Prescribed Terms has the meaning in the Residential Tenancies Act;

Property means the unexpired term of the Lease, the Improvements and the Goods, or (if the Land is a Unit) the unexpired term of the Unit Lease, the Improvements and the Goods;

Property Act means the *Civil Law (Property) Act 2006* (ACT);

Required Documents has the meaning in the Sale of Residential Property Act and includes a Unit Title Certificate but excludes a copy of this Contract;

Rescission Notice has the meaning in the Sale of Residential Property Act;

Residential Tenancies Act means the *Residential Tenancies Act 1997* (ACT);

Sale of Residential Property Act means the *Civil Law (Sale of Residential Property) Act 2003* (ACT);

Section 56 Certificate means a certificate for a Lot issued under section 56 of the Community Title Act;

Section 67 Statement means a statement for a Lot complying with section 67(2)-(4) of the Community Title Act;

Service includes air, communication, drainage, electricity, garbage, gas, oil, radio, sewerage, telephone, television, or water service;

Staged Development has the meaning given by section 17(4) of the Unit Titles Act;

Tenancy Agreement includes a lease for any term and whether for residential purposes or otherwise;

Unapproved Structure has the meaning in the Sale of Residential Property Act;

Unit means the Unit referred to in the Schedule and which has the meaning in the Unit Titles Act;

Unit Entitlement for the Unit has the meaning in the Unit Titles Act;

Unit Title is the Lease together with the rights of the registered lessee of the Unit;

Unit Title Certificate means a certificate for the Unit issued under section 119 of the Unit Titles Management Act;

Unit Titles Act means the *Unit Titles Act 2001* (ACT);

Unit Titles Management Act means the *Unit Titles (Management) Act 2011* (ACT);

Units Plan means all the documents relating to the subdivision of the Land registered as the Units Plan for the Unit under the *Land Titles (Unit Titles) Act 1970*; and

Withholding Law means Subdivision 14 of Schedule 1 of the *Taxation Administration Act 1953* (Cth) and associated provisions.

1.2 In this Contract:

- a reference to the Seller or to the Buyer includes the executors, administrators and permitted assigns of any of them, if an individual, and the successors or permitted assigns of any of them, if a corporation;
- the singular includes the plural, and the plural includes the singular;
- a reference to a person includes a body corporate;
- a term not otherwise defined has the meaning in the Legislation Act; and
- a reference to an Act includes a reference to any subordinate legislation made under it or any Act which replaces it.

1.3 Headings are inserted for convenience only and are not part of this Contract.

1.4 If the time for something to be done or to happen is not a Business Day, the time is extended to the next Business Day, except in the case of clause 2.1.

1.5 A reference to "this Contract" extends to the Schedule, any annexure, additional clauses and attachments forming part of this Contract.

1.6 If there is more than one buyer or more than one seller the obligations which they undertake bind them jointly and individually.

1.7 Where the Buyer consists of more than one person, as between themselves, they agree to buy the Property in the specified manner of Co-ownership or if one alternative is not marked, as joint tenants.

1.8 Without limiting clause 13, the parties agree that for the purposes of the *Electronic Transactions Act 2001* (ACT) and the *Electronic Transactions Act 1999* (Cth), this Contract may be signed and/or exchanged electronically.

2. Terms of payment

2.1 The Buyer must pay the Deposit on the Date of this Contract, to the Stakeholder or, if no Stakeholder is named, then to the Seller.

2.2 The Deposit becomes the Seller's property on Completion.

2.3 The Deposit may be paid by cheque or in cash (up to \$3,000.00) but if it is not paid on time or, if it is paid by cheque which is not honoured on first presentation, the Buyer is in default.

2.4 If the Buyer is in default under clause 2.3, then immediately and without the notice otherwise necessary under clause 18, clause 19 applies.

2.5 On Completion the Buyer must give the Seller an authority directing the Stakeholder to account to the Seller for the Deposit.

2.6 On Completion the Buyer must pay to the Seller in Canberra the Balance of the Price by unendorsed bank cheque, or in cash (up to \$200.00).

2.7 Any money payable to the Seller by the Buyer or the Stakeholder must be paid to the Seller or as the Seller Solicitor directs in writing and payment in accordance with that direction will be sufficient discharge to the person paying.

2.8 Completion must take place on the Date for Completion or as otherwise determined by this Contract and if not specified or determined, within a reasonable time.

3. Title to the Lease

- 3.1 The Lease is or will before Completion be granted under the Planning Act.
- 3.2 The Lease is transferred subject to its provisions.
- 3.3 The title to the Lease is or will before Completion be registered under the Land Titles Act.
- 3.4 The title to the Lease must be transferred free from all Affecting Interests except as otherwise provided.
- 3.5 The Buyer cannot insist on any Affecting Interests being removed from the title to the Lease before Completion provided, on Completion, the Seller gives the Buyer any documents and registration fees necessary to remove the Affecting Interests.

4. Restrictions on transfer

- 4.1 The Lease is not subject to any restrictions on transfer other than any Restriction on Transfer.
- 4.2 If the Lease is subject to a Restriction on Transfer under the Planning Act due to non-compliance with the Building and Development Provision then this Contract is subject to the grant of the approval referred to in section 370 of the Planning Act. A Restriction on Transfer referring to "section 370" refers to this restriction.
- 4.3 If the Lease is a lease of the type referred to in section 279 of the Planning Act then this Contract is subject to the approval in accordance with the Planning Act. A Restriction on Transfer referring to "section 280" refers to this restriction.
- 4.3A If the Lease is subject to a Restriction on Transfer under section 306 of the Planning Act, then this Contract is subject to the grant of the approval mentioned in sections 306 and 307 of the Planning Act. A Restriction on Transfer referring to "section 306" refers to this restriction.
- 4.3B If the Lease is subject to a Restriction on Transfer under section 351 of the Planning Act, then this Contract is subject to the grant of the approval mentioned in section 351 of the Planning Act. A Restriction on Transfer referring to "section 351" refers to this restriction. Immediately after the Date of this Contract the Seller must do everything reasonably necessary to remove the restriction or obtain the consent required. If requested in writing, the Buyer must join in any application of the Seller and must do everything reasonably necessary to enable the Seller to obtain the consent. The Seller must pay all associated fees in connection with the application.

- 4.4 If the consent referred to in clauses 4.2, 4.3, 4.3A or 4.3B is not granted by the Date for Completion then either party may rescind this Contract (provided that the party seeking to rescind is not then in default) and clause 21 applies.

5. Particulars of title and submission of transfer

- 5.1 Unless clause 5.3 applies the Seller need not provide particulars of title.
- 5.2 No later than 7 days before the Date for Completion, the Buyer must give the Seller a transfer of the Lease in the form prescribed by the Land Titles Act, to be returned by the Seller to the Buyer on Completion in registrable form.
- 5.3 If the Seller is not the registered proprietor of the Lease at the Date of this Contract, the Seller must give to the Buyer no later than 14 days before the Date for Completion a copy of the instrument and any other documents necessary to enable the Seller to be registered as proprietor.

6. Buyer rights and limitations

- 6.1 If the Buyer establishes before Completion that except as disclosed in this Contract there is any Unapproved Structure on the Property, then the Buyer may:
 - 6.1.1 require the Seller to arrange for the Unapproved Structure to be approved before Completion; and
 - 6.1.2 if the Unapproved Structure is not approved before Completion, rescind or complete and sue the Seller for damages.
- 6.2 If the Buyer establishes, immediately before Completion, that, except as disclosed in this Contract:
 - 6.2.1 the Property is subject to an encumbrance other than the encumbrances shown on the title to the Lease; or
 - 6.2.2 the Buyer is not entitled to vacant possession, then the Buyer may either:
 - 6.2.3 rescind; or
 - 6.2.4 complete and sue the Seller for damages.
- 6.3 The Buyer is not entitled to make any requisitions on the title to the Property.
- 6.4 The Buyer cannot make a claim or objection or rescind or terminate in respect of:
 - 6.4.1 a Service for the Property being a joint service or passing through another property, or any Service for another property passing through the Property;
 - 6.4.2 a wall being or not being a party wall or the Property being affected by an

easement for support or not having the benefit of an easement for support;

- 6.4.3 any change in the Property due to fair wear and tear before Completion;
- 6.4.4 a promise, representation or statement about this Contract, the Property or the Lease, not made in this Contract;
- 6.4.5 any Breach of Covenant described in the Schedule or disclosed elsewhere in this Contract;
- 6.4.6 the ownership or location of any dividing fence;
- 6.4.7 the ownership of any fuel storage tank; and
- 6.4.8 anything disclosed in this Contract (except an Affecting Interest).

7. Seller warranties

- 7.1 The Seller warrants that at the Date of this Contract:
 - 7.1.1 the Seller will be able to complete at Completion;
 - 7.1.2 the Seller has no knowledge of any unsatisfied judgment, order or writ affecting the Property;
 - 7.1.3 the Seller has no knowledge of any current or threatened claims, notices or proceedings that may lead to a judgment, order or writ affecting the Property; and
 - 7.1.4 the Seller is not aware of any material change in the matters disclosed in the Required Documents.
- 7.2 The Seller warrants that on Completion:
 - 7.2.1 the Seller will be or will be able to be the registered proprietor of the Lease and will own the rest of the Property free from any Affecting Interests;
 - 7.2.2 the Seller will have the capacity to complete;
 - 7.2.3 there will be no unsatisfied judgment, order or writ affecting the Property;
 - 7.2.4 the Seller has no knowledge of any current or threatened claims, notices or proceedings that may lead to a judgment, order or writ affecting the Property;
 - 7.2.5 the Seller is not aware of any encroachments by or upon the Property except as disclosed. This warranty does not extend to the location of any dividing fence;
 - 7.2.6 there will be no Breach of Covenant except as disclosed in this Contract; and
 - 7.2.7 unless disclosed in the Schedule or elsewhere in this Contract, the Lease is a

Non-Land Rent Lease and not a Land Rent Lease.

- 7.3 The Seller gives no warranties as to the present state of repair of any of the Improvements or condition of the Land, except as required by law.

8. Adjustments

- 8.1 The Seller is entitled to the Income and is liable for all Land Charges up to and including Completion after which the Buyer will be entitled to the Income and liable for the Land Charges, provided the Seller will be liable for all land tax in respect of the Property if the 'Land Tax to be adjusted?' option on the Schedule is marked 'No'.
- 8.2 The parties must pay any adjustment of the Income and Land Charges calculated under clause 8.1 on Completion.
- 8.3 Any concessional Land Charges must be adjusted on the concessional amount of those Land Charges.
- 8.4 If any of the Land Charges have not been assessed on Completion, the Buyer will be entitled to retain in the Buyer Solicitor trust account from the Balance of the Price an amount sufficient to pay the Seller's proportion of those Land Charges.
- 8.5 Attached are copies of the relevant invoices for the cost of obtaining the Building and Compliance Inspection Report and Pest Inspection Report. The Buyer must pay to the Seller the cost of obtaining the Building and Compliance Inspection Report and the Pest Inspection Report as required by section 18 of the Sale of Residential Property Act on Completion.

9. Terms of possession

- 9.1 The Seller must give the Buyer vacant possession of the Property on Completion unless otherwise marked in the Schedule.
- 9.2 If the Property is sold subject to a tenancy, the Seller has:
 - 9.2.1 attached to this Contract a copy of the signed Tenancy Agreement; or
 - 9.2.2 completed the tenancy summary on page 2 of this Contract.
- 9.3 If the Property is sold subject to a tenancy:
 - 9.3.1 the Seller warrants that except as disclosed in this Contract:
 - (a) if applicable, the rental bond has been provided in accordance with the Residential Tenancies Act;
 - (b) if applicable, the Seller has complied with the Residential Tenancies Act;

- (c) if applicable, the Seller has no notice of any application by the tenant for the release of the rental bond;
- (d) no notices relating to the tenancy have been served on the Seller or any agent of the Seller or on the tenant other than as disclosed in this Contract and there are no outstanding claims or disputes with the tenant;
- (e) there is no unremedied breach of the Tenancy Agreement by the tenant or the Seller; and
- (f) if applicable, the Tenancy Agreement incorporates:
 - (i) the Prescribed Terms; and
 - (ii) any other terms approved by the Residential Tenancies Tribunal.

9.3.2 The Seller must hand to the Buyer on Completion:

- (a) any written Tenancy Agreement to which this Contract is subject;
- (b) a notice of attornment;
- (c) if applicable, any notice required to be signed by the Seller to transfer the rental bond by the Office of Rental Bonds to the Buyer; and
- (d) if applicable, any other notice required to be signed by the Seller under the Residential Tenancies Act.

9.3.3 The Buyer indemnifies the Seller in relation to any liability which the Seller incurs or to which the Seller is subject under the tenancy because of matters occurring after Completion.

10. Inspection and condition of Property

- 10.1 The Buyer may on reasonable notice to the Seller and at reasonable times inspect the Property before Completion.
- 10.2 The Seller must leave the Property clean and tidy on Completion.

11. Inspection of building file

- 11.1 The Seller must, if requested by the Buyer, give to the Buyer all authorities necessary to enable the Buyer (or Buyer's nominee) to inspect and obtain at the Buyer's expense, copies of:
 - 11.1.1 any document in relation to the Land and Improvements held by any government or statutory authority; and

- 11.1.2 any notices issued by any authority in relation to the Land and Improvements.

12. Additional Seller obligations

- 12.1 Except for any Breach of Covenant disclosed in this Contract, the Seller must before Completion:
 - 12.1.1 comply with any notice issued by any authority before the Date of this Contract which requires work to be done or money to be spent on or in relation to the Property or the Lease;
 - 12.1.2 obtain approval for any Development conducted on the Land;
 - 12.1.3 comply with the Lease to the extent to which the Seller is required to comply up to Completion;
 - 12.1.4 comply with any obligations on the Seller in a registered restrictive covenant affecting the Lease; and
 - 12.1.5 give the Buyer notice of any material change (other than fair wear and tear) the Seller becomes aware of in the matters disclosed in the Required Documents, since the date of each of the relevant Required Documents.

13. Electronic transaction

- 13.1 In this clause 13, the following words mean:

Adjustment Figures mean details of the adjustments to be made to the Price under this Contract;

Completion Time means the time of day on the Date for Completion when the Electronic Transaction is to be Completed;

Conveyancing Transaction has the meaning given in the Participation Rules;

Digitally Signed has the meaning given in the Participation Rules and **Digitally Sign** has a corresponding meaning;

Discharging Mortgagee means any discharging mortgagee, chargee, covenant chargee or caveator whose provision of a Digitally Signed discharge of mortgage, discharge of charge or withdrawal of caveat is required in order for unencumbered title to the Lease to be transferred to the Buyer;

ECNL means the *Electronic Conveyancing National Law (ACT) Act 2020 (ACT)*;

Effective Date means the date on which the Conveyancing Transaction is agreed to be an Electronic Transaction under clause 13.2.2 or, if clause 13.2.1 applies, the Date of this Contract;

Electronic Document means a caveat, a Crown lease or an instrument as defined in the Land Titles Act which may be created and Digitally Signed in an Electronic Workspace;

Electronic Transaction means a Conveyancing Transaction to be conducted for the parties by their legal representatives as Subscribers using an ELN and in accordance with the ECNL and the Participation Rules;

Electronic Transfer means a transfer of the Lease under the Land Titles Act to be prepared and Digitally Signed in the Electronic Workspace established for the purposes of the parties' Conveyancing Transaction;

Electronic Workspace has the meaning given in the Participation Rules;

Electronically Tradeable means a land title dealing that can be lodged electronically;

ELN has the meaning given in the Participation Rules;

FRCGW Remittance means a remittance which the Buyer must make in accordance with the Withholding Law and clauses 51.4 to 51.8;

GSTRW Payment means a payment which the Buyer must make in accordance with the Withholding Law and clauses 53.5 to 53.9;

Incoming Mortgagee means any mortgagee who is to provide finance to the Buyer on the security of the Lease and to enable the Buyer to pay the whole or part of the price;

Land Registry has the meaning given in the Participation Rules;

Lodgment Case has the meaning given in the Participation Rules;

Mortgagee Details mean the details which a party to the Electronic Transaction must provide about any Discharging Mortgagee of the Land as at Completion;

Nominated ELN means the ELN specified in the Schedule;

Participation Rules mean the participation rules as determined by the ECNL;

Populate means to complete data fields in the Electronic Workspace;

Prescribed Requirement has the meaning given in the Participation Rules;

Subscribers has the meaning given in the Participation Rules; and

Title Data means the details of the title to the Lease made available to the Electronic Workspace by the Land Registry.

13.2 This Conveyancing Transaction is to be conducted as an Electronic Transaction and this Contract is amended as required if:

13.2.1 this Contract says that it is an Electronic Transaction; or

13.2.2 the parties otherwise agree that it is to be conducted as an Electronic Transaction.

13.3 However, this Conveyancing Transaction is not to be conducted as an Electronic Transaction:

13.3.1 if the title to the Lease is not Electronically Tradeable or the transfer of the Lease is not eligible to be lodged electronically; or

13.3.2 if, at any time after the Effective Date, but at least 14 days before the Date for Completion, a party serves a notice on the other party stating a valid reason why it cannot be conducted as an Electronic Transaction.

13.4 If, because of clause 13.3.2, this Conveyancing Transaction is not to be conducted as an Electronic Transaction:

13.4.1 each party must:

(a) bear equally any disbursements or fees; and

(b) otherwise bear that party's own costs; incurred because this Conveyancing Transaction was to be conducted as an Electronic Transaction; and

13.4.2 if a party has paid all of a disbursement or fee which by reason of this clause, is to be borne equally by the parties, that amount must be adjusted on Completion.

13.5 If this Conveyancing Transaction is to be conducted as an Electronic Transaction:

13.5.1 to the extent that any other provision of this Contract is inconsistent with this clause, the provisions of this clause prevail and this Contract is amended to give full effect to the Electronic Transaction;

13.5.2 without limiting clause 13.5.1, clause 5.2 does not apply;

13.5.3 the parties must conduct the Electronic Transaction:

(a) in accordance with the Participation Rules and the ECNL; and

(b) using the Nominated ELN, unless the parties otherwise agree;

13.5.4 a party must pay the fees and charges payable by that party to the ELN and the

- Land Registry as a result of this transaction being an Electronic Transaction; and
- 13.5.5 a document which is an Electronic Document is served as soon as it is first Digitally Signed in the Electronic Workspace on behalf of the party required to serve it.
- 13.6 The Seller must within 7 days of the Effective Date:
- 13.6.1 create an Electronic Workspace;
- 13.6.2 Populate the Electronic Workspace with Title Data, the Date for Completion and, if applicable, Mortgagee Details; and
- 13.6.3 invite the Buyer and any Discharging Mortgagee to the Electronic Workspace.
- 13.7 If the Seller has not created an Electronic Workspace in accordance with clause 13.6, the Buyer may create an Electronic Workspace. If the Buyer creates the Electronic Workspace the Buyer must:
- 13.7.1 Populate the Electronic Workspace with Title Data;
- 13.7.2 create and Populate the Electronic Transfer;
- 13.7.3 Populate the Electronic Workspace with the Date for Completion and a nominated Completion Time; and
- 13.7.4 invite the Seller and any Incoming Mortgagee to join the Electronic Workspace.
- 13.8 Within 7 days of receiving an invitation from the Seller to join the Electronic Workspace, the Buyer must:
- 13.8.1 join the Electronic Workspace;
- 13.8.2 create and Populate the Electronic Transfer;
- 13.8.3 invite any Incoming Mortgagee to join the Electronic Workspace; and
- 13.8.4 Populate the Electronic Workspace with a nominated Completion Time.
- 13.9 If the Buyer has created the Electronic Workspace the Seller must within 7 days of being invited to the Electronic Workspace:
- 13.9.1 join the Electronic Workspace;
- 13.9.2 Populate the Electronic Workspace with Mortgagee Details, if applicable; and
- 13.9.3 invite any Discharging Mortgagee to join the Electronic Workspace.
- 13.10 To complete the financial settlement schedule in the Electronic Workspace:
- 13.10.1 the Seller must provide the Buyer with Adjustment Figures at least 2 Business Days before the Date for Completion;
- 13.10.2 the Buyer must confirm the Adjustment Figures at least 1 Business Day before the Date for Completion; and
- 13.10.3 if the Buyer must make a GSTRW Payment and / or an FRCGW Remittance, the Buyer must Populate the Electronic Workspace with the payment details for the GSTRW Payment or FRCGW Remittance payable to the ATO at least 2 Business Days before the Date for Completion.
- 13.11 Before Completion, the parties must ensure that:
- 13.11.1 all Electronic Documents which a party must Digitally Sign to complete the Electronic Transaction are Populated and Digitally Signed;
- 13.11.2 all certifications required by the ECNL are properly given; and
- 13.11.3 they do everything else in the Electronic Workspace which that party must do to enable the Electronic Transaction to proceed to Completion.
- 13.12 If Completion takes place in the Electronic Workspace:
- 13.12.1 payment electronically on Completion of the Balance of the Price in accordance with clause 2.6 is taken to be payment by a single unendorsed bank cheque; and
- 13.12.2 clauses 51.4.3, 51.4.4, 53.8 and 53.9 do not apply.
- 13.13 If the computer systems of any of the Land Registry, the ELN, the ATO or the Reserve Bank of Australia are inoperative for any reason at the Completion Time agreed by the parties, a failure to complete this Contract for that reason is not a default under this Contract on the part of either party.
- 13.14 If the computer systems of the Land Registry are inoperative for any reason at the Completion Time agreed by the parties, and the parties agree that financial settlement is to occur despite this, then on financial settlement occurring:
- 13.14.1 all Electronic Documents Digitally Signed by the Seller, any discharge of mortgage, withdrawal of caveat or other Electronic Document forming part of the Lodgment Case for the Electronic Transaction shall be taken to have been unconditionally and irrevocably delivered to the Buyer or

the Buyer's mortgagee at the time of financial settlement; and

13.14.2 the Seller shall be taken to have no legal or equitable interest in the Property.

13.15 If the parties do not agree about the delivery before Completion of one or more documents or things that cannot be delivered through the Electronic Workspace, the party required to deliver the documents or things:

13.15.1 holds them on Completion in escrow for the benefit of the other party; and

13.15.2 must immediately after Completion deliver the documents or things to, or as directed by the party entitled to them.

14. Off the plan purchase and Compliance Certificate

14.1 If the Lease contains a Building and Development Provision which has not been complied with at the Date of this Contract, and clause 4.2 does not apply:

14.1.1 where the Seller is obliged to construct Improvements by Completion, before the Date for Completion, the Seller must at the Seller's expense complete the construction of the Improvements promptly and in a good and workmanlike manner substantially in accordance with the proposed plan, specifications and inclusions list attached; and

14.1.2 on or before Completion, the Seller must at the Seller's expense give to the Buyer evidence that a Compliance Certificate has been obtained.

15. Goods

15.1 The Seller gives no warranties as to the present state of repair of any of the Goods except as required by law.

15.2 The Goods are included in the Price.

15.3 The Seller warrants that the Goods are unencumbered and that the Seller has the right to sell them.

15.4 The Goods become the Buyer's property on Completion.

15.5 Except for fair wear and tear, the Seller must give the Goods to the Buyer on Completion in the same state of repair they are in at the Date of this Contract.

16. Errors and misdescriptions

16.1 If, before Completion, the Buyer becomes aware of an error in the description of the Property the Buyer may:

16.1.1 identify whether the error is material or not material, and ask the Seller to arrange for the error to be corrected before Completion; and

16.1.2 if the error is not corrected before Completion:

(a) for an error that is material — rescind this Contract, or complete this Contract and make a claim for compensation; and

(b) for an error that is not material — complete this Contract and make a claim for compensation.

16.2 This clause applies even if the Buyer did not take notice of or rely on anything in this Contract containing or giving rise to the error or misdescription.

16.3 The Buyer is not entitled to compensation to the extent the Buyer knew the true position before the Date of this Contract.

17. Compensation claims by Buyer

17.1 To make a claim for compensation (including a claim under clause 16) the Buyer must give notice to the Seller before Completion specifying the amount claimed and:

17.1.1 the Seller can rescind if in the case of a claim that is not a claim for delay:

(a) the total amount claimed exceeds 5% of the Price;

(b) the Seller gives notice to the Buyer of an intention to rescind; and

(c) the Buyer does not give notice to the Seller waiving the claim within 14 days after receiving the notice; and

17.1.2 if the Seller does not rescind under clause 17.1.1, the parties must complete and:

(a) the lesser of the total amount claimed and 5% of the Price must be paid out of the Price to, and held by, the Stakeholder until the claim is finalised or lapses;

(b) the amount held is to be invested by the Stakeholder (at the risk of the party who becomes entitled to it) with an Australian bank in an interest-bearing account at call in the name of

- the Stakeholder in trust for the Seller and the Buyer;
- (c) the claim must be finalised by an arbitrator appointed by the parties or, if an appointment is not made within 28 days of Completion, by an arbitrator appointed by the President of the Law Society of the Australian Capital Territory at the request of a party;
 - (d) the decision of the arbitrator is final and binding;
 - (e) the costs of the arbitration must be shared equally by the parties unless otherwise determined by the arbitrator. For clarity, the arbitrator has the power to award indemnity costs on a legal basis against either party;
 - (f) the Buyer is not entitled, in respect of the claim, to more than the total amount claimed and the costs of the Buyer;
 - (g) interest on the amount held, after deduction of all taxes and bank charges, Stakeholder administration fee and other similar charges and expenses, must be paid to the parties equally or as otherwise determined by the arbitrator; and
 - (h) the claim lapses if the parties do not appoint an arbitrator and neither party asks the President of the Law Society of the Australian Capital Territory to appoint an arbitrator within 90 days after Completion and the amount held by the Stakeholder must be paid immediately to the Seller without any further authority being necessary.

18. Notice to Complete and Default Notice

- 18.1 If Completion does not take place in accordance with clause 2.8, either party may, at any time after the Date for Completion, serve the other party a Notice to Complete.
- 18.2 A Notice to Complete must appoint a time during business hours and a date being not less than 14* days after service of the Notice to Complete (excluding the date of service) by which and a place in Canberra at which to complete this Contract.
- 18.3 At the time the Notice to Complete is served the party serving the Notice to Complete must:
 - 18.3.1 not be in default; and

- 18.3.2 be ready willing and able to complete but for some default or omission of the other party.

- 18.4 Completion at the time date and place specified in the Notice to Complete is an essential term.
- 18.5 Where one party is in default (other than failing to complete) the other party may at any time after the default serve the party in default a Default Notice.
- 18.6 A Default Notice:
 - 18.6.1 must specify the default;
 - 18.6.2 must require the party served with the Default Notice to rectify the default within 7* days after service of the Default Notice (excluding the date of service), except in the case of a Default Notice for the purposes of clause 52.6, in which case the period specified in clause 52.6 will apply; and
 - 18.6.3 cannot be used to require a party to complete this Contract.
- 18.7 At the time the Default Notice is served, the party serving the Default Notice must not be in default.
- 18.8 The time specified in a Default Notice to rectify the specified default is an essential term.
- 18.9 Clauses 19 or 20 will apply as appropriate where the party served does not comply with the Notice to Complete or the Default Notice which complies with this clause.
- 18.10 If the party serving a notice under this clause varies the time referred to in the notice at the request of the other party, the time agreed to in the variation remains an essential term. The consent to the variation must be in writing and be served on the other party.
- 18.11 The parties agree that the time referred to in clauses 18.2 and 18.6.2 is fair and reasonable.

19. Termination — Buyer default

- 19.1 If the Buyer does not comply with a Notice to Complete or a Default Notice or is otherwise in breach of an essential term then the Seller may by notice served on the Buyer terminate and may then keep, or recover and keep, the Deposit (except so much of it as exceeds 10% of the Price) and either:
 - 19.1.1 sue the Buyer for breach; or
 - 19.1.2 resell the Property and any deficiency arising on the resale and all expenses of and incidental to the resale or attempted resale and the Buyer's default are

* Alter as necessary

recoverable by the Seller from the Buyer as liquidated damages provided the Seller has entered into a contract for the resale of the Property within 12 months of termination.

- 19.2 In addition to any money kept or recovered under clause 19.1, the Seller may retain on termination any other money paid by the Buyer as security for any damages awarded to the Seller arising from the Buyer's default provided that proceedings for the recovery of damages are commenced within 12 months of termination.

20. Termination — Seller default

- 20.1 If the Seller does not comply with a Notice to Complete or a Default Notice or is otherwise in breach of an essential term the Buyer may by notice served on the Seller either:
- 20.1.1 terminate and seek damages; or
 - 20.1.2 enforce without further notice any other rights and remedies available to the Buyer.
- 20.2 If the Buyer terminates, the Stakeholder is authorised to refund to the Buyer immediately any money paid on account of the Price.

21. Rescission

- 21.1 Unless section 15 of the Sale of Residential Property Act applies, if this Contract is rescinded, it is rescinded from the beginning, and unless the parties otherwise agree:
- 21.1.1 the Deposit and all other money paid by the Buyer must be refunded to the Buyer immediately without any further authority being necessary; and
 - 21.1.2 neither party is liable to pay the other any amount for damages, costs or expenses.

22. Damages for delay in Completion

- 22.1 If Completion does not occur by the Date for Completion, due to the default of either party, the party who is at fault must pay the other party as liquidated damages on Completion:
- 22.1.1 if the defaulting party is the Seller, interest on the Price at the rate this Contract says on page 2, calculated on a daily basis from the date 7 days after the Date for Completion to Completion;
 - 22.1.2 if the defaulting party is the Buyer, interest on the Price at the rate this Contract says on page 2, calculated on a daily basis from the date 7 days after the Date for Completion to Completion; and
 - 22.1.3 the amount this Contract says on page 2 to be applied towards any legal costs and disbursements incurred by the party not

at fault if Completion occurs later than 7 days after the Date for Completion.

- 22.2 Whether or not percentages are inserted in clauses 22.1.1 or 22.1.2 the party at fault must pay the amount specified in clause 22.1.3 in addition to any other damages to which the party not at fault is entitled both at law and under this Contract.
- 22.3 The parties agree that:
- 22.3.1 the amount of any damages payable under clause 22.1.1 or clause 22.1.2 to the party not in default is a genuine and honest pre-estimate of loss to that party for the delay in Completion, and
 - 22.3.2 the damages must be paid on Completion.

23. Foreign Buyer

- 23.1 The Buyer warrants the Commonwealth Treasurer cannot prohibit and has not prohibited the transfer of the Lease under the *Foreign Acquisitions and Takeovers Act 1975* (Cth).
- 23.2 This clause is an essential term.

24. GST

- 24.1 If a party must pay the Price or provide any other consideration to another party under this Contract, GST is not to be added to the Price or amount, unless this Contract provides otherwise.
- 24.2 If the Price is stated in the Schedule to exclude GST and the sale of the Property is a taxable supply, the Buyer must pay to the Seller on Completion an amount equal to the GST payable by the Seller in relation to the supply.
- 24.3 If under this Contract a party (Relevant Party) must make an adjustment, pay an amount to another party (excluding the Price but including the Deposit if it is released or forfeited to the Seller) or pay an amount payable by or to a third party:
- 24.3.1 the Relevant Party must adjust or pay at that time any GST added to or included in the amount; but
 - 24.3.2 if this Contract says this sale is a taxable supply, and payment would entitle the Relevant Party to claim an input tax credit, the adjustment or payment is to be worked out by deducting any input tax credit to which the party receiving the adjustment or payment is or was entitled multiplied by the GST Rate.
- 24.4 If this Contract says this sale is the supply of a going concern:

24.4.1 the parties agree the supply of the Property is the supply of a going concern;

24.4.2 the Seller must on Completion supply to the Buyer all of the things that are necessary for the continued operation of the enterprise;

24.4.3 the Seller must carry on the enterprise until Completion;

24.4.4 the Buyer warrants to the Seller that on Completion the Buyer will be registered or required to be registered; and

24.4.5 if for any reason (and despite clauses 24.1 and 24.4.1) the sale of the Property is not the supply of a going concern but is a taxable supply:

(a) the Buyer must pay to the Seller on demand the amount of any GST payable by the Seller in respect of the sale of the Property; and

(b) the Buyer indemnifies the Seller against any loss or expense incurred by the Seller in respect of that GST and any breach of clause 24.4.5(a).

24.5 If this Contract says the margin scheme applies:

24.5.1 the Seller warrants that it can use the margin scheme; and

24.5.2 the Buyer and Seller agree that the margin scheme is to apply,

in respect of the sale of the Property.

24.6 If this Contract says the sale is a taxable supply, does not say the margin scheme applies to the sale of the Property, and the sale is in fact not a taxable supply, then the Seller must pay the Buyer on Completion an amount of one-eleventh of the Price.

24.7 Unless the margin scheme applies the Seller must, on Completion, give the Buyer a tax invoice for any taxable supply by the Seller by or under this Contract.

25. Power of attorney

25.1 Any party who signs this Contract or any document in connection with it under a power of attorney must, on request and without cost, provide the other party with a true copy of the registered power of attorney.

26. Notices claims and authorities

26.1 Notices, claims and authorities required or authorised by this Contract must be in writing.

26.2 To serve a notice a party must:

26.2.1 leave it at; or

26.2.2 send it by a method of post requiring acknowledgment of receipt by the addressee to,

the address of the person to be served as stated in the Schedule or as notified by that person to the other as that person's address for service under this Contract; or

26.2.3 serve it on that party's solicitor in any of the above ways; or

26.2.4 deliver it to an appropriate place in the facilities of a document exchange system in which the recipient solicitor has receiving facilities (and in the latter case service is deemed effected on the Business Day following delivery); or

26.2.5 transmit it by email to a party's solicitor to the email address for that solicitor as stated in the Schedule or as notified by that solicitor to the other solicitor as the email address for service under this Contract.

26.3 A party's solicitor may give a notice, claim or authority on behalf of that party.

27. Unit title

27.1 The following clauses 28 to 39 inclusive apply if the Property is a Unit.

28. Definitions and interpretation

28.1 A reference in these clauses 28 to 39 inclusive to a section or Part is a reference to a section or Part of the Unit Titles Management Act.

28.2 For the purposes of a claim for compensation pursuant to clause 39, the provisions of clause 17 will apply provided that clause 17.1.1(c) is amended to read "the Buyer does not give notice to the Seller waiving the claim, or so much of it as exceeds 5% of the Price within 14 days after receiving the notice".

29. Title to the Unit

29.1 Clauses 3.1, 3.2 and 3.3 do not apply.

29.2 The Unit Title is or will before Completion be granted under the Planning Act and is or will before Completion be registered under the *Land Titles (Unit Titles) Act 1970* (ACT).

29.3 The Unit Title is transferred subject to the Units Plan under which the lease to the Unit is held.

30. Buyer rights limited

30.1 In addition to clause 6, the Buyer cannot make any requisition on title or make a claim for compensation in respect of any Breach of Covenant of the Unit Title, any breach of the

lease of the Common Property or breach of rules of the Owners Corporation disclosed in this Contract.

31. Adjustment of contribution

- 31.1 Any adjustment under clause 8 must include an adjustment of the contributions to the Owners Corporation under section 78 and section 89 of the Unit Titles Management Act.

32. Inspection of Unit

- 32.1 For the purposes of clause 10.1 Property includes the Common Property.

33. Seller warranties

- 33.1 The Seller warrants that at the Date of this Contract:
- 33.1.1 to the Seller's knowledge, there are no unfunded latent or patent defects in the Common Property or Owners Corporation assets, other than the following:
- (a) defects arising through fair wear and tear; and
 - (b) defects disclosed in this Contract;
- 33.1.2 the Owners Corporation records do not disclose any defects to which the warranty in clause 33.1.1 applies;
- 33.1.3 to the Seller's knowledge, there are no actual, contingent or expected unfunded liabilities of the Owners Corporation that are not part of the Owners Corporation's normal operating expenses, other than liabilities disclosed in this Contract;
- 33.1.4 the Owners Corporation records do not disclose any liabilities of the Owners Corporation to which the warranty in clause 33.1.3 applies;
- 33.1.5 the Seller or any occupier of the Unit has not committed any act or omission which may cause the Owners Corporation to incur any costs or perform any repairs;
- 33.1.6 there is no amount payable to the Owners Corporation by the Seller other than a contribution due under section 78 and section 89 of the Unit Titles Management Act; and
- 33.1.7 except for an unregistered Units Plan, the rules of the Owners Corporation are, as appropriate:
- (a) as set out in Schedule 4 to the Unit Titles Management Act; or

- (b) in respect of a corporation established under the *Unit Titles Act 1970 (repealed)* and that was in existence immediately prior to 30 March 2012, the articles in force immediately prior to 30 March 2012; or

- (c) in respect of a corporation established under the Unit Titles Act and that was in existence immediately prior to 30 March 2012, the articles in force immediately prior to 30 March 2012;

except for any alterations to those rules registered under section 108.

- 33.2 For clauses 33.1.1 to 33.1.4 inclusive, a Seller is taken to have knowledge of a thing if the Seller has actual knowledge, or ought reasonably to have knowledge, of that thing.
- 33.3 The Seller warrants that at Completion to the Seller's knowledge, there are no circumstances (other than circumstances disclosed in this Contract) in relation to the affairs of the Owners Corporation likely to significantly prejudice the Buyer.
- 33.4 For the purposes of clause 7, Property includes the Common Property.
- 33.5 These warranties are in addition to those given in clause 7.

34. Damage or destruction before Completion

- 34.1 If the Unit is destroyed or substantially damaged before Completion not due to the fault of either party then either party may by notice to the other rescind and clause 21 applies.
- 34.2 For the purposes of clause 34.1, the Unit is deemed to be substantially damaged if though not destroyed is unfit for the use to which it was being put at the Date of this Contract or, if not being used at that time, for the purpose permitted by the Unit Title.

35. Notice to Owners Corporation

- 35.1 The parties must comply with the rules of the Owners Corporation in relation to notification of the sale and purchase of the Unit.

36. Unit Title Certificate

- 36.1 On Completion the Buyer must pay to the Seller the fee as determined by the Minister pursuant to section 119(7) of the Units Title Management Act for the Unit Title Certificate attached.

37. Unregistered Units Plan

Warning: The following clauses 37, 38 and 39 do not encompass all obligations, rights and remedies under Part 2.9 of the Property Act for off the plan contracts.

- 37.1 This clause 37 applies if at the Date of this Contract, the Units Plan has not been registered.
- 37.2 The Seller must attach a copy of the proposed Units Plan or a sketch plan showing the location and dimensions of the Unit sufficient to enable the Buyer to determine the location and dimensions of the Unit in relation to other units and the Common Property in the proposed development.
- 37.3 If the Units Plan is not registered by the date specified in the Schedule, or elsewhere in this Contract, the Buyer may at any time after that date by notice served on the Seller require that the Units Plan be registered within 14 days of the service of the notice. If the Units Plan is not registered within the time limited by the notice the Buyer may at any time after expiry of the time in the notice rescind and clause 21 will apply.
- 37.4 If the Seller notifies the Buyer that the Units Plan is registered before rescission under this clause, the Buyer will not be entitled to rescind under this clause.
- 37.5 The Buyer cannot make any objection or requisition on title or claim for compensation in respect of:
- 37.5.1 any minor variations to the Unit between the plan attached, and the Units Plan registered by the Registrar General; or
- 37.5.2 any minor alterations required by an authority or the Registrar General in the number, size, location or Unit Entitlement of any other unit in the Units Plan or in or to the Common Property provided the proportion of the Unit Entitlement of the Unit to the other units in the Units Plan is not varied.
- In this clause, a minor variation is any variation less than 5% to either the size or value of the Unit described in the plan attached.
- 37.6 After the Owners Corporation has been constituted under section 8, the Seller must cause the Owners Corporation to comply with the rules of the Owners Corporation and with Parts 2, 3, 4, 5 and 7 to the extent to which the Owners Corporation is required by law to comply with those provisions up to the Date for Completion.
- 37.7 The Seller must not permit the Owners Corporation to vary the rules of the Owners

Corporation from those set out in Schedule 4 of the Unit Title Management Act.

- 37.8 If clause 37.1 applies, the Seller must give to the Buyer a Unit Title Certificate at the Buyer's expense at least 7 days before Completion.
- 37.9 The parties acknowledge that the following must form part of the Contract:
- 37.9.1 a Disclosure Statement for the Unit that complies with the requirements of section 260 of the Property Act; and
- 37.9.2 if a right to approve the keeping of animals during the Developer Control Period is reserved — details of the reservation, including the kind and number of animals.
- 37.10 The Seller warrants that the information disclosed in the Disclosure Statement, including information in any Disclosure Update Notice, is accurate.

38. Rescission of Contract

- 38.1 The Buyer may, by written notice given to the Seller, rescind this Contract if:
- 38.1.1 there would be a breach of a warranty provided in any of clauses 33.1.1, 33.1.2, 33.1.3, 33.1.4 or 33.3, were this Contract completed at the time it is rescinded; or
- 38.1.2 there would be a breach of a warranty provided in clause 37.10:
- (a) were this Contract completed at the time it is rescinded; and
- (b) the Buyer is significantly prejudiced by the breach,
- and the breach does not relate to an amendment to the Development Statement that is an Excluded Change.
- 38.2 A notice must be given:
- 38.2.1 under clause 38.1.1:
- (a) if this Contract is entered before the Units Plan for the Unit is registered — not later than 3 days before the Buyer is required to complete this Contract; or
- (b) in any other case — not later than 14 days after the later of the following happens:
- (i) the Date of this Contract; and
- (ii) another period agreed between the Buyer and Seller ends; or

38.2.2 under clause 38.1.2 – at any time before the Buyer is required to complete this Contract.

38.3 If the Buyer rescinds this Contract, the Seller must repay any amount paid to the Seller towards the purchase of the Unit and otherwise the provisions of clause 21 will apply.

39. Claims for compensation

39.1 This clause 39 applies if, before Completion, the Buyer reasonably believes that, except as disclosed in this Contract, there would be a breach of a warranty established under any of clauses 33.1.1, 33.1.2, 33.1.3, 33.1.4, 33.3 or 37.10 were this Contract to be completed.

39.2 The Buyer may, by written notice given to the Seller:

39.2.1 tell the Seller:

- (a) about the breach; and
- (b) that the Buyer will complete this Contract; and

39.2.2 claim compensation for the breach.

39.3 A notice under clause 39.2 must be given:

39.3.1 if this Contract is entered before the Units Plan for the Unit is registered – not later than 3 days before the Buyer is required to complete this Contract; or

39.3.2 in any other case – not later than 14 days after the later of the following happens:

- (a) the Buyer's copy of the Contract is received by the Buyer;
- (b) another period agreed between the Buyer and Seller ends.

39.4 The Buyer may not claim compensation under this clause 39 only because of the breach of a warranty related to an amendment to the Development Statement that is an Excluded Change.

40. Community title

40.1 The following clauses 41 to 50 inclusive apply if the Property is, or will on Completion form, a Lot within a Community Title Scheme.

41. Definitions and interpretation

41.1 A reference in these clauses 40 to 50 inclusive to a section or Part is a reference to a section or Part of the Community Title Act.

42. Buyer rights limited

42.1 In addition to clause 6, the Buyer cannot make any requisition on title or make a claim for

compensation in respect of any breach of the lease of the Common Property or breach of rules or by-laws of the Community Title Body Corporate disclosed in this Contract.

43. Adjustment of contribution

43.1 Any adjustment under clause 8 must include an adjustment of the contributions to the fund under section 45.

44. Inspection of property

44.1 For the purposes of clause 10.1 Property includes the Common Property.

45. Unregistered Community Title Scheme

45.1 This clause 45 applies if at the Date of this Contract, the Community Title Scheme has not registered.

45.2 The Seller must attach a copy of the proposed Community Title Master Plan, or a sketch plan showing the location and dimensions of the Lot sufficient to enable the Buyer to determine the location and dimensions of the Lot in relation to other lots and the Common Property in the proposed scheme.

45.3 The Seller must attach a copy of the proposed Community Title Management Statement.

45.4 The Buyer cannot make any objection or requisition on title or claim for compensation in respect of:

45.4.1 any minor variations to the Lot between the plan attached, and the registered Community Title Master Plan; or

45.4.2 any minor alterations required by an authority or the Registrar General in the number, size, location or entitlement of any other Lot in the Community Title Scheme or in or to the Common Property provided the proportion of the entitlement of the Lot to the other lots in the Community Title Scheme is not varied; or

45.4.3 any minor variations between the proposed Community Title Management Statement and the registered Community Title Management Statement.

In this clause, a minor variation is any variation less than 5% to either the size or value of the Lot described in the plan attached and referred to in the proposed Community Title Management Statement.

45.5 The Seller must not permit the Community Title Body Corporate to vary the by-laws of the

Community Title Scheme from those set out in Schedule 1 of the Community Title Act, unless otherwise disclosed in this Contract.

- 45.6 After the Community Title Body Corporate has been constituted under section 30, the Seller must cause the Community Title Body Corporate to comply with Part 8 to the extent to which the Community Title Body Corporate is required by law to comply with those provisions up to the Date for Completion.

46. Incomplete development of Community Title Scheme

- 46.1 This clause 46 applies if at the Date of this Contract, development of the Community Title Scheme has not completed.
- 46.2 Until the development of a Community Title Scheme is finished, the Developer warrants to the Buyer that the development will be carried out in accordance with the scheme.
- 46.3 Without limiting the damages recoverable for breach of the warranty in clause 46.2, the Buyer may recover damages for the loss of a reasonably expected capital appreciation of the Lot that would have resulted from completion of the development in accordance with the terms of the Community Title Scheme.

47. Incomplete development of Lot

- 47.1 This clause 47 applies if at the Date of this Contract, the Lot is to be developed or further developed in accordance with the Community Title Scheme. For clarity, this clause does not apply if an unconditional Compliance Certificate has issued before the Date of this Contract and the Seller gives to the Buyer evidence acceptable to the Registrar General that an unconditional Compliance Certificate has issued for the Lot, or if the Seller gives an unconditional Compliance Certificate to the Buyer on Completion.
- 47.2 The Buyer becomes bound to develop the Lot in accordance with the Community Title Scheme.
- 47.3 The Seller must give written notice of the proposed sale of the Lot to the Planning and Land Authority.
- 47.4 The Buyer must:
- 47.4.1 give to the Planning and Land Authority a written undertaking to develop the Lot in accordance with the Community Title Scheme (if a form is approved for an undertaking, the form must be used); and
 - 47.4.2 give the Planning and Land Authority any security required by the Planning and Land Authority, within 28 days after notice of the transaction was given to the

Planning and Land Authority, for the development of the Lot in accordance with the Community Title Scheme.

48. Required first or top sheet

- 48.1 The Seller must give to the Buyer, before the Buyer enters into this Contract, a Section 67 Statement.
- 48.2 The Section 67 Statement must:
- 48.2.1 state that the Lot is included in a Community Title Scheme that imposes obligations on the owner of the Lot;
 - 48.2.2 state the name and address of:
 - (a) the body corporate of the scheme; or
 - (b) if it is the duty of the Community Title Body Corporate manager to act for the Community Title Body Corporate in supplying Section 56 Certificates — the manager;
 - 48.2.3 state the amount of annual contributions currently fixed by the Community Title Body Corporate as payable by the owner of the Lot;
 - 48.2.4 identify improvements on common property of the scheme for which the owner of the Lot is responsible;
 - 48.2.5 be signed by the Seller or a person authorised by the Seller; and
 - 48.2.6 be substantially complete.
- 48.3 The Seller must attach to this Contract, as a first or top sheet, a copy of the Section 67 Statement given to the Buyer under clause 48.1.
- 48.4 The Buyer may rescind this Contract if:
- 48.4.1 the Seller has not complied with clauses 48.1 and 48.3; and
 - 48.4.2 Completion has not taken place.

49. Notice to Community Title Body Corporate

- 49.1 The parties must comply with the rules and by-laws of the Community Title Body Corporate in relation to notification of the sale and purchase of the Lot.

50. Section 56 Certificate

- 50.1 The Seller must give to the Buyer a Section 56 Certificate at least 7 days before Completion.
- 50.2 On Completion, the Buyer must pay to the Seller the fee charged for the Section 56 Certificate.

51. Foreign Resident Withholding Tax

Warning: The questions in the Schedule regarding the Relevant Price and the Clearance Certificates are not binding, and are included to remind the parties of their obligations under the Withholding Law.

Warning: The following clauses 51.1 to 51.8 are subject to the Withholding Law, and do not encompass all obligations under the Withholding Law.

51.1 In this clause 51 the following words have the following meanings:

CGT Asset has the meaning in the *Income Tax Assessment Act 1997*;

Clearance Certificate means a certificate issued under section 14-220 of the Withholding Law that covers the date of Completion;

Relevant Percentage means the percentage amount stated in section 14-200(3)(a) and 14-205(4)(a) of the Withholding Law;

Relevant Price means the higher of:

- the Price (including GST); and
- the market value of the CGT Assets sold under this Contract;

as at the Date of this Contract;

Variation Certificate means a certificate issued under section 14-235 of the Withholding Law that covers the date of Completion;

Withholding Amount means, subject to clauses 51.6 and 51.7, the Relevant Percentage of the first element of the CGT Asset's cost base (for all CGT Assets sold under this Contract) as at the Date of this Contract; and

Withholding Law means Subdivision 14-D of Schedule 1 of the *Taxation Administration Act 1953* and associated provisions.

51.2 If the Relevant Price is less than the dollar amount stated in section 14-215(1)(a) of the Withholding Law as at the Date of this Contract, the parties acknowledge that there are no obligations under the Withholding Law.

51.3 If Clearance Certificates for all the Sellers are provided to the Buyer prior to Completion, the parties acknowledge that there are no obligations under the Withholding Law.

51.4 If neither clauses 51.2 or 51.3 apply, then:

51.4.1 the Seller must provide to the Buyer any information required to enable the Buyer to comply with clause 51.4.2(a), within 5 days of written request from the Buyer;

51.4.2 the Buyer must:

(a) lodge a purchaser payment notification form with the ATO; and

(b) give evidence of compliance with clause 51.4.2(a) to the Seller;

no later than 5 days before the Date for Completion;

51.4.3 the Seller irrevocably instructs the Buyer to draw as part of the Price, and the Buyer must draw and retain on Completion, an unendorsed bank cheque payable to the ATO for the Withholding Amount; and

51.4.4 the parties must both, on the date of Completion, attend the offices of an authorised collection agent of the ATO to deposit the bank cheque referred to in clause 51.4.3 in payment of the Withholding Amount following Completion.

51.5 If clause 51.4 applies and the parties do not comply with clause 51.4.4:

51.5.1 the Buyer indemnifies the Seller for any loss or damage resulting from the Buyer's delay in remitting and/or failure to remit the Withholding Amount to the ATO; and

51.5.2 the Buyer charges the Property (for the benefit of the Seller) with the Buyer's obligations under this clause 51.5.

51.6 Where the Seller gives the Buyer a Variation Certificate prior to Completion, the Withholding Amount is the amount stated in the Variation Certificate.

51.7 Where Clearance Certificates for some but not all of the Sellers are provided to the Buyer prior to Completion, then the Withholding Amount is reduced by the same percentage as the percentage ownership of the Property of the Sellers that are subject to a Clearance Certificate.

51.8 Where a Clearance Certificate is provided by a Seller to the Buyer, the Seller warrants to the Buyer that that Seller is the entity referred to in the Clearance Certificate and is the relevant taxpayer for capital gains tax payable on the sale of the CGT Assets sold under this Contract.

52. Deposit by Instalments

52.1 The following clauses 52.2 to 52.8 inclusive only apply if the 'Deposit by Instalments' option on the Schedule is selected.

52.2 Clauses 2.1, 2.2, 2.3 and 2.4 are deleted.

52.3 The Buyer must pay the Deposit to the Stakeholder. The Seller agrees to accept the payment of the Deposit in two instalments as follows:

52.3.1 5% of the Price by cheque on the Date of this Contract (**First Instalment**); and

52.3.2 the balance of the Deposit (if it has not already been paid) by unendorsed bank cheque on the Date for Completion (**Second Instalment**);

and in every respect time is of the essence for payment of the First Instalment in this clause 52.3.1.

52.4 The Deposit becomes the Seller's property on Completion or on the earlier termination of this Contract by the Seller for the Buyer's default.

52.5 If the First Instalment of the Deposit is:

52.5.1 not paid on time and in accordance with clause 52.3; or

52.5.2 paid by cheque and the cheque is not honoured on first presentation,

the Buyer is in default and the Seller may terminate this Contract immediately by written notice to the Buyer (without the notice otherwise necessary under clause 18) and clause 19 applies. If the Seller does not terminate this Contract in accordance with this clause 52.5, then this Contract remains on foot, subject to this clause 52.5, until either the Seller terminates the Contract pursuant to this clause 52.5, or waives the benefit of this clause 52.5 pursuant to clause 52.8.

52.6 If the Second Instalment of the Deposit is not paid on time in accordance with clause 52.3, then the Seller cannot immediately terminate the Contract for the Buyer's breach of an essential condition. The Seller must make timing of the payment of the Second Instalment an essential condition of the Contract by serving on the Buyer a Default Notice requiring the Buyer to pay the Second Instalment within 14* days after service of the Default Notice (excluding the date of service).

52.7 For clarity, the Buyer must pay the full Price to the Seller, on or before Completion.

52.8 These clauses 52.2 to 52.8 inclusive are for the benefit of the Seller. The Seller may at any time before this Contract is terminated notify the Buyer in writing that the benefit of these clauses 52.2 to 52.8 inclusive is waived.

53. Residential Withholding Tax

Warning: The following clauses 53.1 to 53.9 are subject to the Withholding Law, and do not encompass all obligations under the Withholding Law.

53.1 In this clause 53 the following words have the following meanings:

RW Amount means the amount which the Buyer must pay under section 14-250 of the Withholding Law;

RW Amount Information means the completed RW Amount details referred to on page 3 of this Contract; and

RW Percentage means the percentage amount stated in section 14-250(6), (8) and (9) of the Withholding Law, as applicable to the supply of the Property from the Seller to the Buyer.

53.2 The Seller must provide the Buyer with the RW Amount Information no later than 7 days after the Date of this Contract.

53.3 If the 'Buyer required to make a withholding payment?' option on the Schedule is selected 'no' or if no selection is made, the Seller warrants to the Buyer that the Buyer is not required to make a payment under section 14-250 in relation to the supply of the Property from the Seller to the Buyer.

53.4 The following clauses 53.5 to 53.9 inclusive only apply if the 'Buyer required to make a withholding payment?' option on the Schedule is selected 'yes'.

53.5 Subject to any adjustments to the Price that may arise after the date that the RW Amount Information is provided in accordance with clause 53.2 and which affect the RW Amount, the Seller warrants to the Buyer on the date that the RW Amount Information is provided to the Buyer that the Seller has provided the Buyer with the information required under section 14 255 of the Withholding Law in relation to the supply of the Property from the Seller to the Buyer, and that this information is true and correct to the Seller's knowledge.

53.6 The Buyer must provide the Seller with a copy of the 'GST property settlement withholding notification online form' confirmation email (or emails, if applicable) issued to the Buyer by the ATO no later than:

53.6.1 21 days after a written request from the Seller; or

53.6.2 7 days prior to the Date for Completion, whichever is the earlier.

53.7 The Buyer must provide the Seller with evidence of submission by the Buyer to the ATO of the 'GST property settlement date confirmation online form', with such evidence to be provided prior to or on Completion.

* Alter as necessary

- 53.8 The Seller irrevocably instructs the Buyer to draw as part of the Price, and the Buyer must draw and retain on Completion, an unendorsed bank cheque payable to the ATO for the RW Amount.
- 53.9 In relation to the unendorsed bank cheque required by clause 53.8, the Buyer must:
- 53.9.1 forward the unendorsed bank cheque to the ATO immediately after Completion; and
 - 53.9.2 provide the Seller with evidence of payment of the RW Amount to the ATO.

Block 12 Section 101 Narrabundah

SPECIAL CONDITIONS

1. AMENDMENTS TO THE PRINTED TERMS

- 1.1. In printed terms clause 2.3, the words "electronic funds transfer" are added after the word "cheque".
- 1.2. In printed terms clause 2.6, the words "in cash (up to \$200)" are replaced with "by electronic funds transfer".
- 1.3. In printed terms clause 5.2, "7" is replaced with "14".
- 1.4. In printed terms clause 5.3, "14" is replaced with "7".
- 1.5. In printed terms clause 8.4, "Buyer solicitor" is replaced with "Seller Solicitor".
- 1.6. In printed terms clause 17.1.1 (a) "5%" is replaced with "\$1,000".
- 1.7. In printed terms clause 17.1.2 (a) "5%" is replaced with "\$1,000".
- 1.8. The relevant interest for printed term clause 22.1.1 is "0%"
- 1.9. The relevant interest for printed term clause 22.1.2 is "10%"
- 1.10. In printed terms clause 22.1.3, the words "party not at fault" is replaced by "the seller"
- 1.11. The relevant amount for clause 22.1.3 is "\$660".

2. CONDITION OF THE PROPERTY

- 2.1. The buyer agrees to accept the property and any improvements or goods at the property in its present condition and state of repair.
- 2.2. Unless otherwise specified in this contract, the seller is not required to make any repairs or improvements to the property after the date of this contract.
- 2.3. The buyer must not delay completion, make any objections, requisitions or claims in relation to the condition of the property or any goods at the property.

3. REPRESENTATION

- 3.1. The buyer agrees that they have conducted their own enquiries and that they do not rely on any representations, statements or warranties made by any person except as provided in this contract.
- 3.2. The buyer acknowledges that this contract comprises the entirety of their agreement in relation to the purchase of this property.

4. KEYS

- 4.1. The seller must provide the buyer with keys to obtain access to the property.
- 4.2. The seller shall provide to the buyer all keys to the property in possession of the seller.
- 4.3. The buyer must not make claims, objections or requisitions in relation to the availability of any other keys.

5. REAL ESTATE AGENT

- 5.1. The buyer warrants that they have not been introduced to the Seller or the property by any real estate agent other than the Seller's agent as listed on the Schedule of this contract.
- 5.2. The buyer agrees to indemnify the seller from any claims for commission, damages, compensation or any other costs arising as a result of the buyer being introduced to the property or the Seller by any real estate agent other than the Seller's agent as listed on the Schedule of this contract.
- 5.3. This clause will not merge on completion.

6. DEATH OR MENTAL INCAPACITY

- 6.1. If either the buyer or the seller dies or if either of them become mentally incapable in any way such that they do not have capacity to complete the contract, either party may by written notice rescind the contract. If such a notice is provided detailing the

incapacity, clause 21 of the Printed Terms will apply.

7. ADJUSTMENTS

- 7.1. If Completion does not occur on or before the date of completion as noted in the Schedule as a result of buyer's default, the buyer will be liable for all land charges including but not limited to general rates, water rates, land tax, body corporate levies from the date of completion as per the schedule notwithstanding anything in clause 8 of the printed terms.
- 7.2. The seller will be entitled to all Income in relation to the subject premises up to and including completion.

8. INCONSISTENCY

- 8.1. In the event of an inconsistency between these special conditions and the printed terms, these special conditions will prevail, and the printed terms will be deemed void to the extent of the inconsistency.

9. ERROR

- 9.1. If there are any errors in relation to the adjustments or otherwise in relation to payment of monies, both parties agree that once identified, the parties will do everything necessary to rectify all such errors.
- 9.2. Any outstanding monies as a result of the error will be deemed as a debt owed to the other party.
- 9.3. This clause will not merge at completion.

10. REQUIRED DOCUMENTS

- 10.1. The buyer agrees that they have received all required documents from the seller as a part of this contract.
- 10.2. The buyer must not make any requisitions, objections, claim for compensation or delay completion as a result of any information or lack of information in the required documents.

11. DEFT PAYMENTS

- 11.1. This clause is applicable if the buyer elects to use DEFT Auction pay platform to pay the deposit.
- 11.2. If the monies are not received in the stakeholder's account within one business day from the date of this contract, the buyer will be in breach of this contract and the seller may without notice choose to terminate the contract and clause 19 will apply.
- 11.3. A delay in exercising the right to terminate the contract as per Special condition 11.2 does not in any way affect the seller's right to terminate the contract at a later stage.
- 11.4. Until the Seller chooses to terminate the contract or waive their right to terminate, the contract will remain on foot.
- 11.5. The right to terminate under Special condition 11.2 can only be waived in writing.

12. DEPOSIT BOND

- 12.1. Subject to Special conditions 12.2 & 12.3 below, the delivery of a Deposit bond or Bank guarantee upon or before making this contract to the Seller's solicitor or Seller's Agent, shall to the extent of the amount guaranteed under the guarantee be deemed for the purposes of this contract to be payment of the deposit in accordance with this contract.
- 12.2. The buyer must pay the amount stated on the guarantee or the deposit bond to the seller at completion of this contract or at a time stipulated in this contract.
- 12.3. If the Seller serves on the buyer a notice in writing claiming to forfeit the deposit, then to the extent that the amount has not already been paid by the bank under the bank guarantee or deposit bond, the buyer shall forthwith pay the deposit or so much thereof as has not already been paid to the Stakeholder as stated in this contract.

- 12.4. The seller acknowledges that payment by the bank under the bank guarantee or by the provider under the deposit bond, shall to the extent of the amount paid, be in satisfaction of the buyer's obligation to pay the deposit under Special condition 12.3 above.
- 12.5. If the contract is not completed before the expiration of the term of the bank guarantee or the deposit bond, the buyer must provide to the sellers no later than three (3) days before the expiration date, a new bank guarantee or deposit bond as replacement. The obligation of the buyer to produce the replacement bank guarantee or deposit bond and the time for production of the replacement bank guarantee or deposit bond will be of essence of this contract, and if the buyer fails to do so, the seller may terminate the contract.

13. NO CAVEAT

- 13.1. The buyer must not lodge a caveat on the title of this property prior to completion of this contract. This is an essential term of this contract.
- 13.2. The buyer hereby irrevocable appoints the seller and seller's nominated representative as Buyer's attorney to withdraw any caveat lodged on the title of this property in contravention of this clause.
- 13.3. The buyer must pay for any costs including but not limited to the Registration Fee, Seller's legal cost, Agent fee incurred as a result of contravention of Special condition 13.

14. DIRECTOR GUARANTEE

- 14.1. If the buyer is a corporate entity, the directors of the buyer must execute and complete the directors guarantee attached to this contract.
- 14.2. If at the date of this contract, the directors guarantee is not signed by the all the Directors of the buyer, the buyer is in default and the seller may without notice terminate the contract. Printed term 19 will apply.
- 14.3. This is an essential term of the contract.

ANNEXURE A – DIRECTORS GUARANTEE

I/We _____ (name of all
Director/s)

of _____
(address/s)

agree as follows:

1. I/we am/are a Director/s of the Buyer.
2. In consideration of the Seller entering into this Contract at my/our request, I/we agree to guarantee to the Seller
 - 2.1. The performance and observance by the Buyer of all its obligation under the Contract, before, on and after Completion of this Contract; and
 - 2.2. The payment of all money payable to the Seller or to third parties under this Contract or otherwise.
3. This is a continuing guarantee and binds me/us notwithstanding:
 - 3.1. My/our subsequent death, bankruptcy, liquidation or the subsequent death, bankruptcy, liquidation or any one (1) or more of the Buyer or the Buyer's Directors;
 - 3.2. Any indulgence, waiver or extension of time by the Seller to the Buyer to me/us or to the Buyer's Directors; and
 - 3.3. Completion of this Contract.
4. In the event of any breach by the Buyer covered by this guarantee, including in the payment of any money payable to the Seller or to third parties under this Contract or otherwise, the Seller may proceed to recover the amount claimed as a debt or as damages from me/us without having instituted legal proceedings against the Buyer or any other of the Buyer's Directors and without first exhausting the Seller's remedies against the Buyer.
5. I/we agree to keep the Seller indemnified against any liability, loss, damage or claim due to the default of the Buyer which the Seller may incur in respect of this Contract.

SIGNED, SEALED AND DELIVERED by the Buyer's Director/s in the presence of

Signature of Buyer's Director

Signature of Witness

Name of Buyer's Director

Name of Witness

Signature of Buyer's Director

Signature of Witness

Name of Buyer's Director

Name of Witness

1 SHUTDOWN PERIOD – ACT

1.1 Definitions

Unless the context indicates otherwise, each word or phrase defined in this clause 1 has the meaning given to it in this clause 1.1.

Isolate means any mandatory government requirement to self-isolate, or any mandatory medical requirement to be isolated in hospital, and **Isolation** has a corresponding meaning.

Pandemic means the COVID 19 (or a variant of it) pandemic as declared by WHO.

WHO means the World Health Organisation.

1.2 Shutdown period

In this clause 1 **Shutdown Period** means any day:

1.2.1 when any of the following is closed:

1.2.1.1 the ACT Law Society settlements room;

1.2.1.2 the bank or financial institution of the Seller from whom the Seller must obtain a discharge of mortgage in order to complete this Contract;

1.2.1.3 the bank or financial institution of the Buyer from whom the Buyer is obtaining funding in order to complete this Contract;

1.2.1.4 the place of business of the Seller's solicitor;

1.2.1.5 the place of business of the Buyer's solicitor;

1.2.1.6 the ACT Land Titles Office; or

1.2.1.7 the ACT Revenue Office,
in accordance with any direction by a Government Department or Authority or company policy; or

1.2.2 when the Buyer or the Seller is not able to attend any of the places of business listed in clause 1.2.1 due to being Isolated,

in response to a Pandemic or other national health emergency, and where that closure or Isolation event would reasonably cause either party to be unable to complete this Contract during the period of the closure or Isolation.

1.3 Notice of closure

1.3.1 Either party to this Contract may invoke this clause 1 by notice to the other party that gives sufficient details of the event (including supporting information of any closure or Isolation) giving rise to the Shutdown Period.

1.3.2 Either party may notify the other party of the end of the Shutdown Period.

1.3.3 Each party must act promptly and in good faith to advise the other party if it becomes aware of the start or end of a Shutdown Period.

1.4 Completion Extended

If Completion of this Contract is to take place during the Shutdown Period, then the Date for Completion is deemed to be extended to the 3rd Business Day after the date of notification of the end of the Shutdown Period.

1.5 Extension of Notice to Complete

If the period specified in any Notice to Complete issued pursuant to this Contract expires during the Shutdown Period, then the date for expiration of the notice is deemed to be extended to the 3rd Business Day after the date of notification of the end of the Shutdown Period.

1.6 Extension of other notice

If a notice (other than a Notice to Complete) is served in accordance with this Contract during the Shutdown Period then such notice is deemed to be served on the first Business Day after the date of notification of the end of the Shutdown Period.

1.7 Payment of damages

If this Contract includes any term requiring one or both of the parties to pay damages for any delay in Completion, no damages shall be payable by either party for any period during the Shutdown Period.

CHRISTMAS SHUTDOWN SPECIAL CONDITIONS

1. In the event that Date of Completion falls within the period commencing Monday 21st December 2026 (inclusive) and ending Tuesday 12th January 2027 (inclusive) (Christmas Shutdown Period), the date of Completion is extended to Wednesday 13th January 2027 (Resumption Date).
2. If a party is served with a Notice during the Christmas Shutdown period, the Notice is deemed to be served on the Resumption Date.
3. If a Date to complete the contract under a Notice to complete falls during the Christmas Shutdown period, it is deemed to be extended to the Resumption Date.
4. No damages under clause 22 will be payable during the Christmas Shutdown Period.

Volume 1451 Folio 68 Edition 6

AUSTRALIAN CAPITAL TERRITORY

TITLE SEARCH

LAND

Narrabundah Section 101 Block 12 on Deposited Plan 2059

Lease commenced on 16/12/1987, granted on 19/12/1994, terminating on 15/12/2086

Area is 1032 square metres or thereabouts

Proprietor

JANE SARA MARKS

"WICKHAM", 17 CRAIGIE STREET, HARCOURT VICTORIA 3453

CRAIG ROBERT WATKINS

WICKHAM, 17 CRAIGIE STREET, HARCOURT VICTORIA 3453

as Joint Tenants

REGISTERED ENCUMBRANCES AND INTERESTS

Original title is **Volume 1451 Folio 68**

Restrictions

Purpose Clause: Refer Crown Lease

Registered Date	Dealing Number	Description
18/02/2022	3136998	Mortgage to BENDIGO AND ADELAIDE BANK LIMITED (ACN: 068 049 178)

End of interests

ADMINISTRATIVE INTERESTS

Administrative interests information is **not** guaranteed by the Registrar-General, and the Registrar-General nor an authorised entity incurs liability for any omission, misstatement or inaccuracy in the information.

Territory Planning Authority - For further information concerning the following administrative interests, please refer to decided development application information available at <https://www.planning.act.gov.au/> or on the DA Finder App, available for download on iOS and Android mobile devices. Alternatively, please contact Access Canberra Land, Planning and Building Services at ACEPDCustomerservices@act.gov.au or 6207 1923. The Territory Planning Authority's administrative interest information has been provided to the Registrar-General since 1 February 2010.

Reference Number	Type	Lodgement Date	Assessment Track	Status	Status Date
201936451	Development Application	03/12/2019	MERIT TRACK - MAJOR NOTIFICATION	APPROVAL CONDITIONAL	17/01/2020

Description

REVISED NOTIFICATION CLOSING DATE - PROPOSAL FOR A SECONDARY RESIDENCE - a new secondary residence, deck and associated works.

ORIGINAL

Entered in Register Book Vol. 1451 Folio 68....

P. A. Rowe
P A ROWE
DEPUTY REGISTRAR-GENERAL



AUSTRALIAN CAPITAL TERRITORY

LAND (PLANNING AND ENVIRONMENT) ACT 1991

Australian Capital Territory (Planning and
Land Management) Act 1988 (C'th) ss 29, 30 & 31

LEASE GRANTED pursuant to the Land (Planning and Environment) Act 1991 on the **nineteenth** day of December One thousand nine hundred and ninety four WHEREBY THE AUSTRALIAN CAPITAL TERRITORY EXECUTIVE ON BEHALF OF THE COMMONWEALTH OF AUSTRALIA (hereinafter called "the Commonwealth") grants to the COMMISSIONER FOR HOUSING FOR THE AUSTRALIAN CAPITAL TERRITORY (hereinafter called "the Lessee") ALL THAT piece or parcel of land situate in the Australian Capital Territory containing an area of 1032 square metres or thereabouts and being **Block 12 Section 101 Division of NARRABUNDAH** as delineated on **Deposited Plan Number 2059** in the Registrar-General's Office at Canberra in the said Territory (hereinafter referred to as "the land") RESERVING unto the Territory all minerals TO HOLD unto the Lessee for the term of ninety nine years commencing on the sixteenth day of December One thousand nine hundred and eighty seven (hereinafter referred to as "the date of the commencement of the lease") to be used by the Lessee for the purpose set forth in sub-clause (c) of clause 2 of this lease only YIELDING AND PAYING THEREFOR during the said term rent at the rate of five cents per annum if and when demanded and UPON AND SUBJECT TO the covenants conditions and agreements hereinafter contained.

1. IN THIS LEASE unless the contrary intention appears:

- (a) "Australian Capital Territory Executive" means the Executive established by section 36 of the Australian Capital Territory (Self-Government) Act 1988 (C'th);
- (b) "building" means the building or any buildings on the land at the date of the commencement of the lease or any building or buildings constructed on the land in accordance with the covenants of this lease or any building or buildings replacing the same together with all fittings fixtures (including floor coverings) plant amenities and appurtenances thereof and therein contained or if the context so permits any part thereof;
- (c) "Lessee" shall -
 - (i) where the Lessee consists of one person be deemed to include the Lessee and the executors administrators and assigns of the Lessee;
 - (ii) where the Lessee consists of two or more persons be deemed to include in the case of a tenancy in common the said persons and each of them and their and each of their executors administrators and assigns and in the case of a joint tenancy be deemed to include the said persons and each of them and their and each of their assigns and the executors administrators and assigns of the survivor of them; and
 - (iii) where the Lessee is a corporation be deemed to include such corporation and its successors and assigns;
- (d) "premises" means the land and any building erections and or improvements in on or above the land;
- (e) "Territory" means -
 - (i) when used in a geographical sense the Australian Capital Territory; and
 - (ii) when used in any other sense the body politic established by section 7 of the Australian Capital Territory (Self-Government) Act 1988 (C'th).

2. THE LESSEE COVENANTS WITH THE COMMONWEALTH as follows:

- (a) That the Lessee shall pay to the Territory at Canberra the rent hereinbefore reserved within one month of the date of any demand made by the Territory relating thereto and served on the Lessee;
- (b) That the Lessee shall not without the previous approval in writing of the Territory erect any building on the land or make any structural alterations in any building erected on the land;
- (c) To use the land for residential purposes only;
- (d) That the building erected on the land shall be used only as a single unit private dwelling and SUBJECT TO approval by the Territory a second single unit private dwelling may be permitted PROVIDED THAT any outbuildings erected on the land shall not be used as a habitation;
- (e) That the Lessee shall at all times during the said term maintain repair and keep in repair the premises to the satisfaction of the Territory;
- (f) If and whenever the Lessee is in breach of the Lessee's obligations to maintain repair and keep in repair the premises the Territory may by notice in writing to the Lessee specifying the repairs and maintenance needed require the Lessee to effect the necessary work in accordance with the notice. If the Territory is of the opinion that a building or some other improvement on the land is beyond reasonable repair the Territory may by notice in writing to the Lessee require the Lessee to remove the building or improvement and may require the Lessee to construct a new building or improvement in place of that removed within the time specified in the notice. If the Lessee does not carry out the required work within the time specified by the Territory any person or persons duly authorised by the Territory with such equipment as is necessary may enter the premises and carry out the necessary work and all costs and expenses incurred by the Territory in carrying out the work shall be paid by the Lessee to the Territory on demand and from the date of such demand until paid shall for all purposes of this lease be a debt due and payable to the Territory by the Lessee;
- (g) Subject to the provisions of the Land (Planning and Environment) Act 1991 to permit any person or persons authorised by the Territory to enter and inspect the premises at all reasonable times and in any reasonable manner;
- (h) To pay all rates and charges and other *statutory outgoings* assessed levied or payable in respect of the premises as and when the same fall due.

3. IT IS MUTUALLY COVENANTED AND AGREED as follows:

- (a) That if -
 - (i) the land is at any time not used for a period of one year for the purpose for which this lease is granted; or
 - (ii) the Lessee shall fail to observe or perform any other of the covenants herein contained on the part of the Lessee to be observed or performed and shall have failed to remedy such breach within a period of six months from the date of service on the Lessee of a notice in writing from the Territory specifying the nature of such breach

the Territory may terminate this lease but without prejudice to any claim which the Territory or the Commonwealth may have against the Lessee in respect of any breach of the covenants on the part of the Lessee to be observed or performed;

- (b) That acceptance of rent or other moneys by the Territory during or after any period referred to in paragraph (i) or (ii) of sub-clause (a) of this clause shall not prevent or impede the exercise by the Territory of the powers conferred upon it by sub-clause (a) of this clause;

- (c) Subject to the provisions of the Land (Planning and Environment) Act 1991 the Lessee shall be entitled to a further lease of the land for such further term and at such rent and subject to such conditions as may then be provided or permitted by Statute Ordinance or Regulation;
- (d) That any notice requirement demand consent or other communication to be given to or served upon the Lessee under this lease shall be deemed to have been duly given or served if signed by or on behalf of the Territory and delivered to or sent in a prepaid letter addressed to the Lessee at the land or at the usual or last-known address of the Lessee or affixed in a conspicuous position on the premises;
- (e) Any and every right power and or remedy conferred on the Commonwealth the Territory or the respective Ministers hereunder or implied by law may be exercised on behalf of the Commonwealth the Territory or the respective Ministers as the case may be by -
 - (i) the Australian Capital Territory Executive;
 - (ii) the Minister for the time being administering the Land (Planning and Environment) Act 1991 or any Statute Ordinance or Regulation substituted therefor;
 - (iii) an authority or person for the time being authorised by the Australian Capital Territory Executive or the Minister referred to in (i) or (ii) above or by law to exercise those powers or functions of the Commonwealth the Territory or the relevant Minister; or
 - (iv) the person to whom the Minister referred to in (ii) above has delegated all his powers or functions under the said Land (Planning and Environment) Act 1991 or any Statute Ordinance or Regulation substituted therefor.

IN WITNESS whereof the Territory on behalf of the Commonwealth and the Lessee have executed this lease.

SIGNED SEALED AND DELIVERED)
 by **SHEILA MASON**)
 a person duly authorised by the)
 Australian Capital Territory Executive)
 for and on behalf of the Commonwealth)
 in the presence of:)

Sheila Mason



The Official Seal of the)
 Commissioner for Housing)
 for the Australian Capital)
 Territory was hereunto)
 affixed in the presence of:)

M. Pringle



DELEGATE OF THE
 COMMISSIONER FOR HOUSING

324° 57' 10" 324° 57' 10" 6 ft. G.L.P.F.

89
D.P. 821

35
D.P. 725
D.P. 1473
D.P. 1708

33
D.P. 1261
D.P. 1493

EASEMENT *See Ransom* 12.7.1984
(a) AMENDED BY REQUEST OF A.S.O.
REF. FOLIO No. 114 ON FILE No. 822611

Azimuth: A-B (Strom)

I, WILLIAM MORRIS TWEEDIE of Canberra, a surveyor registered under the provisions of the Surveyors Ordinance 1967 do hereby solemnly and sincerely declare (a) that all boundaries and measurements shown on this plan are correct, (b) that all survey marks found and relevant physical objects on or adjacent to the boundaries are correctly represented, (c) that all physical objects indicated exist in the positions shown, (d) that the whole of the material facts in relation to the land are correctly represented, (e) that the survey has been made (1) by me, (2) under my supervision and completed on the 6th day of February, 1968 and the reference marks have been placed as shown herein.

And I make this solemn declaration by virtue of the Statutory Declarations Act 1959 conscientiously believing the statements contained therein to be true in every particular.

W. Tweedie
Registered Surveyor.

Declared at Canberra the 15th day of July 1968 before me *P.W. Boyle*
Commissioner for Declarations under the Statutory Declarations Act 1959.

I certify that this plan is the plan prepared in accordance with sub-section 4 of section 6 of the Districts Ordinance 1966-1967.
Boyle
Commonwealth Surveyor-General.

PLAN OF
BLOCKS 2-32 SECTION 101

DIVISION: NARRABUNDAH
DISTRICT: CANBERRA CITY
AUSTRALIAN CAPITAL TERRITORY.

Scale: 60 feet to an inch.

Field Books: K 3618

Deposited in the office of the Registrar of Titles at Canberra in the Australian Capital Territory the 1st day of August 1968 at *five* minutes past *two* o'clock in the *after* noon.
Approved *[Signature]*
Registrar of Titles.

DEPOSITED PLAN.
2059



LEASE CONVEYANCING ENQUIRY

Your response is sought to the following questions in relation to:

LAND: Please provide details of the land you are enquiring about.

Unit	0	Block	12	Section	101	Suburb	NARRABUNDAH
------	---	-------	----	---------	-----	--------	-------------

Leased by the Australian Capital Territory on behalf of the Commonwealth under the Land (Planning and Environment) Act 1991, Planning & Development Act 2007 and Planning Act 2023.

	No	Yes
1. Have any notices been issued relating to the Crown Lease?	(X)	()
2. Is the Lessor aware of any notice of a breach of the Crown Lease?	(X)	()
3. Has a Certificate of Compliance been issued? (N/A ex-Government House)	()	()
Certificate Number: N/A		
Dated:		
4. Has an application for Subdivision been received under the Unit Titles Act?	(see report)	
5. Has the Property been nominated for provisional registration, provisionally registered or registered in accordance with provisions of the Heritage Act 2004?	(see report)	
6. If an application has been determined, is the land subject to an Environmental Impact Statement under Chapter 8 of the Planning & Development Act 2007, or part 6.3 of the Planning Act 2023?	(see report)	
7. Has a development application been received, or approval (applications lodged prior to 2 April 1992 will not be included)?	(see report)	
8. Has an application been received or approved for Dual Occupancy? (applications lodged prior to 2 April 1992 will not be included)	(see report)	
9. Has an Order been made in respect of the Land pursuant to Part 11.3 of the Planning & Development Act 2007 or Part 12.3 of the Planning Act 2023?	(see report)	
10 Contaminated Land Search - Is there information recorded by Environment ACT regarding the contamination status of the land?	(see report)	

Applicant's Name :

Info Track

Date: 05-JUN-26 14:12:46

E-mail Address :

actenquiries@infotrack.com.au

Client Reference :

2026/196 - 196659391



STATUTORY PLANNING
DEVELOPMENT SOLUTIONS BRANCH
480 Northbourne Avenue
DICKSON ACT 2601

05-JUN-2026 14:12

PLANNING AND LEASE MANAGER (PaLM)
LEASE CONVEYANCING ENQUIRY REPORT

Page 1 of 3

INFORMATION ABOUT THE PROPERTY

NARRABUNDAH Section 101/Block 12

-

Area(m2): 1,032.6

Unimproved Value: \$957,000

Year: 2025

Subdivision Status: Application not received under the Unit Titles Act.

Heritage Status: Nil.

Environment Assessment: The Land is not subject to an Environmental Impact Statement under Chapter 8 of the Planning & Development ACT 2007, or part 6.3a of the Planning Act 2023.



STATUTORY PLANNING
DEVELOPMENT SOLUTIONS BRANCH
480 Northbourne Avenue
DICKSON ACT 2601

05-JUN-2026 14:12

PLANNING AND LEASE MANAGER (PaLM)
LEASE CONVEYANCING ENQUIRY REPORT

Page 2 of 3

DEVELOPMENT APPLICATIONS ON THE PROPERTY (SINCE APRIL 1992)

Application DA201936451 **Lodged** 03-DEC-19 **Type** See Subclass

-- Application Details -----

Description

REVISED NOTIFICATION CLOSING DATE - PROPOSAL FOR A SECONDARY RESIDENCE - a new secondary residence, deck and associated works.

-- Site Details -----

District	Division	Section	Block(s)	Unit
Canberra Central	Narrabundah	101	12-12	

-- Involved Parties -----

Role	Name
Lessee	Julie Bernadette Cotsell
Applicant	Aldea Pty Ltd T/As Vrd Design

-- Activities -----

Activity Name	Status
Merit Track	Approval Conditional

Application DA200604003 **Lodged** 17-AUG-06 **Type** Single Dwelling

-- Application Details -----

Description

SINGLE RESIDENTIAL-ADDITIONS-KITCHEN, DINING ROOM, LIVING ROOM, GARAGE - Additions to the front of the existing residence to include a new kitchen, dining room, living room and garage.

-- Site Details -----

District	Division	Section	Block(s)	Unit
Canberra Central	Narrabundah	101	12-12	

-- Involved Parties -----

Role	Name
Applicant	Peter & Julie Cotsell
Lessee	Peter & Julie Cotsell

-- Activities -----

Activity Name	Status
Ba Single Hse (Neighbour Cons)	Approved

DEVELOPMENT APPLICATIONS ON THE ADJACENT PROPERTIES (LAST 2 YEARS ONLY)

The information on development applications on adjacent blocks is to assist purchasers to be aware of possible nearby development activity. Please note however, it doesn't cover all development activity. Exempt activities can include but are not limited to, new residences, additions to residences, certain sheds, carports and pergolas etc. Information on exempt developments can be found at <https://www.planning.act.gov.au/applications-and->



STATUTORY PLANNING
DEVELOPMENT SOLUTIONS BRANCH
480 Northbourne Avenue
DICKSON ACT 2601

05-JUN-2026 14:12

PLANNING AND LEASE MANAGER (PaLM)
LEASE CONVEYANCING ENQUIRY REPORT

Page 3 of 3

assessments/development-applications/check-if-you-need-a-da

LAND USE POLICIES

To check the current land use policy in the suburb that you are buying a property in, please check the Territory Plan online at <https://www.legislation.act.gov.au/ni/2023-540/>

CONTAMINATED LAND SEARCH

Information is not recorded by the Environment Protection Authority regarding the contamination status of this land. However, this does not absolutely rule out the possibility of contamination and should not be interpreted as a warranty that there is no contamination. To be completely sure, independent tests should be arranged.

ASBESTOS SEARCH

ACT Government records indicate that asbestos (loose fill or otherwise) is not present on this land. However, the accuracy of this information is not guaranteed. If the property was built prior to 1 January 2004, you should make your own enquiries and obtain reports (from a licensed Asbestos Assessor) in relation to the presence of loose-fill asbestos insulation (and other forms of asbestos e.g. bonded asbestos) on the premises.

CAT CONTAINMENT AREAS

Cat containment has been extended across the ACT for cats born on or after 1 July 2022. Containment means keeping your cat on your premise 24 hours a day. This can include your house or apartment, enclosed area in a backyard or courtyard, a cat crate or leash. Cats born before 1 July 2022 do not have to be contained unless they live in one of the 17 currently declared cat containment suburbs. All cats (regardless of age) located in the following suburbs must be contained to their premise 24 hours a day. However, cats can be walked on a leash and harness under effective control in all containment suburbs: BONNER, COOMBS, CRACE, DENMAN PROSPECT, FORDE, JACKA, LAWSON, MOLONGLO, MONCRIEFF, STRATHNAIRN, THE FAIR in north WATSON, THROSBY, WRIGHT, GUNGAHLIN TOWN CENTRE, MACNAMARA, TAYLOR and WHITLAM. More information on cat containment is available at <https://www.cityservices.act.gov.au/pets-and-wildlife/domestic-animals/cats/cat-containment> or by phoning Access Canberra on 13 22 81.


URBAN FOREST ACT 2023

The Urban Forest Act 2023 (or Tree Protection Act 2005 where applicable) protects individual trees of importance and urban forest areas that require particular protection. A Tree Register has been established and can be found on the Transport Canberra and City Services website https://www.cityservices.act.gov.au/trees-and-nature/trees/act_tree_register or for further information please call Access Canberra on 132281.

---- END OF REPORT ----

Building Reports
Timber Pest Inspection Reports
Compliance Report
Conveyancing Report
Energy Efficiency Ratings
Insurance Certificate
Tax Invoice

Report

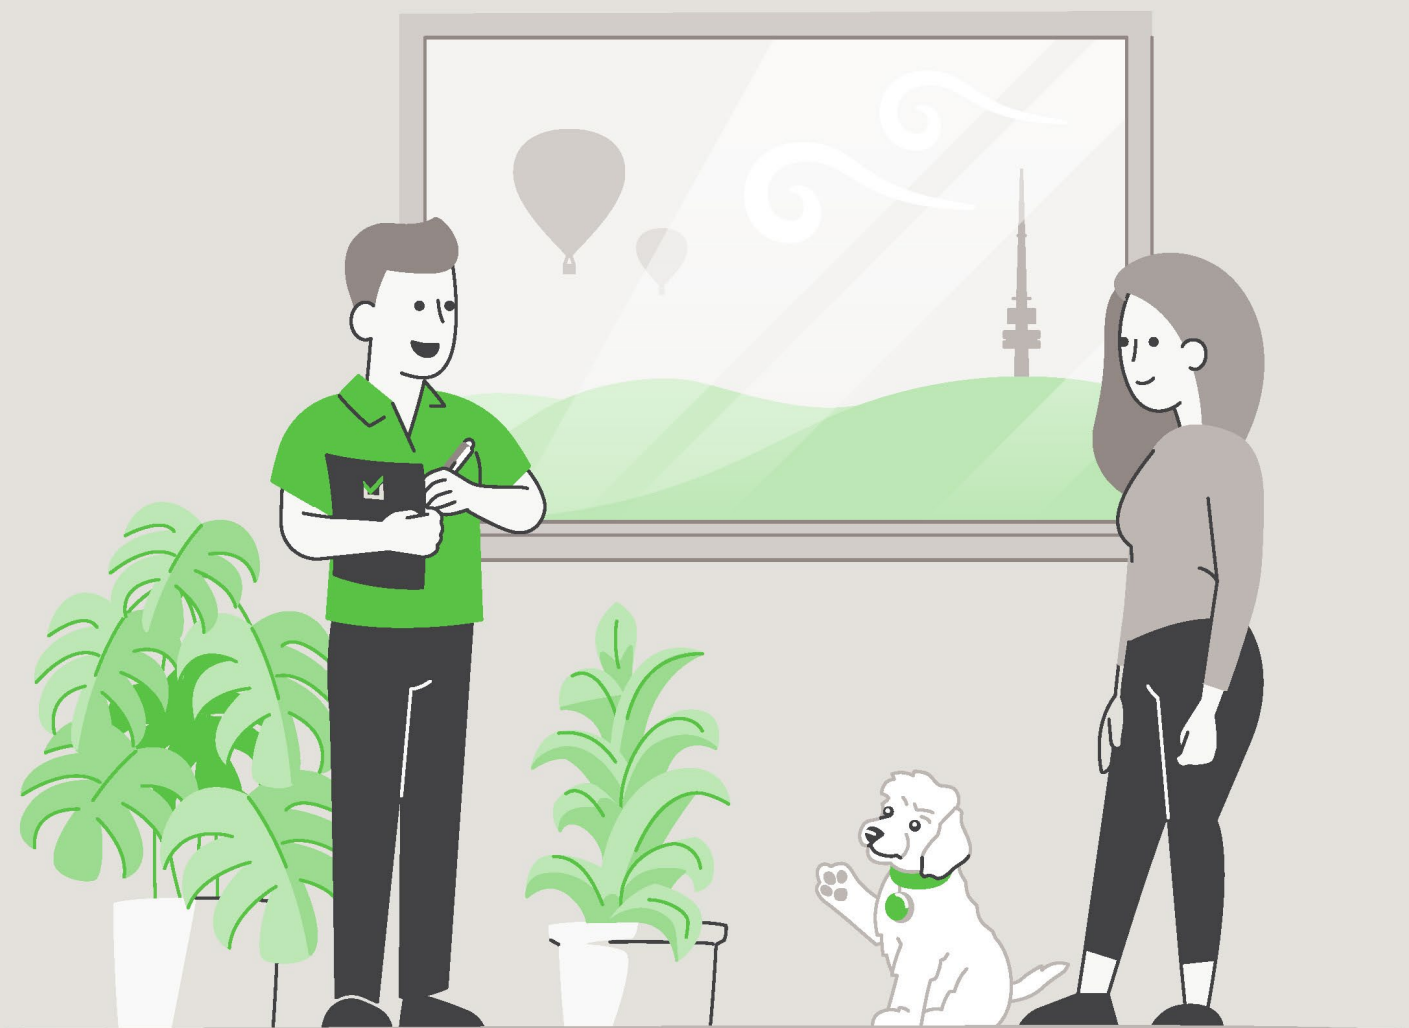


LIMITED LIABILITY TO A PURCHASER WITHIN THE AUSTRALIAN CAPITAL TERRITORY

This Report is made solely for the use and benefit of the Client. The Consultant is not liable for any reliance placed on this report by any third party. However, within the ACT only and in accordance with the Civil Law (Sale of Residential Property) Act 2003 and the Civil Law (Sale of Residential Property) Regulations 2004, a copy of the report must be attached to the Contract for Sale and may in certain circumstances be relied upon by the Purchaser of residential property.

The circumstances in which a Purchaser of residential property within the ACT may rely on this report in respect of the state of the property at the time of the inspection are as follows:

- (a)** The inspection was carried out no earlier than three months before the day the property was first advertised or offered for sale or listed by an agent; and
- (b)** The date on which the contract was entered into was not more than 180 days after the date of the inspection.
- (c)** The report is provided to the Purchaser prior to or at the time the Contract for Sale is entered into between the Purchaser and vendor.
- (d)** The service requested is the Standard Inspection Report.

Building Report Residence 1

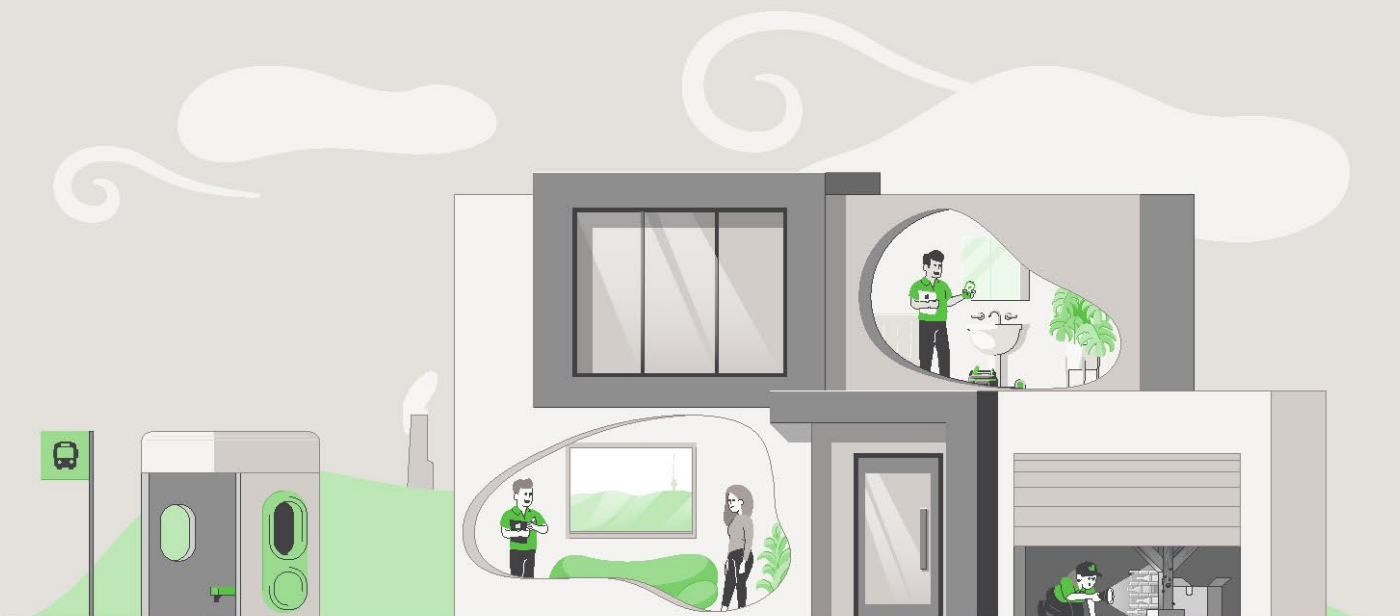

CONCLUSION AND SUMMARY – RESIDENCE 1

The purpose of the Inspection is to identify the major defects and safety hazards associated with the property at the time of the Inspection. The Inspection and reporting are limited to a visual assessment of the Building Members in accord with Appendix C AS4349.1-2007.

The overall condition of this building has been compared to similar constructed buildings of approximately the same age where those buildings have had a maintenance program implemented to ensure that the building members are still fit for purpose.

The incidence of Major Defects in this Residential Building as compared with similar Buildings is considered: **Low**

The incidence of Minor Defects in this Residential Building as compared with similar Buildings is considered: **Low**

The overall condition of this Residential Dwelling in the context of its age, type and general expectations of similar properties is: **Above Average**

Please Note: This is a general appraisal only and cannot be relied upon on its own – read the Report in its entirety.

This Summary is supplied to allow a quick and superficial overview of the Inspection results. This Summary is NOT the Report and cannot be relied upon on its own. This Summary must be read in conjunction with the full Report and not in isolation from the Report. If there should happen to be any discrepancy between anything in the Report and anything in this Summary, the information in the Report shall override that in this Summary.

PROPERTY STATISTICS – RESIDENCE 1

Building Report	Above Average
Compliance Report	Please read full compliance report section of the report
Pest Inspection	Please read full pest inspection report
Energy Efficiency Rating	4.5 Stars
Inspection Date	Tuesday, June 9 th 2026
Name of Assessor	Ned Strickland
Reference Number	70418
Address of Property Inspected	70 Tallara Pkwy, Narrabundah ACT 2604
Client	Watkins & Marks
Block and Section	Block 12 Section 101 NARRABUNDAH
House size (approximately)	Residence: 182.59m ² Garage: 44.10m ²
Weather conditions at time of Inspection	Fine
Occupancy Status	Occupied

*The table above is to be used as a quick reference. Please read the full Report before reaching your conclusion regarding the condition of the Property.

Whilst every care has been taken to ensure the accuracy of the property house and block size, we accept no responsibility for any inaccuracies as supplying this information exceeds a standard building inspection under AS4349.1-2007.

PROPERTY CONSTRUCTION DETAILS – RESIDENCE 1

Flooring	Concrete and timber flooring
External walls	Brick veneer
Roof framing	Timber: Truss roof framing
Roof cladding	Concrete roof tiles
Glazing	Single and double-glazed windows
Cooktop	Gas cooktop
Oven	Electric oven
Dishwasher	Bosch

* Whilst every care has been taken to ensure the accuracy of the property construction details, we accept no responsibility for any inaccuracies of construction details or testing of appliances.

GENERAL ACCESS LIMITATIONS – RESIDENCE 1

Internal	At the time of inspection, the building was furnished. This allows for a limited inspection in areas not restricted by furnishings, stored goods, floor mats, etc.
External	A full inspection was carried out to the exterior of the building
Roof void	NOTE. Inspection around the eaves was restricted due to low pitch and clearance to allow bodily access in this area. This allows only for a limited visual inspection from a distance to be carried out. Other restrictions found in the roof void: Insulation on top of ceiling restricting visual inspection of the ceiling framing Ducting flex throughout the roof space restricting access in areas Areas of the roof cavity were not inspected due to low clearances not allowing bodily access
Subfloor	A full inspection was carried out in the subfloor
On-top of roof	The inspection was restricted to visually looking from a 3.6m ladder lent against the gutter in several areas around the building
Garage	The inspection of the garage was restricted due to stored goods being kept in the area at the time of inspection

*Where access is noted as limited or restricted, it is recommended that access be gained to these areas as these areas may contain concealed defects.

DEFINITIONS

Good	The item is in the Inspector's opinion of an acceptable standard with no defects visible. Superficial defects will not be commented on
Fair	The item in the Inspector's opinion has some minor defects and requires minimal maintenance or repair
Poor	The item in the Inspector's opinion needs significant repair or replacement

ENTRANCE

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good

LIVING ROOM

Ceiling	Good
Walls	Good
Floor coverings	Good

KITCHEN/DINING ROOM

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Kitchen cupboards	Good
Bench top	Good
Splashback	Good
Exhaust fan	The exhaust fan was operational at the time of inspection

RUMPUS ROOM

Ceiling	Good
Walls	A moisture meter was used on the wall adjacent the bathroom shower, indicating elevated moisture levels. Recommend further investigation and repairs as required by a qualified tradesperson Addendum 18/06/2026: We have been advised that further investigation and rectification works have been completed by Mr Water Plumbing & Gas. Documentation relating to the completed works has been attached to the rear of the Pest Report for reference.
Door and door hardware	Good
Floor coverings	Good

MASTER BEDROOM

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Wardrobe	Good

BEDROOM 2

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Wardrobe	Good

BEDROOM 3

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Wardrobe	Good

BEDROOM 4

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Wardrobe	Good

ENSUITE

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Shower screen	Good
Water leakage in shower area?	There was no water leakage detected
Floor and wall tiles in shower area	Good
Vanity/Basin	Good
Taps	Good
Toilet suite	Good
Exhaust fan	The exhaust fan was operational at the time of inspection

BATHROOM

Ceiling	Good
Walls	Good
Door and door hardware	Swelling was noted to the lower door jamb. A moisture meter was used at the time of inspection, indicating no moisture present. Recommend monitoring
Floor coverings	Good
Shower screen	A shower curtain has been installed
Water leakage in shower area?	There are indications the shower is leaking due to the elevated moisture levels found in the rumpus room wall. Recommend further investigation and repairs by a qualified tradesperson Addendum 18/06/2026: We have been advised that further investigation and rectification works have been completed by Mr Water Plumbing & Gas. Documentation relating to the completed works has been attached to the rear of the Pest Report for reference.
Floor and wall tiles in shower area	Good
Vanity/Basin	Good
Taps	Good
Bath	Good
Toilet suite	Good
Exhaust fan	The exhaust fan was operational at the time of inspection

LAUNDRY

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Cracked floor tile was noted. The floor is still considered to be in serviceable condition and repairs are optional
Laundry tub	Good
Splashback	Good

ROOF CAVITY

Construction	Good
--------------	------

SUBFLOOR

Subfloor soil conditions	The subfloor soil was generally dry at the time of inspection
Ventilation	Good
Floor structure	A pier under bedroom 4 has slightly subsided. Recommend repairs by a qualified tradesperson Addendum 18/06/2026: We have been advised that the pier has been repacked. Recommend monitoring Areas of water staining were noted to the flooring under the bathroom and ensuite. A moisture meter was used at the time of inspection, indicating no elevated moisture levels. Recommend monitoring. Repairs to the floor were not required at the time of inspection
Access door to subfloor area	Good

EXTERIOR

Driveway and paths	Good. No major cracking noted
Roof covering	Good
Roof pointing	The roof pointing is generally good, however, there are some areas of minor cracking/flaking
Roof flashings	Good
Eaves	Good
Fascia	Good
Gutters	There are signs that the gutters are holding water in areas. Recommend adjusting the gutter brackets to promote the rainwater runoff to drain towards the downpipes
External walls	Good. No major cracking noted
Windows	Good
Fences	Good
Gate	Good
Deck	Good
Retaining walls	Good
Site drainage	The site generally drains away from the perimeter of the building

GARAGE

Slab	Good. No major cracking noted
Ceiling	Good
Walls	Good. No major cracking noted
Garage door	Good
Is an auto opener installed on the roller door?	Yes
Access door	Good

Building Report Residence 2



CONCLUSION AND SUMMARY – RESIDENCE 2

The purpose of the Inspection is to identify the major defects and safety hazards associated with the property at the time of the Inspection. The Inspection and reporting are limited to a visual assessment of the Building Members in accord with Appendix C AS4349.1-2007.

The overall condition of this building has been compared to similar constructed buildings of approximately the same age where those buildings have had a maintenance program implemented to ensure that the building members are still fit for purpose.

The incidence of Major Defects in this Residential Building as compared with similar Buildings is considered: **Low**

The incidence of Minor Defects in this Residential Building as compared with similar Buildings is considered: **Low**

The overall condition of this Residential Dwelling in the context of its age, type and general expectations of similar properties is: **Above Average**

Please Note: This is a general appraisal only and cannot be relied upon on its own – read the Report in its entirety.

This Summary is supplied to allow a quick and superficial overview of the Inspection results. This Summary is NOT the Report and cannot be relied upon on its own. This Summary must be read in conjunction with the full Report and not in isolation from the Report. If there should happen to be any discrepancy between anything in the Report and anything in this Summary, the information in the Report shall override that in this Summary.

PROPERTY STATISTICS – RESIDENCE 2

Building Report	Above Average
Compliance Report	Please read full compliance report section of the report
Pest Inspection	Please read full pest inspection report
Energy Efficiency Rating	6.0 Stars
Inspection Date	Tuesday, June 9 th 2026
Name of Assessor	Ned Strickland
Reference Number	70418
Address of Property Inspected	70 Tallara Pkwy, Narrabundah ACT 2604
Client	Watkins & Marks
Block and Section	Block 12 Section 101 NARRABUNDAH
Year original residence COU was issued	2020
House size (approximately)	Residence: 89.99m ²
Weather conditions at time of Inspection	Fine
Occupancy Status	Unoccupied (furnished/styled)

*The table above is to be used as a quick reference. Please read the full Report before reaching your conclusion regarding the condition of the Property.

Whilst every care has been taken to ensure the accuracy of the property house and block size, we accept no responsibility for any inaccuracies as supplying this information exceeds a standard building inspection under AS4349.1-2007.

PROPERTY CONSTRUCTION DETAILS – RESIDENCE 2

Flooring	Steel framing
External walls	Greenboard cladding, timber cladding and colorbond cladding installed
Roof cladding	Colorbond roof cladding
Glazing	Double glazed windows
Cooktop	Gas cooktop
Oven	Electric oven
Dishwasher	AEG

* Whilst every care has been taken to ensure the accuracy of the property construction details, we accept no responsibility for any inaccuracies of construction details or testing of appliances.

GENERAL ACCESS LIMITATIONS – RESIDENCE 2

Internal	At the time of inspection, the building was furnished. This allows for a limited inspection in areas not restricted by furnishings, stored goods, floor mats, etc.
Roof void	No inspection was made inside the roof cavity due to no available access
Subfloor	A full inspection was carried out in the subfloor
On-top of roof	The inspection was restricted to visually looking from a ladder lent against the gutter in several areas around the building

*Where access is noted as limited or restricted, it is recommended that access be gained to these areas as these areas may contain concealed defects.

DEFINITIONS

Good	The item is in the Inspector's opinion of an acceptable standard with no defects visible. Superficial defects will not be commented on
Fair	The item in the Inspector's opinion has some minor defects and requires minimal maintenance or repair
Poor	The item in the Inspector's opinion needs significant repair or replacement

KITCHEN/LIVING ROOM

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Kitchen cupboards	Good
Bench top	Good
Splashback	Good
Exhaust fan	The exhaust fan was operational at the time of inspection

BEDROOM 1

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Wardrobe	Good

BEDROOM 2

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Wardrobe	Good

ENSUITE

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Shower screen	Good
Water leakage in shower area?	There was no water leakage detected
Floor and wall tiles in shower area	Good
Vanity/Basin	Good
Taps	Good
Toilet suite	Good
Exhaust fan	The exhaust fan was operational at the time of inspection

BATHROOM

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Shower screen	Good
Water leakage in shower area?	There was no water leakage detected
Floor and wall tiles in shower area	Good
Vanity/Basin	Good
Taps	Good
Toilet suite	Good
Exhaust fan	The exhaust fan was operational at the time of inspection

LAUNDRY

Ceiling	Good
Walls	Good
Floor coverings	Good
Laundry tub	Good
Splashback	Good
Exhaust fan	The exhaust fan was operational at the time of inspection

SUBFLOOR

Subfloor soil conditions	The subfloor soil was generally dry at the time of inspection
Ventilation	Good
Floor structure	Good

EXTERIOR

Roof covering	Good
Roof flashings	Good
Eaves	Good
Fascia	Good
Gutters	Good
External walls	Weathering noted to the timber cladding. Recommend re-painting the affected areas.
Windows	Good
Site drainage	The site generally drains away from the perimeter of the building

DEFINITIONS

Above Average: The overall condition is above that consistent with dwellings of approximately the same age and construction. Most items and areas are well maintained and show a reasonable standard of workmanship when compared with buildings of similar age and construction.

Average: The overall condition is consistent with dwellings of approximately the same age and construction. There will be areas or items requiring some repair or maintenance.

Below Average: The Building and its parts show some significant defects and/or very poor non- tradesman like workmanship and/or long-term neglect and/or defects requiring major repairs or reconstruction of major building elements.

Client: The person or persons, for whom the Inspection Report was carried out or their Principal (i.e., the person or persons for whom the report is being obtained).

Building Consultant: A person, business or company who is qualified and experienced to undertake a pre-purchase inspection in accordance with Australian Standard AS 4349.1-2007 'Inspection of Buildings. Part 1: Pre-Purchase Inspections – Residential Buildings'. The consultant must also meet any Government licensing requirement, where applicable.

Building & Site: The inspection of the nominated residence together with relevant features including any car accommodation, detached laundry, ablution facilities and garden sheds, retaining walls more than 700 mm high, paths and driveways, steps, fencing, earth, embankments, surface water drainage and storm water run-off within 30 m of the building, but within the property boundaries. In the case of strata and company title properties, the inspection is limited to the interior and immediate exterior of the nominated residence and does not include inspection of common property.

Readily Accessible Areas: Areas which can be easily and safely inspected without injury to person or property, are up to 3.6 metres above ground or floor levels or accessible from a 3.6 metre ladder, in roof spaces where the minimum area of accessibility is not less than 600 mm high by 600 mm wide and subfloor spaces where the minimum area of accessibility is not less than 400 mm high by 600 mm wide, providing the spaces or areas permit entry. Or where these clearances are not available, areas within the consultant's unobstructed line of sight and within arm's length.

Structure: The loadbearing part of the building, comprising the Primary Elements.

Primary Elements: Those parts of the building providing the basic loadbearing capacity to the Structure, such as foundations, footings, floor framing, loadbearing walls, beams, or columns. The term 'Primary Elements' also includes other structural building elements including those that provide a level of personal protection such as handrails; floor-to-floor access such as stairways; and the structural flooring of the building such as floorboards.

Secondary Elements: Those parts of the building not providing loadbearing capacity to the Structure, or those non-essential elements which, in the main, perform a completion role around openings in Primary Elements and the building in general such as non-loadbearing walls, partitions, wall linings, ceilings, chimneys, flashings, windows, glazing or doors.

Finishing Elements: The fixtures, fittings and finishes applied or affixed to Primary Elements and Secondary Elements such as baths, water closets, vanity basins, kitchen cupboards, door furniture, window hardware, render, floor, and wall tiles, trim or paint. The term 'Finishing Elements' does not include furniture or soft floor coverings such as carpet and lino.

Major Defect: A defect of significant magnitude where rectification has to be carried out in order to avoid unsafe conditions, loss of utility or further deterioration of the property.

Minor Defect: A defect other than a Major Defect.

Safety Hazard: Any item that may constitute an immediate or imminent risk to life, health, or property. Occupational, health and safety or any other consequence of these hazards has not been assessed.

Tests: Where appropriate the carrying out of tests using the following procedures and instruments:

Dampness Tests means additional attention to the visual examination was given to those accessible areas which the consultant's experience has shown to be particularly susceptible to damp problems. Instrument testing using electronic moisture detecting meter of those areas and other visible accessible elements of construction showing evidence of dampness was performed.

Physical Tests means the following physical actions undertaken by the consultant: opening and shutting of doors, windows and draws; operation of taps; water testing of shower recesses; and the tapping of tiles and wall plaster.

IMPORTANT ADVICE

NB. In the case of strata and company title properties, the Inspection is limited to the interior and immediate exterior of the particular unit being inspected. The exterior above ground floor level is not inspected. The complete Inspection of other common property areas would be the subject of a Special-Purpose Inspection Report which is adequately specified.

Trees: Where trees are too close to the house this could affect the performance of the footing as the moisture levels change in the ground. A Geotechnical Inspection can determine the foundation material and provide advice on the best course of action with regards to the trees.

The Septic Tanks: Should be inspected by a licensed plumber.

Swimming Pools: Swimming Pools/Spas are not part of the Standard Building Report under AS4349.1-2007 and are not covered by this Report. We strongly recommend a pool expert should be consulted to examine the pool and the pool equipment and plumbing, as well as the requirements to meet the standard for pool fencing. Failure to conduct this Inspection and put into place the necessary recommendations could result in finds for non-compliance under the legislation.

Surface Water Drainage: The retention of water from surface run off could have an effect on the foundation material which in turn could affect the footings to the house. Best practice is to monitor the flow of surface water during rainfall and stormwater runoff and have the water directed away from the house or to storm water pipes by a licensed plumber/drainier.

Weep Holes: External brick (and stone) walls are a porous material that behave much like a sponge. During a rain event, the masonry wall absorbs water and actually stores it. The weep holes are designed for two purposes. 1. To provide an opening to allow water to drain out through the bottom of the wall. 2. To allow ventilating air to enter behind the wall to help dry the structure. If weep holes have been noted as being not installed, it is recommended to consult a builder on how to best rectify the problem.

Water Leaks from Roof: The inspector cannot, and does not, offer an opinion on whether the roof currently leaks or may be subject to future leaks. The only way to determine whether a roof is absolutely watertight is to make observations during prolonged rainfall.

Subfloor dampness: The presence of dampness is not always consistent as the prevailing and recent weather conditions at the time an inspection is carried out may affect the detection of damp problems. The absence of any dampness at the time of inspection does not necessarily mean the building will not experience some damp problems in other weather conditions. Likewise, whether or not services have been used for some time prior to an inspection being carried out will affect the detection of dampness.

Shower: Where a shower recess has been water tested, and no leakage was evident, this does not necessarily mean that the shower will not leak after prolonged use. Accordingly, to fully detect and assess a damp problem may require the monitoring of the building over a period of time.

SCOPE AND LIMITATIONS

Any person who relies upon the contents of this Report does so acknowledging that the following clauses, which define the Scope and Limitations of the Inspection, form an integral part of the Report.

1) This Report is not an all-encompassing Report dealing with the building from every aspect. It is a reasonable attempt to identify any obvious or significant defects apparent at the time of the Inspection. Whether or not a defect is considered significant or not, depends to a large extent upon the age and type of the building inspected. This Report is not a Certificate of Compliance with the requirements of any Act, Regulation, Ordinance or By-law. It is not a structural Report. Should you require any advice of a structural nature you should contact a structural engineer.

2) This is a visual Inspection only, limited to those areas and sections of the property fully accessible and visible to the Inspector on the date of Inspection. The Inspection DID NOT include breaking apart, dismantling, removing, or moving objects including, but not limited to, foliage, mouldings, roof insulation/sisalation, floor or wall coverings, sidings, ceilings, floors, furnishings, appliances, or personal possessions. The inspector CANNOT see inside walls, between floors, inside skillion roofing, behind stored goods in cupboards and other areas that are concealed or obstructed. The inspector DID NOT dig, gouge, force or perform any other invasive procedures. Visible timbers CANNOT be destructively probed or hit without the written permission of the property owner.

3) This Report does not and cannot make comment upon: Defects that may have been concealed; the assessment or detection of defects (including rising damp and leaks) which may be subject to the prevailing weather conditions; whether or not services have been used for some time prior to the Inspection and whether this will affect the detection of leaks or other defects (e.g. In the case of shower enclosures the absence of any dampness at the time of the inspection does not necessarily mean that the enclosure will not leak); the presence or absence of timber pests; gas-fittings; common property areas; environmental concerns; the proximity of the property to flight paths, railways, or busy traffic; noise levels; health and safety issues; heritage concerns; security concerns; fire protection; site drainage (apart from **surface** water drainage); swimming pools and spas (non-structural); detection and identification of illegal building work; detection and identification of illegal plumbing work; durability of exposed finishes; neighbourhood problems; document analysis; electrical installation; any matters that are solely regulated by statute; any area(s) or item(s) that could not be inspected by the consultant.

Accordingly, this Report is NOT a guarantee that defects and/or damage does not exist in any inaccessible or partly inaccessible areas or sections of the property.

NB. Such matters may, upon request, be covered under the terms of a 'Special-Purpose Property Report'.

4) Consumer Complaints Procedure: In the event of any dispute or claim arising out of, or relating to the Inspection or the Report, you must notify us as soon as possible of the dispute or claim by email, fax, or mail. You must allow us (which includes persons nominated by us) to visit the property (which visit must occur within twenty eight (28) days of your notification to us) and give us full access in order that we may fully investigate the complaint. You will be provided with a written response to your dispute or claim within twenty-eight (28) days of the date of the Inspection.

If you are not satisfied with our response, you must within twenty one (21) days of your receipt of our written response, refer the matter to a Mediator nominated by us from the Institute of Arbitrators and Mediators of Australia. The cost of the Mediator will be borne equally by both parties, and as agreed as part of the mediated settlement.

Should the dispute or claim not be resolved by mediation, then the dispute or claim will proceed to arbitration. The Institute of Arbitrators and Mediators of Australia will appoint an Arbitrator who will hear and resolve the dispute. The arbitration, subject to any directions of Arbitrator, will proceed in the following manner:

(a) The parties must submit all written submissions and evidence to the Arbitrator within twenty one (21) days of the appointment of the Arbitrator; and

(b) The arbitration will be held within twenty one (21) days of the Arbitrator receiving the written submissions.

The Arbitrator will make a decision determining the dispute or claim within twenty one (21) of the final day of the arbitration. The Arbitrator may, as part of his determination, determine what costs, if any, each of the parties are to pay and the time by which the parties must be paid any settlement or costs.

The decision of the Arbitrator is final and binding on both parties. Should the Arbitrator order either party to pay any settlement amount or costs to the other party but not specify a time for payment, then such payment shall be made within twenty one (21) days of the order.

NB. In the event that you do not comply with the above Complaints Procedure and commence litigation against us, then you agree to fully indemnify us against any awards, costs, legal fees, and expenses incurred by us in having your litigation set aside or adjourned to permit the foregoing Complaints Procedure to complete.

5) Asbestos Disclaimer: “No Inspection for Asbestos was carried out at the property, and no Report on the presence or absence of Asbestos is provided”.

Buildings built prior to 1982 may have wall and/or ceiling sheeting, and other products including roof sheeting that contains Asbestos. Even buildings built after this date, up until the early 90s, may contain some Asbestos. Sheeting should be fully sealed. If you are concerned, the building was built prior to 1990, or if asbestos is noted as present within the property, then you should seek advice from a qualified asbestos removal expert as to the amount and importance of the asbestos present and the cost of sealing or removal. Drilling, cutting, or removing sheeting or products containing Asbestos is a high risk to peoples’ health. You should seek advice from a qualified asbestos removal expert.

6) Mould (Mildew and non-wood decay fungi) Disclaimer: Mildew and non-wood decay fungi are commonly known as mould. However, mould and their spores may cause health problems or allergic reactions, such as asthma and dermatitis in some people. No Inspection for mould was carried out at the property, and no Report on the presence or absence of mould is provided. If mould is noted as present within the property, or if you notice mould and you are concerned as to the possible health risk resulting from its presence, then you should seek advice from your local Council, State or Commonwealth Government Health Department, or a qualified expert such as an Industry Hygienist.

7) Magnesite Flooring Disclaimer: No Inspection for Magnesite Flooring was carried out at the property, and no Report on the presence or absence of Magnesite Flooring is provided. You should ask the owner whether Magnesite Flooring is present and/or seek advice from a Structural Engineer.

8) Estimating Disclaimer: Any estimates provided in this Report are merely opinions of possible costs that could be encountered, based on the knowledge and experience of the inspector, and are not estimates in the sense of being a calculation of the likely costs to be incurred. The estimates are NOT a guarantee or quotation for work to be carried out. The actual cost is ultimately dependent upon the materials used, standard of work carried out, and what a contractor is prepared to do the work for. It is recommended in ALL instances that multiple independent quotes are sourced prior to any work being carried out. The inspector accepts no liability for any estimates provided throughout this Report.

9) Note: If the Client has any doubt about the purpose, scope, and acceptance criteria on which the Report was based please discuss your concerns with the Consultant on receipt of the Report. The Client acknowledges that, unless stated otherwise, the Client as a matter of urgency should implement any recommendation or advice given in this Report.

IMPORTANT DISCLAIMER

Disclaimer Liability: No Liability shall be accepted on an account of failure of the Report to notify any problems in the area(s) or section(s) of the subject property physically inaccessible for Inspection, or to which access for Inspection is denied by or to the Inspector (including but not limited to or any area(s) or section(s) so specified by the Report).

Disclaimer of Liability to Third Parties: Compensation will only be payable for losses arising in contract or tort sustained by the Client named on the front of this Report. Any third party acting or relying on this Report, in whole or in part, does so entirely at their own risk. However, if ordered by a Real Estate Agent or a Vendor for the purpose of auctioning a property, then the Inspection Report may be ordered up to seven (7) days prior to the auction, copies may be given out prior to the auction and the Report will have a life of 14 days during which time it may be transferred to the purchaser. Providing the purchaser agrees to the terms of this agreement, then they may rely on the Report subject to the terms and conditions of this agreement and the Report itself.

NB. In the ACT under the Civil Law (Sale of Residential Property) Act 2003 and Regulations, the Report resulting from this Inspection may be passed to the purchaser as part of the sale process, providing it is carried out no more than three months prior to listing and is not more than six months old.

Limited Liability to a Purchaser within the Australian Capital Territory only: Within the Australian Capital Territory (ACT) and in accordance with the ACT Civil Law (Sale of Residential Property) Act 2003 and Regulations, a copy of the Report may be attached to the Contract for Sale.

WARNING: The Purchaser is advised that this Report reflects the condition of the property existing at the time of the Inspection (Inspection Date) and may not reflect the current state. It is, therefore, very strongly recommended that you promptly arrange for another Inspection and Report in accordance with Australian Standard AS4349.1 to be carried out prior to the expiration of the 'Cooling off Period' and settlement.

This is not a Compliance Report strictly in accordance with Civil Law (Sale of Residential Property) Regulations: The Report may contain copies of any approved plans, building approvals, building permit and Certificates of Occupancy. However, any comments made by the person who prepared the Report as to whether or not, in the opinion of the Inspector, the structures on the land substantially comply with the approved plans (if any) are made on the basis of a cursory glance of the plans and not upon a detailed examination. Any opinion expressed as to whether or not any building approval or approval under the Land (Planning and Environment) Act, 1991, is based on the limited knowledge and belief, at the time, of the Inspector. The Purchaser is advised that a Special Purpose Report is available through the Inspector to advise more fully in respect to these matters. The structures may have been damaged by pests, storm, strong wind or fire or the Vendor may have carried out alterations and/or additions to the Property since the Inspection Date. The Report may no longer reflect the true condition of the Property. The structure(s) may no longer be in accordance with the attached plans etc. IT IS STRONGLY RECOMMENDED that, if the Purchaser has any concerns in respect to the compliance of the structures, a Special Purpose Report be obtained. Alternatively, the Purchaser should rely upon his, her or their own enquiries.

Contact the Inspector: Please feel free to contact the Inspector who carried out this Inspection. Often it is very difficult to fully explain situations, problems, access difficulties, building faults or their importance in a manner that is readily understandable by the reader. Should you have any difficulty in understanding anything contained within this Report, then you should immediately contact the Inspector and have the matter explained to you. If you have any questions at all, or require any clarification, then contact the Inspector prior to acting on this Report.

OTHER INSPECTIONS AND REPORTS REQUIRED

It is strongly recommended that the following Inspections and Reports be obtained prior to any decision to purchase the Property. Obtaining these Reports will better equip the purchaser to make an informed decision. Although appliances may be listed in the Report, they have not been tested as this is outside the scope of the standard Building Inspection. Other Inspections we recommend the purchaser obtains before making their decision are:

- Electrical Inspection,
- Plumbing Inspection,
- Structural (Engineer),
- Geotechnical Inspection,
- Drainage Inspection,
- Asbestos Inspection,
- Mould Inspection,
- Gas fitting Inspection,
- Appliances Inspection,
- Air-conditioning Inspection,
- Alarm/Intercom/Data Systems,
- Hydraulics Inspection,
- Mechanical Services,
- Hazards Inspection,
- Fire/Chimney Inspection,
- Estimating Report,
- Garage Door Mechanical,
- Durability exposed surfaces

SMOKE DETECTORS

The occupier/purchaser should satisfy themselves as to the working condition of the smoke detectors, if installed. It is highly recommended that suitable smoke detectors be installed in all residential properties. AS 3786 advises that smoke detectors are required for all buildings where people sleep. It is recommended that an electrician be consulted to advise on those installed or install these detectors.

CRACKING OF BUILDING ITEMS

Regardless of the type of crack(s), a Pre-Purchase Building Inspector carrying out a Pre-Purchase Inspection within the scope of a visual Inspection is unable to determine the expected consequences of the cracks.

Obtaining Information regarding the below all fall outside the scope of this Pre-Purchase Inspection:

- (a)** The nature of the foundation material on which the building is resting,
- (b)** The design of the footings,
- (c)** The site landscape,
- (d)** The history of the cracks and,
- (e)** Carrying out an invasive Inspection.

However, the information obtained from the five items above is valuable in determining the expected consequences of the cracking and any remedial work needed. Cracks that are small in width and length on the day of the Inspection may have the potential to develop over time into structural problems for the homeowner, resulting in major expensive rectification work being carried out. If cracks have been identified in the Report above, then a Structural Engineer is required to determine the significance of the cracking prior to a decision to purchase.

NOTICE TO THE PURCHASER (ACT ONLY)

(a) At the Exchange, and prior to the 'Cooling-off Period', you were given an Inspection Report on the property you intend on purchasing. This Report reflects the condition of the property existing at the time of the Inspection (Inspection Date) and may not reflect the current state. The structures may have been damaged by pests, storm, strong wind or fire or the vendor may have carried out alterations and/or additions to the property since the Inspection date. The Report may no longer reflect the true condition of the property. The structure(s) may no longer be in accordance with the attached plans etc. It is, therefore, very strongly recommended that you urgently arrange for another Inspection and Report in accordance with Australian Standard AS 4349.1 to be carried out prior to exchange, or prior to the expiration of any 'Cooling Off Period' and prior to settlement.

(b) If the Report indicated the presence of termite damage, or recommends any other Inspections or treatments, you should obtain copies of these Reports and any treatment proposals, certificates of treatment carried out, including details of all repairs including copies of quotations, invoices, and any other Reports. It is strongly recommended that you arrange for an Inspection and Report in accordance with AS 4349.3 to verify that the treatment has been successful and carried out in accordance with AS 3660.2, and a further building Inspection in accordance with AS 4349.1.

(c) If you fail to procure a further Inspection and Report as recommended in (a) and (b), or fail to obtain copies of other Reports, treatment proposals, certificates of treatment carried out, details of all repairs including copies of quotations, invoices and any other Reports as recommended in (b) above, then you agree that you have decided not to have a further Inspection and Report carried out, or to obtain copies of treatment proposals, certificates of treatment carried out, details of all repairs including copies of quotations, invoices and any other Reports and have relied upon your own enquires and the Report, knowing the possible consequences, and that the condition of the property, as stated in the Report, may have changed.

(d) You agree that the person carrying out the Inspection **and** the company, partnership or sole trader that employs that person will have no liability to you for any damage or loss you may suffer as a result of your entering the contract to purchase the property, or in connection with completing the purchase of the property as a result of your failure to heed the advice given in (a) and (b) and the warning contained in (c) above, and may use such failure in defense of any claim that you may later make against any of them.

NB. It is a condition of your right to rely upon the Report that you transmit by fax, post, or otherwise deliver the signed "Notice to the Purchaser" (ACT only) to the company, partnership or sole trader at the address detailed on the front of the Report not less than four (4) days prior to the date of settlement. If you fail to complete, sign, or deliver the Notice then it will be deemed that you did not rely upon the report in respect to your decision as to whether or not to purchase the property. This may seriously affect any rights to future compensation to which you may be entitled.

Please cross out the statement below that does not apply: - At the date of settlement, not more than 180 days will have elapsed since the Inspection date.


1. I/We have read and understood the 'Limited Liability to a Purchaser within the Australian Capital Territory only' clause of the Report, and this Notice to the Purchaser. I/We have not arranged for another inspection and report in respect of the property, and it is my/our intention to **rely upon the findings contained in the report**; or

2. I/We have **arranged for another Inspection of the Property and Report** to be carried out, which I/We will use in conjunction with this Report in deciding whether to proceed with the purchase of the property; or

3. I/We have read and understood the 'Limited Liability to a Purchaser within the Australian Capital Territory only' clause of the Report, and this Notice to the Purchaser. I/We have not arranged for another Inspection and Report in respect of the property and have **relied on my/our own enquiries in respect of the condition of the property** as at the date of settlement including any changes in the condition of the property that have taken place since the Inspection date stated in the Report

Timber Pest Report

Residence 1

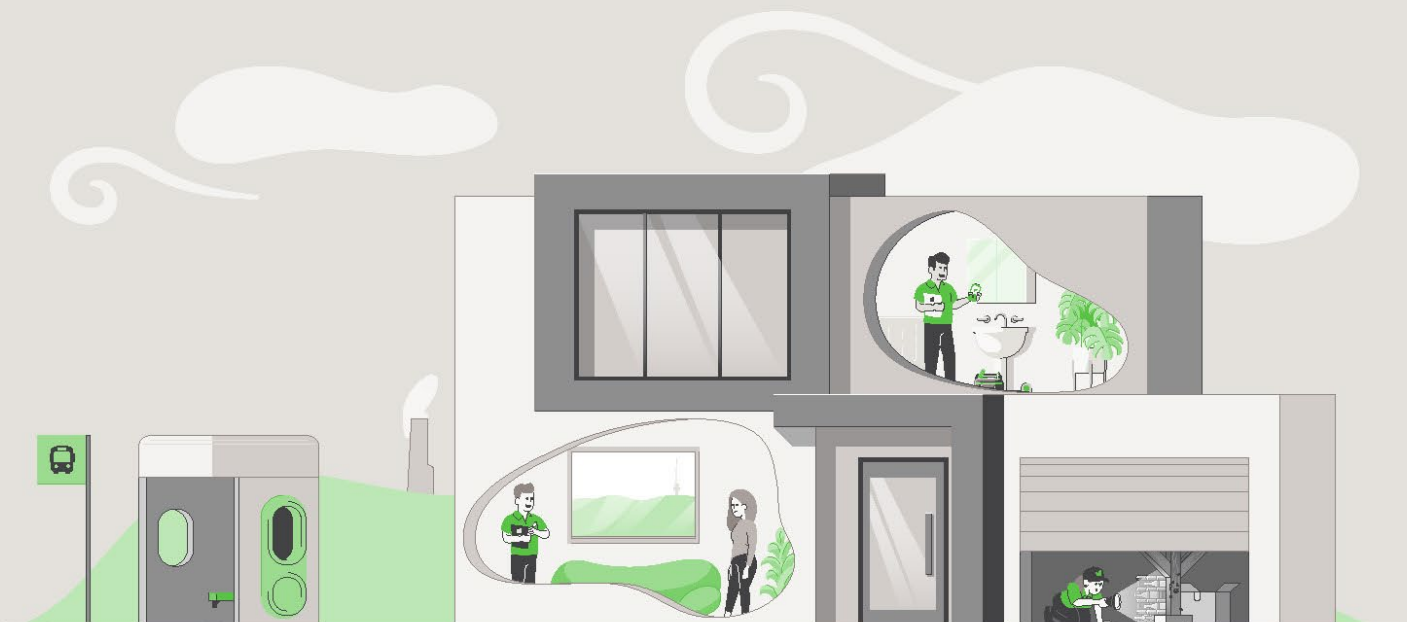

SUMMARY SHEET – RESIDENCE 1

Property Address: 70 Tallara Pkwy, Narrabundah ACT 2604
Client: Watkins & Marks
Inspection Date: Tuesday, June 9th 2026
Inspection carried out by: Ben Halse

This summary is supplied to allow a quick and superficial overview of the Inspection results. This summary is NOT the Report and cannot be relied upon on its own. This summary must be read in conjunction with the full Report and not in isolation from the Report. If there should happen to be any discrepancy between anything in the Report, and anything in this summary, the information in the Report shall override that in the summary. The Report is subject to conditions and limitations. Your attention is particularly drawn to the clauses, disclaimer of liability to third parties, limited liability to a purchaser with the Australian Capital Territory (ACT), and to the notice to the purchaser at the back of this Report.

1.0 ACCESS LIMITATIONS

There were access limitations to the inspection/report. Please refer to section 1.0 of the report.

2.0 TERMITE ACTIVITY

No active subterranean termites (live specimens) were found.

Visible evidence of subterranean termite workings or damage was found. Please refer to Section 2.0 of the Pest Report for further information.

3.0 BORER ACTIVITY

No visible evidence of borers of seasoned timbers was found.

4.0 DECAY FUNGI

Evidence of timber wood decay was found. Please refer to Section 4.0 of the Pest Report.

For complete and accurate information, please refer to the attached 'Visual Timber Pest Report', which is prepared in accordance with AS 4349.3.

CONDITIONS OF THIS INSPECTION

Important Information:

Any person who relies upon the contents of this Report does so acknowledging that the following clauses, which define the scope and limitations of the Inspection, form an integral part of the Report.

This is a **Visual Inspection Only**, prepared in accordance with AS 4349.3, 'Inspection of Buildings Part 3: Timber Pest Inspections'. Visual Inspection was limited to those areas and sections of the property to which reasonable access (see definition) was both available and permitted on the date of Inspection.

The Inspection **did not** include breaking apart, dismantling, removing, or moving objects including but not limited to – foliage, mouldings, roof insulation/sisalation, floor or wall coverings, sidings, ceilings, floors, furnishings, appliances, or personal possessions.

The Inspector **cannot** see inside walls, between floors, inside skillion roofing, inside the eaves, behind stored goods in cupboards, or in any other areas that are concealed or obstructed.

The Inspector **did not** dig, gouge, force or perform any other invasive procedures. An invasive Inspection will not be performed unless a separate contract is entered into.

In an occupied property, it must be understood that furnishings or household items may be concealing evidence of Timber Pests, which may only be revealed when the items are moved or removed.

In the case of strata type properties, only the interior of the unit is inspected.

Scope of Report:

This Report only deals with the detection or non-detection of Timber Pest Attack and Conditions Conducive to Timber Pest Attack discernible at the time of inspection. The inspection was limited to the Readily Accessible Areas of the Building and Site (see note below) and was based on a visual examination of surface work (excluding furniture and stored items), and the carrying out of Tests. Note. With strata and company title properties, the inspection was limited to the interior and the immediate exterior of the particular residence inspected. Common property was not inspected.

Limitations:

The Client acknowledges:

(a) This Report does not include the inspection and assessment of matters outside the scope of the requested inspection and report.

(b) The inspection only covered the Readily Accessible Areas of the Building and Site. The inspection did not include areas which were inaccessible, not readily accessible or obstructed at the time of inspection. Obstructions are defined as any condition or physical limitation which inhibits or prevents inspection and may include – but are not limited to – roofing, fixed ceilings, wall linings, floor coverings, fixtures, fittings, furniture, clothes, stored articles/materials, thermal insulation, sarking, pipe/duct work, builder's debris, vegetation, pavements, or earth.

(c) The detection of dry wood termites may be extremely difficult due to the small size of the colonies. No warranty of absence of these termites is given.

(d) European House Borer (*Hylotrupes bajulus*) attack is difficult to detect in the early stages of infestation as the galleries of boring larvae rarely break through the affected timber surface. No warranty of absence of these borers is given. Regular inspections including the carrying out of appropriate tests are required to help monitor susceptible timbers.

(e) This is not a structural damage report. Neither is this a warranty as to the absence of Timber Pest Attack.

(f) If the inspection was limited to any particular type(s) of timber pest (e.g., subterranean termites), then this would be the subject of a Special-Purpose Inspection Report, which is adequately specified.

(g) This Report does not cover or deal with environmental risk assessment or biological risks not associated with Timber Pests (e.g., toxic Mould) or occupational, health or safety issues. Such advice may be the subject of a Special-Purpose Inspection Report which is adequately specified and must be undertaken by an appropriately qualified inspector. The choice of such inspector is a matter for the Client.

(h) This Report has been produced for the use of the Client. The Consultant or their firm or company are not liable for any reliance placed on this report by any third party, except as provided in the section Limited Liability To a Purchaser within the Australian Capital Territory.

Determining extent of Damage:

This is not a structural building report, and any inexperienced opinion we provide on timber damage cannot be relied upon. This Report **will not** state the full extent of any Timber Pest damage. It will state Timber Pest Damage found as either 'slight', 'moderate', 'moderate to extensive', or 'extensive', and this information is not the opinion of an expert. If any evidence of Timber Pest activity and/or damage resulting from Timber Pest activity is reported, either in the structure(s) or the grounds of the property, then you must assume that there may be concealed structural damage within the building(s).

This concealed damage may only be found when wall linings, cladding or insulation are removed to reveal previously concealed timbers. In this case, an Invasive Timber Pest Inspection (for which a separate contract is required) is strongly recommended, and you should arrange for a qualified professional such as a builder, engineer, or architect to carry out a structural inspection to determine the full extent of the damage, and the extent of repairs that may be required. You agree that neither we, nor the individual conducting the inspection, are responsible or liable for the repair of any damage, whether disclosed by the Report or not.

Disclaimer of Liability:

No liability shall be accepted on account of failure of the Report to notify any termite activity and/or damage present at, or prior to, the date of the Report, in any area(s) or section(s) of the subject property physically inaccessible for inspection, or to which access for inspection is denied by, or to, the licensed inspector (including, but not limited to, any area(s) or section(s) specified by the Report).

1.0 ACCESS LIMITATIONS

1.1 Area(s) inspected:

Only structures, fences &/or trees within 50m of the building but within the property boundaries were inspected.

1.2 Common area(s) not inspected:

No Inspection was made, and no Report will be submitted, of inaccessible area(s).

These include, but may not be limited to; cavity walls, concealed frame timbers, eaves, flat roofs, fully enclosed patios, inaccessible parts of the subfloors, inaccessible parts of the roof void, soil concealed by concrete floors, fireplace hearths, wall linings, landscaping, rubbish, floor coverings, furniture, pictures, appliances, stored items, insulation, and hollow blocks/posts etc.

1.3 Area(s) in which visual inspection was obstructed or restricted and why:

Ceiling framing timbers were concealed by insulation. Clothing and other stored items concealed timbers in cupboards and built in robes/closets. Furniture and stored items concealed some of the skirting boards and architraves inside the house. Ducting flex throughout the roof space restricting access in areas. No access was gained through areas of the roof cavity of due to low clearances.

NB. Please note that since a complete Inspection of the above area(s) was not possible, Timber Pest activity and/or damage may exist in these areas.

1.4 The property was furnished at the time of inspection.

Where a property is furnished at the time of Inspection, it must be understood that the furnishings and stored goods may be concealing evidence of Timber Pest activity. This evidence may be revealed when the property is vacated, and a further Inspection of the vacant property is strongly recommended if the house was furnished at the time of inspection.

1.5 Undetected timber pest risk assessment is considered Moderate.

NB. Where the risk is considered “Moderate” or “Moderate-High” or “High”, a further inspection is strongly recommended of areas that were not readily accessible, and of inaccessible or obstructed areas once access has been provided or the obstruction removed. This may require the moving, lifting or removal of obstructions such as floor coverings, furniture, stored items foliage and insulation. In some instances, it may also require the removal of ceiling and wall linings, and the cutting of traps and access holes. Seek further advice from your Consultant.

2.0 TERMITE ACTIVITY

2.1 No active (live) termites were present at the time of Inspection.

2.2 Visible evidence of subterranean termite workings and/or damage was found in the left side timber fence and the power pole to the front of the residence.

2.3 A termite nest was not found.

2.4 Evidence of minor timber damage was visible.

NB. Where evidence of termite activity by the *Nasutitermes* or *Coptotermes* species was found in the grounds, the risk to buildings is very high. A treatment to eradicate the termites and to protect the building(s) should be carried out. Where the evidence of termite workings was found in the grounds or the building(s), then the risk of a further attack is very high.

2.5 Very important:

If live termites or any evidence of termite workings or damage was reported above, within the building(s) or in the grounds and fences, then it must be assumed that there may be concealed termite activity and/or timber damage. This concealed activity or damage may only be found when alterations are carried out, such as when wall linings, cladding or insulation are removed; or if you arrange for an invasive Inspection. We claim no expertise in structural engineering or building, and we strongly recommend that you have a qualified professional such as a builder, engineer, architect, or other qualified expert determine the full extent of the damage, if any. This may require an invasive Inspection. We take no responsibility for the repair of any damage, whether disclosed by this Report or not (see 'Terms and Limitations').

Where visual evidence of termite workings and/or damage is reported above, but no live termites were present at the time of Inspection, you must realise that it is possible that termites are still active in the immediate vicinity, and that the termites may continue to cause further damage. It is not possible, without further investigation and a number of Inspections over a period of time, to ascertain whether any infestation is active or inactive. Active termites may simply have not been present at the time of Inspection due to a prior disturbance or climatic conditions, or they may have been utilizing an alternative feeding source.

Continued, regular Inspections are essential. Unless written evidence of a termite protection program in accordance with 'AS 3660' with ongoing Inspections is provided, you must arrange for a treatment in accordance with 'AS 3660' to be carried out to reduce the risk of further attack.

2.6 Previous termite treatment: There were no signs of a termite treatment or evidence of a possible previous termite treatment, at the time of inspection.

NB. If there is evidence of drill holes in concrete or brickwork, bait stations or other signs of a possible previous treatment are reported, then the treatment was probably carried out because of an active termite attack. Extensive structural damage may exist in concealed areas. You should have an invasive Inspection carried out, and have a builder determine the full extent of any damage, and the estimated cost of repairs, as the damage may only be found when wall linings etc. are removed. Normally, if a termite treatment has been carried out, then a durable notice should be located in the metre box, indicating the type of termite shield system, treated zone or combination that has been installed.

2.7 Termite management: A durable notice (termite management notice) was not found during the inspection, indicating a barrier system has not been installed.

This firm can give no assurances with regard to work that may have been previously performed by other firms. You should obtain copies of all paperwork and make your own enquiries as to the quality of the treatment when it was carried out, and warranty information. In most cases, you should arrange for a treatment in accordance with "Australian Standard 3660" to be carried out to reduce the risk of further attack.

2.8 General remarks:

Where any current visible evidence of Timber Pest activity is found, it is strongly recommended that a more invasive Inspection be performed. Trees on and near the property up to a height of 2 metres, have been visually Inspected where possible and practicable, for evidence of Termite activity. It is very difficult to locate termite nests since they are underground, and evidence in trees is usually well concealed. Therefore, we strongly recommend that you arrange to have the medium to large eucalypt trees within a 50 metre radius of the property test drilled for evidence of termite nests.

3.0 BORER ACTIVITY

3.1 No visible evidence of borers was found.

The **Lyctid Borer** - The most common lyctid borer in Australia is **Lyctus brunneus (powder post beetle)**. Attack usually takes place during the first six to twelve months of the service life of timber. However, the powder post beetle is not considered a significant pest of timber and treatment of infestation is not usually required. As only the sapwood of certain hardwoods is destroyed, larger-dimensional timbers (such as rafters, bearers, and joists) in a building are seldom weakened significantly to cause collapse. The **Anobiid Borer** There are many different species of Anobiid borer, the most frequently encountered being *Anobium punctatum* (furniture beetle) and *Calymnaderus incisus* (Queensland pine beetle). Attack mainly occurs to softwoods especially pine timbers such as floorboards that have been in service for at least ten years. Should any structural timbers be attacked by Anobiid borers it is often difficult to determine what extent the borer damage has weakened such timbers and replacement is often the only way of ensuring safety from collapse.

In the case of Anobiid borers, once an attack is initiated it is unlikely to cease or die out of its own accord without some sort of eradication treatment. Therefore, unless proof of treatment is provided, evidence of an attack must always be considered active. Although a chemical treatment is an option, replacement of infested timbers with non-susceptible, or treated timber, is the most effective method of treatment. Before any option is considered, competent advice (e.g., from a licensed building contractor) should be sought to determine the extent of any structural damage, and as to the need or otherwise for rectification or repair work.

Other Borers: A further (more invasive) investigation is strongly recommended to determine whether infestation is still active and to positively identify the borer species responsible for the attack. Always seek further advice from the Consultant.

Management Program: Wherever practical, remove any conditions conducive to attack (e.g., *Anobium* borer thrive in badly ventilated subfloor areas). Regular inspections are recommended at intervals not exceeding 12 months. Always seek further advice from the Consultant.

4.0 DECAY FUNGI

4.1 Evidence of damage caused by wood decay (rot) fungi was found.

- Timber decay was found in areas of the timber fence.

NB. If any evidence of fungal decay or damage is reported, you should consult a building expert to determine the full extent of damage, and the estimated cost of repairs or timber.

General Description of Attack Decaying wood contains sufficient moisture to retain its original shape and may have sufficient strength to withstand normal loads. In contrast decayed wood is reduced both in moisture content and size as indicated by cracking either along or across the grain or fibres coming apart in a stringy manner. Decayed wood will have undergone considerable strength reduction.

Economic Significance Fungal decay can cause at one extreme, structural failure of the affected timber, and at the other purely superficial surface damage. The most critical determination is that of which timber is affected and decaying because decay will most likely spread (unless sources of moisture are quickly removed). Affected and decayed timber may warrant timber replacement, but the rot should not spread unless a new moisture source becomes available in that area.

Where evidence of decayed timber exists, competent advice (e.g., from a licensed or registered building contractor) should be sought to determine the extent of any structural damage, and as to the need or otherwise for rectification or repair work. It is important to correct any condition conducive to attack prior to replacing decayed wood.

Where evidence of decaying timber exists, competent advice (e.g., from a licensed or registered building contractor) should be sought to remove the condition(s) conducive to attack, and to determine the extent of any structural damage, and as to the need or otherwise for rectification or repair work.

Where the full extent of damage or the overall condition of the timber is undetermined a further inspection is strongly recommended by a competent person (e.g., from a licensed or registered building contractor). This may require monitoring of the timber over a period and include the assessment of conditions conducive to attack in different weather conditions (e.g., to determine the adequacy of existing drainage).

Management Program Remove any conditions conducive to attack (e.g., lack of ventilation or the presence of excessive moisture). Regular inspections are recommended at intervals not exceeding 12 months. Always seek further advice from the Consultant.

5.0 CONDITIONS THAT ARE CONDUCTIVE TO TIMBER PESTS

5.1 Water leaks: At the time of the inspection there were indications the shower in the main bathroom was leaking.

Addendum 18/06/2026: We have been advised that further investigation and rectification works have been completed by Mr Water Plumbing & Gas. Documentation relating to the completed works has been attached to the rear of the Pest Report for reference.

Water leaks, especially in or into the subfloor, or against the external walls; increase the likelihood of termite attack. Leaking showers or leaks from other 'wet areas' also increase the likelihood of concealed termite attack. Hot water overflows should be plumbed away from the building.

NB. We claim no expertise in building, and if any leaks were reported, you should consult a plumber or other building expert to determine the full extent of damage, and the estimated cost of repairs.

5.2 Moisture/drainage: At the time of the inspection, the subfloor soil was generally dry.

Lack of Adequate Subfloor Ventilation Inadequate ventilation provides a condition suitable for timber pest infestation. For example, subterranean termites thrive in damp humid conditions typical of those provided in a poorly ventilated subfloor space. Where evidence of a lack of adequate ventilation has been identified in the report, the Client should seek competent advice (e.g., from a licensed or registered building contractor) regarding upgrading ventilation. The Presence of Excessive Moisture Ground levels around the building should be maintained in such a way to minimise water entering under the building. Also, the ground surface in subfloor areas should be kept graded to ensure that moisture does not pond or accumulate in any area. Where necessary, sub-surface drains should be installed and maintained to assist with drainage around and under the building. Likewise, the presence of excessive moisture can often be directly related to ventilation limitations and the resultant high humidity. Also, plumbing oversights and defects such as a leaking drain or tap will provide a microclimate conducive to timber pest attack. Where necessary, the Client should seek competent advice (e.g., from a licensed or registered plumbing contractor) to determine the adequacy of existing drainage and remove any conditions conducive to the presence of excessive moisture. The building may need to be monitored over a period of time to detect or confirm a damp problem. The presence of dampness (including moisture) is not always consistent as the prevailing and recent weather conditions at the time an inspection is carried out may affect the detection of damp problems. Importantly, precipitation at or near the time of inspection does not necessarily guarantee that a damp problem will automatically be evident due to such circumstances as prevailing wind conditions or intensity of rainfall. The absence of any dampness at the time of inspection does not necessarily mean the building will not experience some damp problems in other weather conditions. Likewise, whether services have been used for some time prior to an inspection being carried out will affect the detection of dampness.

5.3 Ventilation: Generally adequate.

Lack of Adequate Subfloor Ventilation Inadequate ventilation provides a condition suitable for timber pest infestation. For example, subterranean termites thrive in damp humid conditions typical of those provided in a poorly ventilated subfloor space. Where evidence of a lack of adequate ventilation has been identified in the report, the Client should seek competent advice (e.g., from a licensed or registered building contractor) in regard to upgrading ventilation.

5.4 Hot water services and air conditioning units: There is no need for this work to be carried out.

Hot water services and air conditioning units which release water alongside or near to building walls should be piped to a drain (if not possible then several metres away from the building), as the resulting wet area is highly conducive to termites.

5.5 Slab edge exposure: The slab edge inspection zone does not apply to this property.

Where external concrete slab edges are not exposed, there is a high risk of concealed termite entry.

In some buildings built since July 1995, the edge of the slab forms part of the termite shield system. In these buildings an Inspection zone of at least 75mm should be maintained to permit detection of termite entry. The edge should not be concealed by render, tiles, cladding, flashings, adjoining structures, paving, soil, turf, or landscaping etc. Where this is the case, you should arrange to have the slab edge exposed for Inspection.

Concealed termite entry may already be taking place but could not be detected at the time of the Inspection. This may have resulted in concealed timber damage.

NB. A very high proportion of termite attacks are over the slab edge. Covering the slab edge makes concealed entry easy. This is particularly true of infill type slab construction. Termite activity and/or damage may be present in concealed timbers of the building. We strongly recommend frequent regular inspections in accordance with AS 3660.2.

5.6 Weep holes in external walls: Weep holes were clear allowing the free flow of air.

It is very important that soil, lawn, concrete paths, or pavers do not cover the weep holes. Sometimes, they have been covered during the rendering of the brick work. They should be clean and free flowing and covering the weep holes in part or in whole may allow undetected termite entry.

5.7 Termite shields: Inadequate, as ant capping is not continuous. This is typical for a home of this age.

Termite Shields (Ant Caps) should be in good order and condition, so termite workings are exposed and visible. This helps prevent termites from gaining undetected entry. Joins in the shielding should have been soldered during the installation. If it is observed that the joins in the shielding have not been soldered, then the shielding must be reported as inadequate. It may be possible for a builder to repair the shielding. If not, a chemical treated zone may need to be installed to deter termites from gaining concealed access to the building. Missing, damaged or poor shields increase the risk of termite infestation. If considered inadequate, a builder or other building expert should be consulted.

Other physical shield systems are not visible to inspection and no comment is made on such systems.

5.8 Bridging or breaching of termite barriers and inspection zones: No bridging or breaching was found.

“Bridging” is the spanning of a termite barrier or inspection zone so that subterranean termites are provided with passage over or around that barrier. “Breaching” is the making of a hole or gap in a termite barrier so that termites are provided with a passage through that barrier.

5.9 Other area(s) and/or situations that appear conducive to (may attract) subterranean termite infestation: Medium to large trees and stumps within a 50 metre radius of the property, due to the nesting conditions.

6.0 OVERALL ASSESSMENT OF THE PROPERTY

6.1 Where evidence of live termites, termite damage or termite workings (mudding) was found in the building(s) then the risk of a further attack is extremely high.

Where evidence of live termites, termite damage or termite workings was found in the grounds but not in the building(s) then the risk to buildings must be reported as high to extremely high.

6.2 At the time of the Inspection, the degree of risk of subterranean termite infestation to the overall property was considered to be **Moderate to High**.

6.3 Subterranean Termite Treatment Recommendation: A management program in accordance with AS 3660-2000 to protect against subterranean termites is considered **not essential, but 6 to 12 monthly inspections are essential**.

6.4 Future Inspections: AS 3660.0-2000 recommends “regular competent Inspections should be carried out at least on an annual basis, but more frequent Inspections are strongly recommended”.

It goes on to inform that “regular Inspections will not prevent termite attack but may help in the detection of termite activity. Early detection will allow remedial treatment to be commenced sooner, and damage to be minimized”.

Due to the degree of risk of subterranean termite infestation noted above and all other findings of this Report; we strongly recommend that a full Inspection and written Report in accordance with AS 4349.3 or AS 3660.2-2000 is conducted at this property every 6 months, but no more than 12 months.



ACT P/L 2026306
Fraser ACT 2615
0409227042
admin@mrwaterplumbingandgas.com

Tax Invoice
ABN: 32 241 798 684

Tax Invoice # 198
17th June 2026

Jane Marks
70 Tallara Parkway
Narrabundah ACT 2604

WORK COMPLETED:

Attended site and inspected area.

Upon inspection found slight moisture from back of mixer cover plate in shower.

Customer accepted quote for re-sealing shower / new shower head installation & bath taps

Come back following day after exposing moisture affected area to dry out

Removed old silicone and re - sealed mixer cover plate between wall penetration and tiles.

Installed new shower head & bath taps & tested all ok

Shower not to be used for 24 hours after installation to allow silicone to fully cure and create watertight seal

Collected remaining owing and initiated another water seal test - testing all ok

Both flood test and pressure test passed indicating no other leaks at time of testing and installation

DESCRIPTION	QTY	UNIT PRICE	TOTAL PRICE
Call-Out Fee (Includes Travel) Covers travel to your location and a professional service assessment. Charged per job, with any additional services quoted prior to commencement.	1	\$109.09	\$109.09
Shower Leak Investigation Scope of Works Attend site to investigate reported shower leak Carry out pressure testing of shower head connection and tapware to identify any leaks or pressure faults Conduct flood testing of shower base to assess waterproofing integrity Perform dye testing of shower base (if required) to trace source of leak Inspect accessible plumbing and surrounding areas for signs of water	1	\$309.09	\$309.09

How to Pay

Tax Invoice # 198
\$968.62 due by 17th June 2026

We accept payment by: Bank Deposit, Card or Cash

Bank Details **Name:** MR WATER PLUMBING &
GAS
BSB: 067873
Account Number: 22411015

Online payment Visit this link to pay your invoice online: <https://sm8.link/dns069j>



ACT P/L 2026306
Fraser ACT 2615
0409227042
admin@mrwaterplumbingandgas.com

Tax Invoice
ABN: 32 241 798 684

Tax Invoice # 198
17th June 2026

DESCRIPTION	QTY	UNIT PRICE	TOTAL PRICE
ingress or failure Reporting Provide a detailed written report outlining findings Identify likely cause(s) of leak Include recommendations for repair and/or further works if required Notes This service is investigative only and does not include repair works Any required repairs will be quoted separately upon completion of investigation			
POSH DOMAINE SHORT TWIN SHOWER CP (3*) (EA)	1	\$453.41	\$453.41
Bath set - Mizu Drift Bath Set Family time is fun time. And mizu is all about comfortable, practical bathroom/kitchen products that everyone in the home can enjoy. Designed to stand the rigours of modern living, the Mizu Drift Bath Set features a 1/4 turn ceramic disc operation.	1	\$386.36	\$386.36
* Supply and install new bath tap set with spout * Test all connections * Integrated spindles mean no maintenance ever * Cillit - offer to extend warranty by 3 years			
Credit Card Processing Fee	1	\$6.50	\$6.50
SUBTOTAL:			\$1,264.45
GST:			\$126.45
TOTAL:			\$1,390.90
PAID:			\$422.28
BALANCE DUE:			\$968.62

How to Pay

Tax Invoice # 198
\$968.62 due by 17th June 2026


We accept payment by: Bank Deposit, Card or Cash

Bank Details **Name:** MR WATER PLUMBING &
GAS
BSB: 067873
Account Number: 22411015

Online payment Visit this link to pay your invoice online: <https://sm8.link/dns069j>

Thank you for your business, have a great day!
Page 36 of 105

Timber Pest Report Residence 2

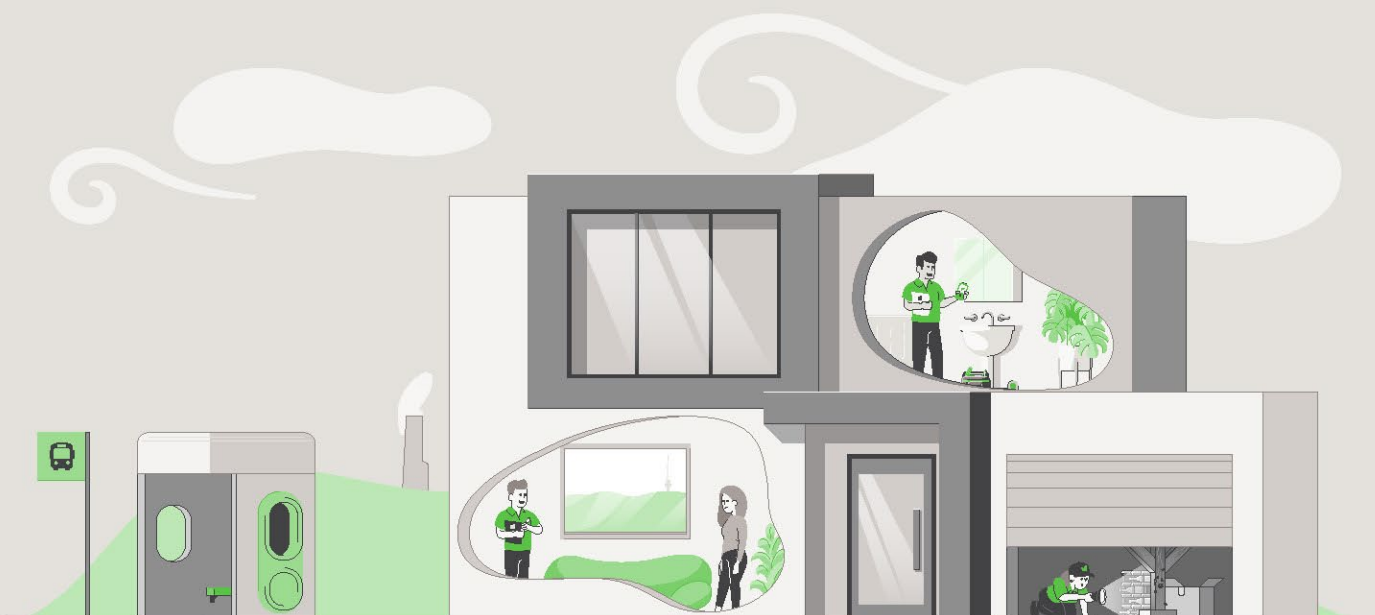

SUMMARY SHEET – RESIDENCE 2

Property Address: 70 Tallara Pkwy, Narrabundah ACT 2604
Client: Watkins & Marks
Inspection Date: Tuesday, June 9th 2026
Inspection carried out by: Ben Halse

This summary is supplied to allow a quick and superficial overview of the Inspection results. This summary is NOT the Report and cannot be relied upon on its own. This summary must be read in conjunction with the full Report and not in isolation from the Report. If there should happen to be any discrepancy between anything in the Report, and anything in this summary, the information in the Report shall override that in the summary. The Report is subject to conditions and limitations. Your attention is particularly drawn to the clauses, disclaimer of liability to third parties, limited liability to a purchaser with the Australian Capital Territory (ACT), and to the notice to the purchaser at the back of this Report.

1.0 ACCESS LIMITATIONS

There were access limitations to the inspection/report. Please refer to section 1.0 of the report.

2.0 TERMITE ACTIVITY

No active subterranean termites (live specimens) were found.

Visible evidence of subterranean termite workings or damage was found. Please refer to Section 2.0 of the Pest Report for further information.

3.0 BORER ACTIVITY

No visible evidence of borers of seasoned timbers was found.

4.0 DECAY FUNGI

Evidence of timber wood decay was found. Please refer to Section 4.0 of the Pest Report.

For complete and accurate information, please refer to the attached 'Visual Timber Pest Report', which is prepared in accordance with AS 4349.3.

CONDITIONS OF THIS INSPECTION

Important Information:

Any person who relies upon the contents of this Report does so acknowledging that the following clauses, which define the scope and limitations of the Inspection, form an integral part of the Report.

This is a **Visual Inspection Only**, prepared in accordance with AS 4349.3, 'Inspection of Buildings Part 3: Timber Pest Inspections'. Visual Inspection was limited to those areas and sections of the property to which reasonable access (see definition) was both available and permitted on the date of Inspection.

The Inspection **did not** include breaking apart, dismantling, removing, or moving objects including but not limited to – foliage, mouldings, roof insulation/sisalation, floor or wall coverings, sidings, ceilings, floors, furnishings, appliances, or personal possessions.

The Inspector **cannot** see inside walls, between floors, inside skillion roofing, inside the eaves, behind stored goods in cupboards, or in any other areas that are concealed or obstructed.

The Inspector **did not** dig, gouge, force or perform any other invasive procedures. An invasive Inspection will not be performed unless a separate contract is entered into.

In an occupied property, it must be understood that furnishings or household items may be concealing evidence of Timber Pests, which may only be revealed when the items are moved or removed.

In the case of strata type properties, only the interior of the unit is inspected.

Scope of Report:

This Report only deals with the detection or non-detection of Timber Pest Attack and Conditions Conducive to Timber Pest Attack discernible at the time of inspection. The inspection was limited to the Readily Accessible Areas of the Building and Site (see note below) and was based on a visual examination of surface work (excluding furniture and stored items), and the carrying out of Tests. Note. With strata and company title properties, the inspection was limited to the interior and the immediate exterior of the particular residence inspected. Common property was not inspected.

Limitations:

The Client acknowledges:

(a) This Report does not include the inspection and assessment of matters outside the scope of the requested inspection and report.

(b) The inspection only covered the Readily Accessible Areas of the Building and Site. The inspection did not include areas which were inaccessible, not readily accessible or obstructed at the time of inspection. Obstructions are defined as any condition or physical limitation which inhibits or prevents inspection and may include – but are not limited to – roofing, fixed ceilings, wall linings, floor coverings, fixtures, fittings, furniture, clothes, stored articles/materials, thermal insulation, sarking, pipe/duct work, builder's debris, vegetation, pavements, or earth.

(c) The detection of dry wood termites may be extremely difficult due to the small size of the colonies. No warranty of absence of these termites is given.

(d) European House Borer (*Hylotrupes bajulus*) attack is difficult to detect in the early stages of infestation as the galleries of boring larvae rarely break through the affected timber surface. No warranty of absence of these borers is given. Regular inspections including the carrying out of appropriate tests are required to help monitor susceptible timbers.

(e) This is not a structural damage report. Neither is this a warranty as to the absence of Timber Pest Attack.

(f) If the inspection was limited to any particular type(s) of timber pest (e.g., subterranean termites), then this would be the subject of a Special-Purpose Inspection Report, which is adequately specified.

(g) This Report does not cover or deal with environmental risk assessment or biological risks not associated with Timber Pests (e.g., toxic Mould) or occupational, health or safety issues. Such advice may be the subject of a Special-Purpose Inspection Report which is adequately specified and must be undertaken by an appropriately qualified inspector. The choice of such inspector is a matter for the Client.

(h) This Report has been produced for the use of the Client. The Consultant or their firm or company are not liable for any reliance placed on this report by any third party, except as provided in the section Limited Liability To a Purchaser within the Australian Capital Territory.

Determining extent of Damage:

This is not a structural building report, and any inexperienced opinion we provide on timber damage cannot be relied upon. This Report **will not** state the full extent of any Timber Pest damage. It will state Timber Pest Damage found as either 'slight', 'moderate', 'moderate to extensive', or 'extensive', and this information is not the opinion of an expert. If any evidence of Timber Pest activity and/or damage resulting from Timber Pest activity is reported, either in the structure(s) or the grounds of the property, then you must assume that there may be concealed structural damage within the building(s).

This concealed damage may only be found when wall linings, cladding or insulation are removed to reveal previously concealed timbers. In this case, an Invasive Timber Pest Inspection (for which a separate contract is required) is strongly recommended, and you should arrange for a qualified professional such as a builder, engineer, or architect to carry out a structural inspection to determine the full extent of the damage, and the extent of repairs that may be required. You agree that neither we, nor the individual conducting the inspection, are responsible or liable for the repair of any damage, whether disclosed by the Report or not.

Disclaimer of Liability:

No liability shall be accepted on account of failure of the Report to notify any termite activity and/or damage present at, or prior to, the date of the Report, in any area(s) or section(s) of the subject property physically inaccessible for inspection, or to which access for inspection is denied by, or to, the licensed Inspector (including, but not limited to, any area(s) or section(s) specified by the Report).

1.0 ACCESS LIMITATIONS

1.1 Area(s) inspected:

Only structures, fences &/or trees within 50m of the building but within the property boundaries were inspected.

1.2 Common area(s) not inspected:

No Inspection was made, and no Report will be submitted, of inaccessible area(s).

These include, but may not be limited to; cavity walls, concealed frame timbers, eaves, flat roofs, fully enclosed patios, inaccessible parts of the subfloors, inaccessible parts of the roof void, soil concealed by concrete floors, fireplace hearths, wall linings, landscaping, rubbish, floor coverings, furniture, pictures, appliances, stored items, insulation, and hollow blocks/posts etc.

1.3 Area(s) in which visual inspection was obstructed or restricted and why:

Clothing and other stored items concealed timbers in cupboards and built in robes/closets. Furniture and stored items concealed some of the skirting boards and architraves inside the house. No inspection was made inside the roof cavity due to no available access.

NB. Please note that since a complete Inspection of the above area(s) was not possible, Timber Pest activity and/or damage may exist in these areas.

1.4 The property was furnished/styled at the time of inspection.

Where a property is furnished at the time of Inspection, it must be understood that the furnishings and stored goods may be concealing evidence of Timber Pest activity. This evidence may be revealed when the property is vacated, and a further Inspection of the vacant property is strongly recommended if the house was furnished at the time of inspection.

1.5 Undetected timber pest risk assessment is considered Moderate.

NB. Where the risk is considered “Moderate” or “Moderate-High” or “High”, a further inspection is strongly recommended of areas that were not readily accessible, and of inaccessible or obstructed areas once access has been provided or the obstruction removed. This may require the moving, lifting or removal of obstructions such as floor coverings, furniture, stored items foliage and insulation. In some instances, it may also require the removal of ceiling and wall linings, and the cutting of traps and access holes. Seek further advice from your Consultant.

2.0 TERMITE ACTIVITY

2.1 No active (live) termites were present at the time of Inspection.

2.2 Visible evidence of subterranean termite workings and/or damage was found in the left side timber fence and the power pole to the front of the residence.

2.3 A termite nest was not found.

2.4 Evidence of minor timber damage was visible.

NB. Where evidence of termite activity by the *Nasutitermes* or *Coptotermes* species was found in the grounds, the risk to buildings is very high. A treatment to eradicate the termites and to protect the building(s) should be carried out. Where the evidence of termite workings was found in the grounds or the building(s), then the risk of a further attack is very high.

2.5 Very important:

If live termites or any evidence of termite workings or damage was reported above, within the building(s) or in the grounds and fences, then it must be assumed that there may be concealed termite activity and/or timber damage. This concealed activity or damage may only be found when alterations are carried out, such as when wall linings, cladding or insulation are removed; or if you arrange for an invasive Inspection. We claim no expertise in structural engineering or building, and we strongly recommend that you have a qualified professional such as a builder, engineer, architect, or other qualified expert determine the full extent of the damage, if any. This may require an invasive Inspection. We take no responsibility for the repair of any damage, whether disclosed by this Report or not (see 'Terms and Limitations').

Where visual evidence of termite workings and/or damage is reported above, but no live termites were present at the time of Inspection, you must realise that it is possible that termites are still active in the immediate vicinity, and that the termites may continue to cause further damage. It is not possible, without further investigation and a number of Inspections over a period of time, to ascertain whether any infestation is active or inactive. Active termites may simply have not been present at the time of Inspection due to a prior disturbance or climatic conditions, or they may have been utilizing an alternative feeding source.

Continued, regular Inspections are essential. Unless written evidence of a termite protection program in accordance with 'AS 3660' with ongoing Inspections is provided, you must arrange for a treatment in accordance with 'AS 3660' to be carried out to reduce the risk of further attack.

2.6 Previous termite treatment: There were no signs of a termite treatment or evidence of a possible previous termite treatment, at the time of inspection.

NB. If there is evidence of drill holes in concrete or brickwork, bait stations or other signs of a possible previous treatment are reported, then the treatment was probably carried out because of an active termite attack. Extensive structural damage may exist in concealed areas. You should have an invasive Inspection carried out, and have a builder determine the full extent of any damage, and the estimated cost of repairs, as the damage may only be found when wall linings etc. are removed. Normally, if a termite treatment has been carried out, then a durable notice should be located in the metre box, indicating the type of termite shield system, treated zone or combination that has been installed.

2.7 Termite management: A termite management notice was not found in the meter box; however, due to the age of the residence a barrier system should have been installed.

This firm can give no assurances with regard to work that may have been previously performed by other firms. You should obtain copies of all paperwork and make your own enquiries as to the quality of the treatment when it was carried out, and warranty information. In most cases, you should arrange for a treatment in accordance with "Australian Standard 3660" to be carried out to reduce the risk of further attack.

2.8 General remarks:

Where any current visible evidence of Timber Pest activity is found, it is strongly recommended that a more invasive Inspection be performed. Trees on and near the property up to a height of 2 metres, have been visually Inspected where possible and practicable, for evidence of Termite activity. It is very difficult to locate termite nests since they are underground, and evidence in trees is usually well concealed. Therefore, we strongly recommend that you arrange to have the medium to large eucalypt trees within a 50 metre radius of the property test drilled for evidence of termite nests.

3.0 BORER ACTIVITY

3.1 No visible evidence of borers was found.

The **Lyctid Borer** - The most common lyctid borer in Australia is **Lyctus brunneus (powder post beetle)**. Attack usually takes place during the first six to twelve months of the service life of timber. However, the powder post beetle is not considered a significant pest of timber and treatment of infestation is not usually required. As only the sapwood of certain hardwoods is destroyed, larger-dimensional timbers (such as rafters, bearers, and joists) in a building are seldom weakened significantly to cause collapse. The **Anobiid Borer** There are many different species of Anobiid borer, the most frequently encountered being *Anobium punctatum* (furniture beetle) and *Calymnaderus incisus* (Queensland pine beetle). Attack mainly occurs to softwoods especially pine timbers such as floorboards that have been in service for at least ten years. Should any structural timbers be attacked by Anobiid borers it is often difficult to determine what extent the borer damage has weakened such timbers and replacement is often the only way of ensuring safety from collapse.

In the case of Anobiid borers, once an attack is initiated it is unlikely to cease or die out of its own accord without some sort of eradication treatment. Therefore, unless proof of treatment is provided, evidence of an attack must always be considered active. Although a chemical treatment is an option, replacement of infested timbers with non-susceptible, or treated timber, is the most effective method of treatment. Before any option is considered, competent advice (e.g., from a licensed building contractor) should be sought to determine the extent of any structural damage, and as to the need or otherwise for rectification or repair work.

Other Borers: A further (more invasive) investigation is strongly recommended to determine whether infestation is still active and to positively identify the borer species responsible for the attack. Always seek further advice from the Consultant.

Management Program: Wherever practical, remove any conditions conducive to attack (e.g., *Anobium* borer thrive in badly ventilated subfloor areas). Regular inspections are recommended at intervals not exceeding 12 months. Always seek further advice from the Consultant.

4.0 DECAY FUNGI

4.1 Evidence of damage caused by wood decay (rot) fungi was found.

- Timber decay was found in areas of the timber fence.

NB. If any evidence of fungal decay or damage is reported, you should consult a building expert to determine the full extent of damage, and the estimated cost of repairs or timber.

General Description of Attack Decaying wood contains sufficient moisture to retain its original shape and may have sufficient strength to withstand normal loads. In contrast decayed wood is reduced both in moisture content and size as indicated by cracking either along or across the grain or fibres coming apart in a stringy manner. Decayed wood will have undergone considerable strength reduction.

Economic Significance Fungal decay can cause at one extreme, structural failure of the affected timber, and at the other purely superficial surface damage. The most critical determination is that of which timber is affected and decaying because decay will most likely spread (unless sources of moisture are quickly removed). Affected and decayed timber may warrant timber replacement, but the rot should not spread unless a new moisture source becomes available in that area.

Where evidence of decayed timber exists, competent advice (e.g., from a licensed or registered building contractor) should be sought to determine the extent of any structural damage, and as to the need or otherwise for rectification or repair work. It is important to correct any condition conducive to attack prior to replacing decayed wood.

Where evidence of decaying timber exists, competent advice (e.g., from a licensed or registered building contractor) should be sought to remove the condition(s) conducive to attack, and to determine the extent of any structural damage, and as to the need or otherwise for rectification or repair work.

Where the full extent of damage or the overall condition of the timber is undetermined a further inspection is strongly recommended by a competent person (e.g., from a licensed or registered building contractor). This may require monitoring of the timber over a period and include the assessment of conditions conducive to attack in different weather conditions (e.g., to determine the adequacy of existing drainage).

Management Program Remove any conditions conducive to attack (e.g., lack of ventilation or the presence of excessive moisture). Regular inspections are recommended at intervals not exceeding 12 months. Always seek further advice from the Consultant.

5.0 CONDITIONS THAT ARE CONDUCTIVE TO TIMBER PESTS

5.1 Water leaks: At the time of the inspection no leaks were found to be present.

Water leaks, especially in or into the subfloor, or against the external walls; increase the likelihood of termite attack. Leaking showers or leaks from other 'wet areas' also increase the likelihood of concealed termite attack. Hot water overflows should be plumbed away from the building.

NB. We claim no expertise in building, and if any leaks were reported, you should consult a plumber or other building expert to determine the full extent of damage, and the estimated cost of repairs.

5.2 Moisture/drainage: At the time of the inspection, the subfloor soil was generally dry.

Lack of Adequate Subfloor Ventilation Inadequate ventilation provides a condition suitable for timber pest infestation. For example, subterranean termites thrive in damp humid conditions typical of those provided in a poorly ventilated subfloor space. Where evidence of a lack of adequate ventilation has been identified in the report, the Client should seek competent advice (e.g., from a licensed or registered building contractor) regarding upgrading ventilation. The Presence of Excessive Moisture Ground levels around the building should be maintained in such a way to minimise water entering under the building. Also, the ground surface in subfloor areas should be kept graded to ensure that moisture does not pond or accumulate in any area. Where necessary, sub-surface drains should be installed and maintained to assist with drainage around and under the building. Likewise, the presence of excessive moisture can often be directly related to ventilation limitations and the resultant high humidity. Also, plumbing oversights and defects such as a leaking drain or tap will provide a microclimate conducive to timber pest attack. Where necessary, the Client should seek competent advice (e.g., from a licensed or registered plumbing contractor) to determine the adequacy of existing drainage and remove any conditions conducive to the presence of excessive moisture. The building may need to be monitored over a period of time to detect or confirm a damp problem. The presence of dampness (including moisture) is not always consistent as the prevailing and recent weather conditions at the time an inspection is carried out may affect the detection of damp problems. Importantly, precipitation at or near the time of inspection does not necessarily guarantee that a damp problem will automatically be evident due to such circumstances as prevailing wind conditions or intensity of rainfall. The absence of any dampness at the time of inspection does not necessarily mean the building will not experience some damp problems in other weather conditions. Likewise, whether services have been used for some time prior to an inspection being carried out will affect the detection of dampness.

5.3 Ventilation: Generally adequate.

Lack of Adequate Subfloor Ventilation Inadequate ventilation provides a condition suitable for timber pest infestation. For example, subterranean termites thrive in damp humid conditions typical of those provided in a poorly ventilated subfloor space. Where evidence of a lack of adequate ventilation has been identified in the report, the Client should seek competent advice (e.g., from a licensed or registered building contractor) in regard to upgrading ventilation.

5.4 Hot water services and air conditioning units: There is no need for this work to be carried out.

Hot water services and air conditioning units which release water alongside or near to building walls should be piped to a drain (if not possible then several metres away from the building), as the resulting wet area is highly conducive to termites.

5.5 Slab edge exposure: The slab edge inspection zone does not apply to this property.

Where external concrete slab edges are not exposed, there is a high risk of concealed termite entry.

In some buildings built since July 1995, the edge of the slab forms part of the termite shield system. In these buildings an Inspection zone of at least 75mm should be maintained to permit detection of termite entry. The edge should not be concealed by render, tiles, cladding, flashings, adjoining structures, paving, soil, turf, or landscaping etc. Where this is the case, you should arrange to have the slab edge exposed for Inspection.

Concealed termite entry may already be taking place but could not be detected at the time of the Inspection. This may have resulted in concealed timber damage.

NB. A very high proportion of termite attacks are over the slab edge. Covering the slab edge makes concealed entry easy. This is particularly true of infill type slab construction. Termite activity and/or damage may be present in concealed timbers of the building. We strongly recommend frequent regular inspections in accordance with AS 3660.2.

5.6 Weep holes in external walls: Weep holes are not applicable to this property.

It is very important that soil, lawn, concrete paths, or pavers do not cover the weep holes. Sometimes, they have been covered during the rendering of the brick work. They should be clean and free flowing and covering the weep holes in part or in whole may allow undetected termite entry.

5.7 Termite shields: Adequate.

Termite Shields (Ant Caps) should be in good order and condition, so termite workings are exposed and visible. This helps prevent termites from gaining undetected entry. Joins in the shielding should have been soldered during the installation. If it is observed that the joins in the shielding have not been soldered, then the shielding must be reported as inadequate. It may be possible for a builder to repair the shielding. If not, a chemical treated zone may need to be installed to deter termites from gaining concealed access to the building. Missing, damaged or poor shields increase the risk of termite infestation. If considered inadequate, a builder or other building expert should be consulted.

Other physical shield systems are not visible to inspection and no comment is made on such systems.

5.8 Bridging or breaching of termite barriers and inspection zones: No bridging or breaching was found.

“Bridging” is the spanning of a termite barrier or inspection zone so that subterranean termites are provided with passage over or around that barrier. “Breaching” is the making of a hole or gap in a termite barrier so that termites are provided with a passage through that barrier.

5.9 Other area(s) and/or situations that appear conducive to (may attract) subterranean termite infestation: Medium to large trees and stumps within a 50 metre radius of the property, due to the nesting conditions.

6.0 OVERALL ASSESSMENT OF THE PROPERTY

6.1 Where evidence of live termites, termite damage or termite workings (mudding) was found in the building(s) then the risk of a further attack is extremely high.

Where evidence of live termites, termite damage or termite workings was found in the grounds but not in the building(s) then the risk to buildings must be reported as high to extremely high.

6.2 At the time of the Inspection, the degree of risk of subterranean termite infestation to the overall property was considered to be **Moderate to High**.

6.3 Subterranean Termite Treatment Recommendation: A management program in accordance with AS 3660-2000 to protect against subterranean termites is considered **not essential, but 6 to 12 monthly inspections are essential**.

6.4 Future Inspections: AS 3660.0-2000 recommends “regular competent Inspections should be carried out at least on an annual basis, but more frequent Inspections are strongly recommended”.

It goes on to inform that “regular Inspections will not prevent termite attack but may help in the detection of termite activity. Early detection will allow remedial treatment to be commenced sooner, and damage to be minimized”.

Due to the degree of risk of subterranean termite infestation noted above and all other findings of this Report; we strongly recommend that a full Inspection and written Report in accordance with AS 4349.3 or AS 3660.2-2000 is conducted at this property every 6 months, but no more than 12 months.

DEFINITIONS

Timber Pest Attack: Means Timber Pest Activity and/or Timber Pest Damage.

Timber Pest Activity: Means telltale signs associated with 'active' (live) and/or 'inactive' (absence of live) Timber Pests at the time of inspection.

Timber Pest Damage: Means noticeable impairments to the integrity of timber and other susceptible materials resulting from attack by Timber Pests.

Major Safety Hazard: Means any item that may constitute an immediate or imminent risk to life, health or property resulting directly from Timber Pest Attack. Occupational, health and safety or any other consequence of these hazards has not been assessed.

Conditions Conducive to Timber Pest Attack: Means noticeable building deficiencies or environmental factors that may contribute to the presence of Timber Pests.

Readily Accessible Areas: Means areas which can be easily and safely inspected without injury to person or property, are up to 3.6 metres above ground or floor levels, in roof spaces where the minimum area of accessibility is not less than 600 mm high by 600 mm wide and subfloor spaces where the minimum area of accessibility is not less than 400 mm high by 600 mm wide, providing the spaces or areas permit entry. The term 'readily accessible' also includes accessible subfloor areas on a sloping site where the minimum clearance is not less than 150 mm high, provided that the area is not more than 2 metres from a point with conforming clearance (i.e., 400 mm high by 600 mm wide); and areas at the eaves of accessible roof spaces that are within the consultant's unobstructed line of sight and within arm's length from a point with conforming clearance (i.e. 600 mm high by 600 mm wide).

Client: Means the person or persons for whom the Timber Pest Detection Report was carried out or their Principal (i.e., the person or persons for whom the report was being obtained).

Timber Pest Detection Consultant: Means a person who meets the minimum skills requirement set out in the current Australian Standard AS 4349.3 Inspections of Buildings. Part 3: Timber Pest Inspection Reports or state/territory legislation requirements beyond this Standard, where applicable.

Building and Site: Means the main building (or main buildings in the case of a building complex) and all timber structures (such as outbuildings, landscaping, retaining walls, fences, bridges, trees, and stumps with a diameter greater than 100 mm and timber embedded in soil) and the land within the property boundaries up to a distance of 50 metres from the main building(s).

Timber Pests: Means one or more of the following woods destroying agents which attack timber in service and affect its structural properties:

Chemical Delignification: The breakdown of timber through chemical action.

Fungal Decay: The microbiological degradation of timber caused by soft rot fungi and decay fungi, but does not include Mould, which is a type of fungus that does not structurally damage wood.

Wood Borers: Wood destroying insects belonging to the order 'Coleoptera' which commonly attack seasoned timber.

Termites: Wood destroying insects belonging to the order 'Isoptera' which commonly attack seasoned timber.

Tests: Means additional attention to the visual examination was given to those accessible areas which the consultant's experience has shown to be particularly susceptible to attack by Timber Pests. Instrument testing of those areas and other visible accessible timbers/materials/areas showing evidence of attack was performed.

Instrument Testing: Means where appropriate the carrying out of Tests using the following techniques and instruments:

- (a) Electronic moisture detecting meter - an instrument used for assessing the moisture content of building elements.
- (b) Stethoscope - an instrument used to hear sounds made by termites within building elements.
- (c) Probing - a technique where timber and other materials/areas are penetrated with a sharp instrument (e.g., bradawl or pocket knife), but does not include probing of decorative timbers or finishes, or the drilling of timber and trees; and
- (d) Sounding - a technique where timber is tapped with a solid object.

IMPORTANT MAINTENANCE ADVICE REGARDING INTEGRATED PEST MANAGEMENT FOR PROTECTING AGAINST TIMBER PESTS

You should read and understand the following important information. It will help explain what is involved in a Timber Pest Inspection, the difficulties faced by a Timber Pest Inspector, and why it is not possible to guarantee that a property is free of Timber Pests. It also details important information about what you can do to help protect your property from Timber Pests. This information forms an integral part of the Report. Any structure can be attacked by Timber Pests. Periodic maintenance should include measures to minimise possibilities of infestation in and around a property. Factors which may lead to infestation from Timber Pests include situations where the edge of the concrete slab is covered by soil or garden debris, filled areas, areas with less than 400mm clearance, foam insulation at foundations, earth/wood contact, damp areas, leaking pipes, etc.; form-work timbers, scrap timber, tree stumps, mulch, tree branches touching the structure, wood rot, etc. Gardens, pathways, or turf abutting or concealing the edge of a concrete slab will allow for concealed entry by timber pests any timber in contact with soil such as form-work, scrap timbers or stumps must be removed from under and around the buildings and any leaks repaired. You should endeavor to ensure such conditions DO NOT occur around your property. We further advise that you engage a professional pest control firm to provide a termite management program in accord with AS 3660 to minimise the risk of termite attack. There is no way of preventing termite attack. Even AS 3660 advises that "the provision of a complete termite barrier will impede and discourage termite entry into a building. It cannot prevent termite attack. Termites can still bridge or breach barriers, but they can be detected more readily during routine inspections."

Reasonable access:

Unless specified in writing, the inspection only covered the Readily Accessible Areas of the Building and Site.

The inspection did not include areas which were inaccessible, not readily accessible or obstructed at the time of inspection. Areas which are not normally accessible were not inspected and include - but not limited to – inside walls, the interior of a flat roof or beneath a suspended floor filled with earth.

Building Interior, the Consultant did not move or remove any ceilings, wall coverings, flooring, floor coverings (including carpeting), furnishing, equipment, appliances, pictures, or other household goods. In an occupied property, furnishings or household items may be concealing evidence of timber pest attack which may only be revealed when the items are moved or removed.

Building Exterior, Roof Exterior and Site, the Consultant did not move or remove any obstructions such as wall cladding, awnings, trellis, earth, plants, bushes, foliage, stored materials, debris, or rubbish. Due to the 'secretive' nature of timber pests, it is possible that hidden damage may exist in concealed areas, e.g., wall framing. Damage may only be found when the obstruction is removed. In the case of buildings constructed on concrete slabs, if the edge of the slab or any weep hole or vent at the base of external walls is concealed by pavements, gardens, lawns, or landscaping then it is possible for termites to gain undetected entry into the building. The building of gardens or planting of shrubs close to the perimeter of the building can promote and conceal termite entry points. The storage of cellulose materials such as building materials and firewood near the ground or building may encourage termite activity.

Roof Space Obstructions such as roofing, stored articles, thermal insulation, sarking, and pipe/duct work may be concealing evidence of timber pest attack which may only be revealed when the obstructions are moved or removed. Also, bodily access should be provided to the interior of all accessible roof spaces. In accordance with Australian Standard ASS 4349 the minimum requirement is a 400mm by 500 mm access manhole.

Subfloor Space Subfloor areas should be kept free from all vegetation (including tree stumps) and other cellulose material which may encourage timber pest activity. Also, storage of materials in subfloor areas is not recommended as it reduces ventilation and makes inspection difficult. Obstructions may be concealing evidence of timber pest attack which may only be revealed when the obstructions are moved or removed. Bodily access should be provided to all accessible subfloor areas with the minimum requirement being a 500 mm x 400 mm access manhole. In the case of suspended floors, if the clearance between the ground and structural components is less than 400 mm, then the ground should be excavated to provide the required clearance, subject to maintaining adequate drainage and support to footings. If the subfloor has been sprayed for subterranean termites or if the area is susceptible to mould growth, appropriate health precautions must be followed before entering the area. Also, special care should be taken not to disturb the treated soil. Always seek further advice from the Consultant.

A further inspection is strongly recommended of those areas that were not readily accessible and of inaccessible or obstructed areas once access has been provided or the obstruction removed. This will involve a separate visit to the site, permission from the owner of the property and additional cost.

Unless stated otherwise, any recommendation or advice given in this Report should be implemented as a matter of urgency.

A more invasive physical inspection is available and recommended:

As detailed above, there are many limitations to this visual inspection only. With the permission of the owner of the premises we WILL perform a more invasive physical inspection that involves moving or lifting insulation, stored items, furniture, or foliage during the inspection. We WILL physically touch, tap, test and when necessary, force/gouge suspected accessible timbers. We WILL gain access to areas, where physically possible and considered practical and necessary, by way of cutting traps and access holes.

This style of Report is available by ordering with several days' notice. Inspection time for this style of Report will be greater than for a VISUAL INSPECTION.

It involves disruption in the case of an occupied property, and some permanent marking is likely. You must arrange for the written permission of the owner who must acknowledge all the above information and confirm that our firm will not be held liable for any damage caused to the property.

A price is available on request.

Concrete slab homes:

Homes constructed on concrete slabs pose special problems with respect to termite attack. If the edge of the slab is concealed by concrete paths, patios, pavers, garden beds, lawns, foliage, etc. then it is possible for termites to affect concealed entry into the property, and they can then cause extensive damage to concealed framing timbers. Even the most experienced Inspector may be unable to detect their presence due to concealment by wall linings. Only when the termites attack timbers in the roof void, which may in turn be concealed by insulation, can their presence be detected. Where termite damage is in the roof, it should be expected that concealed framing timbers will be extensively damaged. With a concrete slab home, it is imperative that you expose the edge of the slab and ensure that foliage and garden beds do not cover the slab edge. Weep holes must be kept free of obstructions. It is strongly recommended that you have a Termite Inspection in accordance with AS 3660.2 carried out every 6 to 12 months.

Subterranean termites:

No property is safe from termites. General Description of Attack Timber hollowed beneath; some cracking at the surface of timber; earthen channels present; or pale faecal spots present.

Important note:

As a delay may exist between the time of an attack and the appearance of telltale signs associated with the attack, it is possible that termite activity and damage exists though not discernible at the time of inspection.

Treatment After discovery of an active infestation, it is imperative that the species of termite is accurately identified before costly (and sometimes unnecessary or inappropriate) methods of treatment are initiated. Only economically important species which are known to attack timber structures should be treated.

In the case of economically important species, it is important that the termite workings are not further disturbed until the proposed method of control has been determined by a licensed pest control operator. Premature attempts to repair or replace infested timber may cause the termites to withdraw from the area temporarily, thereby hindering effective treatment. Any repair or replacement of infested timber should be carried out after the appropriate treatment has been completed.

Where evidence of active termites is detected within a building or within 50 metres of any building, it must always be assumed that the termites may also be active in areas of the property not inspected. Accordingly, where the termites are known to be of economic significance, a further (more invasive) inspection is strongly recommended of areas which were inaccessible, not readily accessible or obstructed at the time of inspection.

Termite Workings and Damage Where evidence of damage to building timbers exists, competent advice (e.g. from a licensed or registered building contractor) should be obtained to determine the extent of any structural damage and as to the need or otherwise for rectification or repair work.

Where evidence of inactive termites is located within the building, it is possible that termites are still active in areas of the property not inspected and they may continue to cause damage. A furthermore invasive inspection is strongly recommended of areas which were inaccessible, not readily accessible or obstructed at the time of inspection.

Where evidence of an inactive termite infestation exists, it is not possible, without benefit of further investigation and inspections over a period, to ascertain whether any infestation is active or inactive. Continued, regular, inspections are essential.

Where evidence of termite attack exists to any trees or tree stumps a more conclusive search should be undertaken. This may require the tree or stump to be drilled to determine the existence of a termite nest. In addition, the soundness and stability of any standing trees identified as being affected by termite attack should be confirmed. Always seek further advice from the Consultant.

Previous Treatments Where evidence of a possible termite treatment was located, the Client should obtain and keep on file all relevant documents pertaining to the extent of the treatment, any service warranties and advice in regard to the building owner's obligation to maintain the treatment and/or barrier. If evidence of a previous treatment of termite infestation is noted, and appropriate documentation is not available, the Client must assume that the termite infestation may still be active in areas of the property not inspected. Accordingly, a re-treatment may be required. Always seek further advice from the Consultant.

Frequency of Future Inspections Australian Standard AS 3660 recognises that regular inspections will not prevent termite attack but may help in the detection of termite activity. Early detection will allow remedial treatment to be commenced sooner and damage to be minimised.

Inspections at intervals not exceeding twelve (12) months are recommended. Where the termite risk is high or the building type susceptible to termite attack, more frequent inspections (3-6 months) should be undertaken.

Risk management options:

To help protect against financial loss, it is essential that the building owner immediately control or rectify any evidence of destructive timber pest activity or damage identified in this inspection report. The Client should further investigate any high-risk area where access was not gained. It is strongly advised that appropriate steps be taken to remove, rectify or monitor any evidence of conditions conducive to timber pest attack.

To help minimise the risk of any future loss, the Client should consider whether the following options to further protect their investment against timber pest infestation are appropriate for their circumstances:

Undertake thorough regular inspections at intervals not exceeding twelve months or more frequent inspections where the risk of timber pest attack is high, or the building type is susceptible to attack. To further reduce the risk of subterranean termite attacks, implement a management program in accordance with Australian Standard AS 3660. This may include the installation of a monitoring and/or baiting system, or chemical and/or physical barrier. However, AS 3660 stresses that subterranean termites can bridge, or breach barrier systems and inspection zones and that thorough regular inspection of the building are necessary.

CONTACT THE INSPECTOR

Please feel free to contact the Inspector who carried out this inspection. Often it is very difficult to fully explain situations, problems, access difficulties or timber pest activity and/or damage in a manner that is readily understandable by the reader. Should you have any difficulty in understanding anything contained within this Report, then you should immediately contact the Inspector and have the matter explained to you.

If you have any questions at all or require any clarification, then contact the Inspector prior to acting on this Report.

NOTICE TO THE PURCHASER

(a) Prior to or on Exchange, and prior to the commencement of the 'Cooling-off Period', you were given an Inspection Report on the Property you intend on purchasing ("the Report"). The Purchaser is advised that this Report reflects the condition of the property existing at the time of the Inspection (Inspection Date) and may not reflect the current state. Timber Pests, particularly Termites, may have gained entry to the property since the Inspection Date. Termites can, in a relatively short period, cause significant damage to both structural and non-structural timbers within and around the buildings of the Property.

Termites (white ants) may be difficult to detect and much of the damage caused may not be readily visible. If damage exists, then it may cost thousands of dollars to repair.

It is, therefore, very strongly recommended that you urgently arrange for another Inspection and Report in accordance with AS4349.3 to be carried out prior to exchange, or prior to the expiration of any 'Cooling off Period', and prior to settlement.

(b) If the Report indicated the presence of Termites, termite damage or recommends any treatments or other Inspections and Reports, you should obtain copies of the treatment proposal, any certificates of treatments carried out, details of all repairs including copies of quotations, invoices, and any other Reports.

It is strongly recommended that you arrange for an Inspection and Report in accordance with AS 4349.3 to verify that the treatment has been successful and carried out in accordance with AS 3660.2 and a further building Inspection in accordance with AS 4349.1.

(c) If you fail to procure a further Inspection and report as recommended in (a) and (b), or fail to obtain copies of the treatment proposal, certificates of treatment carried out, details of all repairs including copies of quotations, invoices and any other reports as recommended in (b) above, then it will be deemed that you have decided not to have a further Inspection and report carried out, or to obtain copies of certificates of treatments carried out, details of all repairs including copies of quotations, invoices and any other reports.

It will be deemed that you have relied upon your own enquiries and the report, knowing the possible consequences and that the condition of the property, as stated in the report, may have changed.

(d) The person carrying out the Inspection and the company, partnership or sole trader that employs that person will have no liability to you for any damage or loss you may suffer as a result of your entering the contract to purchase the property or in connection with completing the purchase of the property as a result of your failure to heed the advice given in (a) and (b) and the warning contained in (c) above, and may use such failure in defense of any claim that you may later make against any of them.

Compliance Report

Residence 1 & 2



COMPLIANCE REPORT

This is a Compliance Report regarding any unapproved structures or alterations. ACT Property Inspections have accessed the attached Building File from ACT Planning and Land Authority (ACTPLA) and hold no responsibility for any inaccuracies in the Building File supplied by ACTPLA. The Compliance report is based solely upon the information available from the Building File which does not contain information regarding Plumbing or Electrical work that has taken place since the original construction. Information regarding the Plumbing and Electrical is available upon application from ACTPLA. Since we are not Plumbers or Electricians, we are unable to comment on those works. If structures have been noted as requiring approval, a Certifier should be engaged to assess if the structure will comply with the relevant ACT legislation. Owners must be aware that unapproved structures may not comply and may require significant repair, design change or possible removal.

Property Address: 70 Tallara Pkwy, Narrabundah ACT 2604
Block & Section: Block 12 Section 101 NARRABUNDAH
Inspection Date: Tuesday, June 9th 2026

APPROVAL STATUS

Description	Plan number	Certificate of occupancy date	Approval status
Ex-Government Residence	-	-	Approved.
Additions and Alterations to Residence including Garage & Courtyard Wall	078645/A	18/05/2017	Approved.
New Residence	B2020613/A	28/05/2020	Approved.
Metal screens	-	-	This structure is unapproved as it exceeds 2.3m in height from natural ground level. Development approval is required.
Rear garden shed	-	-	This structure has been built inside a service easement. Should access be required to the easement by the service provider, this structure may need to be removed at the owner's expense.


ACTPLA COMMENTS

- This is an Ex-Government Residence

SURVEY REPORT

Survey Report completed by	Date Survey report was completed	Comments
Scott D. McNiven & Associates	Monday, 30 January 2012	This survey applies to the additions to residence 1. There are no apparent encroachments upon this land or by this property on adjoining lands or street
Scott D. McNiven & Associates	Friday, 22 May 2020	This survey applies to residence 2. There are no apparent encroachments upon this land or by this property on adjoining lands or street

Conveyancing File

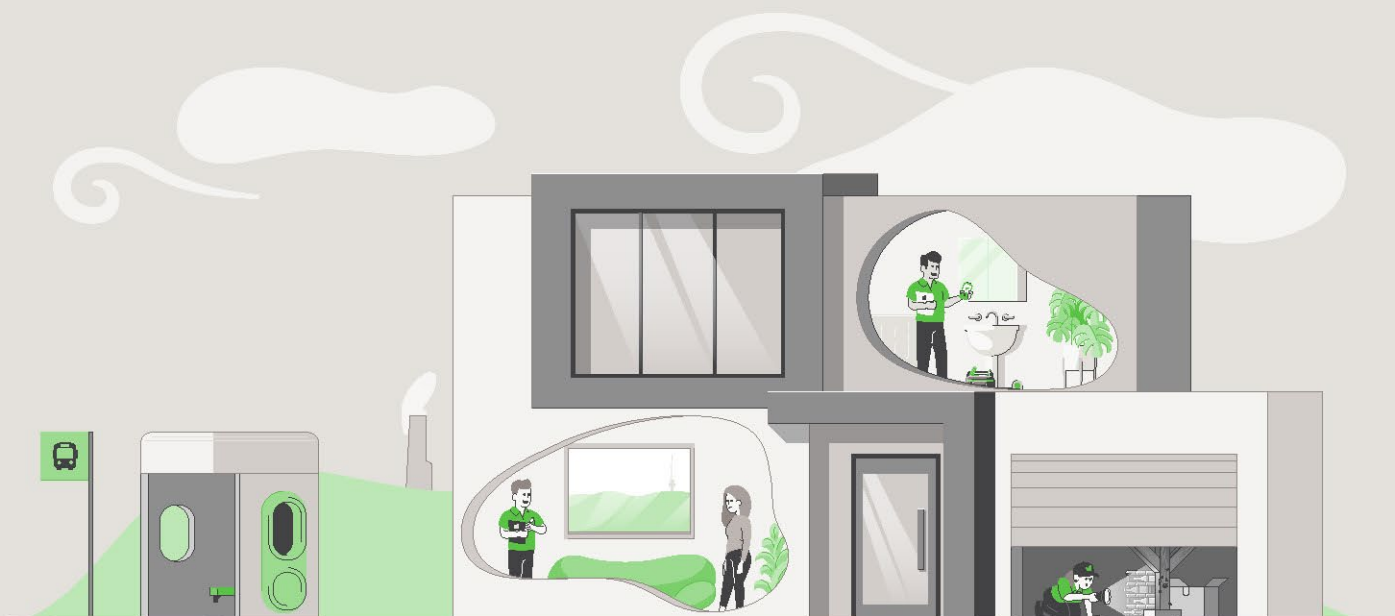

CONVEYANCING BUILDING FILE INDEX

SUBURB: NARRABUNDAH

SECTION: 101

BLOCK:	12
---------------	-----------

UNIT: N/A

EX GOV:	YES
---------	-----

[illegible]

For any incomplete approvals please email acbuildingconveyance@act.gov.au for further information on how to complete.

Drainage Plan Number: 12358

Survey: Y (2)

Comments: THIS IS AN EX-GOVERNMENT RESIDENCE

CONVEYANCING PART 2

No information is provided in respect of electrical, drainage or sewer matters and or to the location of overhead power lines or underground cables in relation to the building.

	<u>Yes</u>	<u>No</u>
1. (a) Is this a government or ex government house?	☒	☐
(b) If yes, is there a building file with approvals on it?	☒	☐
2. Is there any record of incomplete building work on the building file?	☐	☒
If yes - file copies attached		
3. Are there any records on the building file of current (within 5 years) housing Indemnity insurance policies for building work? If yes - file copies attached	☐	☒
4. Are there any records on the building file showing building applications still being processed? (Current within 3 years) If yes - file copies attached	☐	☒
5. Are there any records on the building file in relation to loose-fill asbestos insulation?	☐	☒

If available, copies of the following documents are provided:

- | | | |
|--|-------------------------------------|-------------------------------------|
| • Certificate/s of Occupancy and Use | ☒ | ☐ |
| • Survey Certificates | ☒ | ☐ |
| • Unit Plan/Unit Entitlements (if property is unit titled) | ☐ | ☒ |
| • Approved Building Plans | ☒ | ☐ |
| • Ex- government Building Plans* | ☒ | ☐ |

If requested:

- | | | |
|--------------------|-------------------------------------|--------------------------|
| • Drainage Plan(s) | ☒ | ☐ |
|--------------------|-------------------------------------|--------------------------|

ASBESTOS

The ACT Government is not able to guarantee the accuracy of the information in this report.

You should make your own enquiries and obtain reports (from a licensed Asbestos Assessor) in relation to the presence of loose fill asbestos insulation (and other forms of asbestos) on the premises. For more information go to the Asbestos Awareness Website –

www.asbestos.act.gov.au

Please note: Development Approval plans will not be included in this report (We do not receive Development Approval Plans unless they are part of a Building Approval in which case they become Building Approval Plans), if development approval was granted you can request copies of the Development Approval plans from ACEPDcustomerservices@act.gov.au.

Please Note: Building approvals that have been generated via eDevelopment will be issued with a project number prefixed by the letter B. Initial building approval documentation will be identified with project number B20XXXXX only but will be referenced as B20XXXXX/A on the Certificate of Occupancy and Use. Any amendments to the original approval will be issued with the project number and an alphanumeric digit. The first amendment will be identified as B20XXXXX/B, the second amendment B20XXXXX/C etc. Not all eDevelopment plans will be stamped with the plan number.

***Ex Government plans:** Plans are typical and not specific to each residence. There may be slight changes to the layout or window locations that were not required to be approved.

Search officer comments (if any?)

Search officer initials: Kayne

Cost of application: \$ 144.79

Date completed:

04/06/2026



Peter Cotsell

OUR REF: 08238

Dear Sir,


As instructed by you, we have surveyed for identification purposes only, part of the land being Block 12, Section 101, Narrabundah, with a frontage to Tallara Parkway, Narrabundah, in the District of Canberra Central of the Australian Capital Territory

- The subject land is shown by red edging on the diagram.
- Easements for services affect the subject land.
- Standing upon and wholly within the boundaries of the subject land are the brick foundations of extensions to the existing residence.
- The relationship of the brick foundations with respect to the boundaries is as indicated on the diagram.
- This survey report is with respect to the brick foundations only.
- This survey report is for the purpose of obtaining a Building Certificate only and should not be used to set out future additions.

Yours Faithfully

Scott D. McNiven
Registered Surveyor
30 Jan 2012



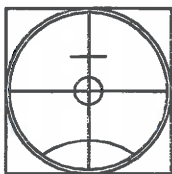

SCOTT D McNIVEN & ASSOCIATES Pty Ltd
CONSULTING LAND & ENGINEERING SURVEYORS ACN 052 870 747

MODE CREATIVE

Our Ref: 20069


Dear Sir,

As instructed by you, we have surveyed for identification purposes only, part of the land being Block 12, Section 1017, Narrabundah with a frontage to Tallara Parkway, Narrabundah in the District of Canberra Central of the Australian Capital Territory

- The subject land is shown by red edging on the diagram.
- Easements for services affects the subject land.
- Standing upon and wholly within the boundaries of the subject land are the concrete and steel foundations of a secondary residence under construction.
- The relationship of the concrete and steel foundations with respect to the boundaries is as indicated on the diagram.
- This survey report is with respect to the concrete and steel foundations only.
- This survey report is for the purpose of obtaining a Building Certificate only and should not be used to set out future additions.

Yours Faithfully

Scott D. McNiven
Registered Surveyor
22 May 2020

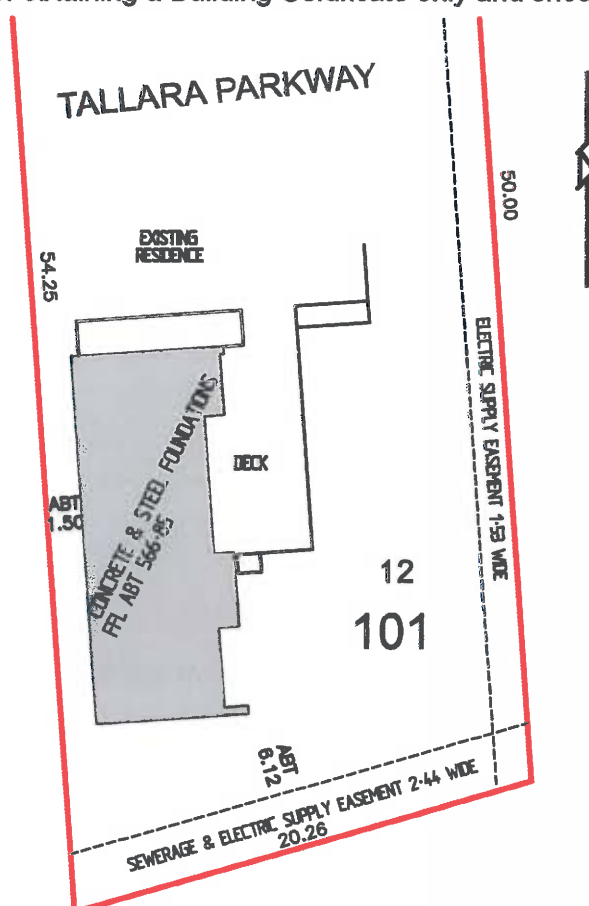



Certificate of Occupancy and Use

Certificate No. **078645N1C1**

This Certificate is issued in accordance with Section 69 (2) of the Building Act 2004

The building work listed on this certificate has been completed substantially in accordance with the prescribed requirements and is considered fit for occupation and use.

Builder PETER DAVID COTSELL	Suburb NARRABUNDAH	Section 101	Block 12
Notice of Intention to Start Work Number 078645N1	Plan 078645/A		

Building Work

Nature of Work	Project Item Description	Unit	Other Description	Class of Occupancy	Type of Construction
ALTERATIONS TO	RESIDENCE		AND ADDITIONS INCLUDING GARAGE & COURTYARD WALL	1a(i) & 10	NA

Comments

Important note:

1. Residential building statutory warranties and residential insurance does not apply in relation to building work.
2. The issue, under this Part, of a certificate in respect of a building or portion of a building does not affect the liability of a person to comply with the provisions of a law of the Territory (including this Act) relating to the building or portion of the building.


NATALIE POOLEY
Delegate of the Registrar

18 / 5 / 2017
Date


LAND (PLANNING AND ENVIRONMENT) ACT 1991
APPROVAL GRANTED
 PURSUANT TO SECTION 230

Delegate name BEN TRELOGGEN

Date 26/9/2006

ADVICE

* The lessee's or their agents are responsible for protecting the verge and any trees within by installing a temporary minimum 1.8 metre high chain wire mesh fence around the verge during the demolition and construction process leaving adequate room for pedestrian passage along the verge.

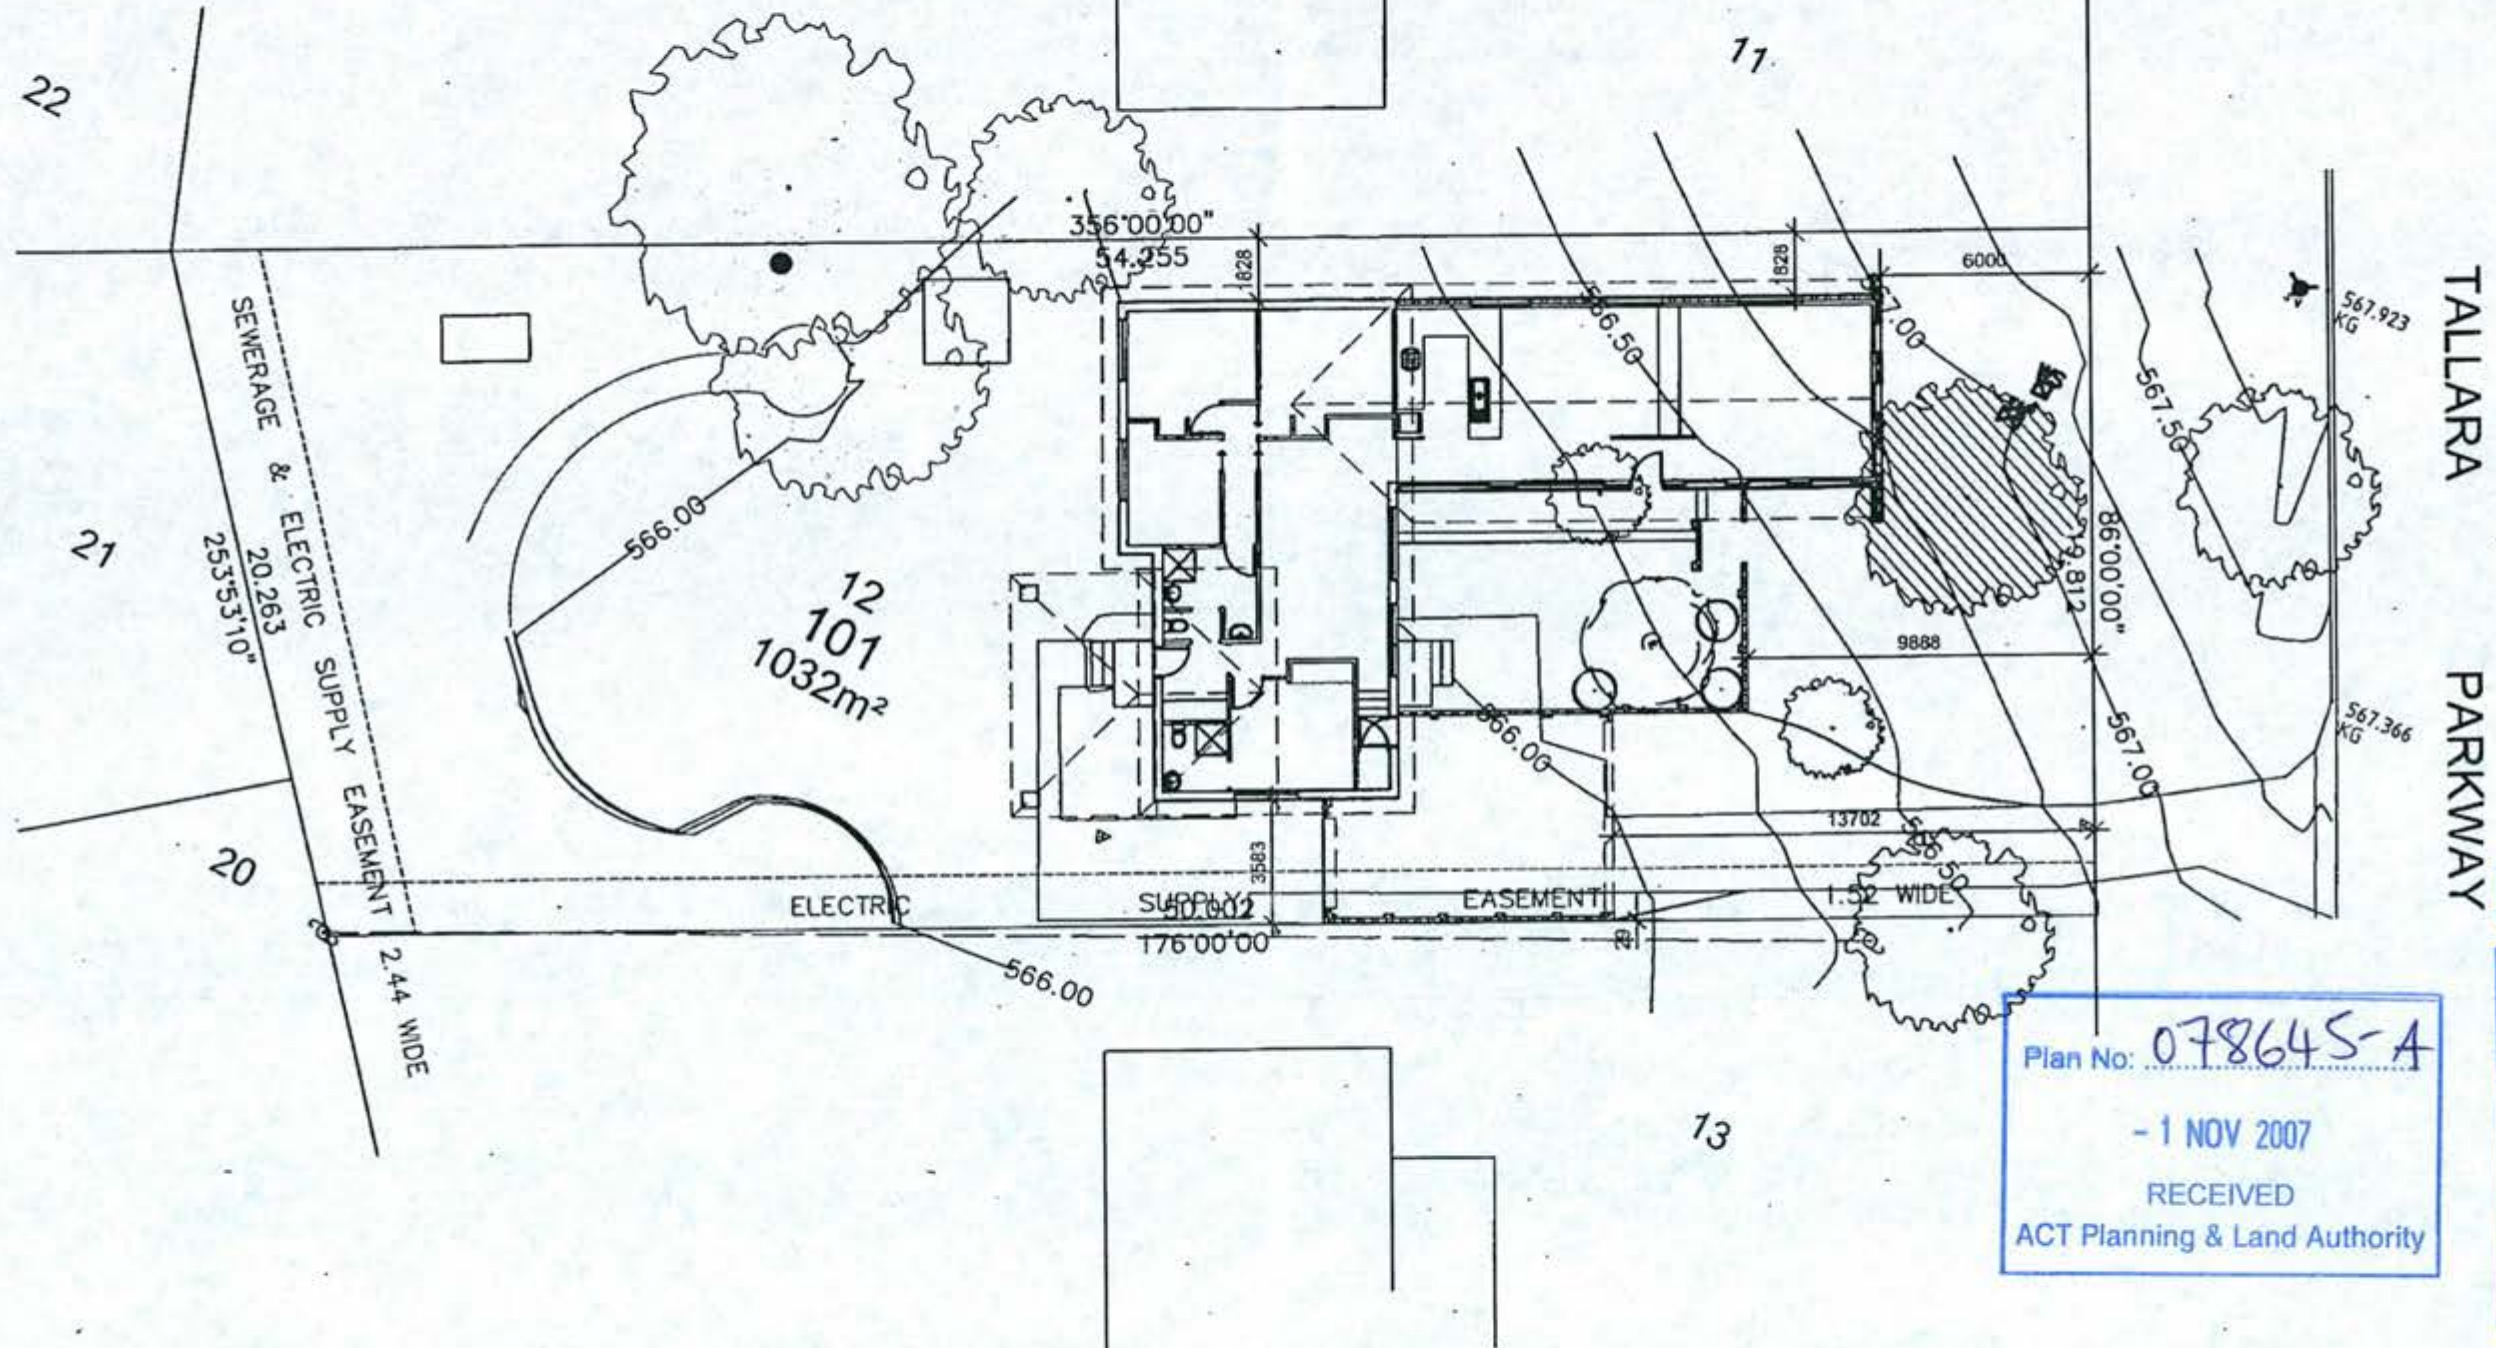

Plan No: 078645-A
 - 1 NOV 2007
 RECEIVED
 ACT Planning & Land Authority

BCA certifiers
 AP# 58 119 755 724

29 OCT 2007
 Date Issued
BUILDING APPROVAL
 Issued under s.28 of the Building Act 2004
 BCA CERTIFIERS AUSTRALIA PTY LTD
 Lic. No: 200714


COTSELL EXTENSION

REVISION	DATE	ISSUE
A		

PROJECT:
 PROPOSED NEW EXTENSION AT
 70 TALLARA PARKWAY BLOCK 12 SECTION 101 NARRABUNDAH
 C:\Documents and Settings\mrrick\My Documents\cotsell\060626\sk4.dwg


SITE PLAN

A01

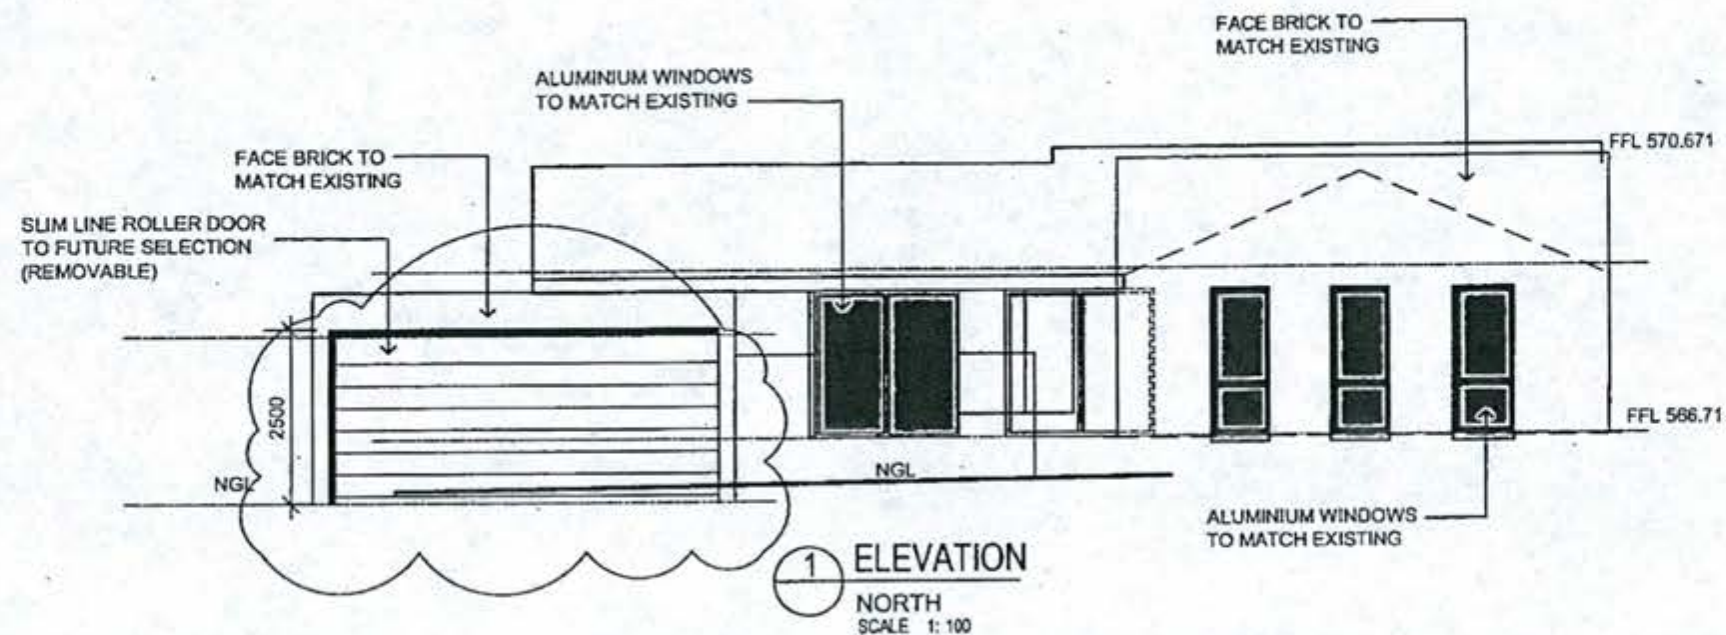

LAND (PLANNING AND ENVIRONMENT) ACT 1991
APPROVAL GRANTED
 PURSUANT TO SECTION 230
 Delegate name BEN TRELOGGEN
 Date 26/9/2006

Plan No: 078645-A
 - 1 NOV 2007
 RECEIVED
 ACT Planning & Land Authority

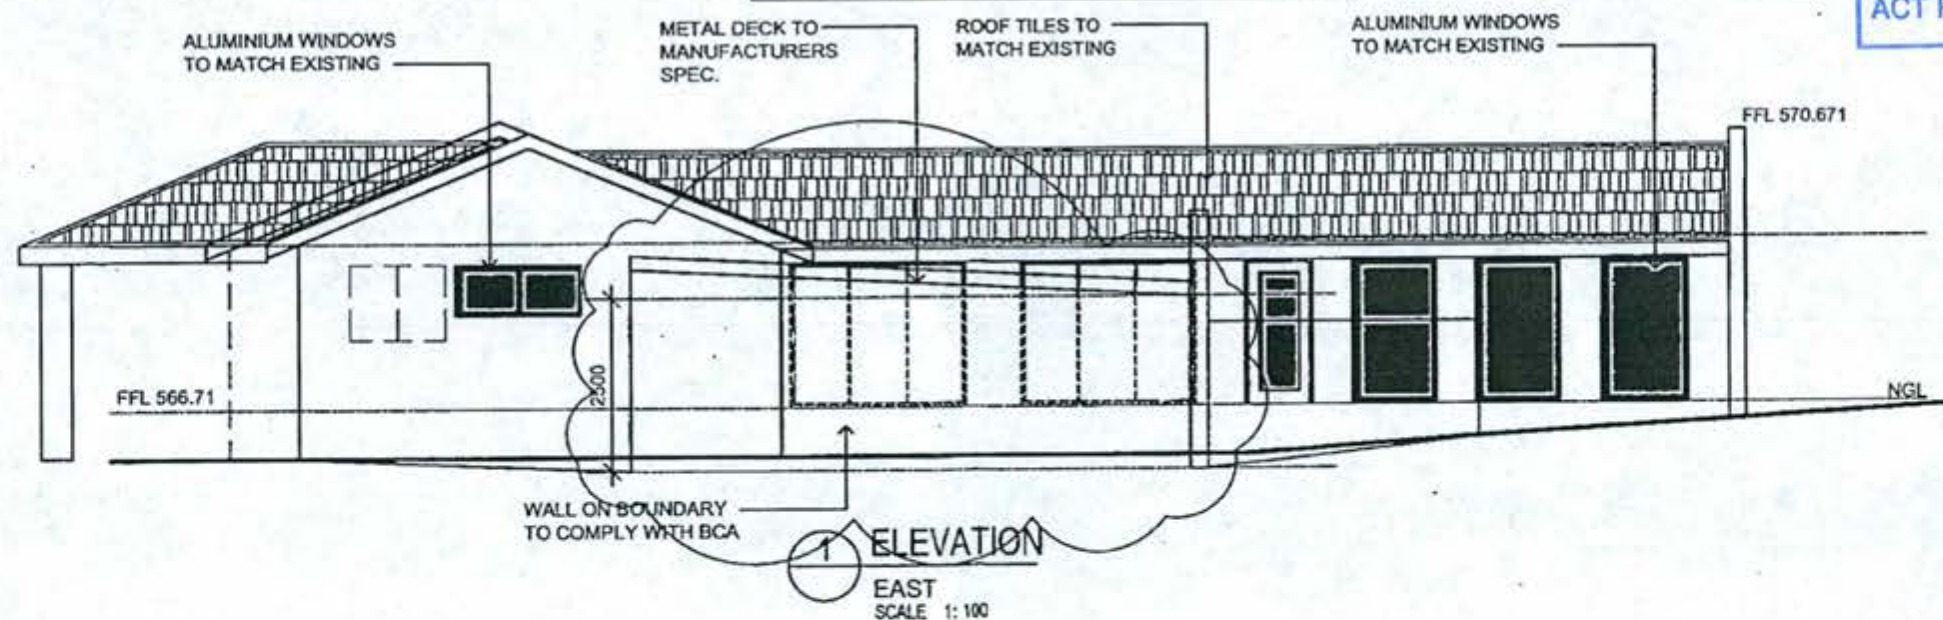

BCA certifiers
 APN: 58 119 755 734
 29 OCT 2007
 Date Iss: 1
BUILDING APPROVAL
 Issued under s.28 of
 the Building Act 2004
 BCA CERTIFIERS
 AUSTRALIA PTY LTD
 Lic. No: 200714


COTSELL EXTENSION

REVISION
 A DA ISSUE
 B 25 x 25 ACTEW COMPLIANCE ACHIEVED

PROJECT:
 PROPOSED NEW EXTENSION AT
 70 TALLARA PARKWAY BLOCK 12 SECTION 101 NARRABURDAH
 F:\cotsell\060625\sk4.dwg

ELEVATIONS


A04

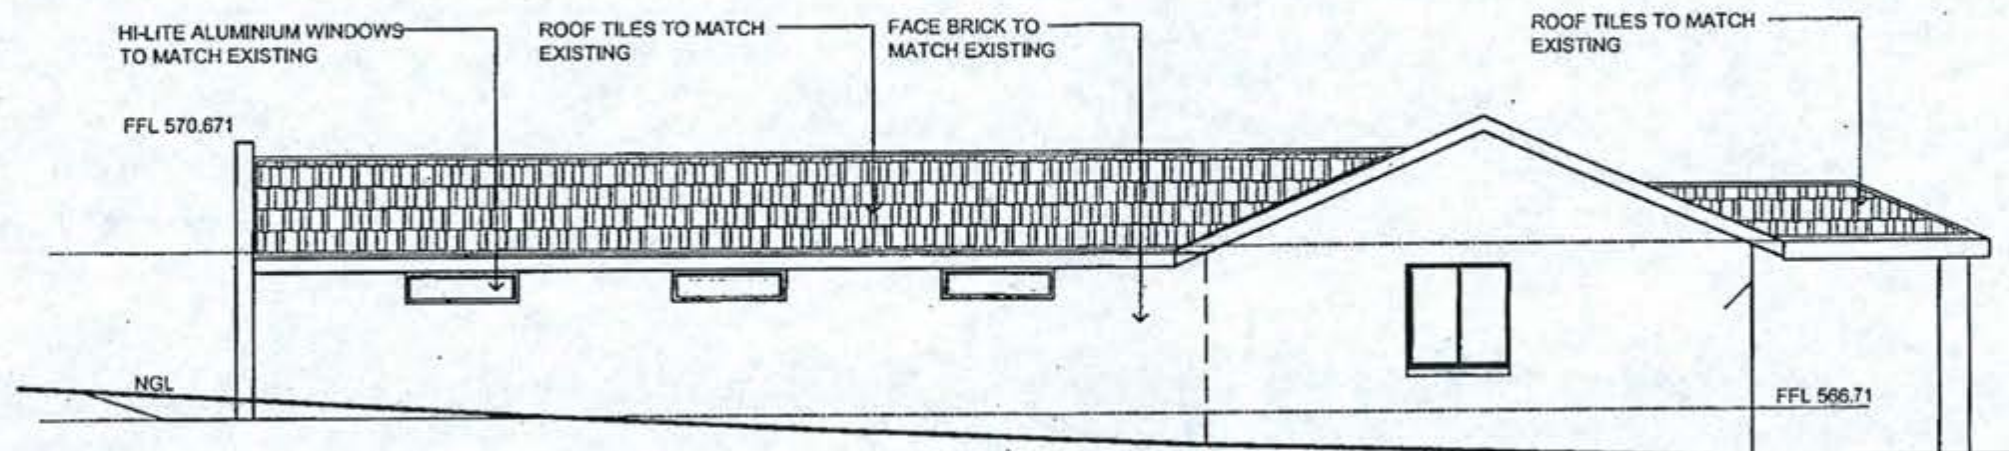

3 ELEVATION
WEST
SCALE 1:100

LAND (PLANNING AND ENVIRONMENT) ACT 1991
APPROVAL GRANTED
PURSUANT TO SECTION 230
Delegate name BEN TRELOGGEN
Date 26/9/2006

Plan No: 078645-A
- 1 NOV 2007
RECEIVED
ACT Planning & Land Authority

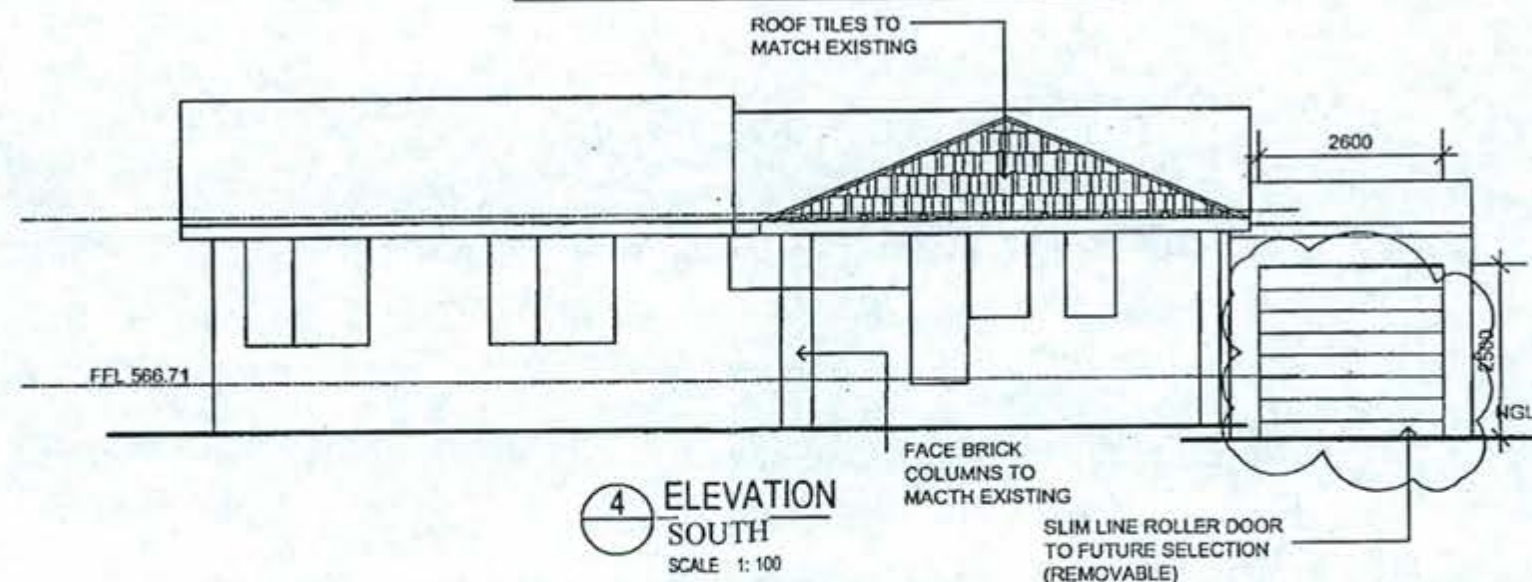

4 ELEVATION
SOUTH
SCALE 1:100

BCA **certifiers**
APN: 58 113 765 734
29 OCT 2007
Date Issued
BUILDING APPROVAL
Issued under s.28 of
the Building Act 2004
BCA CERTIFIERS
AUSTRALIA PTY LTD
Lic. No: 200714


COTSELL EXTENSION

REVISION	DATE	DESCRIPTION
A	25/9/2006	DA ISSUE
B	25/9/2006	2.5 x 2.5 ACTEW COMPLIANCE ACHIEVED

PROJECT:
PROPOSED NEW EXTENSION AT
70 TALLARA PARWAY BLOCK 12 SECTION 101 NARRABUNDAN
F:\cotsell\060625\sk4.dwg

ELEVATIONS

A05

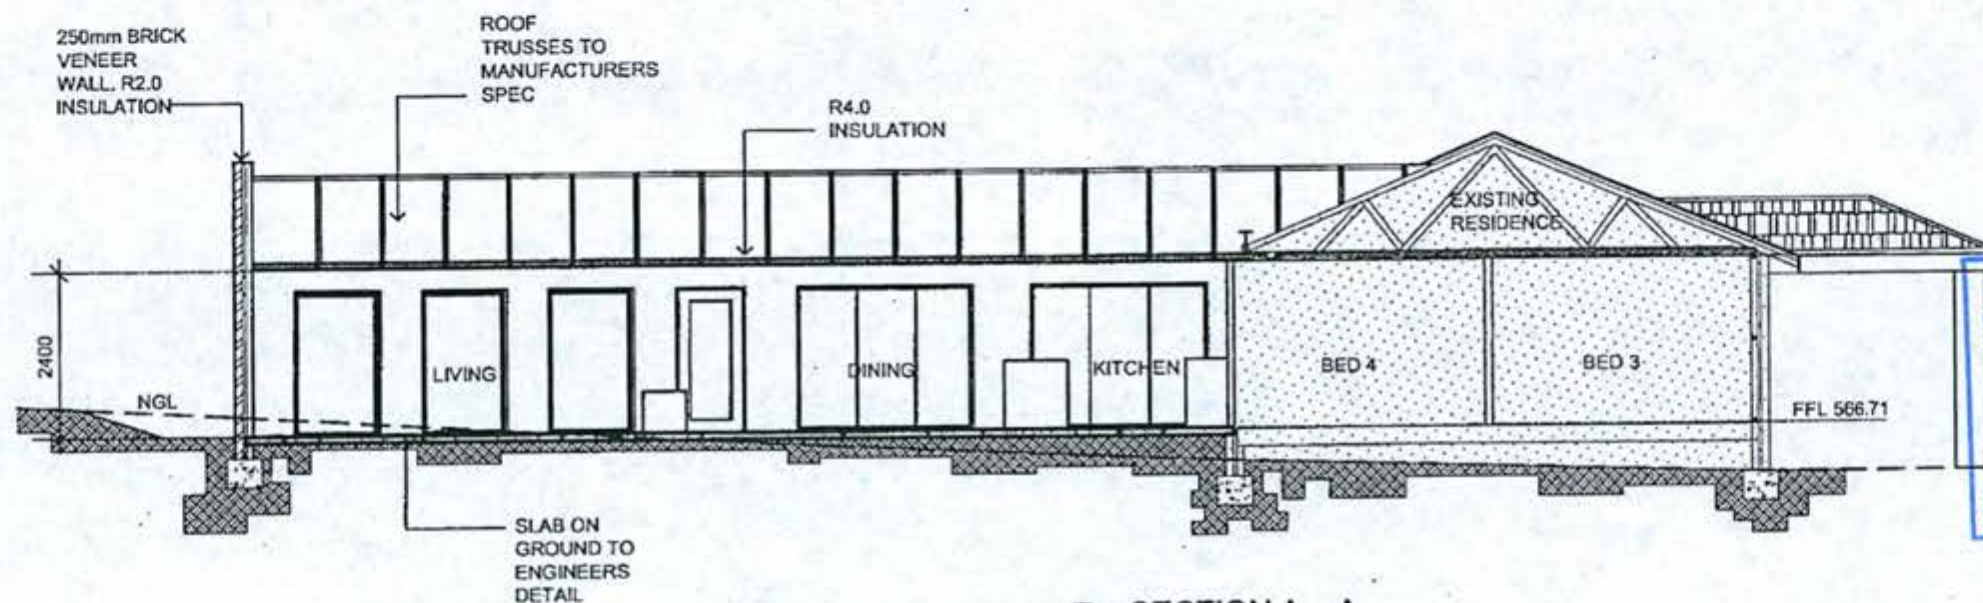

Plan No: 078645-A
- 1 NOV 2007
RECEIVED
ACT Planning & Land Authority

LAND (PLANNING AND ENVIRONMENT) ACT 1991
APPROVAL GRANTED
PURSUANT TO SECTION 230
Delegate name BEN TRELOGGEN
Date 26/9/2006

5 SECTION A ~ A
SCALE 1:100

BCA certifiers
ABN: 68 119 755 734
29 OCT 2007
Date issued
BUILDING APPROVAL
Issued under s.28 of
the Building Act 2004
BCA CERTIFIERS
AUSTRALIA PTY LTD
Lic. No: 200714

COTSELL EXTENSION

REVISION	DATE	ISSUE

PROJECT:
PROPOSED NEW EXTENSION AT
70 TALLARA PARKWAY BLOCK 12 SECTION 101 NARRABUNDAH
C:\Documents and Settings\merrick\My Documents\cotsell\050626\sk4.dwg

SECTION A



A06

* Drill and epoxy grout
2N12 x 300 long bars
100mm into existing footing

PF1

PF1

Concrete Footings : Grade N20
Site Classification : M
Type of construction : Articulated Masonry Veneer

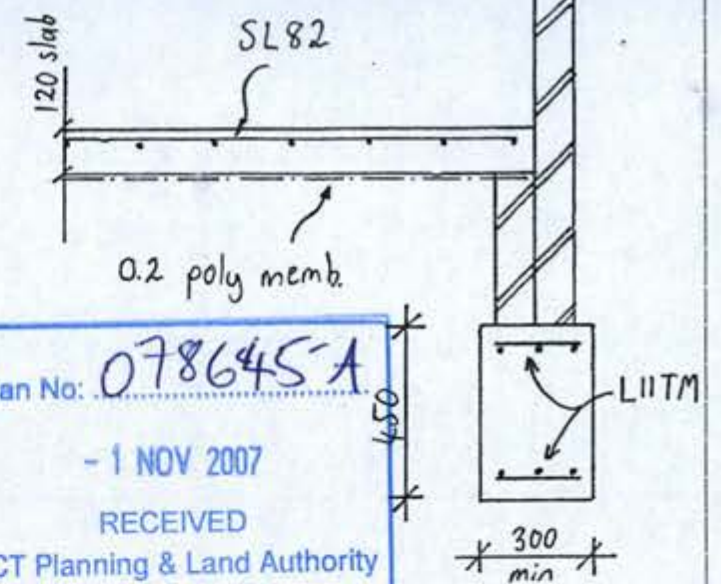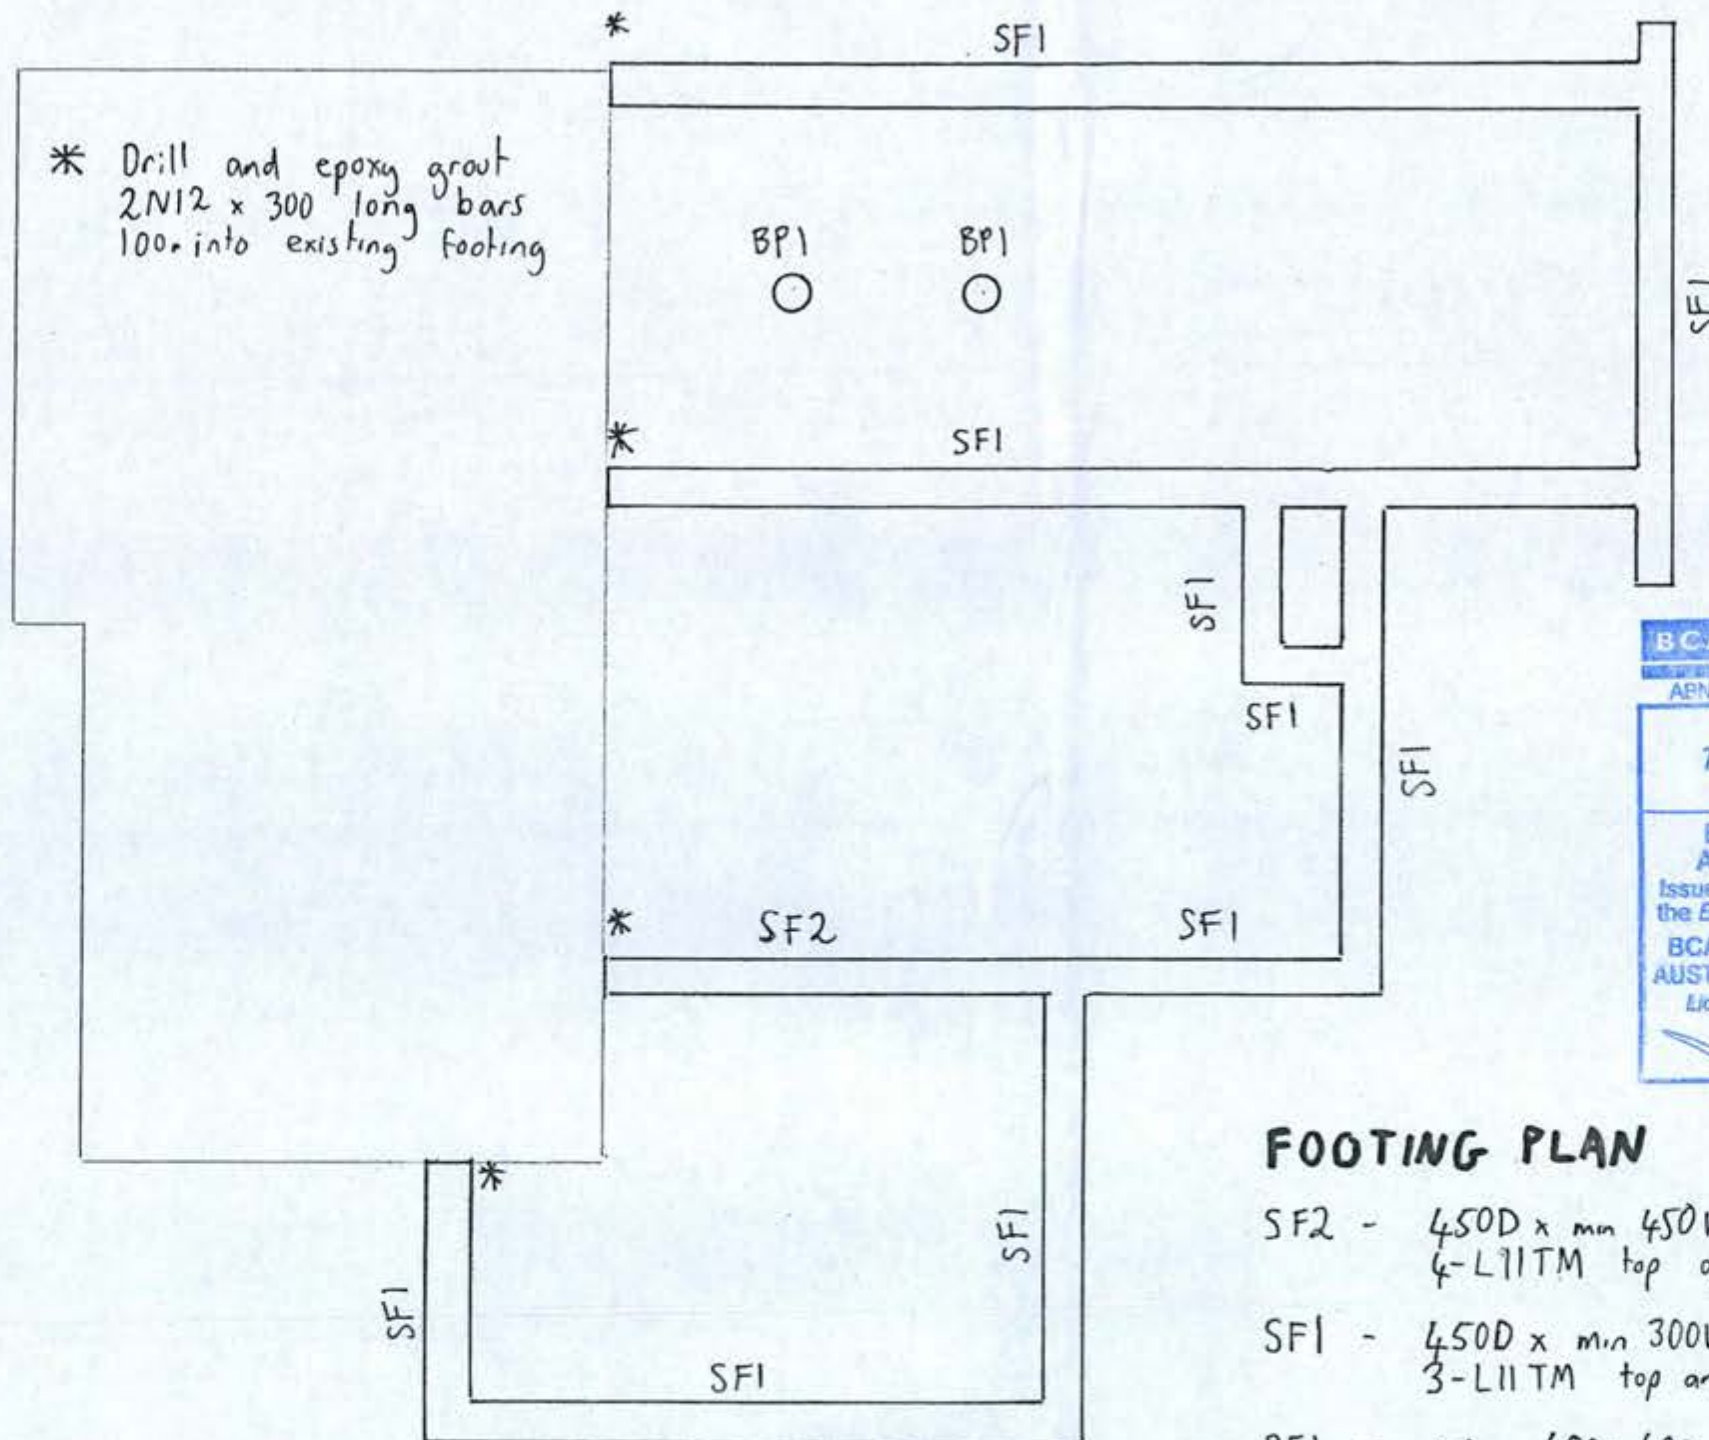


Typical Footing and Slab Details




FOOTING PLAN

- SF2 - 450D x min 450W strip footing
4-LIITM top and bottom.
- SF1 - 450D x min 300W strip footing
3-LIITM top and bottom.
- PF1 - min 600 x 600 x 400D pad footing
mass concrete.
- BP1 - 450Ø bored pier min 600 into
natural ground.

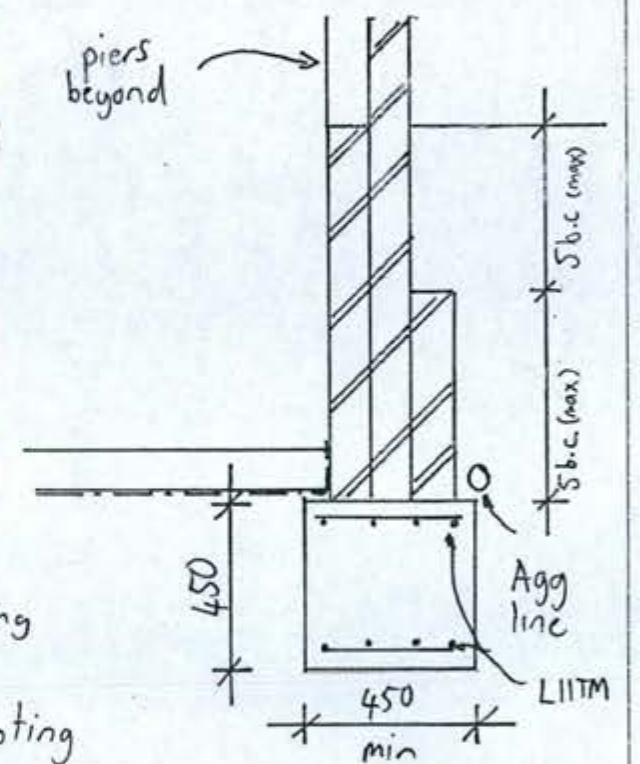

SF2 Details

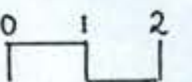

PROJECT:

PETER COTSELL HOUSE

Block 12, Section 101, Narrabundah

DRAWING TITLE:

Footings

All dimensions to be verified on site before making any shop drawings or commencing any work. The copyright of this drawing remains with Northrop Engineers PTY LTD.



Tel (02) 6285 1822 Fax (02) 6285 1863
Canberra Sydney Newcastle Wollongong Terrigal
Northrop Engineers Pty Ltd ABN 82 064 775 088

DATE: 17-11-06


DRAWN: SCM

SCALE:

JOB No: CRO60661


DRAWING No/Rev: S1 A

DATE	REVISION	ISSUE AMMENDMENT
17-11-06	A	For BA

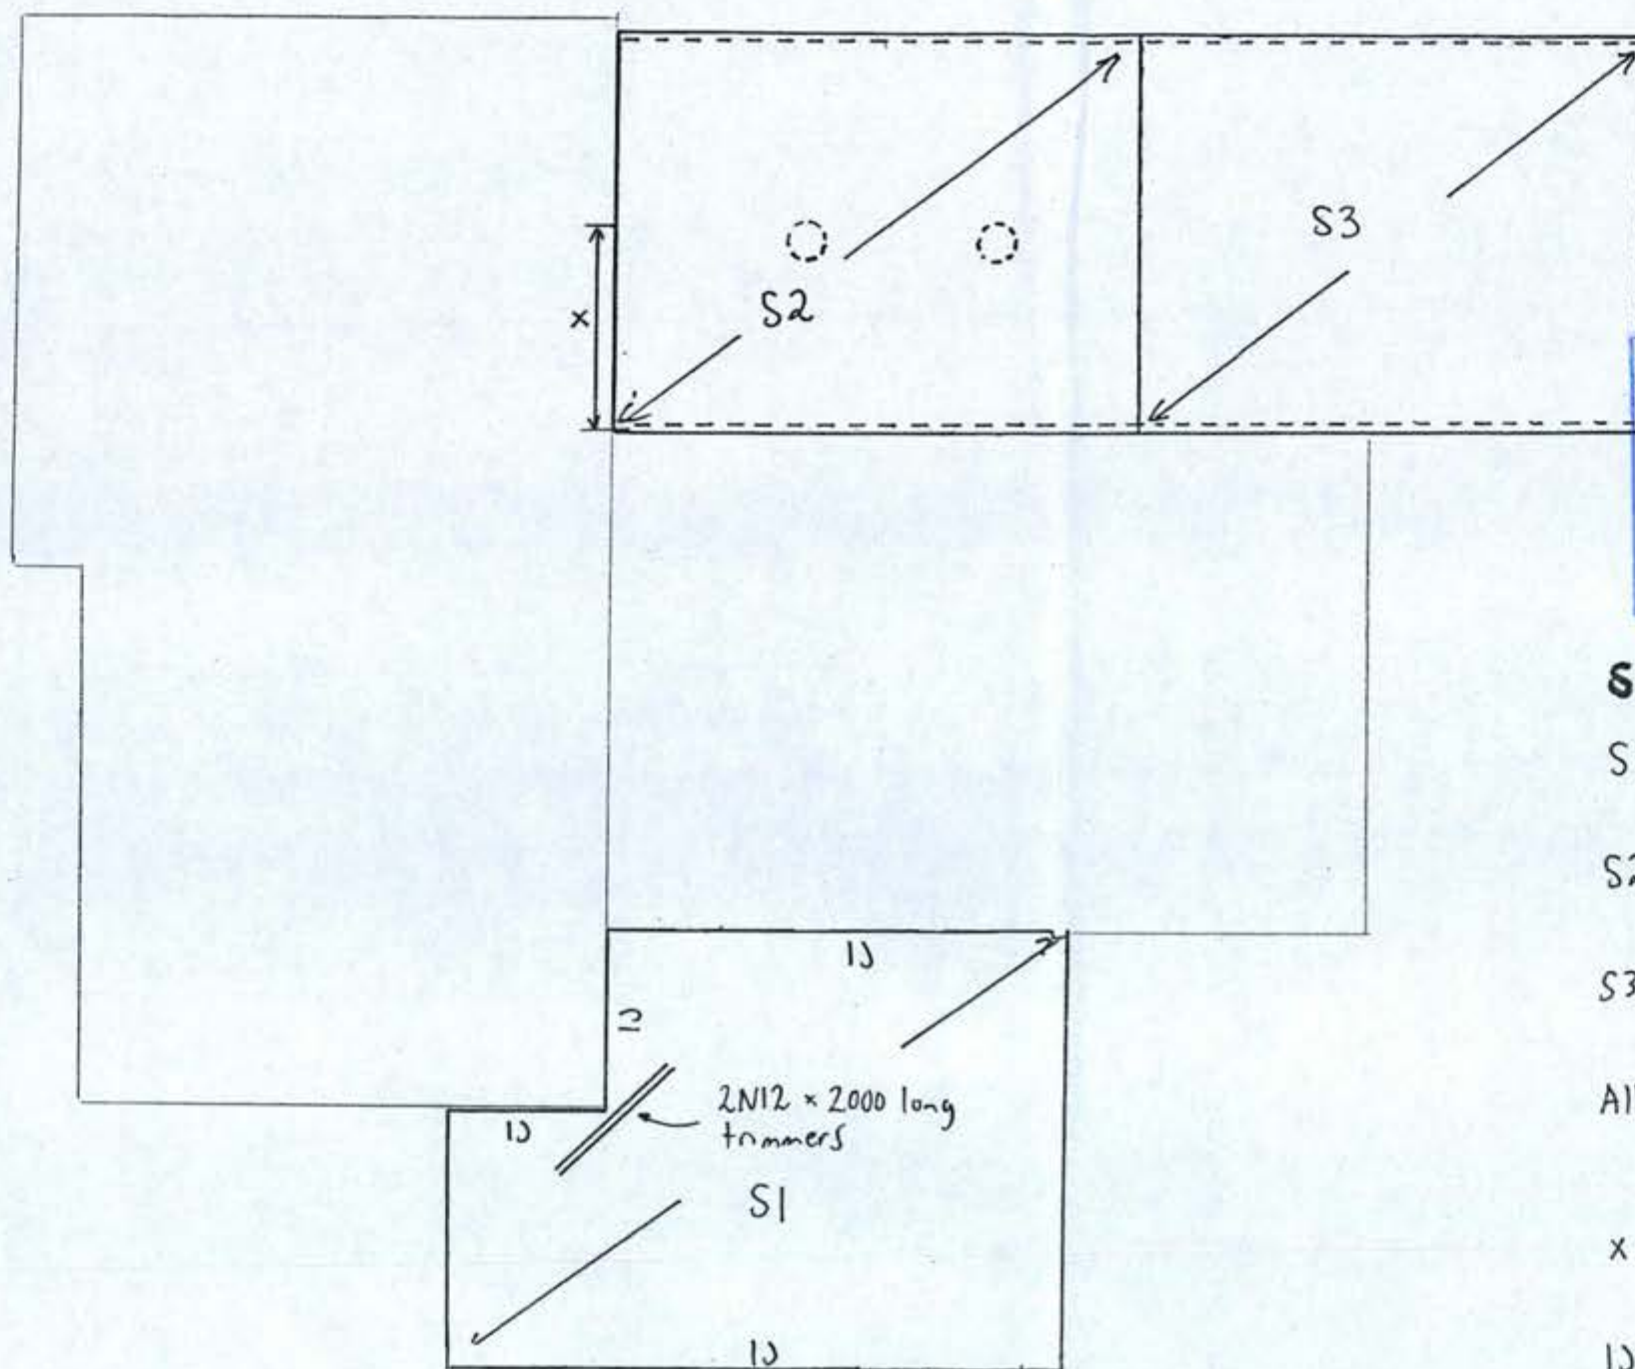


Slab Plan

- S1 - 100 thick
SL82 mesh top, 30mm cover
- S2 - 120 thick
SL82 mesh top and bottom, 30 cover top
25 cover bottom.
- S3 - 100 thick
SL82 mesh top, 30 cover top.
- All slabs - 0.2 poly membrane
sand levelling layer
Compact subgrade to AS2870
- x - Drill and epoxy grout N12 x 300 long
200 into existing slab.
- 10 - Isolation Joint. Isolate edge of slab
and walls with 10mm thick Ableflex.

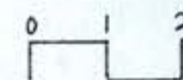

			PROJECT:	DRAWING TITLE:	 CONSULTING ENGINEERS	DATE: 17-11-06
			PETER COTSELL HOUSE	Floor Slab		DRAWN: SCM
			Block 12, Section 101, Narrabundah	All dimensions to be verified on site before making any shop drawings or commencing any work. The copyright of this drawing remains with Northrop Engineers PTY LTD.	Tel (02) 6285 1822 Fax (02) 6285 1863 Canberra Sydney Newcastle Wollongong Terrigal Northrop Engineers Pty Ltd ABN 82 064 775 088	SCALE:
17-11-06	A	For BA				JOB No: CR060661
DATE	REVISION	ISSUE AMMENDMENT				DRAWING No/Rev: S2 A

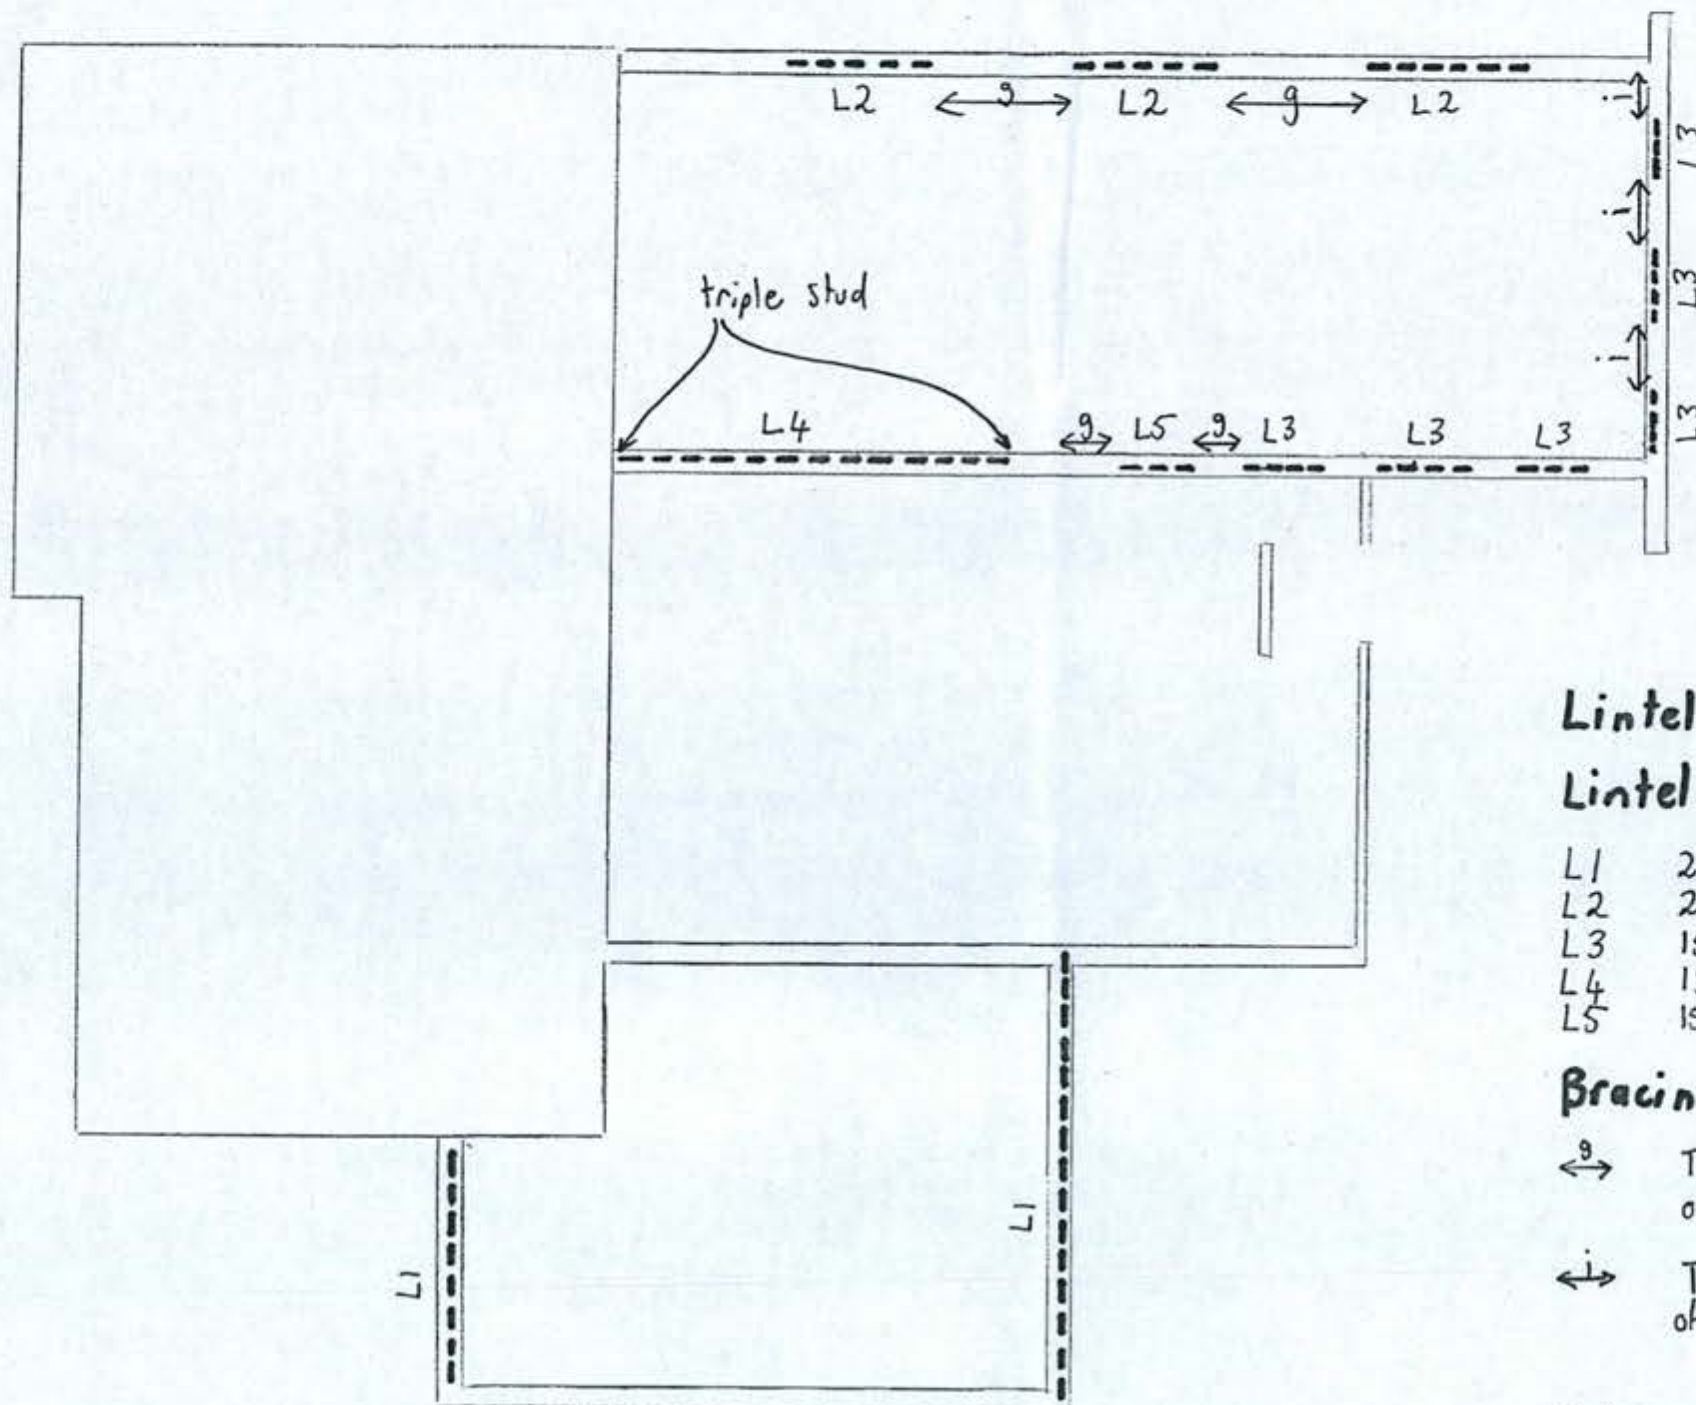

Lintel and Bracing Plan


Lintels

- L1 200x200x9 "Galintel"
- L2 2/150 x 45 LVL
- L3 150 x 45 LVL
- L4 150 PFC
- L5 150 x 45 LVL

Bracing

- g Type g ply bracing for full length of wall indicated.
- i Type i ply bracing for full length of both sides of wall indicated.

Refer general notes for brick lintels.

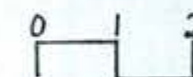

PROJECT: **PETER COTSELL HOUSE**

DRAWING TITLE:

Lintels and Bracing

Block 12, Section 101, Narrabundah

All dimensions to be verified on site before making any shop drawings or commencing any work. The copyright of this drawing remains with Northrop Engineers PTY LTD.

NORTHROP
CONSULTING ENGINEERS

Tel (02) 6285 1822 Fax (02) 6285 1863
Canberra Sydney Newcastle Wollongong Terrigal
Northrop Engineers Pty Ltd ABN 82 064 775 088

DATE: 17-11-06


DRAWN: S.C.M

SCALE:

JOB No: CB060661

DRAWING No/Rev: S3 A

DATE	REVISION	ISSUE AMMENDMENT
17-11-06	A	For BA

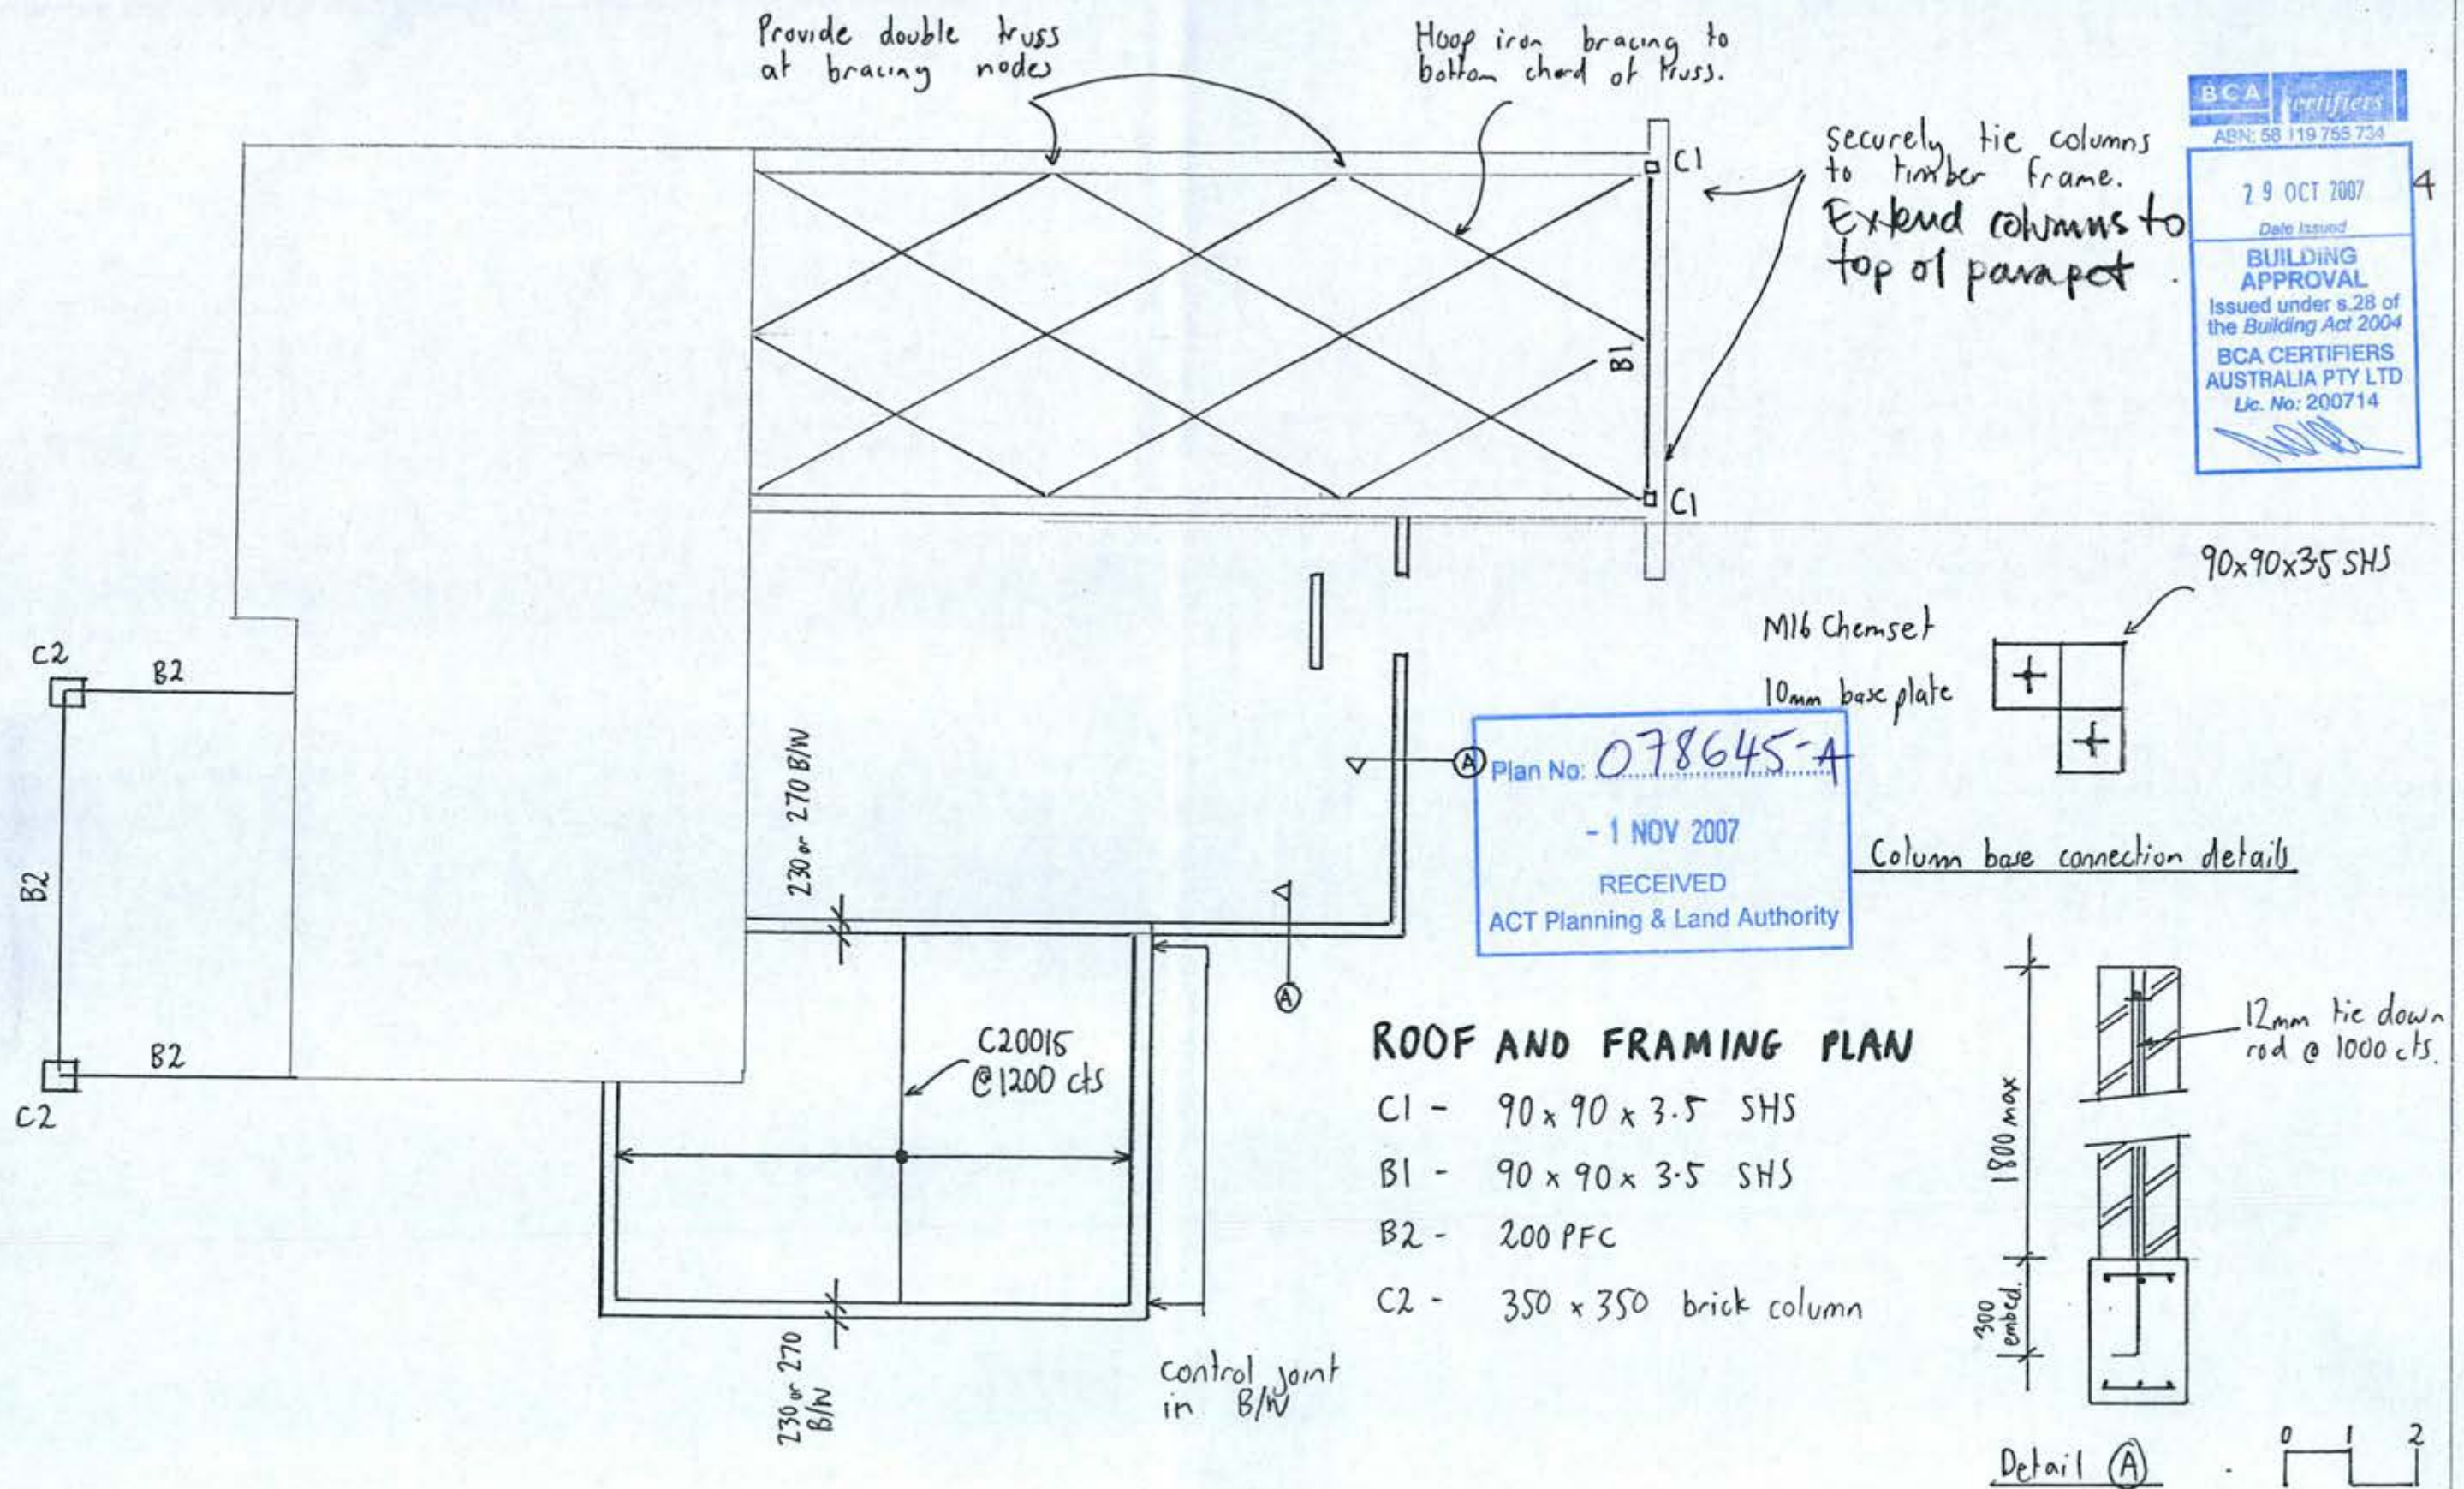

			PROJECT:	DRAWING TITLE:	 Tel (02) 6285 1822 Fax (02) 6285 1863 Canberra Sydney Newcastle Wollongong Terrigal Northrop Engineers Pty Ltd ABN 82 064 775 088	DATE: 17.11.06
			PETER COTSELL HOUSE	Roof and Framing Plan		DRAWN: SCM
			Block 12, Section 101, Narrabundah	All dimensions to be verified on site before making any shop drawings or commencing any work. The copyright of this drawing remains with Northrop Engineers PTY LTD.		SCALE:
17.11.06	A	For BA				JOB No: CR060661
DATE	REVISION	ISSUE AMMENDMENT				DRAWING No/Rev: S4 A



MASTER BUILDERS
FIDELITY FUND

Certificate number
Fund Reference Number

71818

18/0002

Certificate

Date Issued: 13/02/2020

This Certificate is not underwritten by the ACT Government nor by the Master Builders Association (ACT)

This Certificate applies to one dwelling only.

The contract price, or value of the work, is: \$307,246.

The builder's *estimated* construction period is from: 13/02/2020 to 30/04/2020.

Variations of up to 10% of the contract price are automatically included.

This Certificate is issued subject to the requirements of the **ACT Building Act 2004** and section 91, and in accordance with the terms and conditions set out in the Master Builders Fidelity Fund Trust Deed.

Builder's Name: **Robert Valk**

Builder's Licence No: **20121390**

Block: **12** Section: **101** Unit: **n/a** Suburb: **Narrabundah**

Residential Address: **70 Tallara Parkway**

Type of project, (ie speculative, contract or project management): **Contract**

For the construction of: **custom house, standard specifications, single storey**

Special conditions: **n/a**

Name of Owner(s): **J Cotsell**

Instructions to Builder:

This original certificate **MUST** be given to the home owner. Please photocopy for building approval purposes and for your records.

For variations in excess of 10% of the contract price, contact the Master Builders Fidelity Fund Manager on (02) 6175 5995.

Signature: 

(For and on behalf of the Master Builders Fidelity Fund)

This certificate is issued by the Master Builders Fidelity Fund and any enquiries regarding claims against this certificate must be directed to the Master Builders Fidelity Fund c/- MBA - ACT at 1 Iron Knob Street, Fyshwick ACT 2609, telephone (02) 6280 9119.

Please read the important information overleaf regarding this Certificate.

18/0002



Certificate of Occupancy and Use

Certificate No.: **B2020613C1**

Access Canberra Building Services

ABN 16 479 763 216
8 Darling Street Mitchell
GPO Box 158 ACT 2601
www.act.gov.au/accesscbr

This Certificate is issued in accordance with Section 69 (2) of the Building Act 2004.

The building work listed on this certificate has been completed substantially in accordance with the prescribed requirements and is considered fit for occupation and use.

Unit	Block	Section	Division (Suburb)	District	Jurisdiction
	12	101	NARRABUNDAH	CANBERRA CENTRAL	Australian Capital Territory

Plans

B2020613/A

Building Works

Class of Occupancy	Nature of Work	Project Item Description	Other Description	Type Of Const.	Unit	BCN ID	Builder
1a(l)	New	RESIDENCE		NA		B2020613N1	ROBERT JOHN VALK

Comments

Important Note:

1. Statutory warranties and statutory warranty insurance or a statutory warranty fidelity certificate apply in relation to some or all of the building work.

2. The issue of this certificate in respect of a building or a portion of a building does not affect the liability of a person or other entity to comply with the provisions of an ACT law, including the Building Act 2004, relating to the building or portion of the building.

Issued by: Rebecca Rattenbury

Issued on: 28/05/2020

Delegate of the ACT Construction
Occupations Registrar.

DO NOT SCALE OFF PLAN.
WRITTEN DIMENSIONS WILL TAKE PRECEDENCE


ANY DISCREPANCIES MUST BE DISCUSSED
WITH THE DRAFTSMAN

THE DRAFTSMAN TAKES NO
RESPONSIBILITY FOR MISINTERPRETED
DRAWINGS OR CONSTRUCTION ERRORS

THE BUILDING IS TO BE SITED BY A
SURVEYOR. ALL DIMENSIONS, LEVELS AND
SETBACKS NOTED ON PLAN MUST BE
CHECKED ON SITE BY SURVEYOR & BUILDER
PRIOR TO ANY CONSTRUCTION.

ALL BUILDING WORK MUST COMPLY WITH THE N.C.C.
AND ALL RELEVANT AS CODES.

ALL BUILDING WORKS TO BE DONE BY LICENSED
PROFESSIONALS. THEY ARE RESPONSIBLE FOR
THEIR OWN WORK AND THE COMPLETION AND
SUBMISSION OF ANY ASSOCIATED DOCUMENTS.

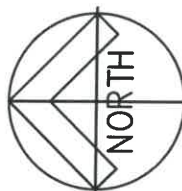

EROSION & SEDIMENT CONTROL NOTES

THE DEVELOPMENT WILL COMPLY WITH THE ACT
ENVIRONMENT PROTECTION AUTHORITY,
ENVIRONMENT PROTECTION GUIDELINES FOR
CONSTRUCTION AND LAND DEVELOPMENT IN
THE ACT, AUGUST 2007.

THE MEASURES REQUIRED FOR CONFORMING WITH
ACT WATER POLLUTION ACT & AS SHOWN IN THE
ENVIRONMENTAL PROTECTION GUIDELINES FOR
CONSTRUCTION & LAND DEVELOPMENT IN THE
ACT 2007.

EROSION & SEDIMENT CONTROL MEASURES TO BE
INSTALLED TO THE SATISFACTION OF ENVIRONMENT
ACT BEFORE COMMENCEMENT OF ANY EXCAVATION.

EXACT LOCATIONS OF EROSION SEDIMENT
CONTROL FEATURES TO BE AGREED ON SITE WITH
SUPERINTENDENT & INSTALLED PRIOR TO
CONSTRUCTION.


STORMWATER INLET SEDIMENT TRAPS SHALL BE
INSTALLED WHERE NECESSARY.

A 150mm CRUSHED AGGREGATE DRIVEWAY MAY BE
REQUIRED TO AVOID SOIL TRANSFER.

MAKE SURE THAT ALL LOADS GOING TO OR FROM THE
SITE ARE COVERED TO AVOID SOIL TRANSFER.

Class 1a(i)
BUILDING APPROVAL
Issued under section 28 of the Building Act 2004
CBS Residential Certifiers Pty Ltd
19 FEB 2020
Licence No:
2019937

THIS APPROVAL IS SUBJECT TO CONDITIONS INCLUDING THE FOLLOWING:
ALL WORKS, INCLUDING BUILDINGS/STRUCTURES, RETAINING WALLS AND SUBSTRUCTURE
(I.E. FOOTINGS ETC) AND ALL DRAINAGE E.G. GUTTERING ARE TO BE SITED WHOLLY WITHIN THE
LEASED BOUNDARIES OF BLOCK 12 SECTION 101 NARRABUNDAH

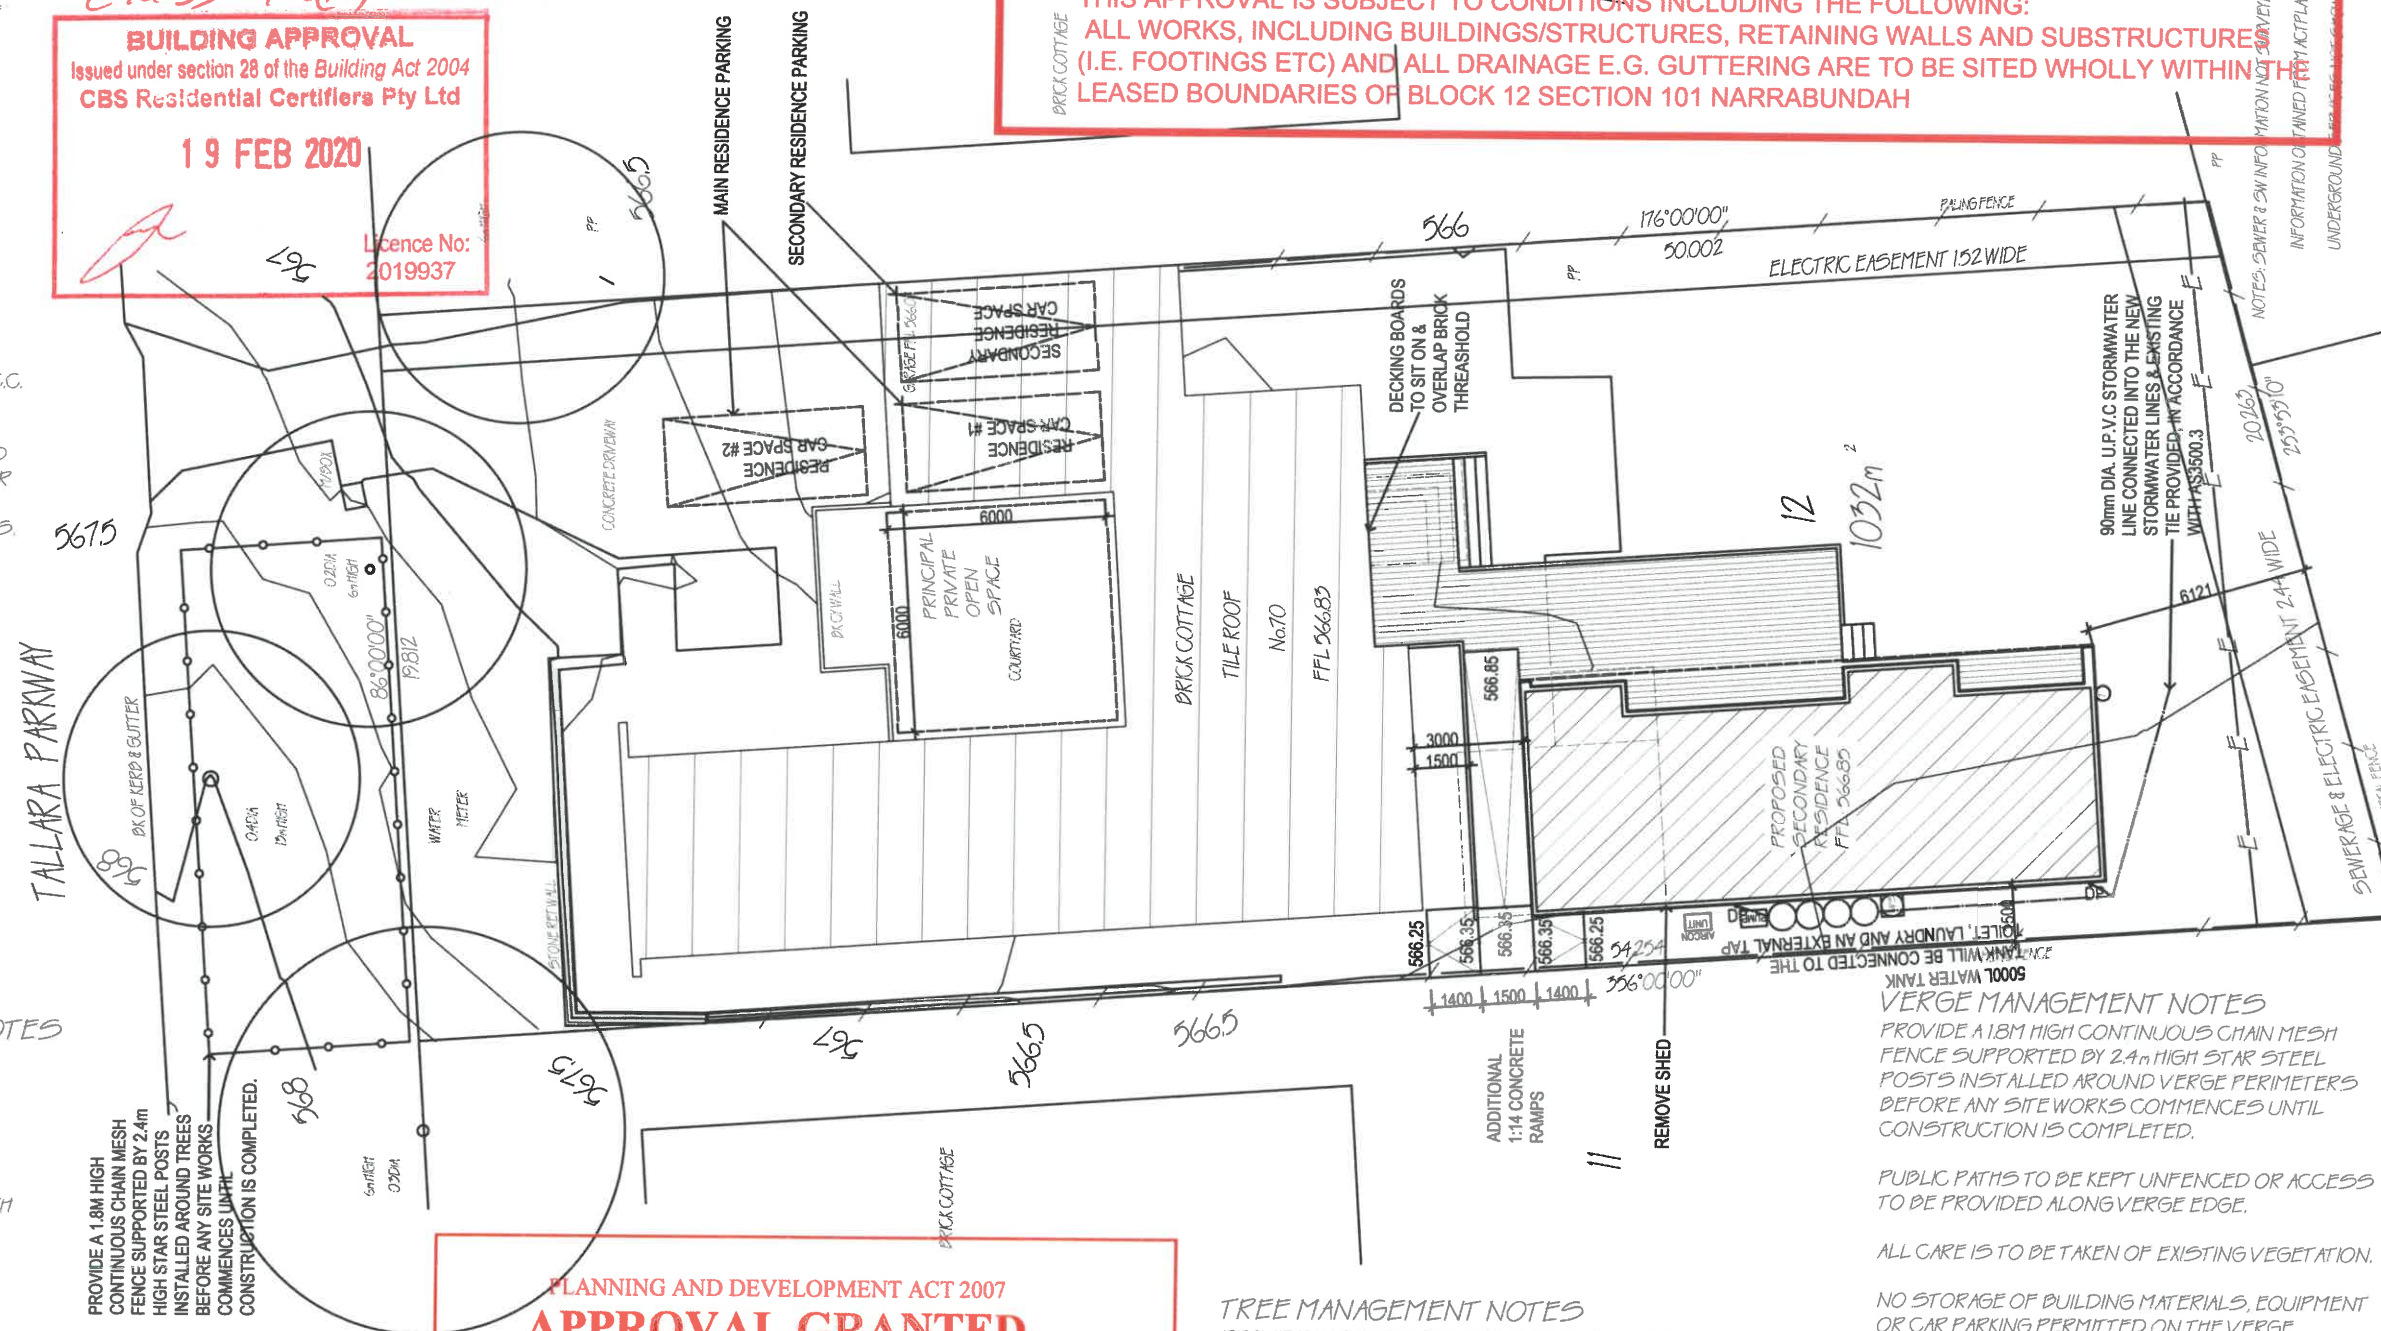

PLANNING AND DEVELOPMENT ACT 2007
APPROVAL GRANTED
PURSUANT TO SECTION 165

Delegate name SUSAN KIM

Date 29/1/2020

DO NOT SCALE OFF PLAN. WRITTEN
DIMENSIONS WILL TAKE PRECEDENCE

SMOKE ALARMS MUST COMPLY WITH
3.7.2 OF THE N.C.C. & AS 3786, INSTALLED
WHERE SHOWN & HARD WIRED TO AS 3000

FR INDICATIVE LOCATIONS OF
REFRIGERATOR & OTHER APPLIANCES

MAINTAIN CAVITY CONSTRUCTION.

ALL BUILDING WORK MUST COMPLY WITH THE
N.C.C. AND ALL RELEVANT AS CODES.

WINDOWS ARE ALUMINIUM FRAMED AND
SINGLE GLAZED, UNLESS NOTED OTHERWISE.
ALL WINDOW SIZES MUST BE CHECKED BY
THE BUILDER PRIOR TO ORDERING.

DG = DOUBLE GLAZING
OGS = OPGURE GLAZING

RAKED CEILINGS

3.5 DEG. ROOF PITCH

T TAP

INSULATION

EXT WALLS: R20 + SISALATION
CEILING: R4.0 + SISALATION
FLOOR: R15 + SISALATION

DRAWN FOR:

VRD
DEVELOPMENTS
ABN 31 626 219 458 PH: (02) 6101 5917

DRAWN BY: MLS

CLIENT:

VRD DEVELOPMENTS

SHEET TITLE:

2 BED & 2 BATH PLAN

PROJECT:

PROPOSED SECONDARY
RESIDENCE

LOCATION:

BLK: SEC:
SUB:

SHEET No: 4 of 10

DATE: 30/10/19

SCALE: 1:100


JOB No: 0013-POD


AREAS: SECONDARY RESIDENCE: 89.99m2
(DECK: 68.75m2)

Class 1a(i)
BUILDING APPROVAL
Issued under section 28 of the Building Act 2004
CBS Residential Certifiers Pty Ltd

19 FEB 2020

Licence No:
2019937



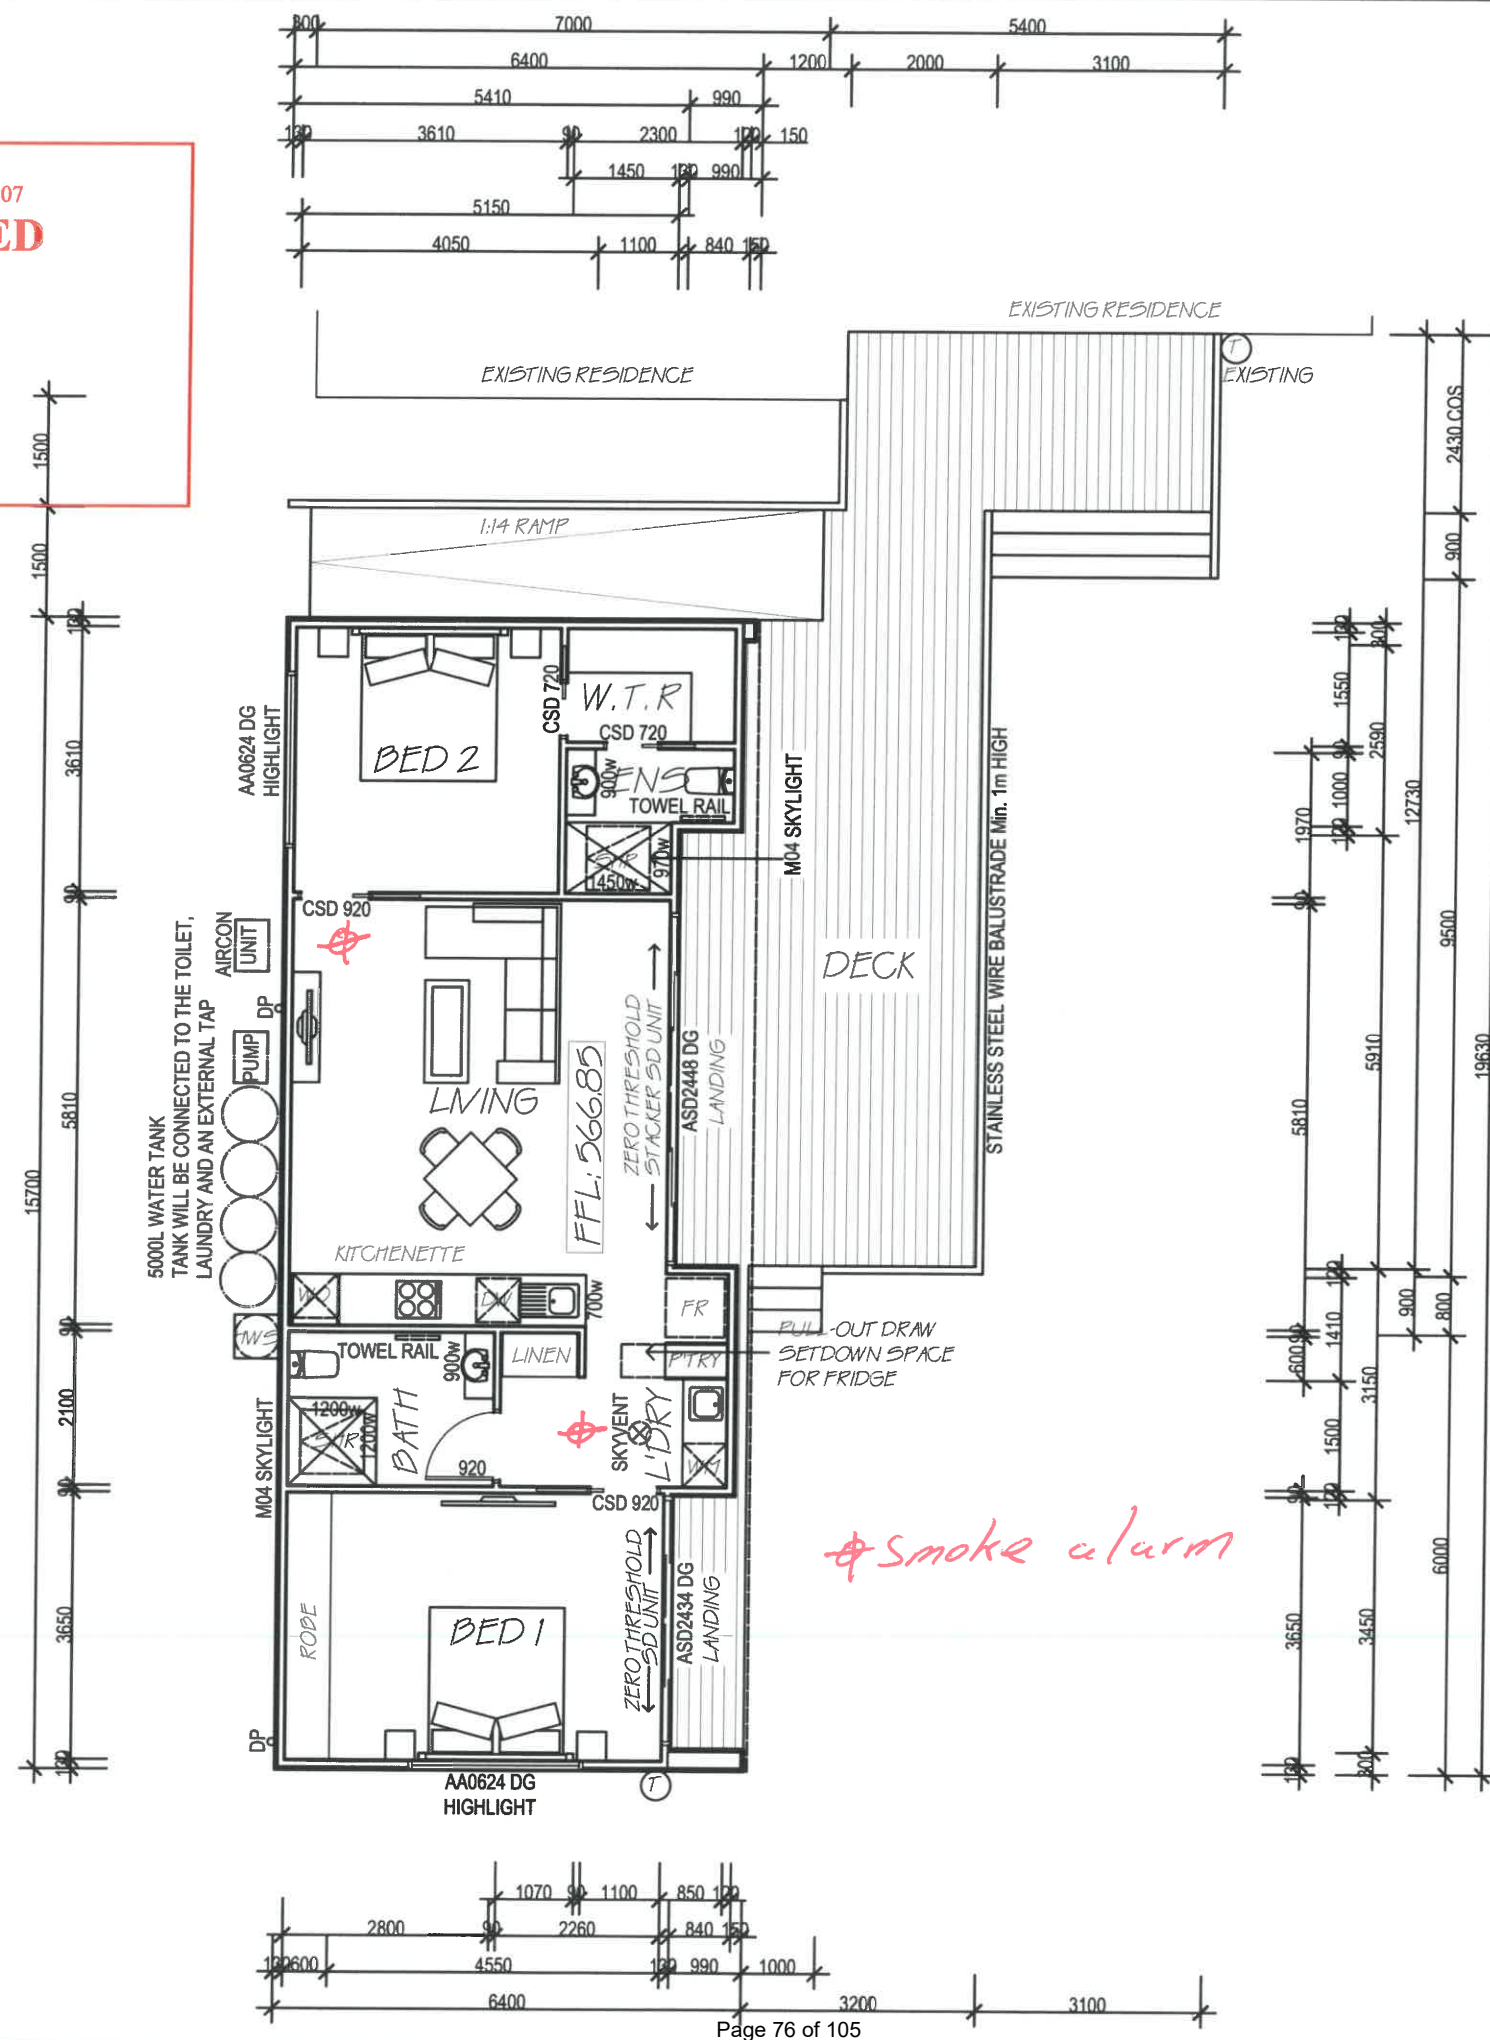


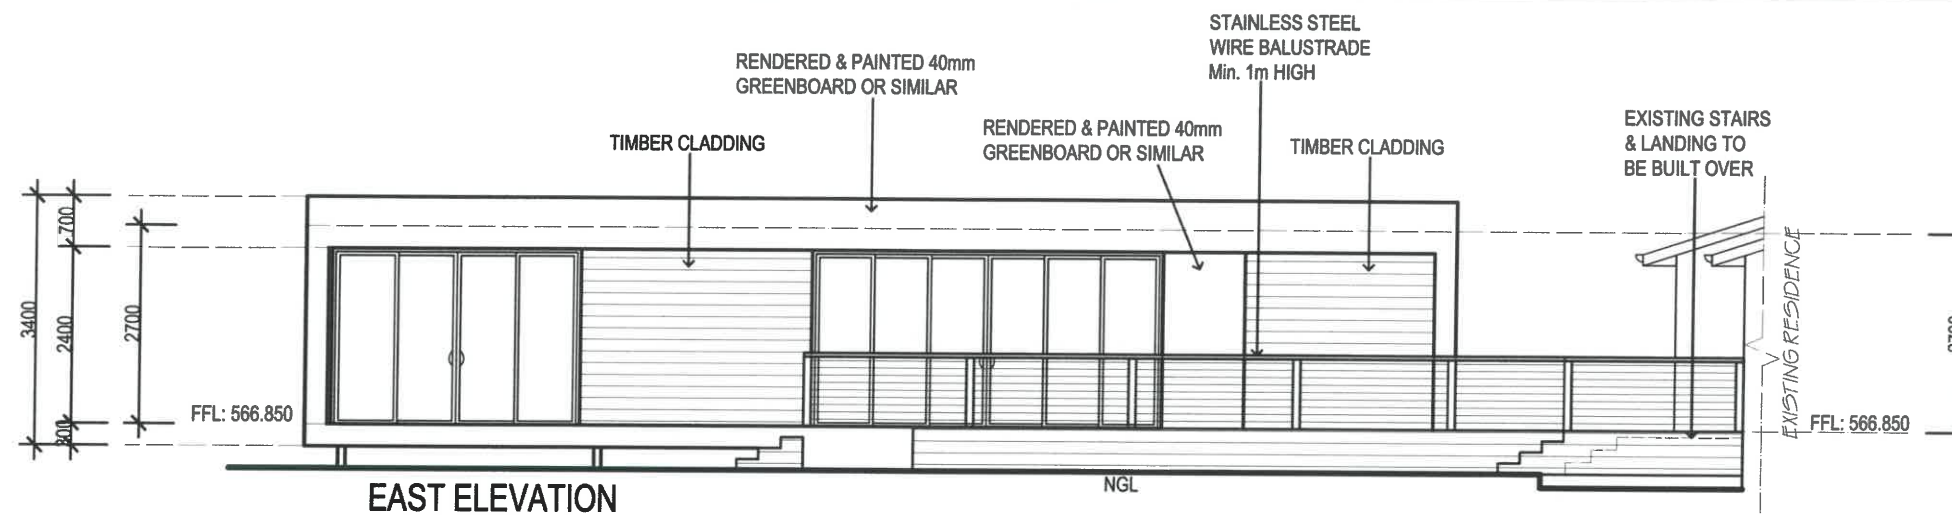

Class 1a(1)

BUILDING APPROVAL
 Issued under section 28 of the Building Act 2004
 CBS Residential Certifiers Pty Ltd
19 FEB 2020

Licence No:
 2019937

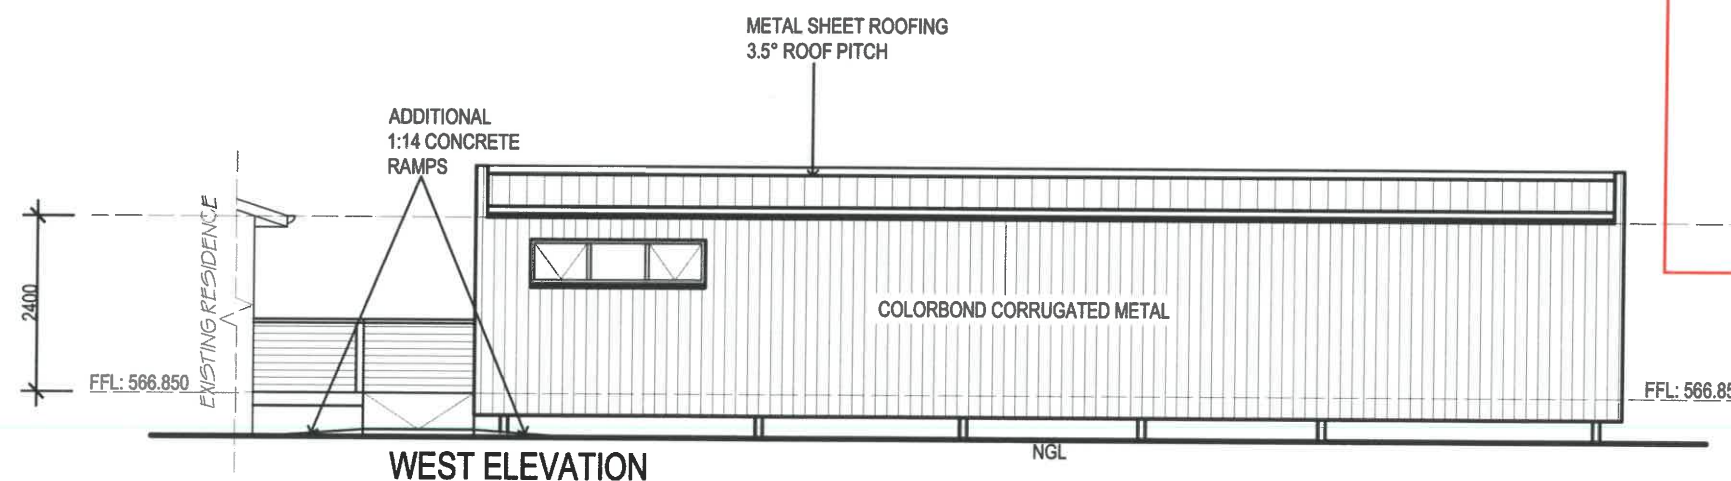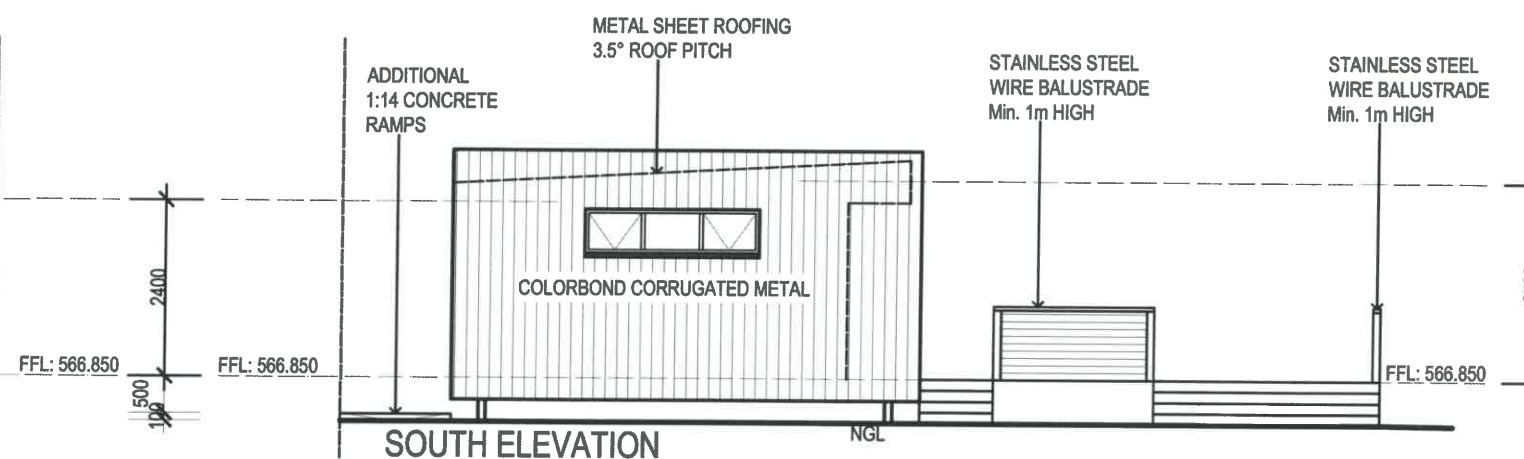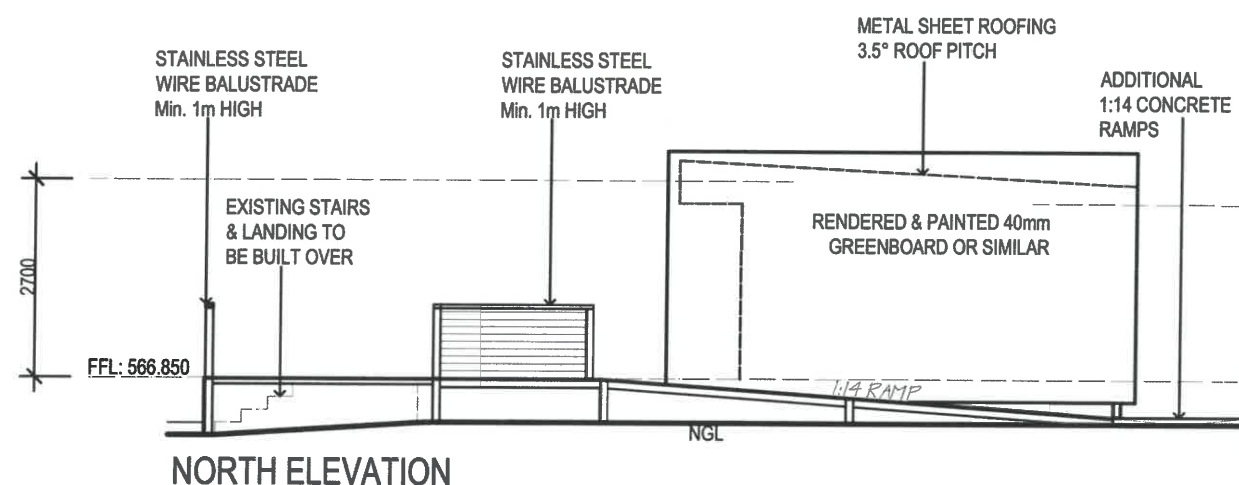

PLANNING AND DEVELOPMENT ACT 2007
APPROVAL GRANTED
 PURSUANT TO SECTION 165

Delegate name SUSAN KIM
 Date 29/1/2020

DRAWN FOR:

VRD
DEVELOPMENTS
 ABN 31 626 219 458 PH: (02) 6101 5917

DRAWN BY: *MLS*

CLIENT:

VRD DEVELOPMENTS

SHEET TITLE:

ELEVATIONS

Page 77 of 105

PROJECT:

PROPOSED SECONDARY
 RESIDENCE

LOCATION:

BLK: 12 SEC: 101
 SUB: NARRABUNDAH


SHEET No: 8 of 10

DATE: 30/10/19

SCALE: 1:100

JOB No: 0013-POD

AREAS:

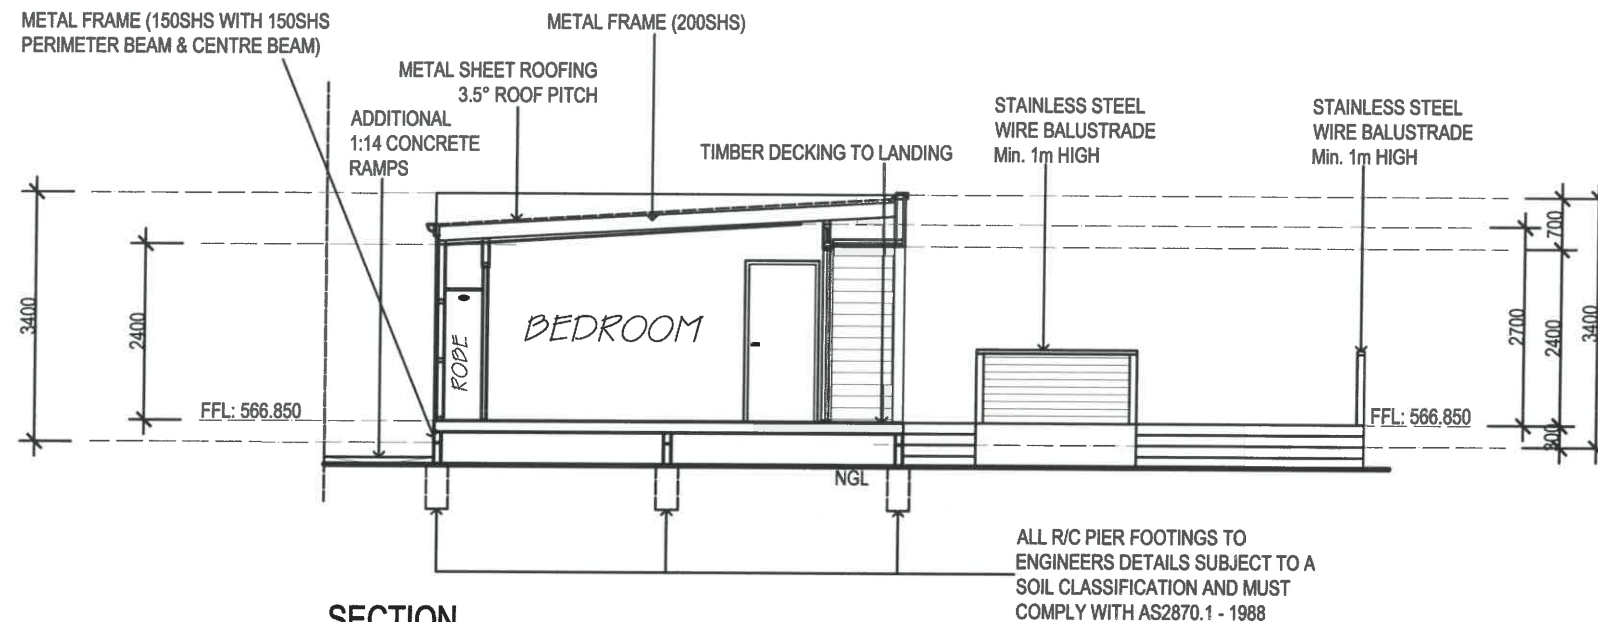

SECTION

PLANNING AND DEVELOPMENT ACT 2007
APPROVAL GRANTED
 PURSUANT TO SECTION 165

Delegate name SUSAN KIM

Date 29/1/2020

DO NOT SCALE OFF PLAN. WRITTEN DIMENSIONS WILL TAKE PRECEDENCE.



ALL TIMBER FRAMING AND CONSTRUCTION MUST COMPLY WITH AS 1684-2010 'THE NATIONAL TIMBER FRAMING CODE'

ALL R/C FOOTINGS AND CONCRETE SLABS ARE SUBJECTED TO A SOIL CLASSIFICATION AND MUST COMPLY WITH AS 2870.1998 'RESIDENTIAL SLABS & FOOTING CODE'.


LINTELS TO TRUSS MANUFACTURERS CHART. DESIGN WIND LOADING - 33m/s TERRAIN CATEGORY - 3

ALL BUILDING WORK MUST BE IN ACCORDANCE WITH THE BUILDING CODE OF AUSTRALIA, COMPLY WITH ALL RELEVANT SAA CODES AND ACT. SUPPLEMENT (AS REQUIRED)

ANY DISCREPANCIES MUST BE DISCUSSED WITH THE DRAFTSMAN

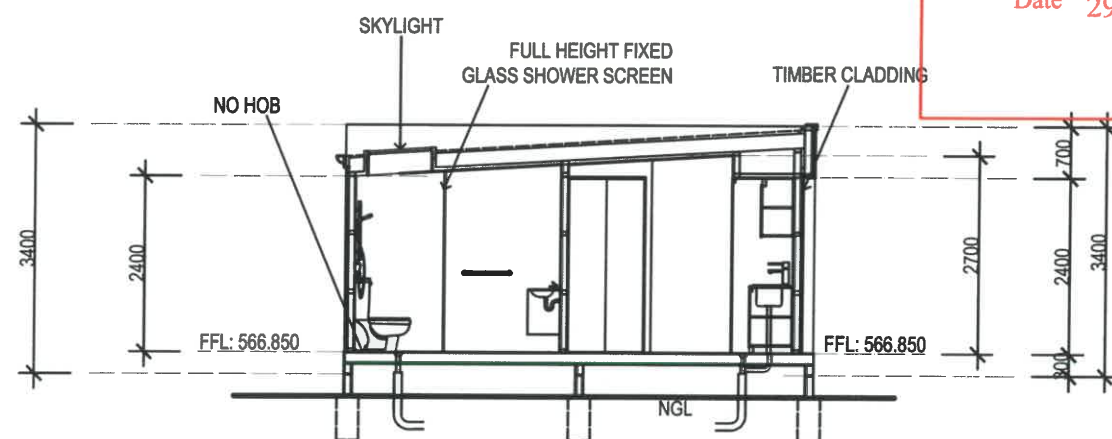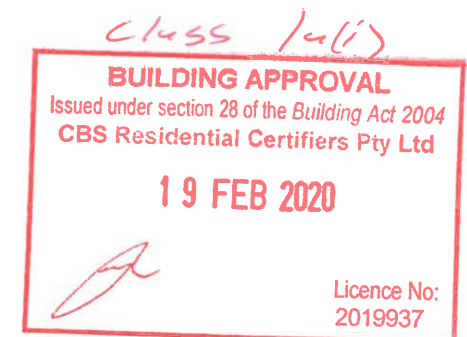

LAUNDRY & BATHROOM
ELEVATION/ SECTION

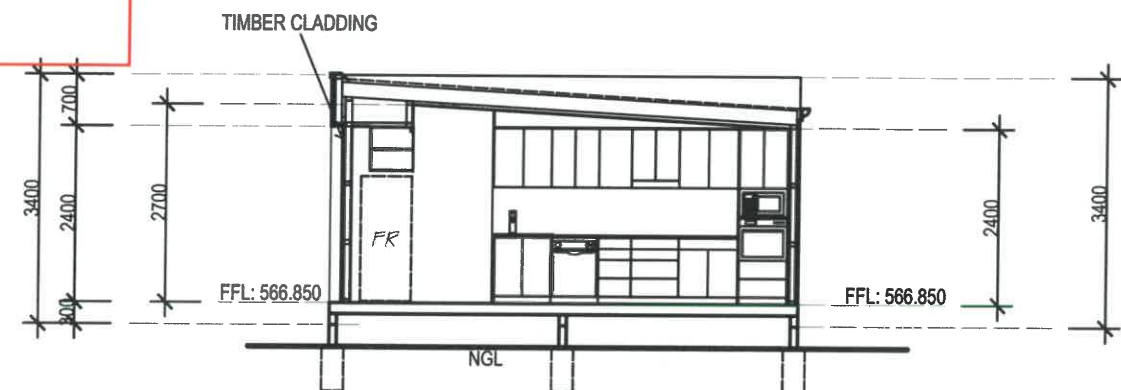

KITCHEN ELEVATION/ SECTION

DRAWN FOR:

VRD
 DEVELOPMENTS
 ABN 31 626 219 458 PH: (02) 6101 5917

DRAWN BY: MLS

CLIENT:

VRD DEVELOPMENTS

SHEET TITLE:

SECTIONS

Page 78 of 105

PROJECT:

PROPOSED SECONDARY
RESIDENCE

LOCATION:

BLK: 12 SEC: 101
SUB: NARRABUNDAH

SHEET No: 9 of 10

DATE: 30/10/19

SCALE: 1:100

JOB No: 0013-POD

AREAS:

BLOCK: 12 SECTION 101, NARRABUNDAH

GENERAL NOTES

- G1 These drawings shall be read in conjunction with other consultants' drawings and specifications and with other such written instructions as may be issued during the course of the Contract. Any discrepancy shall be referred to the Engineer before proceeding with the work.
- G2 All dimensions are in millimetres, U.N.O. (unless noted otherwise).
- G3 No dimension shall be obtained by scaling the drawings.
- G4 All levels and setting out dimensions shown on the drawings shall be checked on site prior to the commencement of the work.
- G5 During construction the structure shall be maintained in a stable condition and no part shall be overstressed.
- G6 Damp-proofing & sealing details shall be in accordance with Architect's details. All joints in concrete elements shall be suitably sealed or damp-proofed.

FOUNDATIONS

- F1 Refer Slab Design Criteria for classification of site.
- F2 Footings have been designed for an allowable bearing pressure of 150 kPa U.N.O. All foundations must be stable and uniform throughout.
- F3 Foundation material shall be inspected and approved for the above site classification and allowable bearing pressure by a Geotechnical Engineer before placing footing reinforcement.
- F4 Footings shall be placed centrally under walls and columns, U.N.O.

LOADING

- L1 Superimposed floor loads are generally in accordance with AS 1170.1 or as noted in Table L4.
- L2 Wind loads are in accordance with AS/NZS 1170.2 as follows:
Region : A Terrain category 3 wind classification N2
- L3 Earthquake loads are in accordance with AS 1170.4 as follows:
a = 0.08 S = 1.0 I = 1.0, U.N.O.
- L4 Live loads & additional dead loads: (to AS/NZS 1170.1)

Area subject to loading	Live Load		Add. Dead Load
	Uniform	Point	
Floors - Internal	1.50 kPa	1.80 kN	0.50 kPa
Floors - External & Garage	3.00 kPa	1.80 kN	1.00 kPa
Roof Areas	0.25 kPa	1.40 kN	0.15 kPa

MASONRY

- M1 All workmanship and materials shall be in accordance with AS 3700.
- M2 Characteristic compressive strength of masonry (f_{uc}) = 24 MPa

Durability Requirements			
Mortar	Salt Attack Resistance Grade	Built In Component	Min. Cover to Reinforcement & Tendons in Grouted Cavities
M2	Protected	R1 (Galv'd 300 g/m² each side)	5
M3	General Purpose	R3 (Galv'd 470 g/m² each side)	15
M4	Exposure	R4 (Stainless)	30

- M3 All masonry walls supporting slabs and beams shall have a pre-greased two layer galvanised steel slip joint between concrete and masonry.
- M4 All masonry walls supporting or supported by concrete floors shall be provided with vertical joints to match any control joints in the concrete.
- M5 Non load bearing walls shall be separated from concrete above by 12 mm thick closed cell polyethylene strip.
- M6 Provide vertical control joints at 8 metres maximum centres, and 4 metres maximum from corners in masonry walls, and between new & existing brickwork.
- M7 Masonry retaining walls are to be backfilled with either of the following material:
- Coarse grained soil with low silt content
- Residual soil containing stones
- Fine silty sand
- Granular materials with low clay content

REINFORCED CONCRETE

- C1 All workmanship and materials shall be in accordance with AS 3600 current edition, except where varied by the contract documents.
- C2 Concrete quality shall be as follows (subject to note C4 being satisfied):

Element	Slump mm	Max. Agg. Size mm	Cement Type	f'c at 28 Days MPa
Footings	80	20	Normal	20
Slabs on Ground	80	20	Portland	25
Suspended Floors	80	20	Type A	32

- C3 Engineer to approve any admixtures used in concrete mix.
- C4 Cover to reinforcement shall be obtained by the use of approved bar chairs. All chairs to be placed at 750 maximum centres.
- C5 Minimum clear concrete cover to reinforcement including ties and stirrups (other than residential slabs on ground or footings) shall be as follows uno.

Exposure Classification	Minimum Cover (mm)				
	Concrete Strength (f'c)				
	20 MPa	25 MPa	32 MPa	40 MPa	>50 MPa
A1	20	20	20	20	20
A2	(50)	30	25	20	20
B1	-	(60)	40	30	25
B2	-	-	(65)	45	35
C	-	-	-	(70)	50

For bracketed figures refer to AS 3600 current edition table 4.10.3.2

- C6 Residential slab on ground and footings cover requirements: (Minimum concrete grade N20)
- Unprotected ground: 40 mm
- External exposure: 40 mm
- Membrane in contact with ground: 30 mm
- Internal surface: 20 mm
- Strip & pad footing: 40 mm
- C7 All concrete shall be mechanically vibrated. Vibrators shall not be used to spread concrete.
- C8 Sizes of concrete elements do not include thickness of applied finishes.
- C9 No holes or chases other than those shown on the structural drawings shall be made in concrete members without the prior approval of the Engineer.
- C10 Construction joints where not shown shall be located to the approval of the Engineer.
- C11 Curing of all concrete is to be achieved by keeping surfaces continuously wet for a period of 3 days, and prevention of loss of moisture for a total of 7 days followed by gradual drying out. Approved sprayed on compounds may be used where no floor finishes are proposed. Polythene sheeting or wet hessian may be used if protected from wind and traffic.
- C12 Construction support propping is to be left in place where needed to avoid over stressing the structure due to construction loading. No masonry or partition walls are to be constructed on suspended levels until all propping is removed and the slab has absorbed its dead load deflection.
- C13 Conduits, pipes, etc. shall only be placed in the middle one third of slab depth and spread at not less than 3 diameters.
- C14 Reinforcement symbols :
N - Denotes deformed grade 500 normal ductility reinforcing bars to AS/NZS 4671.
R - Denotes plain round grade 250 normal ductility reinforcing bars to AS/NZS 4671.
SL - Denotes deformed grade 500 low ductility reinforcing mesh to AS/NZS 4671.
RL - Denotes deformed grade 500 low ductility reinforcing mesh to AS/NZS 4671.
L--TM - Denotes deformed grade 500 low ductility trench mesh to AS/NZS 4671.

- C15 Reinforcement is represented diagrammatically; it is not necessarily shown in true projection.
- C16 Splices in reinforcement shall be made only in positions shown or otherwise approved by the Engineer.
- C17 Fabric reinforcement shall have splices made so that the overlap, measured between the outermost transverse wires of each sheet of fabric, is not less than the spacing of those wires plus 25 mm.
- C18 Welding of reinforcement shall not be permitted unless shown on the structural drawings or approved by the Engineer.

STRUCTURAL STEEL

- S1 All workmanship and materials shall be in accordance with AS 4100, AS 1163, AS 1554.1 and AS/NZS 4600.
- S2 The structural design has been based on the following steel grades, U.N.O:
Hot rolled universal beams, columns, channels & angles:300PLUS
Circular, square & rectangular hollow sections: C350/C450LO
Cold formed open DuraGal profiles: C400/C450LO
Cold formed lipped Cee & Zed purlins: G550/G500/G450
- S3 The structural design has been based on MBPMA nominal size Cee & Zed lipped purlins. All purlin profiles shall be in accordance with the MBPMA specifications.
- S4 Qualifications of welding procedures and personnel shall conform to Section 4 of AS 1554.1. Non destructive testing of welds shall include 100% visual inspection and additional testing as shown on the drawings.
All welds shall be 6 mm continuous fillet type SP, U.N.O. All butt welds shall be complete penetration in accordance with AS 1554.1, U.N.O.
Commercial bolts to AS 1111, snug tightened
High strength structural bolts to AS 1562, snug tightened
High strength structural bolts to AS 1562, fully tensioned bearing joint to AS 1511
High strength structural bolts to AS 1562, fully tensioned friction joint to AS 1511
All bolts shall be M16 8.8/S, with a minimum of 2 bolts per connection, U.N.O.
- S7 High strength TF & TB bolts shall be installed using approved load indicator washers, or in accordance with the part turn method nominated in AS 4100.
- S8 Gusset plates shall be 10 mm thick, grade 300PLUS steel, U.N.O.
- S9 Concrete encased steelwork shall be wrapped with SL41 fabric and shall have a minimum of 50 mm cover, U.N.O.
- S10 Steelwork not encased shall have the following surface treatment :

Exposure Classification	Steelwork Protection Required
A1 / A2	Power tool clean to AS1627 Class 1 1 Coat Alkyd Primer (Zinc Phosphate)
B1	Abrasive blast to AS1627 Class 2.5 1 Coat Inorganic Zinc Silicate
B2	Hot Dipped Galvanised to AS4680

S11 Where sealed tube members are hot dip galvanised, the fabricator shall provide drill holes as necessary.

S12 All transport and erection damage, site welds etc., shall be reinstated to an equivalent finish to adjacent steelwork

SITE PREPARATION FOR SLABS ON GROUND

- P1 Strip topsoil containing organic matter. Proof roll fill sub grade and remove any soft zones.
- P2 Where additional fill is required to the underside of slabs on ground, non cohesive materials such as sand and gravel dust shall be placed by "controlled" compaction in horizontal layers of 200 mm (loose) maximum depth. This fill shall be compacted to at least 95% of Standard Maximum Dry Density (SMDD).
- P3 For slabs on ground, sand 50 mm approximate thickness is to be spread as a levelling layer and well watered down.
- P4 Damp-proofing membrane unpunctured and taped at laps, is to be placed over the sand, sufficient membrane being provided at edges to return under brickwork. Where no brickwork, tape membrane to side of footing below ground.

FOUNDATION MAINTENANCE

FOUNDATION SOILS : All soils are affected by water. Silts are weakened by water and some sands can settle if heavily watered, but most problems arise on clay foundations. Clays swell and shrink due to changes in moisture content and the potential amount of the movement is implied in the site classification in Australian Standard AS2870, which is specified as follows:

- A Stable (Non-reactive).
S Slightly Reactive.
M Moderately Reactive.
H Highly Reactive.
E Extremely Reactive.

CLASS A & S SITES : Sands, silts and clays shall be protected from becoming extremely wet by adequate attention to site drainage and prompt repair of plumbing leaks.

CLASS M, H & E SITES : Sites classified as M, H, or E shall be maintained at essentially stable moisture conditions and extremes of wetting and drying prevented. This will require attention to the following :

Drainage of the site : The site shall be graded or drained so that water cannot pond against or near the house. The ground immediately adjacent to the house shall be graded to a uniform fall of 50 mm minimum away from the house over the first metre. The sub floor space for houses with suspended floors shall be graded or drained to prevent ponding where this may affect the performance of the footing system. The site drainage requirements shall be maintained for the economic life of the building.

Limitations on gardens : The development of the gardens shall not interfere with the drainage requirements or the sub floor ventilation and weep hole drainage systems. Garden beds adjacent to the house should be avoided. Care should be taken to avoid over watering of gardens close to the house footings.

Restrictions on trees and shrubs : Planting of trees should be avoided near the foundation of a house or neighbouring house on reactive sites as they can cause damage due to drying of the clay at substantial distances. To reduce, but not eliminate, the possibility of damage, tree planting should be restricted to a distance from the house of :

- 1.50 x mature height for Class E sites
1.00 x mature height for Class H sites
0.75 x mature height for Class M sites

Where rows or groups of trees are involved, the distance from the building should be increased. Removal of trees from the site can also cause similar problems.

Repair of leaks : Leaks in plumbing, including storm water and sewerage drainage should be repaired promptly.




The level to which these measures are implemented depends on the reactivity of the site. The measures apply mainly to masonry houses and masonry veneer houses. For frame houses clad with timber or sheeting, lesser precautions may be appropriate.

BONDEK/CONDECK FORMWORK


- B1 U.N.O. BONDEK/CONDECK PANELS SHALL BE 1.00Mmm BMT
- B2 PANELS ARE TO BE SECURELY FIXED OR HELD DOWN TO PREVENT DISPLACEMENT DUE TO CONSTRUCTION LOADING OR WIND UPLIFT PRIOR TO CONCRETING
- B3 FIX PANELS TO STEELWORK BY PUDDLE WELDING DRIVE PINS OR OTHER SUITABLE METHODS. SLIP JOINTS SHALL BE LOCATED AS SHOWN
- B4 FIXING TO MASONRY IS NOT NECESSARY PROVIDED CONCRETE IS PLACED IMMEDIATELY AFTER PANELS ARE LAID. TOP COURSE OF BRICKWORK IS TO BE STRAIGHT AND LEVEL. IF REQUIRED, PROVIDE LAYER OF SMOOTH HARD MORTAR SLIP JOINTS SHALL BE PROVIDED AT ALL MASONRY U.N.O.



- B5 BEFORE CONCRETE IS PLACED, ANY ACCUMULATED DEBRIS, GREASE OR ANY OTHER SUBSTANCE WILL NEED TO BE REMOVED TO ENSURE CLEAN BONDING SURFACE. ANY PONDED RAINWATER SHOULD BE REMOVED BY BLOWING OR SWEEPING
- B6 FASTENING OF SIDE LAP JOINTS SHALL BE IN ACCORDANCE WITH LYSAGHT PUBLICATIONS, AND GENERALLY ONE No. 10-24x16mm SELF-DRILLING TAPPING SCREW IS REQUIRED MID-SPAN FOR SUPPORT SPACING OF 2750mm OR GREATER. FOR POINT LOADS RATINGS OR EXPOSED SOFFITS ADDITIONAL FIXING MAY BE REQUIRED
- B7 U.N.O PROPPING SHALL BE IN ACCORDANCE WITH LYSAGHT PUBLICATIONS
- B8 PROPS SHALL NOT BE REMOVED UNTIL CONCRETE HAS REACHED SUFFICIENT STRENGTH



LEGEND


-  DENOTES LOAD BEARING BRICK WALL OVER
-  DENOTES CORE FILLED BLOCK WALL OVER
-  DENOTES NON LOAD BEARING WALL OVER
-  DENOTES NON LOAD BEARING WALL UNDER
-  DENOTES LOAD BEARING MASONRY WALL UNDER
-  DENOTES LOAD BEARING 190 DINCEL WALL
-  DENOTES LOAD BEARING STUD WALL OVER


-  DENOTES SLAB PENETRATION
-  DENOTES SLAB STEP DEPTH
-  DENOTES MINIMUM SLAB DEPTH




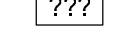
-  DENOTES SLAB DATUM
- SB1(-150) DENOTES STEEL BEAM 150mm BELOW SLAB DATUM

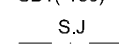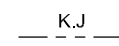-  DENOTES SAWN JOINT. REFER TO DETAILS.
-  DENOTES KEY JOINT. REFER TO DETAILS.

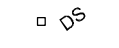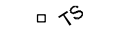
-  DENOTES DOUBLE STUD
-  DENOTES TRIPLE STUD

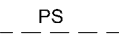-  DENOTES F11x4.5 THICK PLYWOOD SHEET STRUCTURAL BRACING. REFER TO TIMBER FRAMING CODE FOR FIXING.

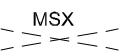-  DENOTES 30x0.8 METAL STRAP CROSS BRACING. REFER TO TIMBER FRAMING CODE AS1684 FOR FIXING

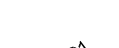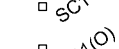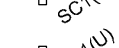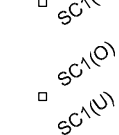-  DENOTES CONTINUOUS STEEL COLUMN
-  DENOTES STEEL COLUMN OVER
-  DENOTES STEEL COLUMN UNDER
-  DENOTES STEEL COLUMN UNDER & OVER

NOTE: DO NOT SCALE OFF DRAWINGS. REFER TO ARCHITECTURAL PLANS. VERIFY DIMENSIONS ON SITE

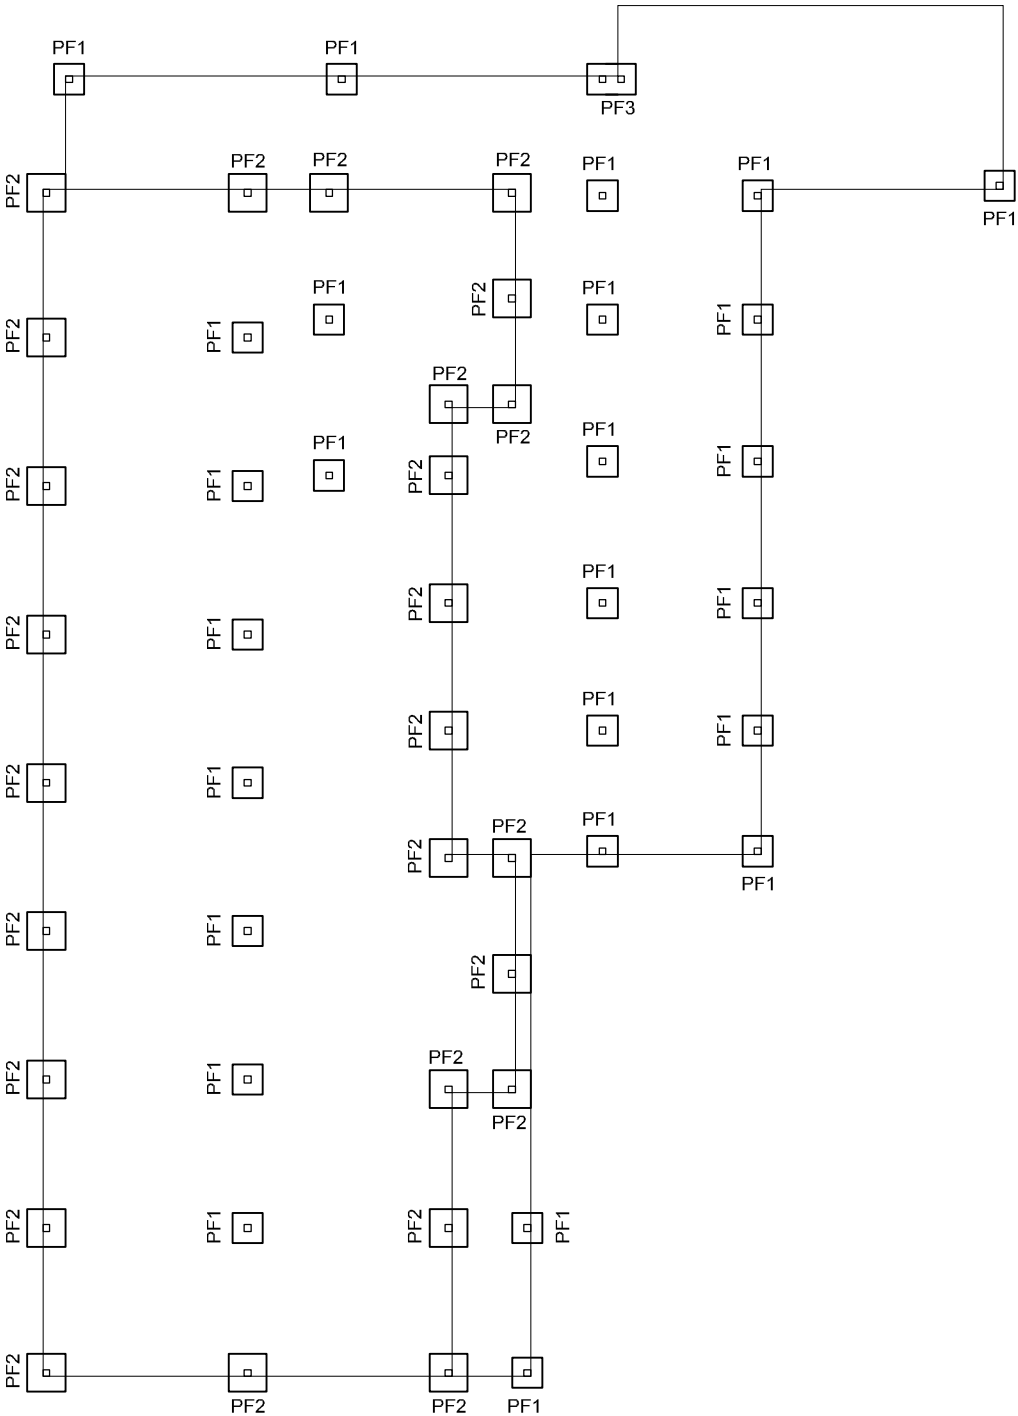

FOOTING PLAN

1:100

NOTES:

- 1. ALL FOOTINGS TO BEAR ON SAME STRATA & ON NATURAL SOLID GROUND OTHERWISE BORED PIERS MAY BE REQUIRED UNDER.
- 2. BUILDER TO REPORT SITE CONDITION TO STRUCTURAL ENGINEER AFTER THE SITE CUT & FILL IS COMPLETE

ELEMENT	STRENGTH	MAX SIZE	SLUMP	CEMENT	ADMIXTURE
CONCRETE QUALITY	f _c	AGG. mm	mm	TYPE	
FOOTINGS	20	20	80	GP	-

REFER TO GENERAL NOTES FOR REINFORCEMENT COVER

FOOTING SCHEDULE

MARK	DESCRIPTION	SIZE	COMMENTS
PF1	PAD FOOTING	400 D x 400 x 400	MASS CONCRETE
PF2	PAD FOOTING	400 D x 500 x 500	MASS CONCRETE
PF3	PAD FOOTING	400 D x 400 x 700	MASS CONCRETE

NOTE:

SITE CLASSIFICATION "M" AS DETERMINED BY ANH CONSULTING ENGINEER.
REFER TO SITE CLASSIFICATION PREPARED BY ANH.

NOTE: DO NOT SCALE OFF DRAWINGS. REFER TO ARCHITECTURAL PLANS. VERIFY DIMENSIONS ON SITE

A	16.02.20	ISSUED FOR BA	ANH
REV	DATE	DESCRIPTION	BY

COPYRIGHT
All rights reserved.
These drawings, plans and specifications and the copyright are the property of ANH Consultants and must not be used, reproduced or copied wholly or in part without the written permission of ANH Consultants.




Suite 4, 28 Collie St Fyshwick ACT (HIA Building)
T (02) 6100 0414 M. 0407 777 877
E. info@anh.net.au www.anh.net.au

NEW RESIDENCE
BLOCK: 12 SECTION 101, NARRABUNDAH
FOR POD CANBERRA

FOOTING & SLAB PLAN

JOB NUMBER: 19-787	DWG NUMBER: S100	ORIGINAL SIZE: A3
DESIGNED BY:	DATE: 16.02.2020	
DRAWN BY: M.H	SCALE: 1:100	

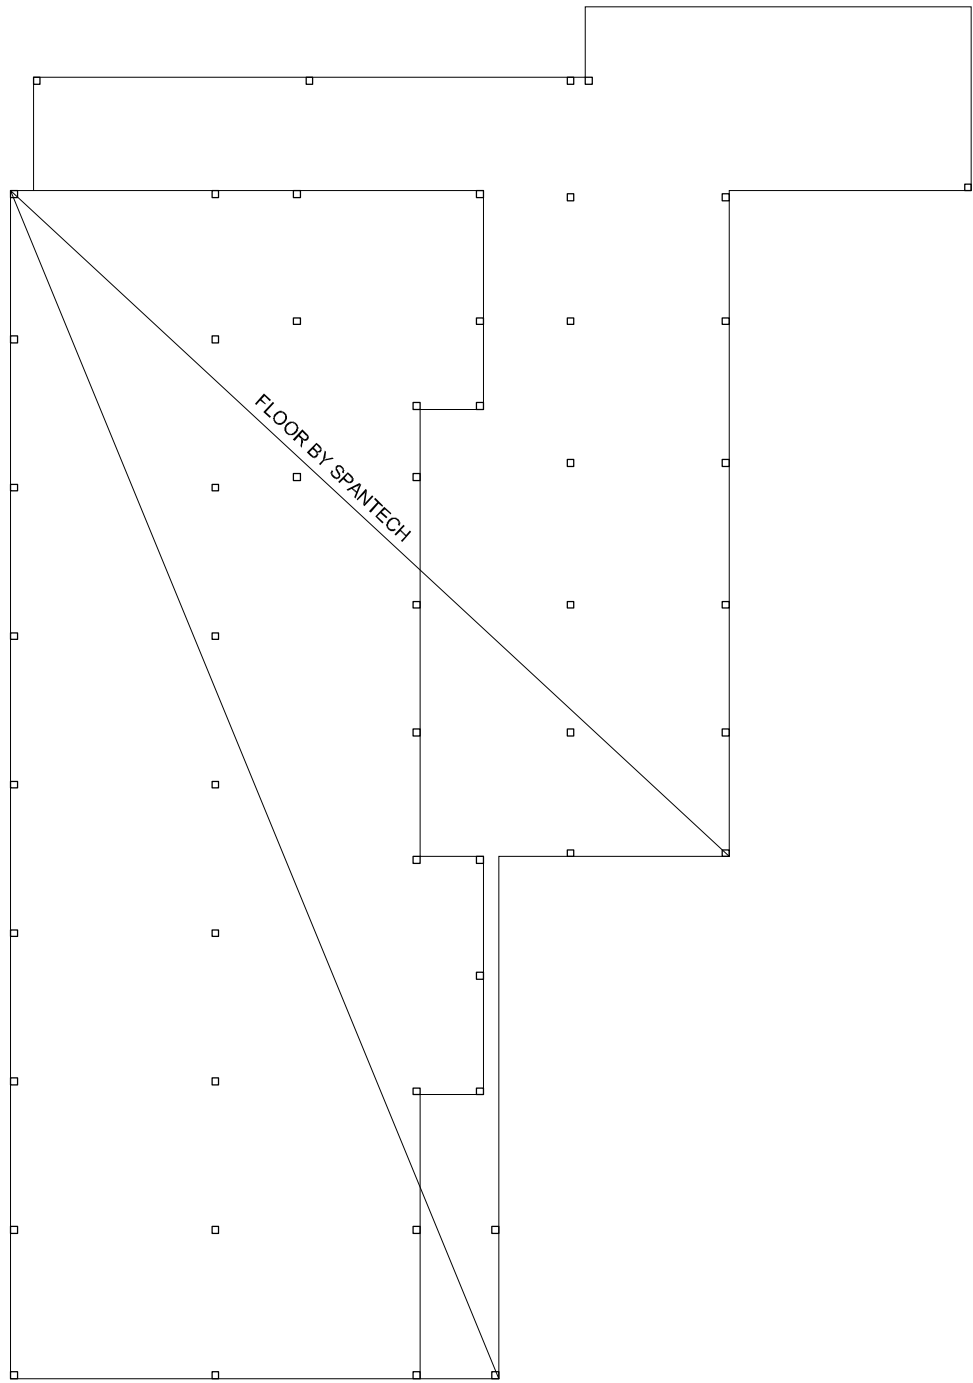

GROUND FLOOR MARKING PLAN
1:100

NOTE: DO NOT SCALE OFF DRAWINGS. REFER TO ARCHITECTURAL PLANS. VERIFY DIMENSIONS ON SITE.


A	16.02.20	ISSUED FOR BA	A.N.H.
REV	DATE	DESCRIPTION	BY


COPYRIGHT
All rights reserved.
These drawings, plans and specifications and the copyright are the property of ANH Consultants and must not be used, reproduced or copied wholly or in part without the written permission of ANH Consultants.



Suite 4, 28 Collie St Fyshwick ACT (HIA Building)
T (02) 6100 0414
E. info@anh.net.au

M. 0407 777 877
www.anh.net.au

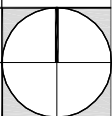NEW RESIDENCE BLOCK: 12 SECTION 101, NARRABUNDAH FOR POD CANBERRA		JOB NUMBER: 19-787	DWG NUMBER: S101	ORIGINAL SIZE: A3
GROUND FLOOR MARKING PLAN		DESIGNED BY: A.N.H.	DATE: 16.02.2020	
		DRAWN BY: M.H.	SCALE: 1:100	

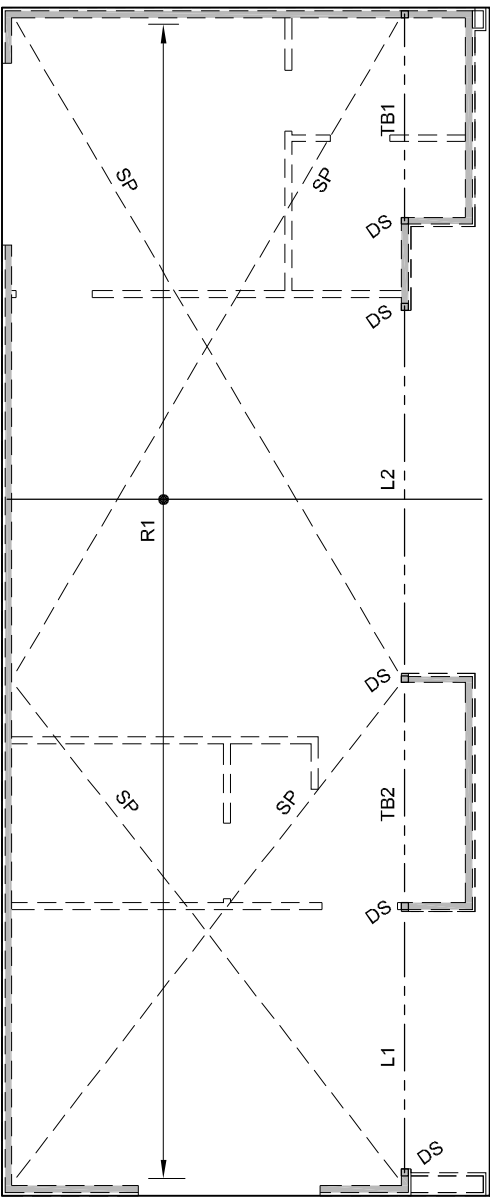

ROOF SUPPORT STRUCTURE

1:100

NOTE:
ALL LVL TIMBER MEMBERS MUST BE WEATHER PROTECTED.
ADVISE OUR OFFICE OTHERWISE

STEEL & TIMBER MEMBER SCHEDULE			
MARK	DESCRIPTION	SIZE	COMMENTS
DS	DOUBLE STUDS	2/90 x 45MGP10	
TB1	TIMBER BEAM	240 x 45 LVL	
TB2	TIMBER BEAM	240 x 45 LVL	
L1	TIMBER LINTEL	300 x 45 LVL	
L2	TIMBER LINTEL	2/300 x 45 LVL	
SP	SPEED BRACE		
R1	TIMBER RAFTER	300 x 45 LVL @ 900 Ctrs	

ALL TIMBER CONNECTIONS, TIEE DOWNS & BRACING TO AS1684 TIMBER FRAMING CODE
IF 400 DEEP CLEARANCE UNDERNEATH THE FLOOR CANNOT BE ACHIEVED ACCORDING TO
BCA REQUIREMENT, CONTACT STRUCTURAL ENGINEER BEFORE YOU CONTINUE THE WORK

NOTE:

DO NOT LOAD INTERNAL WALLS WITHOUT PERMISSION
OF A STRUCTURAL ENGINEER

TIMBER TRUSSES, ROOF BRACING, WALL FRAMING, LINTELS
WALL BRACING AND EXISTING ROOF SUPPORT TRUSSES BY FRAMING COMPANY.

NOTE: DO NOT SCALE OFF DRAWINGS. REFER TO
ARCHITECTURAL PLANS. VERIFY DIMENSIONS ON SITE.


A	16/02/20	ISSUED FOR BA		A.N.H.
REV	DATE	DESCRIPTION		


COPYRIGHT
All rights reserved.
These drawings, plans and specifications and
the copyright are the property of ANH
Consultants and must not be used, reproduced
or copied wholly or in part without the written
permission of ANH Consultants.



Suite 4, 28 Collie St Fyshwick ACT (HIA Building)
T (02) 6100 0414
E. info@anh.net.au

M. 0407 777 877
www.anh.net.au

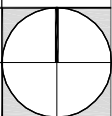NEW RESIDENCE BLOCK: 12 SECTION 101, NARRABUNDAH FOR POD CANBERRA		JOB NUMBER: 19-787	DWG NUMBER: S102	ORIGINAL SIZE: A3
ROOF SUPPORT STRUCTURE		DESIGNED BY: A.N.H.	DATE: 16.02.2020	
		DRAWN BY: M.H.	SCALE: 1:100	

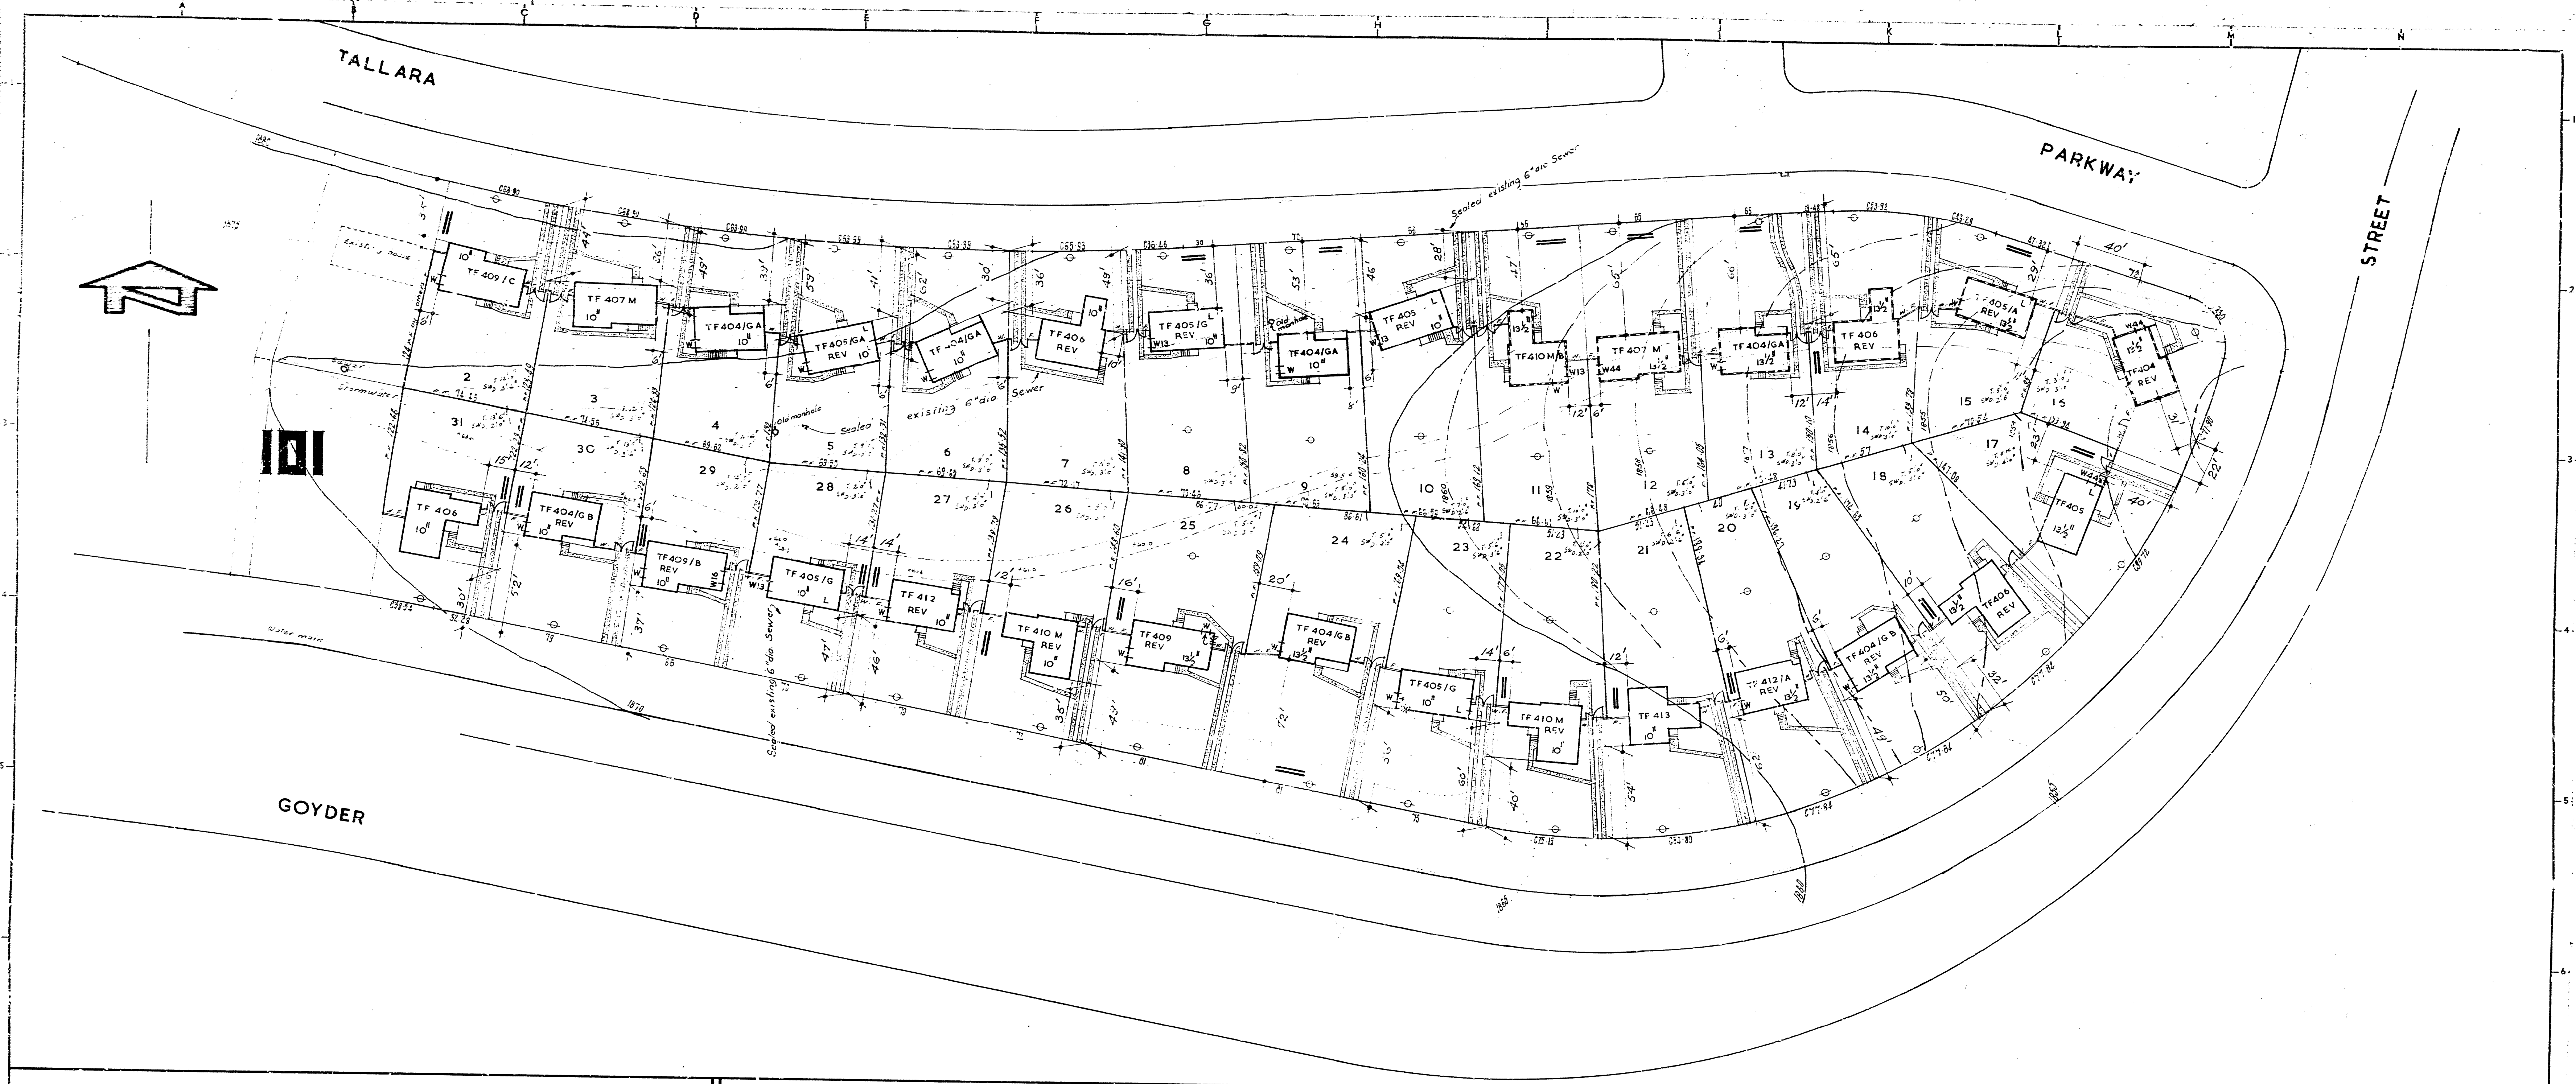

SCHEDULE OF EXTERNAL TREATMENT			
SECTION	BLOCK	TYPE	BRICKWORK
1	2	409	Clay
2	3	407M	Desert Sand concrete
3	4	404	Mulberry cement
4	5	405	Clay
5	6	404	Clay
6	7	406	Warm grey cement
7	8	405	Clay
8	9	404	Clay
9	10	405	Clay
10	11	410	Desert Sand concrete
11	12	407M	Clay
12	13	404	Clay
13	14	406	Cinnamon concrete
14	15	405	Warm grey cement
15	16	404	Natural grey cement bricks painted white
16	17	407	Clay
17	18	406	Desert Sand concrete
18	19	404	Clay
19	20	412	Clay
20	21	413	Cinnamon concrete
21	22	410	Clay
22	23	405	Clay


SCHEDULE OF EXTERNAL TREATMENT			
SECTION	BLOCK	TYPE	BRICKWORK
24	404	Natural grey cement bricks painted white	Olive green
25	409	Clay	Charcoal
26	410M	Clay	Red Black
27	412	Mulberry cement	Brown Black
28	405	Desert Sand concrete	Charcoal
29	409	Clay	Red Black
30	404	Natural grey cement bricks painted white	Red Yellow
31	405	Clay	Red Black

NOTES:

- Water services type "Y"
- Drive strips type "A" to Tallara Parkway, drive strips type "B" to Goyder Street.
- Stonapipes at rear of blocks 8, 9, 10, 11, 12, 16, 18, 20, 21, 24, 25 and 28 Sec. 101.
- Block 9 House Type TF404 relocated back from front boundary.
- Blocks 5, 8 old manholes. Seal sewer pipes inside manholes with concrete plugs to approval. After approval break in manhole to depth of 2'0" and fill with compacted clay soil to within 6" of surrounding ground levels. Fill in remainder with top soil.


KEY:

- Indicates that house is square to boundary adjacent corner.
- These & relevant bear footings to be taken down through recent fill.
- Figures in house indicates minimum height of 2'0" above finished or natural ground level whichever is critical.
- Stonapipes & top 2'0" from front boundary, where shown on drawings and as specified.
- Sewer branch tie.
- Stormwater branch tie.
- Stormwater branch depth.
- Concrete drive strips & paths.
- Specialty reinforced drainage (other than 6" x 6") from boundary to centre line of drive strips.
- Horizontal paling fence.
- Paling fence.
- Chain wire mesh fence as on detail sheet, but only 2'0" high.
- Special paling fence.
- Winged fence.
- House number.

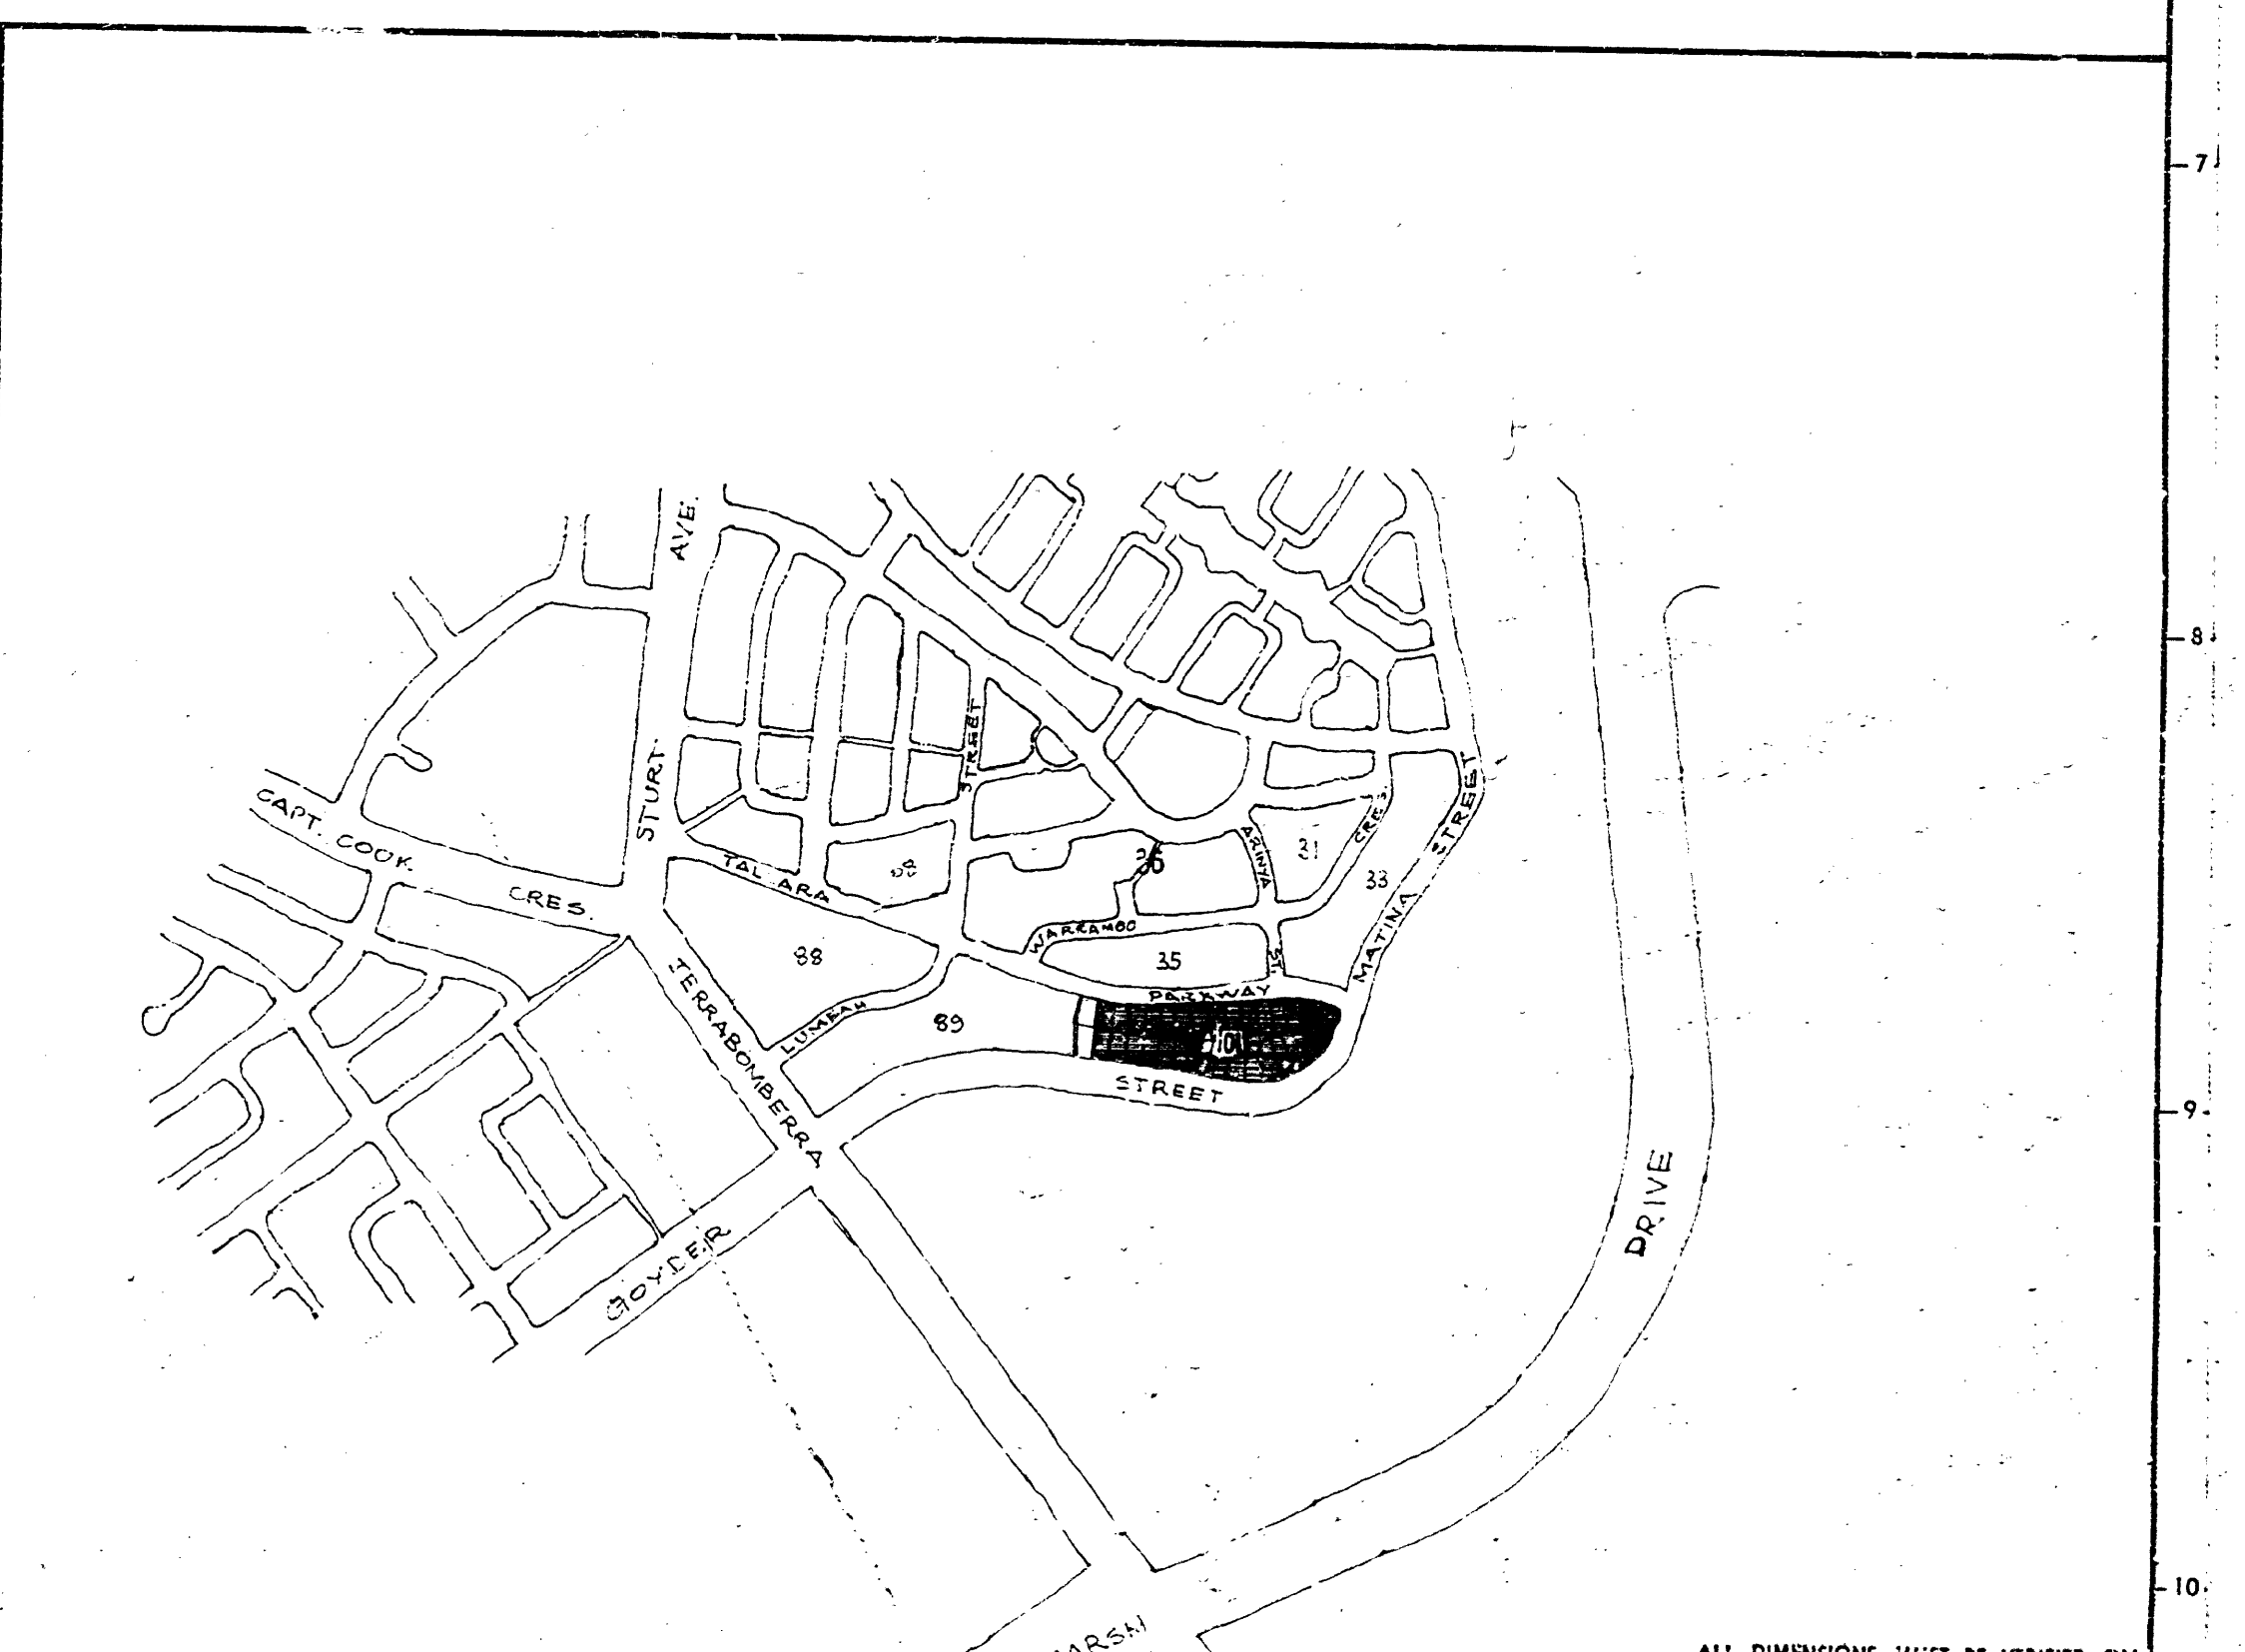

APPROVED BY NCDC, October 1967		COMMONWEALTH OF AUSTRALIA DEPARTMENT OF WORKS CANBERRA, A.C.T.		30 HOUSES NARRABUNDAH SEC. 101 BL. 2-31	
AMEND. NO.	AMENDMENTS	DATE	INITIALS	DRAWING NO.	ASSOCIATED DRAWINGS
THIS DRAWING IS COPYRIGHT AND THE PROPERTY OF THE COMMONWEALTH AND MUST NOT BE REPRODUCED, COPIED OR USED WITHOUT PERMISSION.					
DRAWN BY: [Signature]			CHECKED BY: [Signature]		
SCALE: 1" = 10'			DATE: 5/10/67		
FILE NO: 1286			TRACED: [Signature]		
DRAWING NUMBER			AMEND.		
CA 67 / 1206 2/1					

POSITION OF NO. 15 STANDARD ROOF TRUSSES SHOWN DOTTED

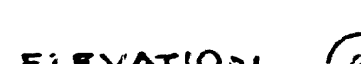


NOTES

1. Vertical expansion joints where indicated this $\triangleright$ for concrete brick walls.
2. For position of steps & piers refer to site plan.
3. Provide balustrade as shown on General Details.
4. Check positions of D.P.'s on site plan.
5. Provide additional gutters & piers within 6" of or under window beam supports where three beams serve roof trusses.



NOTE: FOR GENERAL DETAILS OF JOINERY REFER TO HOUSING DETAILS 1960 STREET

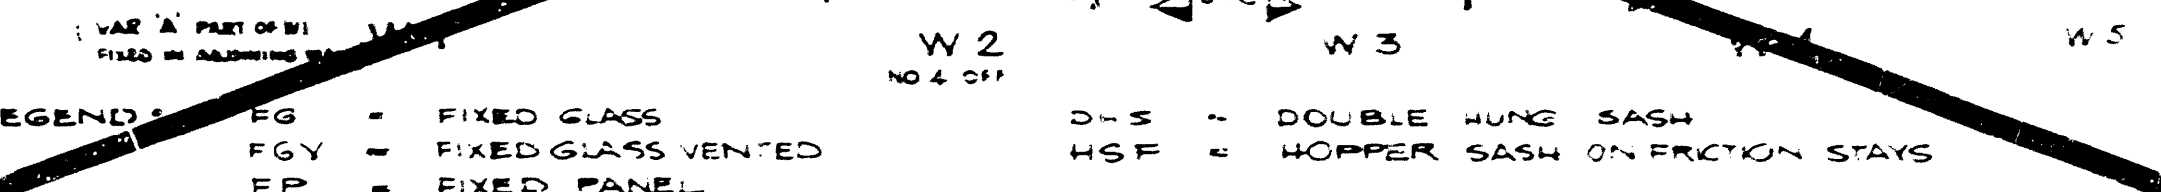

WINDCW AND EXTERNAL DOOR SCHEDULE



SYMBOL	DESCRIPTION	NO OF	REMARKS
A	CEILING POINT	75W	1
B	" " " " " "	100W	1
C	" " " " " "	60W	5
D	" " " " " "	40W	1
OK	10 A FLUSH POWER OUTLET	12	
OK	10 A , REFRIG.	1	27.5% BATT. 20% BATT.
OK	WASHING MACHINE OUTLET	1	
OK	STOVE CONNECTION	1	2-7/8 OR CLO
X	5 A 1WAY FLUSH WALL SWITCH	13	
D	WATER HEATER	1	
EL	DISTRIBUTION BOARD	1	10% TYP. 10% TYP.
EL	KWH METER BOARD	1	Sets on back of house
EL	SWITCH BOARD	1	house

ELECTRICAL SCHEDULE

THIS DRAWING IS COPYRIGHT AND THE PROPERTY OF THE COMMONWEALTH OF AUSTRALIA. DEPT. OF WORKS
COPYRIGHT ACT 1969-64. MUST NOT BE RETAINED, COPIED OR USED WITHOUT THE AUTHORITY OF THE COMMONWEALTH.

COMMONWEALTH OF AUSTRALIA			
DEPARTMENT OF WORKS, A.C.T.			
CANBERRA HOUSING			
FOR AND ON BEHALF OF THE NATIONAL CAPITAL DEVELOPMENT COMMISSION			
WORKING DRAWING			
HOUSE TYPE TF407M			
BRICK VENEER			
APPROXIMATE GROSS AREA 114' SQ. FT.			
CONFORMS WITH THE SPECIFICATION			
DRAWING NO. <i>114/45</i> TRACED ☒ <i>114/45</i> CHECKED ☒ <i>114/45</i> SUPERVISING ARCHITECT	SCALE <i>1/4" = 1'</i> DRAWING NO. <i>CA65/407 M</i> FILE NO. <i>114/45</i> AMEND. <i>114/45</i> CA65/407 M		
JAMES MURPHY PRINCIPAL ARCHITECT, BAYLIS & COOKS			

DEPARTMENT OF WORKS.
CANBERRA.

Drainage Plan No. 12358.
Sheet "B."

PLAN OF SANITARY DRAINAGE.

FOR

Owner THE COMMONWEALTH OF AUSTRALIA.

LOTS 10-23 (Incl.) SECTION 101.

DISTRICT NARRABUNDAH. A.C.T.

REFERENCE

B.T. Boundary Trap.	S.T. Silt Trap.	E.V. Educt Vent.
G.T. Gully Trap.	C.I.P. Cast Iron Pipe.	I.V. Induct Vent.
D.T. Disconnecter Trap.	G.W.I.P. Galv. Wrought Iron Pipe.	S.I.V.P. Soil Induct Vent Pipe.
G.D.T. Gully Disconnecter Trap.	S.P.D. Stoneware Pipe Drain.	S.V.P. Soil Vent Pipe.
G.I.T. Grease Interceptor Trap.	I.C. Inspection Chamber.	V.P. Ventilating Pipe.
S.V. Stop Valve.	I.O. Inspection Opening.	T.I.T. Triple Interceptor Trap.


NOTE: All work to be executed in accordance with the Canberra Sewerage and Water Supply Regulations.

TALLARA

Scale—40 feet to 1 inch

1860.

PARKWAY.

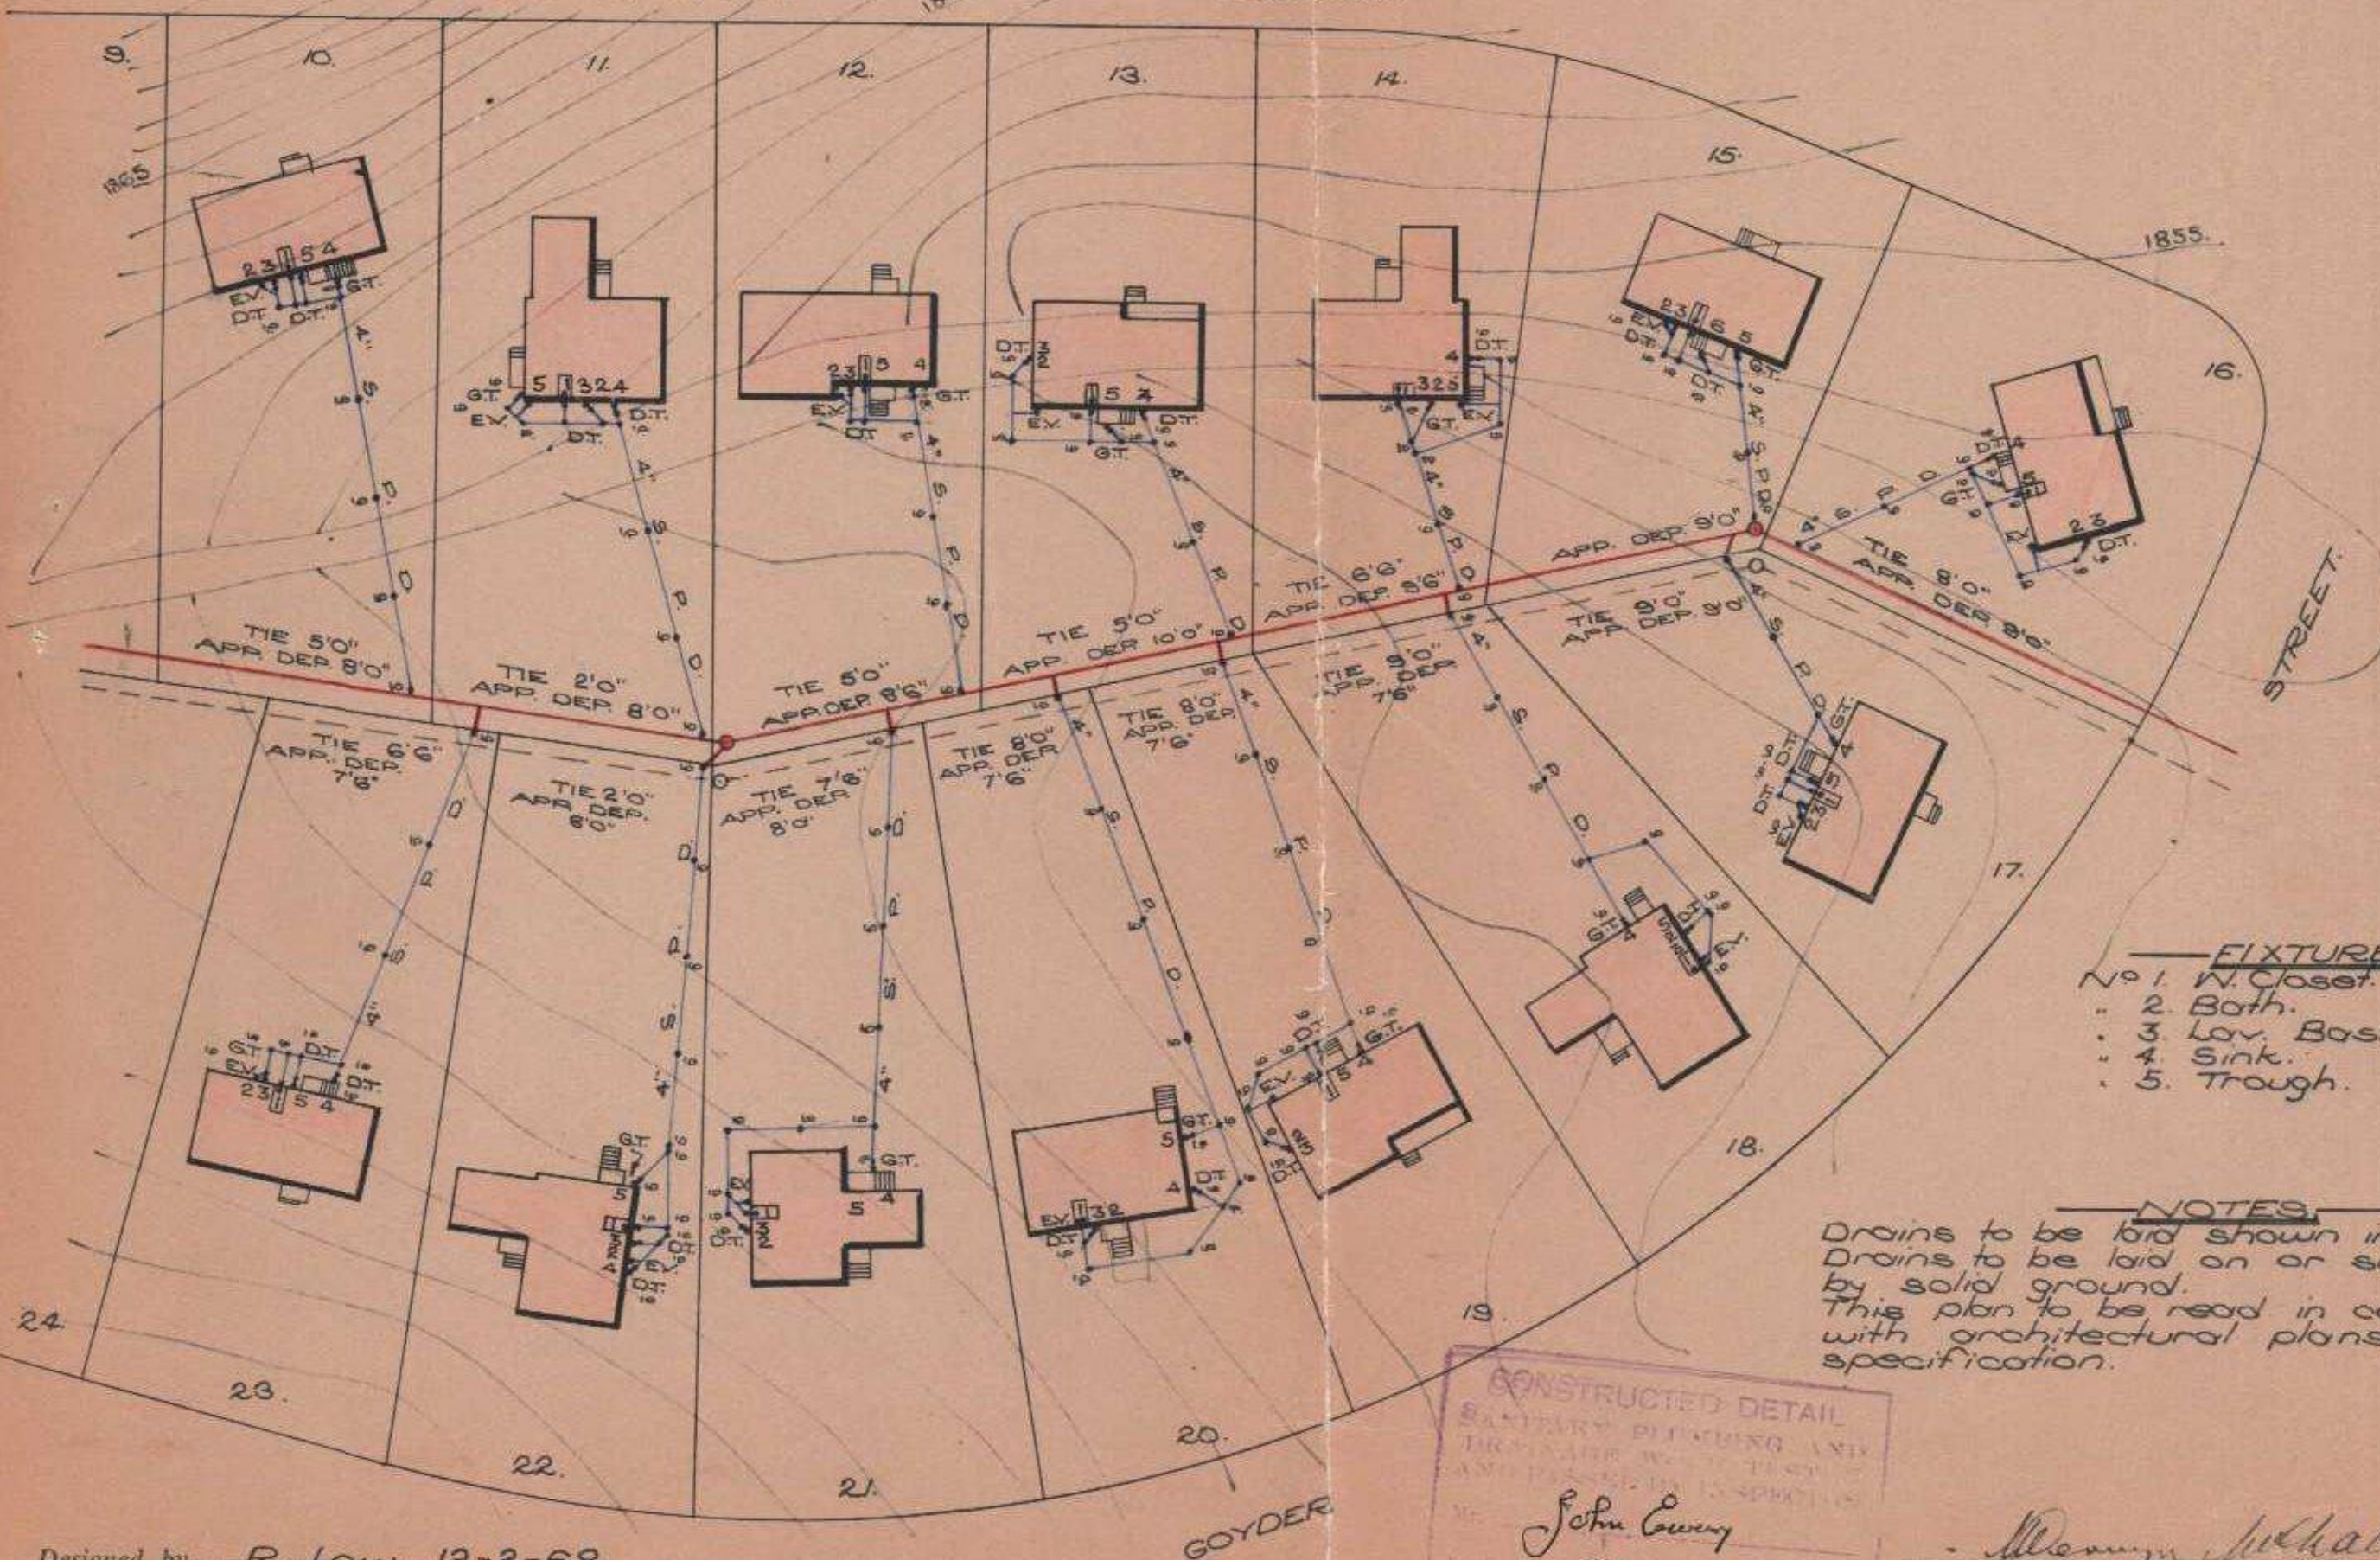

- FIXTURES
- No 1. W. Closet. (Internal.)
 - " 2. Bath.
 - " 3. Lav. Basin.
 - " 4. Sink.
 - " 5. Trough.

NOTES

Drains to be laid shown in blue lines.
Drains to be laid on or supported
by solid ground.
This plan to be read in conjunction
with architectural plans and
specification.

Designed by R. Low. 13-2-68.

GOYDER

CONSTRUCTED DETAIL
SANITARY DRAINAGE AND
SEWERAGE WORKS
AND PIPING IS SPECIFIED
BY
John Curry
21-4-69

— Mervyn Nicholls
Sewerage Engineer 14/2/1968.

GENERAL NOTES

1. EXISTING SEWER LINES TO BE LOCATED ON SITE PRIOR TO COMMENCEMENT OF WORK.
2. ALL PLUMBING AND DRAINAGE TO BE INSTALLED IN ACCORDANCE WITH AS3500.
3. ALL WORK TO BE CARRIED OUT IN ACCORDANCE WITH THE CANBERRA SEWERAGE AND WATER SUPPLY REGULATIONS.
4. THIS PLAN TO BE READ IN CONJUNCTION WITH APPROVED ARCHITECTURAL PLANS AND SPECIFICATIONS.
5. INSPECTION SHAFT AT PROPERTY BOUNDARY TO BE IN ACCORDANCE WITH PLUMBING NOTE No3.
6. ORG LEVELS TO BE IN ACCORDANCE WITH AS3500.2.2 CLAUSE 4.6.6.6 & 4.6.6.7 & PLUMBING NOTE 22.
7. UNPLASTICISED POLYVINYL CHLORIDE PIPE DRAINS (UPVC) TO BE CONSTRUCTED IN ACCORDANCE WITH AS2032 AND THE CANBERRA SEWERAGE AND WATER SUPPLY REGULATIONS.
8. TEMPERED HOT WATER REQUIRED AT ALL ABLUTION FIXTURES.
9. PLUMBING AND DRAINAGE TO CONFORM TO COUNCIL STANDARDS

DOWN PIPE NOTES

1. DOWNPIPES MUST BE SECURELY FIXED TO WALLS.
2. THE SPACING BETWEEN DOWNPIPES MUST NOT MORE THAN 12 M.
3. DOWNPIPES MUST BE FIXED AS CLOSE AS POSSIBLE TO VALLEY GUTTERS AND, IF THE DOWNPIPE IS MORE THAN 1.2M FROM VALLEY, PROVISION FOR OVERFLOW MUST BE MADE.
4. WHERE HIGH-FRONTED GUTTERS ARE INSTALLED, PROVISION MUST BE MADE TO AVOID ANY OVERFLOW FROM FLOWING BACK INTO ROOF OR BUILDING STRUCTURE BY INSTALLING SLOTTED GUTTERS OR THE LIKE.
5. DOWNPIPES MUST-
 - A. BE COMPATIBLE WITH OTHER ROOFING MATERIALS USED IN THE ROOFING SYSTEM IN ACCORDANCE WITH 3.5.3(C) OF THE B.C.A
 - B. BE SELECTED IN ACCORDANCE WITH APPROPRIATE EAVES GUTTER SECTION AS SHOWN IN TABLE 3.5.2.2 OF THE B.C.A.

REFERENCE

AAV	AIR ADMITTANCE VALVE
CO	CLEAR OUT
CWR/D	COLD WATER RISER/DROPPER
DT	DISCONNECTOR TRAP
FW	FLOOR WASTE
GM	GAS METER
GO	GAS OUTLET
HC	HOSE COCK
HDPE	HEAVY DUTY POLYETHYLENE
HWS	HOT WATER SYSTEM
IO	INSPECTION OPENING
IS	INSPECTION SHAFT
O/F	OVERFLOW
ORG	OVERFLOW RELIEF GULLY
SC	STOP COCK
SMH	SEWER MANHOLE
ST	SILT TRAP
SVP	SOIL VENT PIPE
TD	TUNDISH
TG	TEST GATE
TTD	TRAPPED TUNDISH
UPVC	UNPLASTICISED POLYVINYL CHLORIDE
VP	VENT PIPE

LEGEND

	SEWER MAIN
	STORMWATER MAIN
	WATER MAIN
	SEWER DRAIN
	SEWER VENT
	DOMESTIC WATER
	NON-POTABLE WATER SUPPLY
	STORMWATER DRAIN
	STANDARD STREET HYDRANT
	STOP COCK
	WATER METER
	90° AG LINE WITH FILTER SOCK CONNECTION TO STORMWATER DRAINAGE
	300X300 YARD SUMP, EXACT LOCATION TO BE DETERMINED ON SITE BY LANDSCAPE CONTRACTOR AND BUILDER

DRAINAGE PLAN NO: _____

PLAN OF SANITARY DRAINAGE
DESIGNED TO AS3500**PROJECT**

PROPOSED SECONDARY RESIDENCE

CLIENT

VRD

DRAWING TITLE

HYDRAULIC SERVICES


PROJECT BLOCK AND SECTIONBLOCK 12 SECTION 101
NARRABUNDAH

SBQ JOB NO.	DRAWING NO.	SCALE
20015	H01	AS SHOWN @ A3
DESIGNED BY	CHECKED BY	AUTHORISED BY
IK	IK	

DO NOT SCALE OFF DRAWINGS.
CONTRACTOR TO
CONFIRM/VERIFY DIMENSIONS
ON SITE.

ISSUE	DESCRIPTION OF ISSUE	DATE
A	INTERIM PLAN	18.02.20
B	WORK AS EXECUTED	16.04.20

seventeen 17
BUILDING GROUP
IVAN@17BG.COM.AU

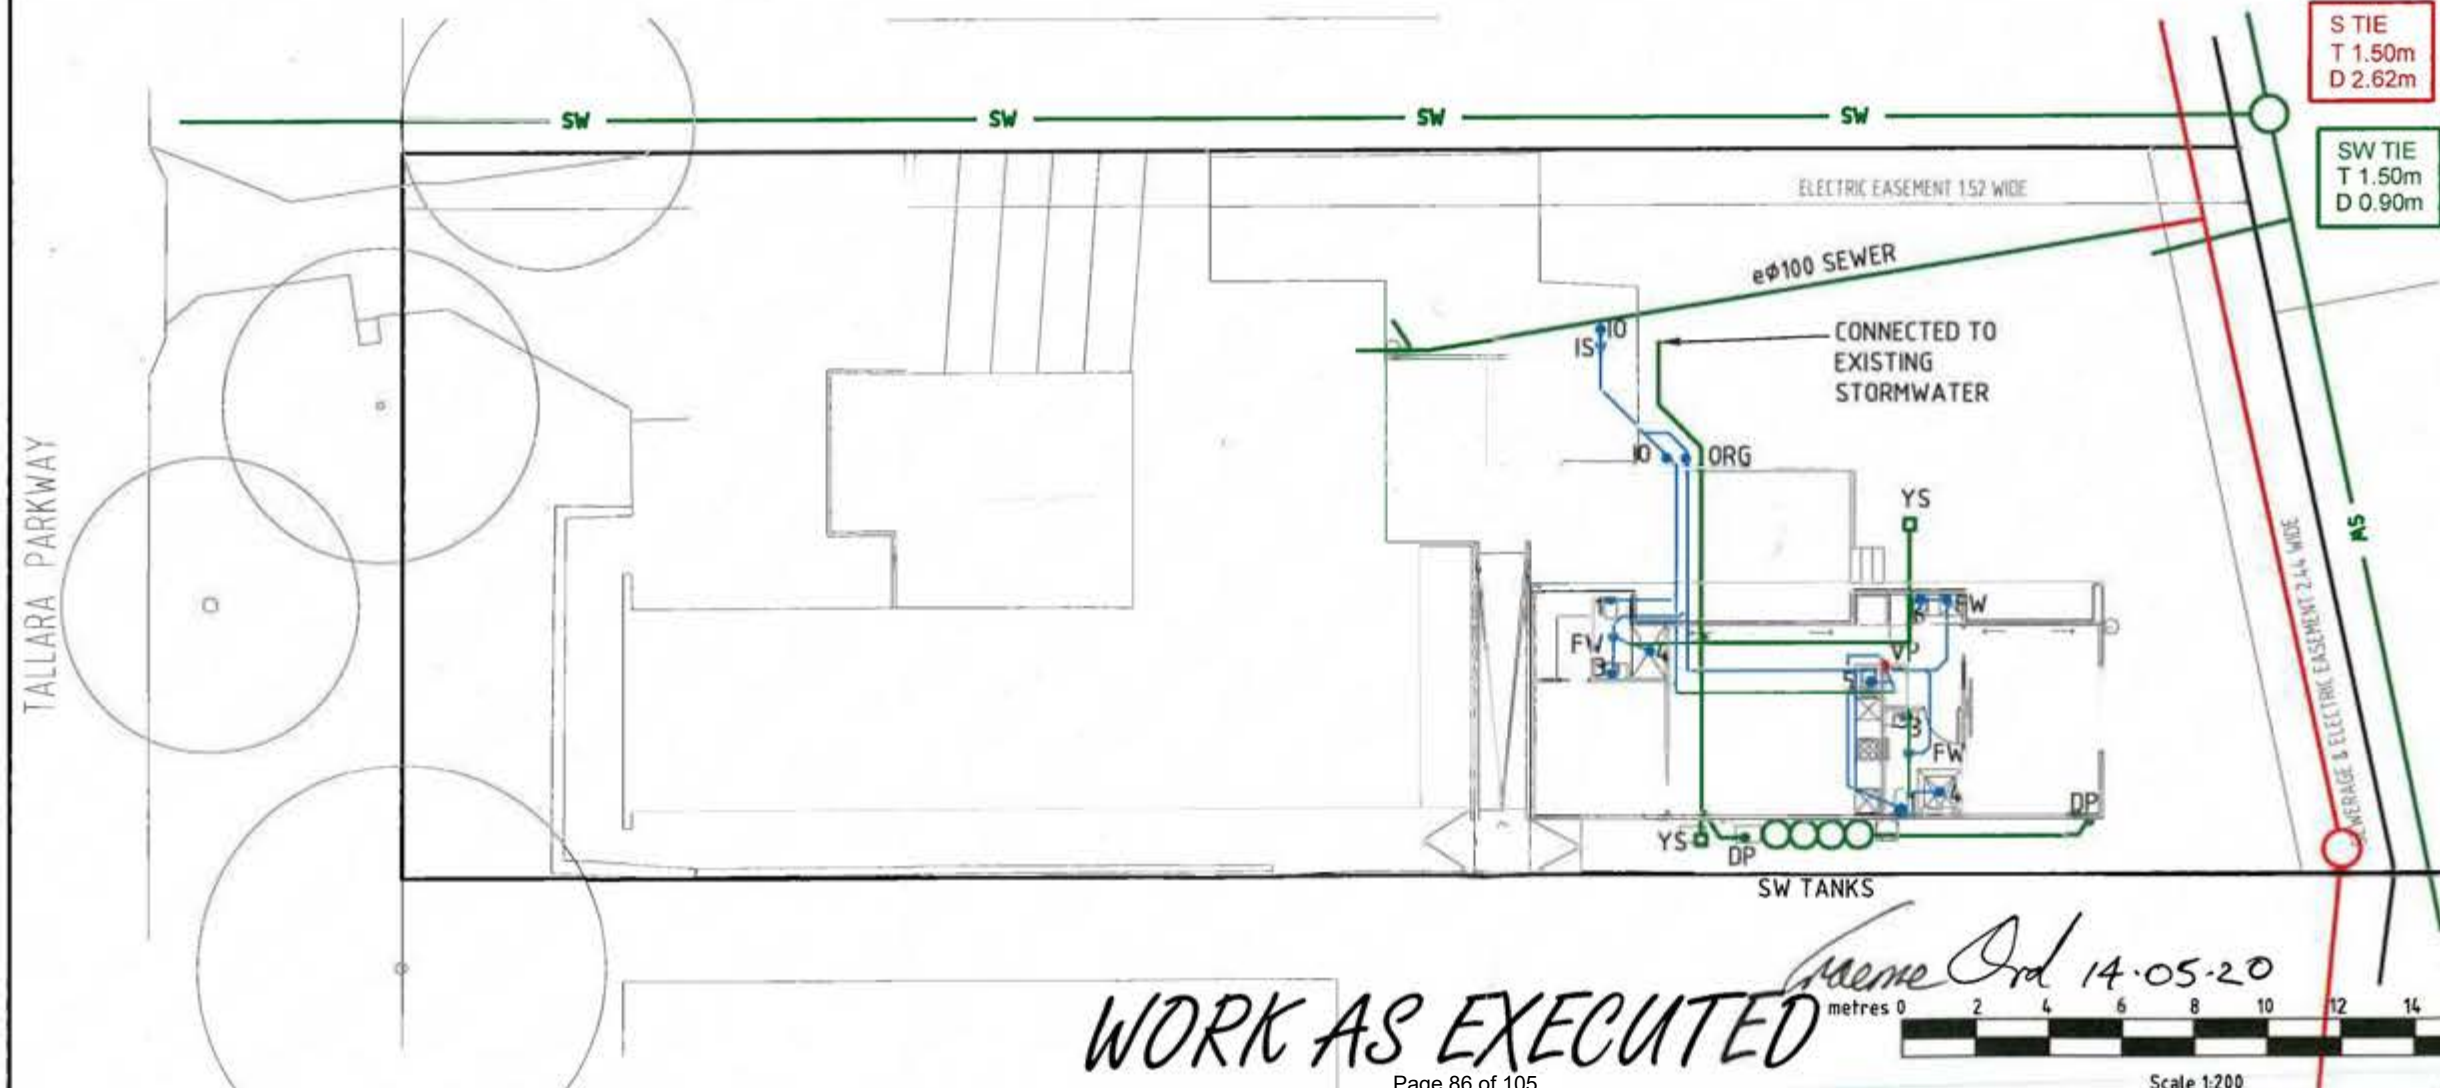
**FIXTURE TABLE**

1	WC	2
2	BATH	-
3	BASIN	2
4	SHOWER	2
5	KITCHEN SINK	1
6	LAUNDRY TROUGH	1
TOTAL		8

Energy Efficiency Rating Residence 1



FirstRate Report

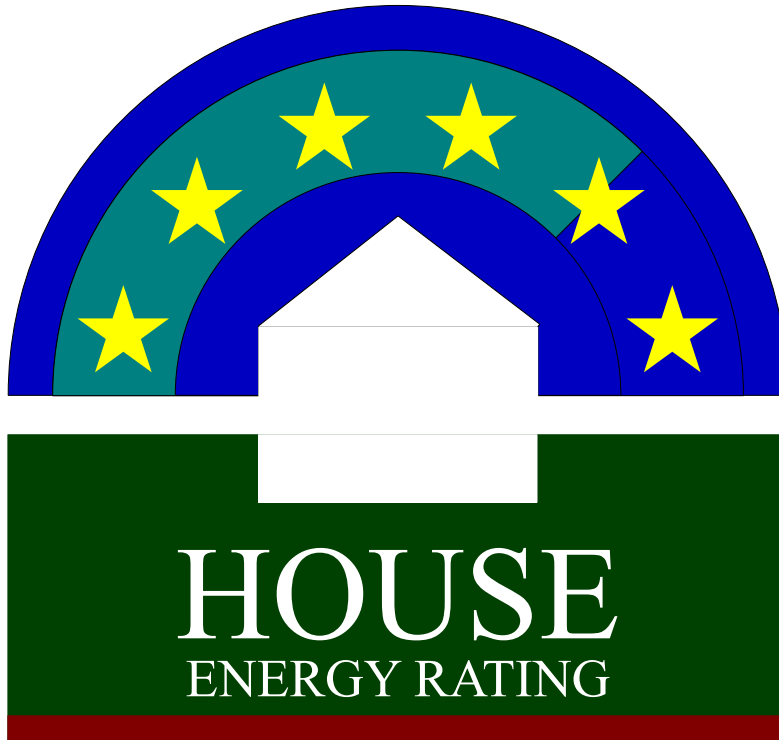

YOUR HOUSE ENERGY RATING IS: ★★☆☆☆ **4.5 STARS**
in Climate: 24

SCORE: 4 POINTS


Name: Watkins & Marks

Ref No: 70418

House Title: Block 12 Section 101 NARRABUNDAH

Date: 09-06-2026

Address: 70 Tallara Pkwy, Narrabundah ACT 2604 - Residence 1

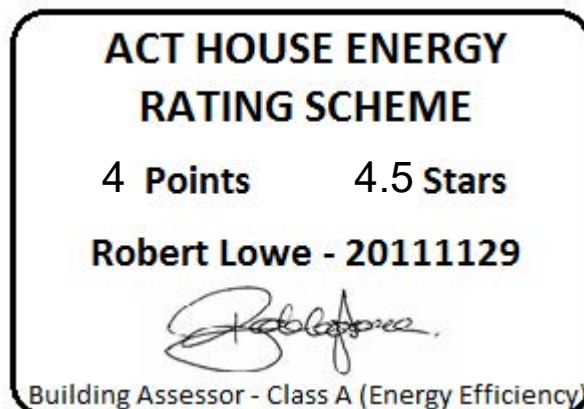

This rating only applies to the floor plan, construction details, orientation and climate as submitted and included in the attached Rating Summary. Changes to any of these could affect the rating.

IMPROVING YOUR RATING

The table below shows the current rating of your house and its potential for improvement.

Star Rating	POOR			AVERAGE				GOOD				V. GOOD
	0 Star	★	★★	★★★	★★★★	★★★★★	★★★★★★	★★★★★★★	★★★★★★★★	★★★★★★★★★	★★★★★★★★★★	★★★★★★★★★★★
Point Score	-71	-70	-46	-45	-26	-25	-11	-10	4	5	16	17
Current	4											
Potential	20											

Incorporating these design options will add the additional points required to achieve the potential rating shown in the table Each point represents about a 1% change in energy efficiency. This list is only a guide to the range of options that could be used.

Design options		Additional points	
Change glass to Double Glazing	100 %		6
Change curtain to	Heavy Drapes & Pelmets		10

ORIENTATION

Orientation is one of the key factors which influences energy efficiency. This dwelling will achieve different scores and star ratings for different orientations.

Current Rating	4	★★★★☆
-----------------------	----------	--------------

Largest windows in the dwelling;

Direction : East

Area : 18 m²

The table below shows the total score for the dwelling when these windows face the direction indicated.

Note that obstructions overshadowing windows have been removed from all windows in these ratings to allow better comparisons to be made between orientations.

ORIENTATION	POINT SCORE	STAR RATING
1. East	4	★★★★☆
2. South East	1	★★★★☆
3. South	0	★★★★☆
4. South West	-2	★★★★
5. West	-4	★★★★
6. North West	-3	★★★★
7. North	3	★★★★☆
8. North East	6	★★★★★

FirstRate Mode
Climate: 24

RATING SUMMARY for: **Block 12 Section 101 NARRABUNDAH, 70 Tallara Pkwy, Narrabundah ACT 2604 (Residence 1)**

Assessor's Name:

Net Conditioned Floor Area: 152.3 m²

Feature			Points		
			Winter	Summer	Total
CEILING			5	1	5
Surface Area:	0	Insulation:	6		
WALL			3	0	3
Surface Area:	-3	Insulation:	6	Mass:	0
FLOOR			3	0	3
Surface Area:	0	Insulation:	-3	Mass:	6
AIR LEAKAGE (Percentage of score shown for each element)			6	0	5
Fire Place	0 %	Vented Skylights	0 %		
Fixed Vents	0 %	Windows	34 %		
Exhaust Fans	28 %	Doors	25 %		
Down Lights	0 %	Gaps (around frames)	13 %		
DESIGN FEATURES			0	1	1
Cross Ventilation	1				
ROOF GLAZING			0	0	0
Winter Gain	0	Winter Loss	0		
WINDOWS			-6	-13	-19

Window Direction	Area		Point Scores			
	m2	%NCFA	Winter* Loss	Winter Gain	Summer Gain	Total
N	8	6%	-10	11	-2	-2
E	18	12%	-18	15	-5	-8
S	4	2%	-3	1	-1	-2
W	7	5%	-9	7	-5	-7
Total	38	25%	-40	34	-13	-19

* Air movement over glazing can significantly increase winter heat losses. SEAV recommends heating/cooling duct outlets be positioned to avoid air movement across glass or use deflectors to direct air away from glass.

The contribution of heavyweight materials to the window score is 0 points

			Winter	Summer	Total
RATING	★★★★☆	SCORE	11	-12	4*

* includes 5 points from Area Adjustment

Detailed House Data

House Details

ClientName	Watkins & Marks
HouseTitle	Block 12 Section 101 NARRABUNDAH
StreetAddress	70 Tallara Pkwy, Narrabundah ACT 2604 - Residence 1
FileCreated	09-06-2026

Climate Details

State	
Town	Canberra
Postcode	2600
Zone	24

Floor Details

ID	Construction	Sub Floor	Upper	Shared	Foil	Carpet	Ins RValue	Area
1	Concrete Slab on ground	No Subfloor	No	No	No	Tiles	R0.0	45.6m ²
2	Concrete Slab on ground	No Subfloor	No	No	No	Carp	R0.0	28.8m ²
3	Timber	Enclosed	No	No	No	Tiles	R0.0	6.0m ²
4	Timber	Enclosed	No	No	No	Carp	R0.0	88.8m ²

Wall Details

ID	Construction	Shared	Ins RValue	Length	Height
1	Brick Veneer	No	R2.5	4.6m	2.4m
2	Brick Veneer	No	R2.0	33.2m	2.4m
3	Brick Veneer	No	R2.0	29.8m	2.4m

Ceiling Details

ID	Construction	Shared	Foil	Ins RValue	Area
1	Attic - Standard	No	No	R4.0	94.8m ²
2	Attic - Low Ventilation	No	Yes	R4.0	74.4m ²

Window Details

ID	Dir	Height	Width	Utility	Glass	Frame	Curtain	Blind	Fixed & Adj Eave	Fixed Eave	Head to Eave
1	N	1.5m	0.8m	No	SG	ALIMPR	CW	No	0.5m	0.5m	0.3m
2	N	1.5m	0.8m	No	SG	ALIMPR	CW	No	0.5m	0.5m	0.3m
3	N	1.5m	0.8m	No	SG	ALIMPR	CW	No	0.5m	0.5m	0.3m
4	E	1.5m	1.2m	No	SG	ALIMPR	CW	No	0.6m	0.6m	0.0m
5	E	1.5m	1.2m	No	SG	ALIMPR	CW	No	0.6m	0.6m	0.0m
6	E	1.5m	1.2m	No	SG	ALIMPR	CW	No	0.6m	0.6m	0.0m
7	E	2.1m	4.8m	No	DG	ALIMPR	HB	No	0.6m	0.6m	0.0m
8	N	1.8m	2.7m	No	SG	ALIMPR	HB	No	0.6m	0.6m	0.0m
9	E	0.6m	2.4m	No	DG	ALIMPR	CW	No	0.0m	0.0m	0.0m
10	E	1.0m	1.2m	No	SGT	ALIMPR	HB	No	0.0m	0.0m	0.0m
11	S	1.0m	0.7m	Yes	SG	ALIMPR	HB	No	0.6m	0.6m	0.0m
12	S	0.6m	2.2m	Yes	SGT	ALIMPR	NC	No	0.6m	0.6m	0.0m
13	S	1.8m	0.9m	No	SG	ALIMPR	CW	No	0.6m	0.6m	0.0m
14	W	1.5m	1.8m	No	SG	ALIMPR	CW	No	0.0m	0.0m	0.0m
15	W	1.8m	0.9m	No	SG	ALIMPR	CW	No	0.0m	0.0m	0.0m
16	W	2.0m	0.6m	No	SG	ALIMPR	HB	No	0.6m	0.6m	0.0m
17	W	0.5m	1.8m	No	DG	ALIMPR	CW	No	0.6m	0.6m	0.0m
18	W	0.5m	1.8m	No	DG	ALIMPR	CW	No	0.6m	0.6m	0.0m


Window Shading Details

ID	Dir	Height	Width	Obst Height	Obst Dist	Obst Width	Obst Offset	LShape Left Fin	LShape Left Off	LShape Right Fin	LShape Right Off
7	E	2.1m	4.8m	3.0m	8.0m	15.6m	0.2m	0.0m	0.0m	8.0m	0.5m
8	N	1.8m	2.7m	0.0m	0.0m	0.0m	0.0m	10.0m	1.5m	8.0m	1.5m
9	E	0.6m	2.4m	0.0m	0.0m	0.0m	0.0m	4.0m	0.0m	0.0m	0.0m

Energy Efficiency Rating Residence 2



FirstRate Report

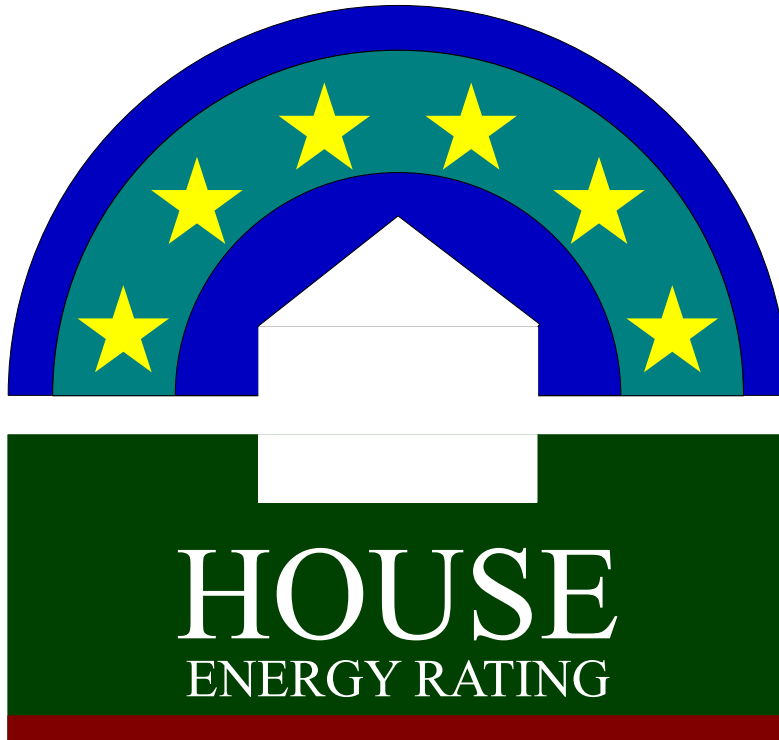

YOUR HOUSE ENERGY RATING IS: ★★☆☆☆☆ **6 STARS**
in Climate: 24 **SCORE: 18 POINTS**


Name: Watkins & Marks

Ref No: 70418

House Title: Block 12 Section 101 NARRABUNDAH

Date: 09-06-2026

Address: 70 Tallara Pkwy, Narrabundah ACT 2604 - Residence 2

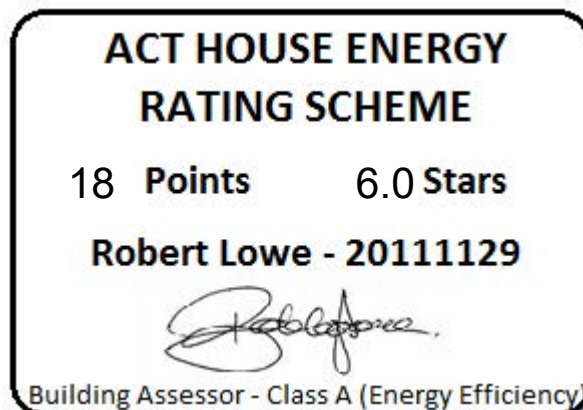

This rating only applies to the floor plan, construction details, orientation and climate as submitted and included in the attached Rating Summary. Changes to any of these could affect the rating.

IMPROVING YOUR RATING

The table below shows the current rating of your house and its potential for improvement.

Star Rating	POOR			AVERAGE				GOOD				V. GOOD
	0 Star	★	★★	★★★	★★★★	★★★★★	★★★★★★	★★★★★★★	★★★★★★★★	★★★★★★★★★	★★★★★★★★★★	★★★★★★★★★★★
Point Score	-71	-70	-46	-45	-26	-25	-11	-10	4	5	16	17
Current	18											
Potential	29											

Incorporating these design options will add the additional points required to achieve the potential rating shown in the table Each point represents about a 1% change in energy efficiency. This list is only a guide to the range of options that could be used.

Design options	Additional points	
Change curtain to	Heavy Drapes & Pelmets	10
Add westerly blinds	100 %	1

ORIENTATION

Orientation is one of the key factors which influences energy efficiency. This dwelling will achieve different scores and star ratings for different orientations.

Current Rating	18	★★★★★★
-----------------------	-----------	---------------

Largest windows in the dwelling;

Direction : East

Area : 20 m²

The table below shows the total score for the dwelling when these windows face the direction indicated.

Note that obstructions overshadowing windows have been removed from all windows in these ratings to allow better comparisons to be made between orientations.

ORIENTATION	POINT SCORE	STAR RATING
1. East	18	★★★★★★
2. South East	13	★★★★★☆
3. South	12	★★★★★☆
4. South West	11	★★★★★
5. West	8	★★★★★
6. North West	14	★★★★★☆
7. North	28	★★★★★★
8. North East	25	★★★★★★

FirstRate Mode
Climate: 24

RATING SUMMARY for: **Block 12 Section 101 NARRABUNDAH, 70 Tallara Pkwy, Narrabundah ACT 2604 (Residence 2)**

Assessor's Name:

Net Conditioned Floor Area: **84.5 m²**

Net Conditioned Floor Area: 84.5 m²				Points		
Feature				Winter	Summer	Total
CEILING				5	0	5
Surface Area: 0		Insulation: 5				
WALL				2	-2	-1
Surface Area: -4		Insulation: 7		Mass: -4		
FLOOR				13	-5	9
Surface Area: 0		Insulation: 9		Mass: 0		
AIR LEAKAGE (Percentage of score shown for each element)				8	0	8
Fire Place 0 %		Vented Skylights 0 %				
Fixed Vents 0 %		Windows 50 %				
Exhaust Fans 30 %		Doors 0 %				
Down Lights 0 %		Gaps (around frames) 19 %				
DESIGN FEATURES				0	1	1
Cross Ventilation 1						
ROOF GLAZING				0	-1	-1
Winter Gain 1		Winter Loss -1				
WINDOWS				-5	-18	-23
Window Direction	Area		Point Scores			
	m2	%NCFA	Winter* Loss	Winter Gain	Summer Gain	Total
E	20	23%	-29	25	-15	-20
S	1	2%	-2	1	-1	-2
W	1	2%	-2	3	-2	-2
Total	23	27%	-34	29	-18	-23

* Air movement over glazing can significantly increase winter heat losses. SEAV recommends heating/cooling duct outlets be positioned to avoid air movement across glass or use deflectors to direct air away from glass.

The contribution of heavyweight materials to the window score is 0 points

		Winter	Summer	Total
RATING	★ ★ ★ ★ ★ ★	23	-25	18*

* includes 19 points from Area Adjustment

Detailed House Data

House Details

ClientName	Watkins & Marks
HouseTitle	Block 12 Section 101 NARRABUNDAH
StreetAddress	70 Tallara Pkwy, Narrabundah ACT 2604 - Residence 2
FileCreated	09-06-2026

Climate Details

State	
Town	Canberra
Postcode	2600
Zone	24

Floor Details

ID	Construction	Sub Floor	Upper	Shared	Foil	Carpet	Ins RValue	Area
1	Timber	Enclosed	No	No	No	Float Timb	R2.4	30.0m ²
2	Timber	Enclosed	No	No	No	Tiles	R2.4	12.0m ²
3	Timber	Enclosed	No	No	No	Carp	R2.4	48.0m ²

Wall Details

ID	Construction	Shared	Ins RValue	Length	Height
1	Weatherboard	No	R2.9	11.9m	2.4m
2	Framed: FC Sheet Clad	No	R5.9	10.3m	2.4m
3	Framed: Metal Clad	No	R2.9	23.5m	2.4m

Ceiling Details

ID	Construction	Shared	Foil	Ins RValue	Area
1	Flat - Framed	No	Yes	R4.0	90.0m ²

Window Details

ID	Dir	Height	Width	Utility	Glass	Frame	Curtain	Blind	Fixed & Adj Eave	Fixed Eave	Head to Eave
1	E	2.4m	4.8m	No	DG	ALIMPR	HB	No	0.8m	0.8m	0.0m
2	E	2.4m	3.4m	No	DG	ALIMPR	HB	No	0.8m	0.8m	0.0m
3	S	0.6m	2.4m	No	DG	ALIMPR	HB	No	0.0m	0.0m	0.0m
4	W	0.6m	2.4m	No	DG	ALIMPR	HB	No	0.0m	0.0m	0.0m

Window Shading Details

ID	Dir	Height	Width	Obst Height	Obst Dist	Obst Width	Obst Offset	LShape Left Fin	LShape Left Off	LShape Right Fin	LShape Right Off
1	E	2.4m	4.8m	0.0m	0.0m	0.0m	0.0m	0.0m	0.0m	0.8m	0.0m
2	E	2.4m	3.4m	0.0m	0.0m	0.0m	0.0m	0.8m	0.0m	0.8m	0.0m

Sky Light Details

ID	Dir	Tilt	Type	Shade	Utility	Width	Length
1	W	0 degrees	Double Clear	Yes	Yes	0.6m	0.6m
2	W	0 degrees	Double Clear	Yes	No	0.6m	0.6m

Zoning Details

Is there Cross Flow Ventilation ?	Good
-----------------------------------	------

Air Leakage Details

Location	Suburban
Is there More than One Storey ?	No
Is the Entry open to the Living Area ?	No

Area of Heavyweight Mass		0m ²
Area of Lightweight Mass		0m ²
	<u>Sealed</u>	<u>UnSealed</u>
Chimneys	0	0
Vents	0	0
Fans	2	0
Downlights	0	0
Skylights	0	0
Utility Doors	0	0
External Doors	0	0
Unflued Gas Heaters		0
Percentage of Windows Sealed		98%
Windows - Average Gap		Small
External Doors - Average Gap		Small
Gaps & Cracks Sealed		Yes

Insurance Certificates & Tax Invoice




If a home was built before 1990 it may contain dangerous asbestos material

Identify where asbestos materials might be. Five common places are:



- 1. Exterior**
roof sheeting, gutters, downpipes, ridge capping, eaves, cladding, electrical switchboards

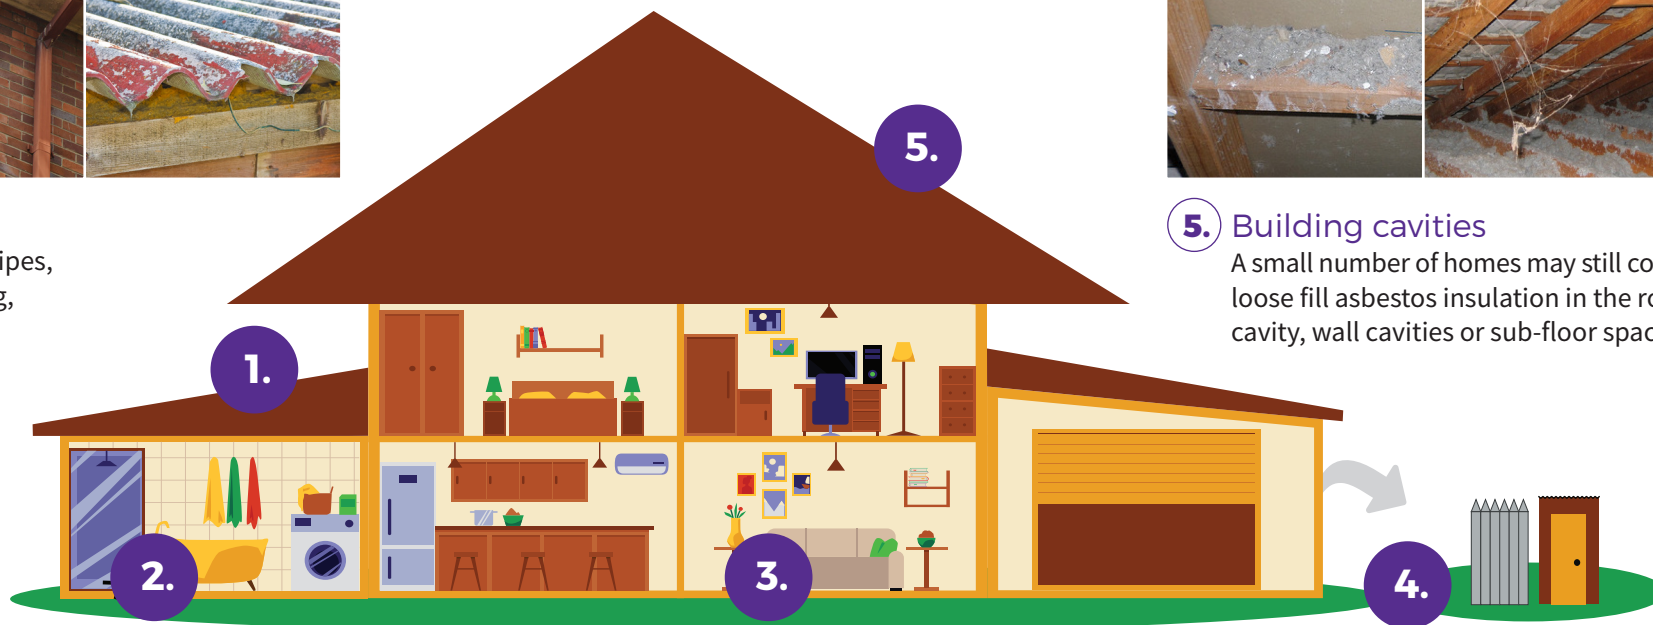

- 5. Building cavities**
A small number of homes may still contain loose fill asbestos insulation in the roof cavity, wall cavities or sub-floor space



- 2. Wet areas - bathroom, laundry and kitchen**
wall and ceiling panels, vinyl floor tiles, backing for wall tiles and splashbacks, hot water pipe insulation



- 3. Internal areas**
wall and ceiling panels, carpet underlay, textured paint, insulation in domestic heaters



- 4. Backyard**
fences, sheds, garages, carports, dog kennels, buried or dumped waste, letterboxes, swimming pools

If a home was built before 1990 it may contain dangerous asbestos material

Assess the risk

A licensed asbestos assessor can help identify asbestos in your home and its condition.

Asbestos materials become dangerous when:



Broken or in poor
condition



Damaged
accidentally



Disturbed during
renovation or repairs



Loose fill asbestos
insulation



Manage asbestos safely

- Monitor the condition of asbestos in your home
- Inform tradespeople of locations of asbestos in your home
- Avoid disturbing or damaging asbestos if working on your home
- Engage a licensed asbestos removalist to remove asbestos

If you suspect your home contains loose fill asbestos insulation, contact Access Canberra

TO WHOM THIS MAY CONCERN

9th March 2026

Certificate of Currency

Dear Sir or Madam,

We, the undersigned Insurance Brokers acting on behalf of the Insured, hereby certify that the following described insurance is in force at this date.

TYPE OF INSURANCE: Professional Indemnity Insurance

INSURED: ACT Property Inspections Pty Ltd.

ADDRESS OF INSURED: Unit 1/33 Aintree Court, Phillip ACT 2606, Australia.

POLICY NUMBER: B0507OE2600060

PERIOD: From: 30th March 2026 to: 30th March 2027
At 4pm Local Standard Time at the Principal Address of the Insured.

LIMIT OF LIABILITY: AUD 5,000,000 in the annual aggregate inclusive of costs and expenses plus one reinstatement.

INSURERS: 100% Lloyd's of London

This letter is provided as a matter of information only and confers no rights on the holder. Our duties in relation to this insurance are to our client and we accept no duty of care or responsibility to you or any other third party and any liability to you or a third party is excluded. This letter does not amend, extend, or alter the coverage afforded by the policy, nor does it purport to set out all of the policy terms, conditions and exclusions. The policy terms, conditions, limits, and exclusions may alter after the date of this document or the insurance may terminate or be cancelled, and the limits shown may be reduced to pay claims. We have no obligation to advise you of any changes which may be made to the policy or to advise you of their cancellation or termination.

Issued on behalf of Price Forbes & Partners



Adam Power
Executive Director



**ACT
PROPERTY
INSPECTIONS**

TAX INVOICE

Craig Robert Watkins & Jane Marks
70 Tallara Pkwy
NARRABUNDAH ACT 2604
AUSTRALIA

Invoice Date
29 May 2026

Invoice Number
INV-70418

Reference
70 Tallara Pkwy,
Narrabundah ACT 2604,
Australia

ACT Property Inspections
(02) 6232 4540
Unit 1, 33 Altree Ct
PHILLIP ACT 2606
ABN: 33 600 397 466

Description	Quantity	Unit Price	GST	Amount AUD
ACTPLA Fees - No GST	1.00	186.70	GST Free	186.70
Property Report	1.00	1,475.73	10%	1,475.73
Energy Efficiency Report (Complimentary)	1.00	0.00		0.00
Deferred Payment (Complimentary)	1.00	0.00		0.00
			Subtotal	1,662.43
			TOTAL GST 10%	147.57
			TOTAL AUD	1,810.00

Due Date: 25 Nov 2026

Payment terms – Deferred payment account. This account should be paid in full within 14 days on the earlier of:

- (a) Settlement of the property
- (b) If the Property has not been listed for sale within 3 months of the Property Inspection Date
- (c) If the property is no longer listed for sale
- (d) 180 days after the Property Inspection Date

Please pay within the payment terms to avoid the Deferred Payment Fee. Note: all bank/legal fees incurred in obtaining payment will be the customer's responsibility

Payment Options

Pexa : please quote the invoice number as the reference

Direct Deposit : BSB: 012084 Account Number: 194679655
Account Name: ACT Property Inspections Pty Ltd
Please reference your name and invoice number

Cheques : please make payable to ACT Property Inspections Pty Ltd

[View and pay online now](#)



DR CRAIG R WATKINS
17 CRAIGIE STREET
WICKHAM
HARCOURT VIC 3453

Our reference: 7170821228894

Phone: **13 28 66**

8 June 2026

Your foreign resident capital gains withholding clearance certificate

- › Purchasers are not required to withhold and pay an amount
- › Provide a copy to the purchaser and retain a copy for your records

Hello CRAIG,

We have decided that purchasers are not required to withhold and pay an amount. Your certificate is below:

Notice number	2411209126040
Vendor name	CRAIG ROBERT WATKINS
Clearance Certificate Period	8 June 2026 to 8 June 2027

The Commissioner may withdraw this clearance certificate at any time if we obtain further information indicating you are a foreign resident.

Yours sincerely,

Ben Kelly

Deputy Commissioner of Taxation

Need help?

Learn more about foreign resident capital gains withholding at ato.gov.au/FRCGW

Contact us

In Australia? Phone us on **13 28 66**

If you're calling from overseas, phone **+61 2 6216 1111** and ask for **13 28 66** between 8:00 am and 5:00 pm Australian Eastern Standard time, Monday to Friday.