

Energy Efficiency Report




FirstRate Report



YOUR HOUSE ENERGY RATING IS: ★★☆☆☆☆ **6 STARS**
in Climate: 24 **SCORE: 21 POINTS**

Name: Ostermaier **Ref No:** 66743
House Title: Unit 230 Block 1 Section 62 BRADDON **Date:** 16-02-2026
Address: 116/43 Currong St N, Braddon ACT 2612

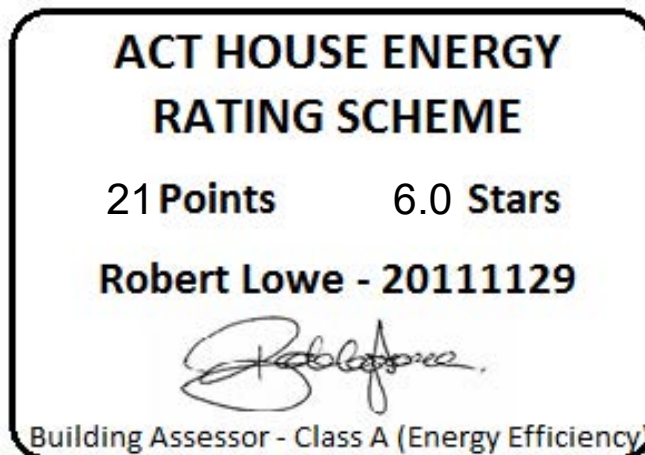

This rating only applies to the floor plan, construction details, orientation and climate as submitted and included in the attached Rating Summary. Changes to any of these could affect the rating.

IMPROVING YOUR RATING

The table below shows the current rating of your house and its potential for improvement.

	POOR			AVERAGE				GOOD			V. GOOD	
Star Rating	0 Star	★	★★	★★★	★★★★	★★★★★	★★★★★★	★★★★★★★	★★★★★★★★	★★★★★★★★★		
Point Score	-71	-70	-46	-45	-26	-25	-11	-10	4	5	16	17
Current	21											
Potential	35											

Incorporating these design options will add the additional points required to achieve the potential rating shown in the table. Each point represents about a 1% change in energy efficiency. This list is only a guide to the range of options that could be used.

Design options

Additional points

Change curtain to

Heavy Drapes & Pelmet

14

ORIENTATION

Orientation is one of the key factors which influences energy efficiency. This dwelling will achieve different scores and star ratings for different orientations.

Current Rating	21	★★★★★★
-----------------------	-----------	---------------

Largest windows in the dwelling;

Direction : South West

Area : 22 m²

The table below shows the total score for the dwelling when these windows face the direction indicated.

Note that obstructions overshadowing windows have been removed from all windows in these ratings to allow better comparisons to be made between orientations.

ORIENTATION	POINT SCORE	STAR RATING
1. South West	21	★★★★★★
2. West	26	★★★★★★
3. North West	39	★★★★★★
4. North	51	★★★★★★
5. North East	48	★★★★★★
6. East	36	★★★★★★
7. South East	25	★★★★★★
8. South	22	★★★★★★

FirstRate Mode
Climate: 24

RATING SUMMARY for: Unit 230 Block 1 Section 62 BRADDON, 116/43 Currong St N, Braddon ACT 2612

Assessor's Name:

Net Conditioned Floor Area: 71.3 m²

				Points		
Feature				Winter	Summer	Total
CEILING				15	0	15
Surface Area:	117	Insulation:	-103			
WALL				0	-3	-4
Surface Area:	1	Insulation:	0	Mass:	-5	
FLOOR				21	-5	16
Surface Area:	17	Insulation:	-4	Mass:	3	
AIR LEAKAGE (Percentage of score shown for each element)				7	0	7
Fire Place	0 %	Vented Skylights	0 %			
Fixed Vents	0 %	Windows	40 %			
Exhaust Fans	29 %	Doors	14 %			
Down Lights	0 %	Gaps (around frames)	16 %			
DESIGN FEATURES				0	-1	-1
Cross Ventilation	-1					
ROOF GLAZING				0	0	0
Winter Gain	0	Winter Loss	0			
WINDOWS				-25	-11	-35
Window Direction	Area		Point Scores			
	m2	%NCFA	Winter* Loss	Winter Gain	Summer Gain	Total
SW	22	30%	-44	19	-11	-35
Total	22	30%	-44	19	-11	-35

* Air movement over glazing can significantly increase winter heat losses. SEAV recommends heating/cooling duct outlets be positioned to avoid air movement across glass or use deflectors to direct air away from glass.

The contribution of heavyweight materials to the window score is 4 points

				Winter	Summer	Total
RATING	★ ★ ★ ★ ★ ★			18	-21	21*
SCORE						

* includes 24 points from Area Adjustment

Detailed House Data

House Details

ClientName Ostermaier
HouseTitle Unit 230 Block 1 Section 62 BRADDON
StreetAddress 116/43 Currong St N, Braddon ACT 2612
FileCreated 16-02-2026

Climate Details

State
Town Canberra
Postcode 2600
Zone 24

Floor Details

ID	Construction	Sub Floor	Upper	Shared	Foil	Carpet	Ins RValue	Area
1	Suspended Slab	Enclosed	No	Yes	No	Carp	R0.0	20.0m ²
2	Suspended Slab	Enclosed	No	Yes	No	Tiles	R0.0	8.0m ²
3	Suspended Slab	Enclosed	No	Yes	No	Float Timb	R0.0	46.0m ²

Wall Details

ID	Construction	Shared	Ins RValue	Length	Height
1	Framed: Metal Clad	No	R2.0	12.2m	2.6m
2	Weatherboard	Yes	R0.0	13.2m	2.6m
3	Weatherboard	No	R0.5	10.6m	2.6m

Ceiling Details

ID	Construction	Shared	Foil	Ins RValue	Area
1	Flat - Suspended Slab	Yes	No	R0.0	74.0m ²

Window Details

ID	Dir	Height	Width	Utility	Glass	Frame	Curtain	Blind	Fixed & Adj Eave	Fixed Eave	Head to Eave
1	SW	2.6m	3.6m	No	DG	ALIMPR	HB	No	1.5m	1.5m	0.0m
2	SW	2.6m	3.5m	No	DG	ALIMPR	HB	No	1.5m	1.5m	0.0m
3	SW	2.6m	1.2m	No	DG	ALIMPR	HB	No	1.5m	1.5m	0.0m

Window Shading Details

ID	Dir	Height	Width	Obst Height	Obst Dist	Obst Width	Obst Offset	LShape Left Fin	LShape Left Off	LShape Right Fin	LShape Right Off
1	SW	2.6m	3.6m	0.0m	0.0m	0.0m	0.0m	0.0m	0.0m	1.5m	0.5m
2	SW	2.6m	3.5m	0.0m	0.0m	0.0m	0.0m	1.5m	1.5m	0.0m	0.0m
3	SW	2.6m	1.2m	0.0m	0.0m	0.0m	0.0m	6.0m	0.0m	5.0m	0.2m

Zoning Details

Is there Cross Flow Ventilation ? Poor

Air Leakage Details

Location Suburban
Is there More than One Storey ? No
Is the Entry open to the Living Area ? Yes
Is the Entry Door Weather Stripped ? Yes
Area of Heavyweight Mass 0m²

Area of Lightweight Mass

0m²

	<u>Sealed</u>	<u>UnSealed</u>
Chimneys	0	0
Vents	0	0
Fans	2	0
Downlights	0	0
Skylights	0	0
Utility Doors	0	0
External Doors	0	0
Unflued Gas Heaters		0
Percentage of Windows Sealed		98%
Windows - Average Gap		Small
External Doors - Average Gap		Small
Gaps & Cracks Sealed		Yes

Insurance Certificates & Tax Invoice



Pest Controllers Combined Liability Certificate of Currency

The Policy below is current until 4.00pm on the expiry date shown below

INSURED: ACT Property Inspections Pty Ltd

BUSINESS DESCRIPTION: General Pest & Weed Control
Timber Pest Inspections
Termite Barrier Installations
Pre-Purchase House Pest Inspections
Building Inspections (Non Pest Related)
Energy Efficiency Ratings
Compliance Reports

POLICY REFERENCE: 09A349653PLB

PERIOD OF INSURANCE: From: 4.00pm on 30/03/2025
To: 4.00pm on 30/03/2026

POLICY CLASS: Pest Controllers Combined Liability

SUMS INSURED: **Section 1: General Public & Products Liability**

\$20,000,000 Our maximum liability in respect of any claim or series of claims for Personal Injury, Property Damage or Advertising Liability caused by or arising out of any one occurrence; and

\$20,000,000 Our total aggregate liability during any one period of insurance for all claims arising out of Your Product

Section 2: Professional Indemnity

\$5,000,000 Our maximum liability in respect of any Claim or any series of Claims inclusive of costs and expenses.

\$10,000,000 Our total aggregate liability for all Claims inclusive of costs and expenses.

This Certificate of Currency is subject to the Policy Documentation to be read in conjunction with the Definitions, Conditions and Exclusions in the Pest Controllers Combined Liability Insurance Policy.

Date Issued: 28 March 2025



**ACT
PROPERTY
INSPECTIONS**

TAX INVOICE

Tanja Ostermaier
116/43 Currong St North
BRADDON ACT 2612
AUSTRALIA

Invoice Date
29 Jan 2026

Invoice Number
INV-66743

ABN
33 600 397 466

ACT Property Inspections
(02) 6232 4540
Unit 1, 33 Altree Ct
PHILLIP ACT 2606
ABN: 33 600 397 466

Description	Quantity	Unit Price	GST	Amount AUD
Energy Efficiency Report	1.00	348.26	10%	348.26
ACTPLA - EER ESDD Lodgement Fee (no GST)	1.00	41.91	GST Free	41.91
			Subtotal	390.17
			TOTAL GST 10%	34.83
			TOTAL AUD	425.00

Due Date: 23 Feb 2026

Payment Terms: 7 Day Account

Please pay within the payment terms to avoid an admin fee. Note: all bank/legal fees incurred in obtaining payment will be the customer's responsibility

Direct Deposit

BSB: 012084

Account Number: 194679655

Account Name: ACT Property Inspections Pty Ltd

Please reference your name and invoice number

Cheques - please make payable to ACT Property Inspections Pty Ltd

[View and pay online now](#)



**ACT
PROPERTY
INSPECTIONS**

RECEIPT

Tanja Ostermaier
116/43 Currong St North
BRADDON ACT 2612
AUSTRALIA

Payment Date
12 Feb 2026

Sent Date
13 Feb 2026

ABN:
33 600 397 466

ACT Property Inspections
(02) 6232 4540
Unit 1, 33 Altree Ct
PHILLIP ACT 2606
ABN: 33 600 397 466

Total AUD paid	425.00
-----------------------	---------------

Invoice Date	Reference	Payment Reference	Invoice Total	Amount Paid	Still Owing
29 Jan 2026	INV-66743	Payment	425.00	425.00	0.00
			Total AUD	425.00	0.00
