


Report

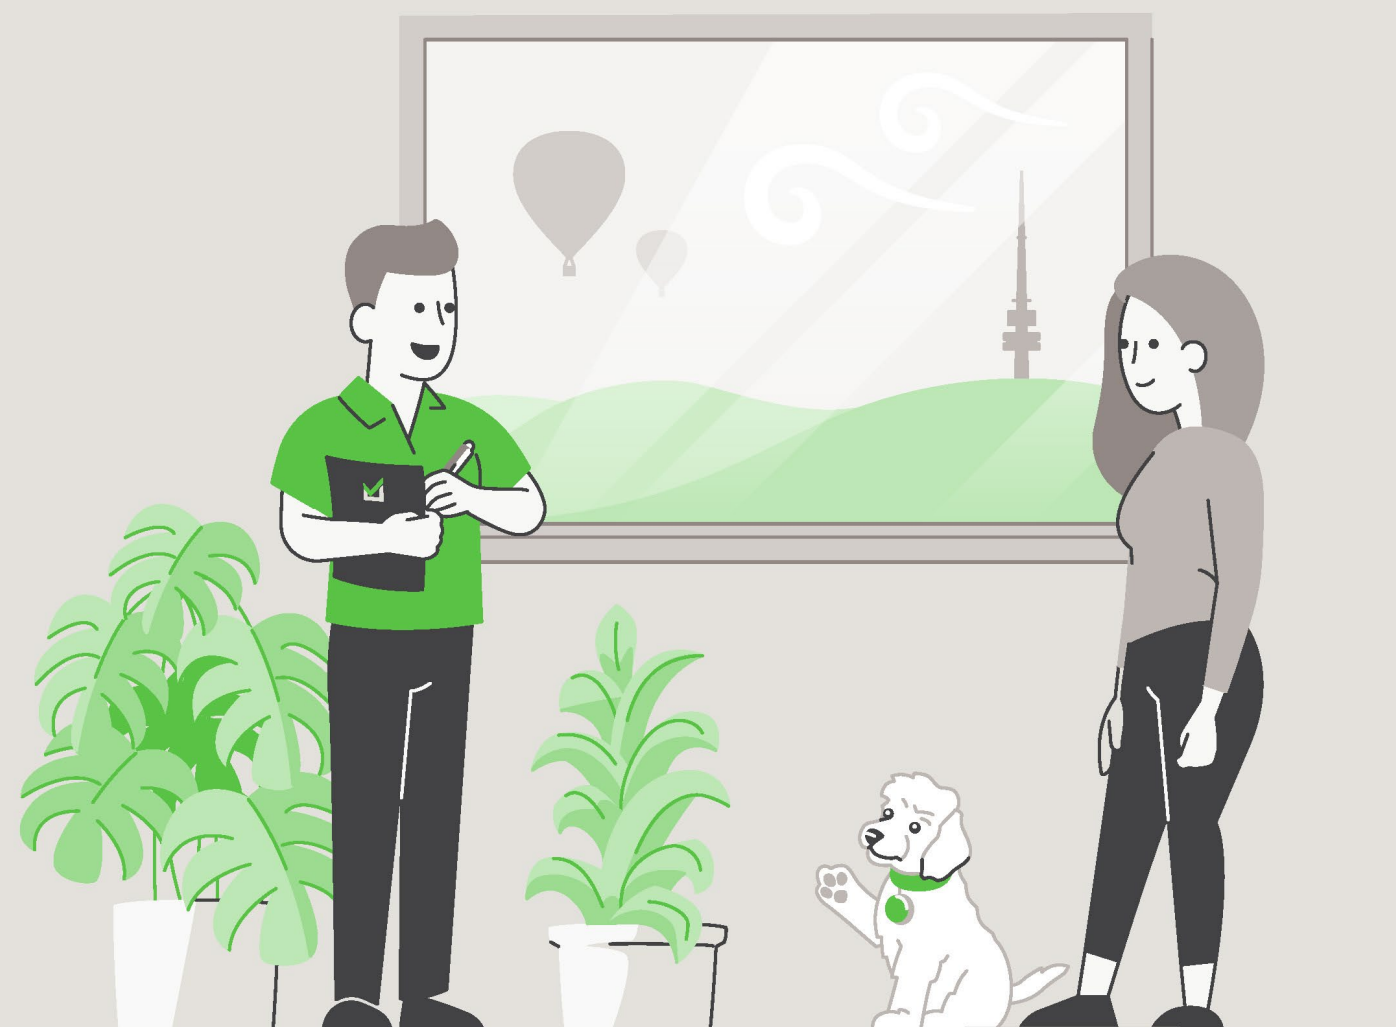

LIMITED LIABILITY TO A PURCHASER WITHIN THE AUSTRALIAN CAPITAL TERRITORY

This Report is made solely for the use and benefit of the Client. The Consultant is not liable for any reliance placed on this report by any third party. However, within the ACT only and in accordance with the Civil Law (Sale of Residential Property) Act 2003 and the Civil Law (Sale of Residential Property) Regulations 2004, a copy of the report must be attached to the Contract for Sale and may in certain circumstances be relied upon by the Purchaser of residential property.

The circumstances in which a Purchaser of residential property within the ACT may rely on this report in respect of the state of the property at the time of the inspection are as follows:

- (a)** The inspection was carried out no earlier than three months before the day the property was first advertised or offered for sale or listed by an agent; and
- (b)** The date on which the contract was entered into was not more than 180 days after the date of the inspection.
- (c)** The report is provided to the Purchaser prior to or at the time the Contract for Sale is entered into between the Purchaser and vendor.
- (d)** The service requested is the Standard Inspection Report.

Building Report



CONCLUSION AND SUMMARY

The purpose of the Inspection is to identify the major defects and safety hazards associated with the property at the time of the Inspection. The Inspection and reporting are limited to a visual assessment of the Building Members in accord with Appendix C AS4349.1-2007.

The overall condition of this building has been compared to similar constructed buildings of approximately the same age where those buildings have had a maintenance program implemented to ensure that the building members are still fit for purpose.

The incidence of Major Defects in this Residential Building as compared with similar Buildings is considered: **Low**

The incidence of Minor Defects in this Residential Building as compared with similar Buildings is considered: **Low**

The overall condition of this Residential Dwelling in the context of its age, type and general expectations of similar properties is: **Above Average**

Please Note: This is a general appraisal only and cannot be relied upon on its own – read the Report in its entirety.

This Summary is supplied to allow a quick and superficial overview of the Inspection results. This Summary is NOT the Report and cannot be relied upon on its own. This Summary must be read in conjunction with the full Report and not in isolation from the Report. If there should happen to be any discrepancy between anything in the Report and anything in this Summary, the information in the Report shall override that in this Summary.

PROPERTY STATISTICS

Building Report	Above Average
Compliance Report	No unapproved structures
Pest Inspection	No active subterranean termites (live specimen) were found
Energy Efficiency Rating	6.0 Stars
Inspection Date	Friday, September 26th 2025
Name of Assessor	Matthew McGuiness
Reference Number	65568
Address of Property Inspected	23A Parker St, Curtin ACT 2605
Client	Roach
Unit, Block and Section	Unit 1 Block 21 Section 16 CURTIN
Year original residence COU was issued	2023
House size (approximately)	Lower Level: 64.08m ² Upper Level: 100.80m ² Garage: 38.00m ² Total: 202.88m ²
Weather conditions at time of Inspection	Fine
Occupancy Status	Occupied

*The table above is to be used as a quick reference. Please read the full Report before reaching your conclusion regarding the condition of the Property.

Whilst every care has been taken to ensure the accuracy of the property house and block size, we accept no responsibility for any inaccuracies as supplying this information exceeds a standard building inspection under AS4349.1-2007.

PROPERTY CONSTRUCTION DETAILS

Flooring	Concrete to ground level. Timber floor framing to upper floor level
External walls	Brick veneer and Styrofoam cladding
Roof framing	Steel: Truss roof framing
Roof cladding	Colorbond roof cladding
Glazing	Double glazed windows
Cooktop	Electric cooktop
Oven	Electric oven
Dishwasher	Bosch

*Whilst every care has been taken to ensure the accuracy of the property construction details, we accept no responsibility for any inaccuracies of construction details or testing of appliances.

GENERAL ACCESS LIMITATIONS

Internal	At the time of inspection, the building was furnished. This allows for a limited inspection in areas not restricted by furnishings, stored goods, floor mats, etc.
External	The inspection of the exterior was restricted to the immediate exterior of the residence
Roof void	The inspection of the roof void was restricted to a visual inspection from the access hole due to the air-conditioning unit not allowing bodily access
On-top of roof	The inspection was restricted to visually looking from a 3.6m ladder lent against the gutter in several areas around the building. No access was gained onto the upper-level roof due to the height of the roof
Garage	The inspection of the garage was restricted due to stored goods being kept in the area at the time of inspection

*Where access is noted as limited or restricted, it is recommended that access be gained to these areas as these areas may contain concealed defects.

DEFINITIONS

Good	The item is in the Inspector's opinion of an acceptable standard with no defects visible. Superficial defects will not be commented on
Fair	The item in the Inspector's opinion has some minor defects and requires minimal maintenance or repair
Poor	The item in the Inspector's opinion needs significant repair or replacement

ENTRANCE

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good

LIVING/DINING ROOM

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good

KITCHEN

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Kitchen cupboards	Good
Bench top	Good
Splashback	Good
Is an exhaust fan fitted?	Yes. The exhaust fan was not operational at the time of inspection.

BEDROOM 1

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Wardrobe	Minor cracking was noted in the ceiling. This is caused through normal building movement and is not considered to be excessive cracking.

BEDROOM 2

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Wardrobe	Good

BEDROOM 3

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Wardrobe	Good

BEDROOM 4

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Wardrobe	Good

ENSUITE

Ceiling	Good
Walls	Good
Floor coverings	Good
Shower screen	Good
Floor and wall tiles in shower area	Good
Vanity/Basin	Good
Taps	Good
Bath	Good
Is an exhaust fan fitted?	Yes. The exhaust fan was operational at the time of inspection.
Toilet suite	Good. Dual flush

BATHROOM

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Shower screen	Good
Floor and wall tiles in shower area	Good
Vanity/Basin	Good
Taps	Good
Bath	Good
Is an exhaust fan fitted?	Yes. The exhaust fan was operational at the time of inspection.
Toilet suite	Good. Dual flush

POWDER ROOM

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Toilet suite	Good
Basin	Good
Taps	Good
Is an exhaust fan fitted?	Yes. The exhaust fan was operational at the time of inspection.

LAUNDRY

Ceiling	Good
Walls	Good
Door and door hardware	Good
Floor coverings	Good
Laundry tub	Good
Splashback	Good
Is an exhaust fan fitted?	Yes. The exhaust fan was operational at the time of inspection.

ROOF CAVITY

Construction	Good
--------------	------

EXTERIOR

Driveway and paths	Good. No major cracking noted.
Roof covering	Good
Eaves	Elevated moisture readings and some water staining/damage was noted in the eave lining along the covered walkway to the entry, likely to be caused by leakage into the upper wall cavity. Repairs by a qualified tradesperson are recommended to prevent this from worsening in the future. Minor water staining was noted to the eave lining under bedroom 2. Moisture readings were normal at the time of inspection. Recommend monitoring.
Fascia	Good
Gutters	Good. The gutters appear to be in functional condition.
External walls	Good
External windows	Good
Alfresco	Good
Fences	Good
Gate	Good
Retaining walls	Good
Site drainage	The site generally drains away from the perimeter of the building.

GARAGE

Ceiling	Good
Slab	Good. No major cracking noted.
Walls	Good
Garage door	Good
Is an auto opener installed on the roller door?	Yes
Access door	Good

DEFINITIONS

Above Average: The overall condition is above that consistent with dwellings of approximately the same age and construction. Most items and areas are well maintained and show a reasonable standard of workmanship when compared with buildings of similar age and construction.

Average: The overall condition is consistent with dwellings of approximately the same age and construction. There will be areas or items requiring some repair or maintenance.

Below Average: The Building and its parts show some significant defects and/or very poor non-tradesman like workmanship and/or long-term neglect and/or defects requiring major repairs or reconstruction of major building elements.

Client: The person or persons, for whom the Inspection Report was carried out or their Principal (i.e., the person or persons for whom the report is being obtained).

Building Consultant: A person, business or company who is qualified and experienced to undertake a pre-purchase inspection in accordance with Australian Standard AS 4349.1-2007 'Inspection of Buildings. Part 1: Pre-Purchase Inspections – Residential Buildings'. The consultant must also meet any Government licensing requirement, where applicable.

Building & Site: The inspection of the nominated residence together with relevant features including any car accommodation, detached laundry, ablution facilities and garden sheds, retaining walls more than 700 mm high, paths and driveways, steps, fencing, earth, embankments, surface water drainage and storm water run-off within 30 m of the building, but within the property boundaries. In the case of strata and company title properties, the inspection is limited to the interior and immediate exterior of the nominated residence and does not include inspection of common property.

Readily Accessible Areas: Areas which can be easily and safely inspected without injury to person or property, are up to 3.6 metres above ground or floor levels or accessible from a 3.6 metre ladder, in roof spaces where the minimum area of accessibility is not less than 600 mm high by 600 mm wide and subfloor spaces where the minimum area of accessibility is not less than 400 mm high by 600 mm wide, providing the spaces or areas permit entry. Or where these clearances are not available, areas within the consultant's unobstructed line of sight and within arm's length.

Structure: The loadbearing part of the building, comprising the Primary Elements.

Primary Elements: Those parts of the building providing the basic loadbearing capacity to the Structure, such as foundations, footings, floor framing, loadbearing walls, beams, or columns. The term 'Primary Elements' also includes other structural building elements including those that provide a level of personal protection such as handrails; floor-to-floor access such as stairways; and the structural flooring of the building such as floorboards.

Secondary Elements: Those parts of the building not providing loadbearing capacity to the Structure, or those non-essential elements which, in the main, perform a completion role around openings in Primary Elements and the building in general such as non-loadbearing walls, partitions, wall linings, ceilings, chimneys, flashings, windows, glazing or doors.

Finishing Elements: The fixtures, fittings and finishes applied or affixed to Primary Elements and Secondary Elements such as baths, water closets, vanity basins, kitchen cupboards, door furniture, window hardware, render, floor, and wall tiles, trim or paint. The term 'Finishing Elements' does not include furniture or soft floor coverings such as carpet and lino.

Major Defect: A defect of significant magnitude where rectification has to be carried out in order to avoid unsafe conditions, loss of utility or further deterioration of the property.

Minor Defect: A defect other than a Major Defect.

Safety Hazard: Any item that may constitute an immediate or imminent risk to life, health, or property. Occupational, health and safety or any other consequence of these hazards has not been assessed.

Tests: Where appropriate the carrying out of tests using the following procedures and instruments:

Dampness Tests means additional attention to the visual examination was given to those accessible areas which the consultant's experience has shown to be particularly susceptible to damp problems. Instrument testing using electronic moisture detecting meter of those areas and other visible accessible elements of construction showing evidence of dampness was performed.

Physical Tests means the following physical actions undertaken by the consultant: opening and shutting of doors, windows and draws; operation of taps; water testing of shower recesses; and the tapping of tiles and wall plaster.

IMPORTANT ADVICE

NB. In the case of strata and company title properties, the Inspection is limited to the interior and immediate exterior of the particular unit being inspected. The exterior above ground floor level is not inspected. The complete Inspection of other common property areas would be the subject of a Special-Purpose Inspection Report which is adequately specified.

Trees: Where trees are too close to the house this could affect the performance of the footing as the moisture levels change in the ground. A Geotechnical Inspection can determine the foundation material and provide advice on the best course of action with regards to the trees.

The Septic Tanks: Should be inspected by a licensed plumber.

Swimming Pools: Swimming Pools/Spas are not part of the Standard Building Report under AS4349.1-2007 and are not covered by this Report. We strongly recommend a pool expert should be consulted to examine the pool and the pool equipment and plumbing, as well as the requirements to meet the standard for pool fencing. Failure to conduct this Inspection and put into place the necessary recommendations could result in finds for non-compliance under the legislation.

Surface Water Drainage: The retention of water from surface run off could have an effect on the foundation material which in turn could affect the footings to the house. Best practice is to monitor the flow of surface water during rainfall and stormwater runoff and have the water directed away from the house or to storm water pipes by a licensed plumber/drainier.

Weep Holes: External brick (and stone) walls are a porous material that behave much like a sponge. During a rain event, the masonry wall absorbs water and actually stores it. The weep holes are designed for two purposes. 1. To provide an opening to allow water to drain out through the bottom of the wall. 2. To allow ventilating air to enter behind the wall to help dry the structure. If weep holes have been noted as being not installed, it is recommended to consult a builder on how to best rectify the problem.

Water Leaks from Roof: The inspector cannot, and does not, offer an opinion on whether the roof currently leaks or may be subject to future leaks. The only way to determine whether a roof is absolutely watertight is to make observations during prolonged rainfall.

Subfloor dampness: The presence of dampness is not always consistent as the prevailing and recent weather conditions at the time an inspection is carried out may affect the detection of damp problems. The absence of any dampness at the time of inspection does not necessarily mean the building will not experience some damp problems in other weather conditions. Likewise, whether or not services have been used for some time prior to an inspection being carried out will affect the detection of dampness.

Shower: Where a shower recess has been water tested, and no leakage was evident, this does not necessarily mean that the shower will not leak after prolonged use. Accordingly, to fully detect and assess a damp problem may require the monitoring of the building over a period of time.

SCOPE AND LIMITATIONS

Any person who relies upon the contents of this Report does so acknowledging that the following clauses, which define the Scope and Limitations of the Inspection, form an integral part of the Report.

1) This Report is not an all-encompassing Report dealing with the building from every aspect. It is a reasonable attempt to identify any obvious or significant defects apparent at the time of the Inspection. Whether or not a defect is considered significant or not, depends to a large extent upon the age and type of the building inspected. This Report is not a Certificate of Compliance with the requirements of any Act, Regulation, Ordinance or By-law. It is not a structural Report. Should you require any advice of a structural nature you should contact a structural engineer.

2) This is a visual Inspection only, limited to those areas and sections of the property fully accessible and visible to the Inspector on the date of Inspection. The Inspection DID NOT include breaking apart, dismantling, removing, or moving objects including, but not limited to, foliage, mouldings, roof insulation/sisalation, floor or wall coverings, sidings, ceilings, floors, furnishings, appliances, or personal possessions. The inspector CANNOT see inside walls, between floors, inside skillion roofing, behind stored goods in cupboards and other areas that are concealed or obstructed. The inspector DID NOT dig, gouge, force or perform any other invasive procedures. Visible timbers CANNOT be destructively probed or hit without the written permission of the property owner.

3) This Report does not and cannot make comment upon: Defects that may have been concealed; the assessment or detection of defects (including rising damp and leaks) which may be subject to the prevailing weather conditions; whether or not services have been used for some time prior to the Inspection and whether this will affect the detection of leaks or other defects (e.g. In the case of shower enclosures the absence of any dampness at the time of the inspection does not necessarily mean that the enclosure will not leak); the presence or absence of timber pests; gas-fittings; common property areas; environmental concerns; the proximity of the property to flight paths, railways, or busy traffic; noise levels; health and safety issues; heritage concerns; security concerns; fire protection; site drainage (apart from **surface** water drainage); swimming pools and spas (non-structural); detection and identification of illegal building work; detection and identification of illegal plumbing work; durability of exposed finishes; neighbourhood problems; document analysis; electrical installation; any matters that are solely regulated by statute; any area(s) or item(s) that could not be inspected by the consultant.

Accordingly, this Report is NOT a guarantee that defects and/or damage does not exist in any inaccessible or partly inaccessible areas or sections of the property.

NB. Such matters may, upon request, be covered under the terms of a 'Special-Purpose Property Report'.

4) Consumer Complaints Procedure: In the event of any dispute or claim arising out of, or relating to the Inspection or the Report, you must notify us as soon as possible of the dispute or claim by email, fax, or mail. You must allow us (which includes persons nominated by us) to visit the property (which visit must occur within twenty eight (28) days of your notification to us) and give us full access in order that we may fully investigate the complaint. You will be provided with a written response to your dispute or claim within twenty-eight (28) days of the date of the Inspection.

If you are not satisfied with our response, you must within twenty one (21) days of your receipt of our written response, refer the matter to a Mediator nominated by us from the Institute of Arbitrators and Mediators of Australia. The cost of the Mediator will be borne equally by both parties, and as agreed as part of the mediated settlement.

Should the dispute or claim not be resolved by mediation, then the dispute or claim will proceed to arbitration. The Institute of Arbitrators and Mediators of Australia will appoint an Arbitrator who will hear and resolve the dispute. The arbitration, subject to any directions of Arbitrator, will proceed in the following manner:

(a) The parties must submit all written submissions and evidence to the Arbitrator within twenty one (21) days of the appointment of the Arbitrator; and

(b) The arbitration will be held within twenty one (21) days of the Arbitrator receiving the written submissions.

The Arbitrator will make a decision determining the dispute or claim within twenty one (21) of the final day of the arbitration. The Arbitrator may, as part of his determination, determine what costs, if any, each of the parties are to pay and the time by which the parties must be paid any settlement or costs.

The decision of the Arbitrator is final and binding on both parties. Should the Arbitrator order either party to pay any settlement amount or costs to the other party but not specify a time for payment, then such payment shall be made within twenty one (21) days of the order.

NB. In the event that you do not comply with the above Complaints Procedure and commence litigation against us, then you agree to fully indemnify us against any awards, costs, legal fees, and expenses incurred by us in having your litigation set aside or adjourned to permit the foregoing Complaints Procedure to complete.

5) Asbestos Disclaimer: “No Inspection for Asbestos was carried out at the property, and no Report on the presence or absence of Asbestos is provided”.

Buildings built prior to 1982 may have wall and/or ceiling sheeting, and other products including roof sheeting that contains Asbestos. Even buildings built after this date, up until the early 90s, may contain some Asbestos. Sheeting should be fully sealed. If you are concerned, the building was built prior to 1990, or if asbestos is noted as present within the property, then you should seek advice from a qualified asbestos removal expert as to the amount and importance of the asbestos present and the cost of sealing or removal. Drilling, cutting, or removing sheeting or products containing Asbestos is a high risk to peoples’ health. You should seek advice from a qualified asbestos removal expert.

6) Mould (Mildew and non-wood decay fungi) Disclaimer: Mildew and non-wood decay fungi are commonly known as mould. However, mould and their spores may cause health problems or allergic reactions, such as asthma and dermatitis in some people. No Inspection for mould was carried out at the property, and no Report on the presence or absence of mould is provided. If mould is noted as present within the property, or if you notice mould and you are concerned as to the possible health risk resulting from its presence, then you should seek advice from your local Council, State or Commonwealth Government Health Department, or a qualified expert such as an Industry Hygienist.

7) Magnesite Flooring Disclaimer: No Inspection for Magnesite Flooring was carried out at the property, and no Report on the presence or absence of Magnesite Flooring is provided. You should ask the owner whether Magnesite Flooring is present and/or seek advice from a Structural Engineer.

8) Estimating Disclaimer: Any estimates provided in this Report are merely opinions of possible costs that could be encountered, based on the knowledge and experience of the inspector, and are not estimates in the sense of being a calculation of the likely costs to be incurred. The estimates are NOT a guarantee or quotation for work to be carried out. The actual cost is ultimately dependent upon the materials used, standard of work carried out, and what a contractor is prepared to do the work for. It is recommended in ALL instances that multiple independent quotes are sourced prior to any work being carried out. The inspector accepts no liability for any estimates provided throughout this Report.

9) Note: If the Client has any doubt about the purpose, scope, and acceptance criteria on which the Report was based please discuss your concerns with the Consultant on receipt of the Report. The Client acknowledges that, unless stated otherwise, the Client as a matter of urgency should implement any recommendation or advice given in this Report.

IMPORTANT DISCLAIMER

Disclaimer Liability: No Liability shall be accepted on an account of failure of the Report to notify any problems in the area(s) or section(s) of the subject property physically inaccessible for Inspection, or to which access for Inspection is denied by or to the Inspector (including but not limited to or any area(s) or section(s) so specified by the Report).

Disclaimer of Liability to Third Parties: Compensation will only be payable for losses arising in contract or tort sustained by the Client named on the front of this Report. Any third party acting or relying on this Report, in whole or in part, does so entirely at their own risk. However, if ordered by a Real Estate Agent or a Vendor for the purpose of auctioning a property, then the Inspection Report may be ordered up to seven (7) days prior to the auction, copies may be given out prior to the auction and the Report will have a life of 14 days during which time it may be transferred to the purchaser. Providing the purchaser agrees to the terms of this agreement, then they may rely on the Report subject to the terms and conditions of this agreement and the Report itself.

NB. In the ACT under the Civil Law (Sale of Residential Property) Act 2003 and Regulations, the Report resulting from this Inspection may be passed to the purchaser as part of the sale process, providing it is carried out no more than three months prior to listing and is not more than six months old.

Limited Liability to a Purchaser within the Australian Capital Territory only: Within the Australian Capital Territory (ACT) and in accordance with the ACT Civil Law (Sale of Residential Property) Act 2003 and Regulations, a copy of the Report may be attached to the Contract for Sale.

WARNING: The Purchaser is advised that this Report reflects the condition of the property existing at the time of the Inspection (Inspection Date) and may not reflect the current state. It is, therefore, very strongly recommended that you promptly arrange for another Inspection and Report in accordance with Australian Standard AS4349.1 to be carried out prior to the expiration of the 'Cooling off Period' and settlement.

This is not a Compliance Report strictly in accordance with Civil Law (Sale of Residential Property) Regulations: The Report may contain copies of any approved plans, building approvals, building permit and Certificates of Occupancy. However, any comments made by the person who prepared the Report as to whether or not, in the opinion of the Inspector, the structures on the land substantially comply with the approved plans (if any) are made on the basis of a cursory glance of the plans and not upon a detailed examination. Any opinion expressed as to whether or not any building approval or approval under the Land (Planning and Environment) Act, 1991, is based on the limited knowledge and belief, at the time, of the Inspector. The Purchaser is advised that a Special Purpose Report is available through the Inspector to advise more fully in respect to these matters. The structures may have been damaged by pests, storm, strong wind or fire or the Vendor may have carried out alterations and/or additions to the Property since the Inspection Date. The Report may no longer reflect the true condition of the Property. The structure(s) may no longer be in accordance with the attached plans etc. IT IS STRONGLY RECOMMENDED that, if the Purchaser has any concerns in respect to the compliance of the structures, a Special Purpose Report be obtained. Alternatively, the Purchaser should rely upon his, her or their own enquiries.

Contact the Inspector: Please feel free to contact the Inspector who carried out this Inspection. Often it is very difficult to fully explain situations, problems, access difficulties, building faults or their importance in a manner that is readily understandable by the reader. Should you have any difficulty in understanding anything contained within this Report, then you should immediately contact the Inspector and have the matter explained to you. If you have any questions at all, or require any clarification, then contact the Inspector prior to acting on this Report.

OTHER INSPECTIONS AND REPORTS REQUIRED

It is strongly recommended that the following Inspections and Reports be obtained prior to any decision to purchase the Property. Obtaining these Reports will better equip the purchaser to make an informed decision. Although appliances may be listed in the Report, they have not been tested as this is outside the scope of the standard Building Inspection. Other Inspections we recommend the purchaser obtains before making their decision are:

- Electrical Inspection,
- Plumbing Inspection,
- Structural (Engineer),
- Geotechnical Inspection,
- Drainage Inspection,
- Asbestos Inspection,
- Mould Inspection,
- Gas fitting Inspection,
- Appliances Inspection,
- Air-conditioning Inspection,
- Alarm/Intercom/Data Systems,
- Hydraulics Inspection,
- Mechanical Services,
- Hazards Inspection,
- Fire/Chimney Inspection,
- Estimating Report,
- Garage Door Mechanical,
- Durability exposed surfaces

SMOKE DETECTORS

The occupier/purchaser should satisfy themselves as to the working condition of the smoke detectors, if installed. It is highly recommended that suitable smoke detectors be installed in all residential properties. AS 3786 advises that smoke detectors are required for all buildings where people sleep. It is recommended that an electrician be consulted to advise on those installed or install these detectors.

CRACKING OF BUILDING ITEMS

Regardless of the type of crack(s), a Pre-Purchase Building Inspector carrying out a Pre-Purchase Inspection within the scope of a visual Inspection is unable to determine the expected consequences of the cracks.

Obtaining Information regarding the below all fall outside the scope of this Pre-Purchase Inspection:

- (a)** The nature of the foundation material on which the building is resting,
- (b)** The design of the footings,
- (c)** The site landscape,
- (d)** The history of the cracks and,
- (e)** Carrying out an invasive Inspection.

However, the information obtained from the five items above is valuable in determining the expected consequences of the cracking and any remedial work needed. Cracks that are small in width and length on the day of the Inspection may have the potential to develop over time into structural problems for the homeowner, resulting in major expensive rectification work being carried out. If cracks have been identified in the Report above, then a Structural Engineer is required to determine the significance of the cracking prior to a decision to purchase.

NOTICE TO THE PURCHASER (ACT ONLY)

(a) At the Exchange, and prior to the 'Cooling-off Period', you were given an Inspection Report on the property you intend on purchasing. This Report reflects the condition of the property existing at the time of the Inspection (Inspection Date) and may not reflect the current state. The structures may have been damaged by pests, storm, strong wind or fire or the vendor may have carried out alterations and/or additions to the property since the Inspection date. The Report may no longer reflect the true condition of the property. The structure(s) may no longer be in accordance with the attached plans etc. It is, therefore, very strongly recommended that you urgently arrange for another Inspection and Report in accordance with Australian Standard AS 4349.1 to be carried out prior to exchange, or prior to the expiration of any 'Cooling Off Period' and prior to settlement.

(b) If the Report indicated the presence of termite damage, or recommends any other Inspections or treatments, you should obtain copies of these Reports and any treatment proposals, certificates of treatment carried out, including details of all repairs including copies of quotations, invoices, and any other Reports. It is strongly recommended that you arrange for an Inspection and Report in accordance with AS 4349.3 to verify that the treatment has been successful and carried out in accordance with AS 3660.2, and a further building Inspection in accordance with AS 4349.1.

(c) If you fail to procure a further Inspection and Report as recommended in (a) and (b), or fail to obtain copies of other Reports, treatment proposals, certificates of treatment carried out, details of all repairs including copies of quotations, invoices and any other Reports as recommended in (b) above, then you agree that you have decided not to have a further Inspection and Report carried out, or to obtain copies of treatment proposals, certificates of treatment carried out, details of all repairs including copies of quotations, invoices and any other Reports and have relied upon your own enquires and the Report, knowing the possible consequences, and that the condition of the property, as stated in the Report, may have changed.

(d) You agree that the person carrying out the Inspection **and** the company, partnership or sole trader that employs that person will have no liability to you for any damage or loss you may suffer as a result of your entering the contract to purchase the property, or in connection with completing the purchase of the property as a result of your failure to heed the advice given in (a) and (b) and the warning contained in (c) above, and may use such failure in defense of any claim that you may later make against any of them.

NB. It is a condition of your right to rely upon the Report that you transmit by fax, post, or otherwise deliver the signed "Notice to the Purchaser" (ACT only) to the company, partnership or sole trader at the address detailed on the front of the Report not less than four (4) days prior to the date of settlement. If you fail to complete, sign, or deliver the Notice then it will be deemed that you did not rely upon the report in respect to your decision as to whether or not to purchase the property. This may seriously affect any rights to future compensation to which you may be entitled.

Please cross out the statement below that does not apply: - At the date of settlement, not more than 180 days will have elapsed since the Inspection date.

1. I/We have read and understood the 'Limited Liability to a Purchaser within the Australian Capital Territory only' clause of the Report, and this Notice to the Purchaser. I/We have not arranged for another inspection and report in respect of the property, and it is my/our intention to **rely upon the findings contained in the report**; or

2. I/We have **arranged for another Inspection of the Property and Report** to be carried out, which I/We will use in conjunction with this Report in deciding whether to proceed with the purchase of the property; or

3. I/We have read and understood the 'Limited Liability to a Purchaser within the Australian Capital Territory only' clause of the Report, and this Notice to the Purchaser. I/We have not arranged for another Inspection and Report in respect of the property and have **relied on my/our own enquiries in respect of the condition of the property** as at the date of settlement including any changes in the condition of the property that have taken place since the Inspection date stated in the Report

Timber Pest Report



SUMMARY SHEET

Property Address: 23A Parker St, Curtin ACT 2605
Client: Roach
Inspection Date: Friday, September 26th 2025
Inspection carried out by: Matthew McGuinness

This summary is supplied to allow a quick and superficial overview of the Inspection results. This summary is NOT the Report and cannot be relied upon on its own. This summary must be read in conjunction with the full Report and not in isolation from the Report. If there should happen to be any discrepancy between anything in the Report, and anything in this summary, the information in the Report shall override that in the summary. The Report is subject to conditions and limitations. Your attention is particularly drawn to the clauses, disclaimer of liability to third parties, limited liability to a purchaser with the Australian Capital Territory (ACT), and to the notice to the purchaser at the back of this Report.

1.0 ACCESS LIMITATIONS

There were access limitations to the inspection/report. Please refer to section 1.0 of the report.

2.0 TERMITE ACTIVITY

No active subterranean termites (live specimens) were found.

No visible evidence of subterranean termite workings or damage was found.

3.0 BORER ACTIVITY

No visible evidence of borers of seasoned timbers was found.

4.0 DECAY FUNGI

No evidence of damage caused by wood decay (rot) fungi was found.

For complete and accurate information, please refer to the attached 'Visual Timber Pest Report', which is prepared in accordance with AS 4349.3.

CONDITIONS OF THIS INSPECTION

Important Information:

Any person who relies upon the contents of this Report does so acknowledging that the following clauses, which define the scope and limitations of the Inspection, form an integral part of the Report.

This is a **Visual Inspection Only**, prepared in accordance with AS 4349.3, 'Inspection of Buildings Part 3: Timber Pest Inspections'. Visual Inspection was limited to those areas and sections of the property to which reasonable access (see definition) was both available and permitted on the date of Inspection.

The Inspection **did not** include breaking apart, dismantling, removing, or moving objects including but not limited to – foliage, mouldings, roof insulation/sisalation, floor or wall coverings, sidings, ceilings, floors, furnishings, appliances, or personal possessions.

The Inspector **cannot** see inside walls, between floors, inside skillion roofing, inside the eaves, behind stored goods in cupboards, or in any other areas that are concealed or obstructed.

The Inspector **did not** dig, gouge, force or perform any other invasive procedures. An invasive Inspection will not be performed unless a separate contract is entered into.

In an occupied property, it must be understood that furnishings or household items may be concealing evidence of Timber Pests, which may only be revealed when the items are moved or removed.

In the case of strata type properties, only the interior of the unit is inspected.

Scope of Report:

This Report only deals with the detection or non-detection of Timber Pest Attack and Conditions Conducive to Timber Pest Attack discernible at the time of inspection. The inspection was limited to the Readily Accessible Areas of the Building and Site (see note below) and was based on a visual examination of surface work (excluding furniture and stored items), and the carrying out of Tests. Note. With strata and company title properties, the inspection was limited to the interior and the immediate exterior of the particular residence inspected. Common property was not inspected.

Limitations:

The Client acknowledges:

(a) This Report does not include the inspection and assessment of matters outside the scope of the requested inspection and report.

(b) The inspection only covered the Readily Accessible Areas of the Building and Site. The inspection did not include areas which were inaccessible, not readily accessible or obstructed at the time of inspection. Obstructions are defined as any condition or physical limitation which inhibits or prevents inspection and may include – but are not limited to – roofing, fixed ceilings, wall linings, floor coverings, fixtures, fittings, furniture, clothes, stored articles/materials, thermal insulation, sarking, pipe/duct work, builder's debris, vegetation, pavements, or earth.

(c) The detection of dry wood termites may be extremely difficult due to the small size of the colonies. No warranty of absence of these termites is given.

(d) European House Borer (*Hylotrupes bajulus*) attack is difficult to detect in the early stages of infestation as the galleries of boring larvae rarely break through the affected timber surface. No warranty of absence of these borers is given. Regular inspections including the carrying out of appropriate tests are required to help monitor susceptible timbers.

(e) This is not a structural damage report. Neither is this a warranty as to the absence of Timber Pest Attack.

(f) If the inspection was limited to any particular type(s) of timber pest (e.g., subterranean termites), then this would be the subject of a Special-Purpose Inspection Report, which is adequately specified.

(g) This Report does not cover or deal with environmental risk assessment or biological risks not associated with Timber Pests (e.g., toxic Mould) or occupational, health or safety issues. Such advice may be the subject of a Special-Purpose Inspection Report which is adequately specified and must be undertaken by an appropriately qualified inspector. The choice of such inspector is a matter for the Client.

(h) This Report has been produced for the use of the Client. The Consultant or their firm or company are not liable for any reliance placed on this report by any third party, except as provided in the section Limited Liability To a Purchaser within the Australian Capital Territory.

Determining extent of Damage:

This is not a structural building report, and any inexpert opinion we provide on timber damage cannot be relied upon. This Report **will not** state the full extent of any Timber Pest damage. It will state Timber Pest Damage found as either 'slight', 'moderate', 'moderate to extensive', or 'extensive', and this information is not the opinion of an expert. If any evidence of Timber Pest activity and/or damage resulting from Timber Pest activity is reported, either in the structure(s) or the grounds of the property, then you must assume that there may be concealed structural damage within the building(s).

This concealed damage may only be found when wall linings, cladding or insulation are removed to reveal previously concealed timbers. In this case, an Invasive Timber Pest Inspection (for which a separate contract is required) is strongly recommended, and you should arrange for a qualified professional such as a builder, engineer, or architect to carry out a structural Inspection to determine the full extent of the damage, and the extent of repairs that may be required. You agree that neither we, nor the individual conducting the Inspection, are responsible or liable for the repair of any damage, whether disclosed by the Report or not.

Disclaimer of Liability:

No liability shall be accepted on account of failure of the Report to notify any termite activity and/or damage present at, or prior to, the date of the Report, in any area(s) or section(s) of the subject property physically inaccessible for Inspection, or to which access for Inspection is denied by, or to, the licensed Inspector (including, but not limited to, any area(s) or section(s) specified by the Report).

1.0 ACCESS LIMITATIONS

1.1 Area(s) inspected:

Only structures, fences &/or trees within 50m of the building but within the property boundaries were inspected.

1.2 Common area(s) not inspected:

No Inspection was made, and no Report will be submitted, of inaccessible area(s).

These include, but may not be limited to; cavity walls, concealed frame timbers, eaves, flat roofs, fully enclosed patios, inaccessible parts of the subfloors, inaccessible parts of the roof void, soil concealed by concrete floors, fireplace hearths, wall linings, landscaping, rubbish, floor coverings, furniture, pictures, appliances, stored items, insulation, and hollow blocks/posts etc.

1.3 Area(s) in which visual inspection was obstructed or restricted and why:

The inspection of the roof void was restricted to a visual inspection from the access hole due to the air-conditioning unit not allowing bodily access. Areas of the timber fence were concealed by vegetation.

NB. Please note that since a complete Inspection of the above area(s) was not possible, Timber Pest activity and/or damage may exist in these areas.

1.4 The property was furnished at the time of inspection.

Where a property is furnished at the time of Inspection, it must be understood that the furnishings and stored goods may be concealing evidence of Timber Pest activity. This evidence may be revealed when the property is vacated, and a further Inspection of the vacant property is strongly recommended if the house was furnished at the time of inspection.

1.5 Undetected timber pest risk assessment is considered Low.

NB. Where the risk is considered "Moderate" or "Moderate-High" or "High", a further inspection is strongly recommended of areas that were not readily accessible, and of inaccessible or obstructed areas once access has been provided or the obstruction removed. This may require the moving, lifting or removal of obstructions such as floor coverings, furniture, stored items foliage and insulation. In some instances, it may also require the removal of ceiling and wall linings, and the cutting of traps and access holes. Seek further advice from your Consultant.

2.0 TERMITE ACTIVITY

2.1 No active (live) termites were present at the time of Inspection.

2.2 No visible evidence of subterranean termite workings and/or damage was found.

2.3 A termite nest was not found.

2.4 No evidence of timber damage caused by Termite attack was visible at the time of the Inspection.

NB. Where evidence of termite activity by the *Nasutitermes* or *Coptotermes* species was found in the grounds, the risk to buildings is very high. A treatment to eradicate the termites and to protect the building(s) should be carried out. Where the evidence of termite workings was found in the grounds or the building(s), then the risk of a further attack is very high.

2.5 Very important:

If live termites or any evidence of termite workings or damage was reported above, within the building(s) or in the grounds and fences, then it must be assumed that there may be concealed termite activity and/or timber damage. This concealed activity or damage may only be found when alterations are carried out, such as when wall linings, cladding or insulation are removed; or if you arrange for an invasive Inspection. We claim no expertise in structural engineering or building, and we strongly recommend that you have a qualified professional such as a builder, engineer, architect, or other qualified expert determine the full extent of the damage, if any. This may require an invasive Inspection. We take no responsibility for the repair of any damage, whether disclosed by this Report or not (see 'Terms and Limitations').

Where visual evidence of termite workings and/or damage is reported above, but no live termites were present at the time of Inspection, you must realise that it is possible that termites are still active in the immediate vicinity, and that the termites may continue to cause further damage. It is not possible, without further investigation and a number of Inspections over a period of time, to ascertain whether any infestation is active or inactive. Active termites may simply have not been present at the time of Inspection due to a prior disturbance or climatic conditions, or they may have been utilizing an alternative feeding source.

Continued, regular Inspections are essential. Unless written evidence of a termite protection program in accordance with 'AS 3660' with ongoing Inspections is provided, you must arrange for a treatment in accordance with 'AS 3660' to be carried out to reduce the risk of further attack.

2.6 Previous termite treatment: There were no signs of a termite treatment or evidence of a possible previous termite treatment, at the time of inspection.

NB. If there is evidence of drill holes in concrete or brickwork, bait stations or other signs of a possible previous treatment are reported, then the treatment was probably carried out because of an active termite attack. Extensive structural damage may exist in concealed areas. You should have an invasive Inspection carried out, and have a builder determine the full extent of any damage, and the estimated cost of repairs, as the damage may only be found when wall linings etc. are removed. Normally, if a termite treatment has been carried out, then a durable notice should be located in the metre box, indicating the type of termite shield system, treated zone or combination that has been installed.

2.7 Termite management: A termite management notice was not found in the meter box; however, due to the age of the residence a barrier system should have been installed.

This firm can give no assurances with regard to work that may have been previously performed by other firms. You should obtain copies of all paperwork and make your own enquiries as to the quality of the treatment when it was carried out, and warranty information. In most cases, you should arrange for a treatment in accordance with "Australian Standard 3660" to be carried out to reduce the risk of further attack.

2.8 General remarks:

Where any current visible evidence of Timber Pest activity is found, it is strongly recommended that a more invasive Inspection be performed. Trees on and near the property up to a height of 2 metres, have been visually Inspected where possible and practicable, for evidence of Termite activity. It is very difficult to locate termite nests since they are underground, and evidence in trees is usually well concealed. Therefore, we strongly recommend that you arrange to have the medium to large eucalypt trees within a 50 metre radius of the property test drilled for evidence of termite nests.

3.0 BORER ACTIVITY

3.1 No visible evidence of borers was found.

The **Lyctid Borer** - The most common lyctid borer in Australia is **Lyctus brunneus (powder post beetle)**. Attack usually takes place during the first six to twelve months of the service life of timber. However, the powder post beetle is not considered a significant pest of timber and treatment of infestation is not usually required. As only the sapwood of certain hardwoods is destroyed, larger-dimensional timbers (such as rafters, bearers, and joists) in a building are seldom weakened significantly to cause collapse. The **Anobiid Borer** There are many different species of Anobiid borer, the most frequently encountered being *Anobium punctatum* (furniture beetle) and *Calymmaderus incisus* (Queensland pine beetle). Attack mainly occurs to softwoods especially pine timbers such as floorboards that have been in service for at least ten years. Should any structural timbers be attacked by Anobiid borers it is often difficult to determine what extent the borer damage has weakened such timbers and replacement is often the only way of ensuring safety from collapse.

In the case of Anobiid borers, once an attack is initiated it is unlikely to cease or die out of its own accord without some sort of eradication treatment. Therefore, unless proof of treatment is provided, evidence of an attack must always be considered active. Although a chemical treatment is an option, replacement of infested timbers with non-susceptible, or treated timber, is the most effective method of treatment. Before any option is considered, competent advice (e.g., from a licensed building contractor) should be sought to determine the extent of any structural damage, and as to the need or otherwise for rectification or repair work.

Other Borers: A further (more invasive) investigation is strongly recommended to determine whether infestation is still active and to positively identify the borer species responsible for the attack. Always seek further advice from the Consultant.

Management Program: Wherever practical, remove any conditions conducive to attack (e.g., *Anobium* borer thrive in badly ventilated subfloor areas). Regular inspections are recommended at intervals not exceeding 12 months. Always seek further advice from the Consultant.

4.0 DECAY FUNGI

4.1 No evidence of damage caused by wood decay (rot) fungi was found.

NB. If any evidence of fungal decay or damage is reported, you should consult a building expert to determine the full extent of damage, and the estimated cost of repairs or timber.

General Description of Attack Decaying wood contains sufficient moisture to retain its original shape and may have sufficient strength to withstand normal loads. In contrast decayed wood is reduced both in moisture content and size as indicated by cracking either along or across the grain or fibres coming apart in a stringy manner. Decayed wood will have undergone considerable strength reduction.

Economic Significance Fungal decay can cause at one extreme, structural failure of the affected timber, and at the other purely superficial surface damage. The most critical determination is that of which timber is affected and decaying because decay will most likely spread (unless sources of moisture are quickly removed). Affected and decayed timber may warrant timber replacement, but the rot should not spread unless a new moisture source becomes available in that area.

Where evidence of decayed timber exists, competent advice (e.g., from a licensed or registered building contractor) should be sought to determine the extent of any structural damage, and as to the need or otherwise for rectification or repair work. It is important to correct any condition conducive to attack prior to replacing decayed wood.

Where evidence of decaying timber exists, competent advice (e.g., from a licensed or registered building contractor) should be sought to remove the condition(s) conducive to attack, and to determine the extent of any structural damage, and as to the need or otherwise for rectification or repair work.

Where the full extent of damage or the overall condition of the timber is undetermined a further inspection is strongly recommended by a competent person (e.g., from a licensed or registered building contractor). This may require monitoring of the timber over a period and include the assessment of conditions conducive to attack in different weather conditions (e.g., to determine the adequacy of existing drainage).

Management Program Remove any conditions conducive to attack (e.g., lack of ventilation or the presence of excessive moisture). Regular inspections are recommended at intervals not exceeding 12 months. Always seek further advice from the Consultant.

5.0 CONDITIONS THAT ARE CONDUCTIVE TO TIMBER PESTS

5.1 Water leaks: At the time of the inspection no leaks were found to be present.

Water leaks, especially in or into the subfloor, or against the external walls; increase the likelihood of termite attack. Leaking showers or leaks from other 'wet areas' also increase the likelihood of concealed termite attack. Hot water overflows should be plumbed away from the building.

NB. We claim no expertise in building, and if any leaks were reported, you should consult a plumber or other building expert to determine the full extent of damage, and the estimated cost of repairs.

5.2 Moisture/drainage: Not applicable as the home is built on a concrete slab.

Lack of Adequate Subfloor Ventilation Inadequate ventilation provides a condition suitable for timber pest infestation. For example, subterranean termites thrive in damp humid conditions typical of those provided in a poorly ventilated subfloor space. Where evidence of a lack of adequate ventilation has been identified in the report, the Client should seek competent advice (e.g., from a licensed or registered building contractor) regarding upgrading ventilation. The Presence of Excessive Moisture Ground levels around the building should be maintained in such a way to minimise water entering under the building. Also, the ground surface in subfloor areas should be kept graded to ensure that moisture does not pond or accumulate in any area. Where necessary, sub-surface drains should be installed and maintained to assist with drainage around and under the building. Likewise, the presence of excessive moisture can often be directly related to ventilation limitations and the resultant high humidity. Also, plumbing oversights and defects such as a leaking drain or tap will provide a microclimate conducive to timber pest attack. Where necessary, the Client should seek competent advice (e.g., from a licensed or registered plumbing contractor) to determine the adequacy of existing drainage and remove any conditions conducive to the presence of excessive moisture. The building may need to be monitored over a period of time to detect or confirm a damp problem. The presence of dampness (including moisture) is not always consistent as the prevailing and recent weather conditions at the time an inspection is carried out may affect the detection of damp problems. Importantly, precipitation at or near the time of inspection does not necessarily guarantee that a damp problem will automatically be evident due to such circumstances as prevailing wind conditions or intensity of rainfall. The absence of any dampness at the time of inspection does not necessarily mean the building will not experience some damp problems in other weather conditions. Likewise, whether services have been used for some time prior to an inspection being carried out will affect the detection of dampness.

5.3 Ventilation: Not applicable as the home is built on a concrete slab.

Lack of Adequate Subfloor Ventilation Inadequate ventilation provides a condition suitable for timber pest infestation. For example, subterranean termites thrive in damp humid conditions typical of those provided in a poorly ventilated subfloor space. Where evidence of a lack of adequate ventilation has been identified in the report, the Client should seek competent advice (e.g., from a licensed or registered building contractor) in regard to upgrading ventilation.

5.4 Hot water services and air conditioning units: There is no need for this work to be carried out.

Hot water services and air conditioning units which release water alongside or near to building walls should be piped to a drain (if not possible then several metres away from the building), as the resulting wet area is highly conducive to termites.

5.5 Slab edge exposure: The slab edge inspection zone does not apply to this property.

Where external concrete slab edges are not exposed, there is a high risk of concealed termite entry.

In some buildings built since July 1995, the edge of the slab forms part of the termite shield system. In these buildings an Inspection zone of at least 75mm should be maintained to permit detection of termite entry. The edge should not be concealed by render, tiles, cladding, flashings, adjoining structures, paving, soil, turf, or landscaping etc. Where this is the case, you should arrange to have the slab edge exposed for Inspection.

Concealed termite entry may already be taking place but could not be detected at the time of the Inspection. This may have resulted in concealed timber damage.

NB. A very high proportion of termite attacks are over the slab edge. Covering the slab edge makes concealed entry easy. This is particularly true of infill type slab construction. Termite activity and/or damage may be present in concealed timbers of the building. We strongly recommend frequent regular inspections in accordance with AS 3660.2.

5.6 Weep holes in external walls: Weep holes were clear allowing the free flow of air.

It is very important that soil, lawn, concrete paths, or pavers do not cover the weep holes. Sometimes, they have been covered during the rendering of the brick work. They should be clean and free flowing and covering the weep holes in part or in whole may allow undetected termite entry.

5.7 Termite shields: Not applicable as the home is built on a concrete slab.

Termite Shields (Ant Caps) should be in good order and condition, so termite workings are exposed and visible. This helps prevent termites from gaining undetected entry. Joints in the shielding should have been soldered during the installation. If it is observed that the joints in the shielding have not been soldered, then the shielding must be reported as inadequate. It may be possible for a builder to repair the shielding. If not, a chemical treated zone may need to be installed to deter termites from gaining concealed access to the building. Missing, damaged or poor shields increase the risk of termite infestation. If considered inadequate, a builder or other building expert should be consulted.

Other physical shield systems are not visible to inspection and no comment is made on such systems.

5.8 Bridging or breaching of termite barriers and inspection zones: No bridging or breaching was found.

“Bridging” is the spanning of a termite barrier or inspection zone so that subterranean termites are provided with passage over or around that barrier. “Breaching” is the making of a hole or gap in a termite barrier so that termites are provided with a passage through that barrier.

5.9 Other area(s) and/or situations that appear conducive to (may attract) subterranean termite infestation: Medium to large trees and stumps within a 50 metre radius of the property, due to the nesting conditions.

6.0 OVERALL ASSESSMENT OF THE PROPERTY

6.1 Where evidence of live termites, termite damage or termite workings (mudding) was found in the building(s) then the risk of a further attack is extremely high.

Where evidence of live termites, termite damage or termite workings was found in the grounds but not in the building(s) then the risk to buildings must be reported as high to extremely high.

6.2 At the time of the Inspection, the degree of risk of subterranean termite infestation to the overall property was considered to be **Moderate**.

6.3 Subterranean Termite Treatment Recommendation: A management program in accordance with AS 3660-2000 to protect against subterranean termites is considered **not essential, but 6 to 12 monthly inspections are essential**.

6.4 Future Inspections: AS 3660.0-2000 recommends “regular competent Inspections should be carried out at least on an annual basis, but more frequent Inspections are strongly recommended”.

It goes on to inform that “regular Inspections will not prevent termite attack but may help in the detection of termite activity. Early detection will allow remedial treatment to be commenced sooner, and damage to be minimized”.

Due to the degree of risk of subterranean termite infestation noted above and all other findings of this Report; we strongly recommend that a full Inspection and written Report in accordance with AS 4349.3 or AS 3660.2-2000 is conducted at this property every 6 months, but no more than 12 months.

DEFINITIONS

Timber Pest Attack: Means Timber Pest Activity and/or Timber Pest Damage.

Timber Pest Activity: Means telltale signs associated with 'active' (live) and/or 'inactive' (absence of live) Timber Pests at the time of inspection.

Timber Pest Damage: Means noticeable impairments to the integrity of timber and other susceptible materials resulting from attack by Timber Pests.

Major Safety Hazard: Means any item that may constitute an immediate or imminent risk to life, health or property resulting directly from Timber Pest Attack. Occupational, health and safety or any other consequence of these hazards has not been assessed.

Conditions Conducive to Timber Pest Attack: Means noticeable building deficiencies or environmental factors that may contribute to the presence of Timber Pests.

Readily Accessible Areas: Means areas which can be easily and safely inspected without injury to person or property, are up to 3.6 metres above ground or floor levels, in roof spaces where the minimum area of accessibility is not less than 600 mm high by 600 mm wide and subfloor spaces where the minimum area of accessibility is not less than 400 mm high by 600 mm wide, providing the spaces or areas permit entry. The term 'readily accessible' also includes accessible subfloor areas on a sloping site where the minimum clearance is not less than 150 mm high, provided that the area is not more than 2 metres from a point with conforming clearance (i.e., 400 mm high by 600 mm wide); and areas at the eaves of accessible roof spaces that are within the consultant's unobstructed line of sight and within arm's length from a point with conforming clearance (i.e. 600 mm high by 600 mm wide).

Client: Means the person or persons for whom the Timber Pest Detection Report was carried out or their Principal (i.e., the person or persons for whom the report was being obtained).

Timber Pest Detection Consultant: Means a person who meets the minimum skills requirement set out in the current Australian Standard AS 4349.3 Inspections of Buildings. Part 3: Timber Pest Inspection Reports or state/territory legislation requirements beyond this Standard, where applicable.

Building and Site: Means the main building (or main buildings in the case of a building complex) and all timber structures (such as outbuildings, landscaping, retaining walls, fences, bridges, trees, and stumps with a diameter greater than 100 mm and timber embedded in soil) and the land within the property boundaries up to a distance of 50 metres from the main building(s).

Timber Pests: Means one or more of the following woods destroying agents which attack timber in service and affect its structural properties:

Chemical Delignification: The breakdown of timber through chemical action.

Fungal Decay: The microbiological degradation of timber caused by soft rot fungi and decay fungi, but does not include Mould, which is a type of fungus that does not structurally damage wood.

Wood Borers: Wood destroying insects belonging to the order 'Coleoptera' which commonly attack seasoned timber.

Termites: Wood destroying insects belonging to the order 'Isoptera' which commonly attack seasoned timber.

Tests: Means additional attention to the visual examination was given to those accessible areas which the consultant's experience has shown to be particularly susceptible to attack by Timber Pests. Instrument testing of those areas and other visible accessible timbers/materials/areas showing evidence of attack was performed.

Instrument Testing: Means where appropriate the carrying out of Tests using the following techniques and instruments:

- (a) Electronic moisture detecting meter - an instrument used for assessing the moisture content of building elements.
- (b) Stethoscope - an instrument used to hear sounds made by termites within building elements.
- (c) Probing - a technique where timber and other materials/areas are penetrated with a sharp instrument (e.g., bradawl or pocket knife), but does not include probing of decorative timbers or finishes, or the drilling of timber and trees; and
- (d) Sounding - a technique where timber is tapped with a solid object.

IMPORTANT MAINTENANCE ADVICE REGARDING INTEGRATED PEST MANAGEMENT FOR PROTECTING AGAINST TIMBER PESTS

You should read and understand the following important information. It will help explain what is involved in a Timber Pest Inspection, the difficulties faced by a Timber Pest Inspector, and why it is not possible to guarantee that a property is free of Timber Pests. It also details important information about what you can do to help protect your property from Timber Pests. This information forms an integral part of the Report. Any structure can be attacked by Timber Pests. Periodic maintenance should include measures to minimise possibilities of infestation in and around a property. Factors which may lead to infestation from Timber Pests include situations where the edge of the concrete slab is covered by soil or garden debris, filled areas, areas with less than 400mm clearance, foam insulation at foundations, earth/wood contact, damp areas, leaking pipes, etc.; form-work timbers, scrap timber, tree stumps, mulch, tree branches touching the structure, wood rot, etc. Gardens, pathways, or turf abutting or concealing the edge of a concrete slab will allow for concealed entry by timber pests any timber in contact with soil such as form-work, scrap timbers or stumps must be removed from under and around the buildings and any leaks repaired. You should endeavor to ensure such conditions DO NOT occur around your property. We further advise that you engage a professional pest control firm to provide a termite management program in accord with AS 3660 to minimise the risk of termite attack. There is no way of preventing termite attack. Even AS 3660 advises that "the provision of a complete termite barrier will impede and discourage termite entry into a building. It cannot prevent termite attack. Termites can still bridge or breach barriers, but they can be detected more readily during routine inspections."

Reasonable access:

Unless specified in writing, the inspection only covered the Readily Accessible Areas of the Building and Site.

The inspection did not include areas which were inaccessible, not readily accessible or obstructed at the time of inspection. Areas which are not normally accessible were not inspected and include - but not limited to – inside walls, the interior of a flat roof or beneath a suspended floor filled with earth.

Building Interior, the Consultant did not move or remove any ceilings, wall coverings, flooring, floor coverings (including carpeting), furnishing, equipment, appliances, pictures, or other household goods. In an occupied property, furnishings or household items may be concealing evidence of timber pest attack which may only be revealed when the items are moved or removed.

Building Exterior, Roof Exterior and Site, the Consultant did not move or remove any obstructions such as wall cladding, awnings, trellis, earth, plants, bushes, foliage, stored materials, debris, or rubbish. Due to the 'secretive' nature of timber pests, it is possible that hidden damage may exist in concealed areas, e.g., wall framing. Damage may only be found when the obstruction is removed. In the case of buildings constructed on concrete slabs, if the edge of the slab or any weep hole or vent at the base of external walls is concealed by pavements, gardens, lawns, or landscaping then it is possible for termites to gain undetected entry into the building. The building of gardens or planting of shrubs close to the perimeter of the building can promote and conceal termite entry points. The storage of cellulose materials such as building materials and firewood near the ground or building may encourage termite activity.

Roof Space Obstructions such as roofing, stored articles, thermal insulation, sarking, and pipe/duct work may be concealing evidence of timber pest attack which may only be revealed when the obstructions are moved or removed. Also, bodily access should be provided to the interior of all accessible roof spaces. In accordance with Australian Standard ASS 4349 the minimum requirement is a 400mm by 500 mm access manhole.

Subfloor Space Subfloor areas should be kept free from all vegetation (including tree stumps) and other cellulose material which may encourage timber pest activity. Also, storage of materials in subfloor areas is not recommended as it reduces ventilation and makes inspection difficult. Obstructions may be concealing evidence of timber pest attack which may only be revealed when the obstructions are moved or removed. Bodily access should be provided to all accessible subfloor areas with the minimum requirement being a 500 mm x 400 mm access manhole. In the case of suspended floors, if the clearance between the ground and structural components is less than 400 mm, then the ground should be excavated to provide the required clearance, subject to maintaining adequate drainage and support to footings. If the subfloor has been sprayed for subterranean termites or if the area is susceptible to mould growth, appropriate health precautions must be followed before entering the area. Also, special care should be taken not to disturb the treated soil. Always seek further advice from the Consultant.

A further inspection is strongly recommended of those areas that were not readily accessible and of inaccessible or obstructed areas once access has been provided or the obstruction removed. This will involve a separate visit to the site, permission from the owner of the property and additional cost.

Unless stated otherwise, any recommendation or advice given in this Report should be implemented as a matter of urgency.

A more invasive physical inspection is available and recommended:

As detailed above, there are many limitations to this visual inspection only. With the permission of the owner of the premises we WILL perform a more invasive physical inspection that involves moving or lifting insulation, stored items, furniture, or foliage during the inspection. We WILL physically touch, tap, test and when necessary, force/gouge suspected accessible timbers. We WILL gain access to areas, where physically possible and considered practical and necessary, by way of cutting traps and access holes.

This style of Report is available by ordering with several days' notice. Inspection time for this style of Report will be greater than for a VISUAL INSPECTION.

It involves disruption in the case of an occupied property, and some permanent marking is likely. You must arrange for the written permission of the owner who must acknowledge all the above information and confirm that our firm will not be held liable for any damage caused to the property.

A price is available on request.

Concrete slab homes:

Homes constructed on concrete slabs pose special problems with respect to termite attack. If the edge of the slab is concealed by concrete paths, patios, pavers, garden beds, lawns, foliage, etc. then it is possible for termites to affect concealed entry into the property, and they can then cause extensive damage to concealed framing timbers. Even the most experienced Inspector may be unable to detect their presence due to concealment by wall linings. Only when the termites attack timbers in the roof void, which may in turn be concealed by insulation, can their presence be detected. Where termite damage is in the roof, it should be expected that concealed framing timbers will be extensively damaged. With a concrete slab home, it is imperative that you expose the edge of the slab and ensure that foliage and garden beds do not cover the slab edge. Weep holes must be kept free of obstructions.

It is strongly recommended that you have a Termite Inspection in accordance with AS 3660.2 carried out every 6 to 12 months.

Subterranean termites:

No property is safe from termites. General Description of Attack Timber hollowed beneath; some cracking at the surface of timber; earthen channels present; or pale faecal spots present.

Important note:

As a delay may exist between the time of an attack and the appearance of telltale signs associated with the attack, it is possible that termite activity and damage exists though not discernible at the time of inspection.

Treatment After discovery of an active infestation, it is imperative that the species of termite is accurately identified before costly (and sometimes unnecessary or inappropriate) methods of treatment are initiated. Only economically important species which are known to attack timber structures should be treated.

In the case of economically important species, it is important that the termite workings are not further disturbed until the proposed method of control has been determined by a licensed pest control operator. Premature attempts to repair or replace infested timber may cause the termites to withdraw from the area temporarily, thereby hindering effective treatment. Any repair or replacement of infested timber should be carried out after the appropriate treatment has been completed.

Where evidence of active termites is detected within a building or within 50 metres of any building, it must always be assumed that the termites may also be active in areas of the property not inspected. Accordingly, where the termites are known to be of economic significance, a further (more invasive) inspection is strongly recommended of areas which were inaccessible, not readily accessible or obstructed at the time of inspection.

Termite Workings and Damage Where evidence of damage to building timbers exists, competent advice (e.g. from a licensed or registered building contractor) should be obtained to determine the extent of any structural damage and as to the need or otherwise for rectification or repair work.

Where evidence of inactive termites is located within the building, it is possible that termites are still active in areas of the property not inspected and they may continue to cause damage. A furthermore invasive inspection is strongly recommended of areas which were inaccessible, not readily accessible or obstructed at the time of inspection.

Where evidence of an inactive termite infestation exists, it is not possible, without benefit of further investigation and inspections over a period, to ascertain whether any infestation is active or inactive. Continued, regular, inspections are essential.

Where evidence of termite attack exists to any trees or tree stumps a more conclusive search should be undertaken. This may require the tree or stump to be drilled to determine the existence of a termite nest. In addition, the soundness and stability of any standing trees identified as being affected by termite attack should be confirmed. Always seek further advice from the Consultant.

Previous Treatments Where evidence of a possible termite treatment was located, the Client should obtain and keep on file all relevant documents pertaining to the extent of the treatment, any service warranties and advice in regard to the building owner's obligation to maintain the treatment and/or barrier. If evidence of a previous treatment of termite infestation is noted, and appropriate documentation is not available, the Client must assume that the termite infestation may still be active in areas of the property not inspected. Accordingly, a re-treatment may be required. Always seek further advice from the Consultant.

Frequency of Future Inspections Australian Standard AS 3660 recognises that regular inspections will not prevent termite attack but may help in the detection of termite activity. Early detection will allow remedial treatment to be commenced sooner and damage to be minimised.

Inspections at intervals not exceeding twelve (12) months are recommended. Where the termite risk is high or the building type susceptible to termite attack, more frequent inspections (3-6 months) should be undertaken.

Risk management options:

To help protect against financial loss, it is essential that the building owner immediately control or rectify any evidence of destructive timber pest activity or damage identified in this inspection report. The Client should further investigate any high-risk area where access was not gained. It is strongly advised that appropriate steps be taken to remove, rectify or monitor any evidence of conditions conducive to timber pest attack.

To help minimise the risk of any future loss, the Client should consider whether the following options to further protect their investment against timber pest infestation are appropriate for their circumstances:

Undertake thorough regular inspections at intervals not exceeding twelve months or more frequent inspections where the risk of timber pest attack is high, or the building type is susceptible to attack. To further reduce the risk of subterranean termite attacks, implement a management program in accordance with Australian Standard AS 3660. This may include the installation of a monitoring and/or baiting system, or chemical and/or physical barrier. However, AS 3660 stresses that subterranean termites can bridge, or breach barrier systems and inspection zones and that thorough regular inspection of the building are necessary.

CONTACT THE INSPECTOR

Please feel free to contact the Inspector who carried out this inspection. Often it is very difficult to fully explain situations, problems, access difficulties or timber pest activity and/or damage in a manner that is readily understandable by the reader. Should you have any difficulty in understanding anything contained within this Report, then you should immediately contact the Inspector and have the matter explained to you.

If you have any questions at all or require any clarification, then contact the Inspector prior to acting on this Report.

NOTICE TO THE PURCHASER

(a) Prior to or on Exchange, and prior to the commencement of the 'Cooling-off Period', you were given an Inspection Report on the Property you intend on purchasing ("the Report"). The Purchaser is advised that this Report reflects the condition of the property existing at the time of the Inspection (Inspection Date) and may not reflect the current state. Timber Pests, particularly Termites, may have gained entry to the property since the Inspection Date. Termites can, in a relatively short period, cause significant damage to both structural and non-structural timbers within and around the buildings of the Property.

Termites (white ants) may be difficult to detect and much of the damage caused may not be readily visible. If damage exists, then it may cost thousands of dollars to repair.

It is, therefore, very strongly recommended that you urgently arrange for another Inspection and Report in accordance with AS4349.3 to be carried out prior to exchange, or prior to the expiration of any 'Cooling off Period', and prior to settlement.

(b) If the Report indicated the presence of Termites, termite damage or recommends any treatments or other Inspections and Reports, you should obtain copies of the treatment proposal, any certificates of treatments carried out, details of all repairs including copies of quotations, invoices, and any other Reports.

It is strongly recommended that you arrange for an Inspection and Report in accordance with AS 4349.3 to verify that the treatment has been successful and carried out in accordance with AS 3660.2 and a further building Inspection in accordance with AS 4349.1.

(c) If you fail to procure a further Inspection and report as recommended in (a) and (b), or fail to obtain copies of the treatment proposal, certificates of treatment carried out, details of all repairs including copies of quotations, invoices and any other reports as recommended in (b) above, then it will be deemed that you have decided not to have a further Inspection and report carried out, or to obtain copies of certificates of treatments carried out, details of all repairs including copies of quotations, invoices and any other reports.

It will be deemed that you have relied upon your own enquiries and the report, knowing the possible consequences and that the condition of the property, as stated in the report, may have changed.

(d) The person carrying out the Inspection and the company, partnership or sole trader that employs that person will have no liability to you for any damage or loss you may suffer as a result of your entering the contract to purchase the property or in connection with completing the purchase of the property as a result of your failure to heed the advice given in (a) and (b) and the warning contained in (c) above, and may use such failure in defense of any claim that you may later make against any of them.

Compliance Report



COMPLIANCE REPORT

This is a Compliance Report regarding any unapproved structures or alterations. ACT Property Inspections have accessed the attached Building File from ACT Planning and Land Authority (ACTPLA) and hold no responsibility for any inaccuracies in the Building File supplied by ACTPLA. The Compliance report is based solely upon the information available from the Building File which does not contain information regarding Plumbing or Electrical work that has taken place since the original construction. Information regarding the Plumbing and Electrical is available upon application from ACTPLA. Since we are not Plumbers or Electricians, we are unable to comment on those works. If structures have been noted as requiring approval, a Certifier should be engaged to assess if the structure will comply with the relevant ACT legislation. Owners must be aware that unapproved structures may not comply and may require significant repair, design change or possible removal.

Property Address: 23A Parker St, Curtin ACT 2605
Unit, Block & Section: Unit 1 Block 21 Section 16 CURTIN
Inspection Date: Friday, September 26th 2025

APPROVAL STATUS

Description	Plan number	Certificate of occupancy date	Approval status
Demolition of Residence Asbestos Removal New Standard Dual Occupancy Residence, Garage, Alfresco, Porch, Retaining Wall, Water Tank – Unit 1	B20202843/A+/B/C 17/01/2023	17/01/2023	Approved.
New Swimming Pool, Pool Safety Barrier & Associated Deck	B20215484/A+/B	23/02/2023	Approved.

Note: As a Pool/Spa has been installed it will require one of the following: Exemption Certificate, Compliance Certificate, Swimming Pool Disclosure Statement or Certificate of Occupancy for the pool/spa and safety barrier that is not older than 5 years.

SURVEY REPORT

Survey Report completed by	Date Survey report was completed	Comments
Steger & Associates	Tuesday, 8 November 2022	There are no apparent encroachments upon this land or by this property on adjoining lands or street.

Conveyancing File



CONVEYANCING BUILDING FILE INDEX

SUBURB: **CURTIN** SECTION: **16** BLOCK: **21** UNIT: **1** EX GOV: **NO**

COU ISSUED Y/N	PLAN NUMBER	FOLIO NO.	DESCRIPTION OF WORK	AMEND	DETAILS	PERMIT NUMBER	COU PLAN NO. & DATE
Y	B20202843/A	-	DEMOLITION OF RESIDENCE ASBESTOS REMOVAL NEW STANDARD DUAL OCCUPANCY, GARAGE, ALFRESCO, PORCH, RETAINING WALL, WATER TANK – UNIT 1			B20202843/A	
Y	B20202843/B	-		Y			
Y	B20202843/C	-		Y			
		-	(DEMOLITION)				B20202843/A+/B/C 17/01/2023
		-	(ASBESTOS)				B20202843/A+/B/C 17/01/2023
		-	(RESIDENCE)				B20202843/A+/B/C 17/01/2023
Y	B20215484/A	-	NEW SWIMMING POOL, POOL SAFETY BARRIER & ASSOCIATED DECK			B20215484/A	
Y	B20215484/B	-		Y			
		-					B20215484/A+/B 23/02/2023

For any incomplete approvals please email acbuildingconveyance@act.gov.au for further information on how to complete.

Drainage Plan Number: 15878

Survey: Y (1)

Comments:

CONVEYANCING PART 2

No information is provided in respect of electrical, drainage or sewer matters and or to the location of overhead power lines or underground cables in relation to the building.

	<u>Yes</u>	<u>No</u>
1. (a) Is this a government or ex government house?	<input type="checkbox"/>	<input checked="" type="checkbox"/>
(b) If yes, is there a building file with approvals on it?	<input type="checkbox"/>	<input type="checkbox"/>
2. Is there any record of incomplete building work on the building file? If yes - file copies attached	<input type="checkbox"/>	<input checked="" type="checkbox"/>
3. Are there any records on the building file of current (within 5 years) housing Indemnity insurance policies for building work? If yes - file copies attached	<input type="checkbox"/>	<input checked="" type="checkbox"/>
4. Are there any records on the building file showing building applications still being processed? (Current within 3 years) If yes - file copies attached	<input type="checkbox"/>	<input checked="" type="checkbox"/>
5. Are there any records on the building file in relation to loose-fill asbestos insulation?	<input type="checkbox"/>	<input checked="" type="checkbox"/>
If available, copies of the following documents are provided:		
• Certificate/s of Occupancy and Use	<input checked="" type="checkbox"/>	<input type="checkbox"/>
• Survey Certificates	<input checked="" type="checkbox"/>	<input type="checkbox"/>
• Unit Plan/Unit Entitlements (if property is unit titled)	<input checked="" type="checkbox"/>	<input type="checkbox"/>
• Approved Building Plans	<input checked="" type="checkbox"/>	<input type="checkbox"/>
• Ex- government Building Plans*	<input type="checkbox"/>	<input checked="" type="checkbox"/>
If requested:		
• Drainage Plan(s)	<input checked="" type="checkbox"/>	<input type="checkbox"/>

ASBESTOS

The ACT Government is not able to guarantee the accuracy of the information in this report.

You should make your own enquiries and obtain reports (from a licensed Asbestos Assessor) in relation to the presence of loose fill asbestos insulation (and other forms of asbestos) on the premises. For more information go to the Asbestos Awareness Website –

www.asbestos.act.gov.au

Please note: Development Approval plans will not be included in this report (We do not receive Development Approval Plans unless they are part of a Building Approval in which case they become Building Approval Plans), if development approval was granted you can request copies of the Development Approval plans from ACEPDcustomerservices@act.gov.au.

Please Note: Building approvals that have been generated via eDevelopment will be issued with a project number prefixed by the letter B. Initial building approval documentation will be identified with project number B20XXXX only but will be referenced as B20XXXX/A on the Certificate of Occupancy and Use. Any amendments to the original approval will be issued with the project number and an alphanumeric digit. The first amendment will be identified as B20XXXX/B, the second amendment B20XXXX/C etc. Not all eDevelopment plans will be stamped with the plan number.

*Ex Government plans: Plans are typical and not specific to each residence. There may be slight changes to the layout or window locations that were not required to be approved.

Search officer comments (if any?)

Search officer initials: Ashleigh

Cost of application: \$ 144.79


Date completed:

26/09/2025

SITE PLAN

LAND DETAILS

Block	21
Section	16
Division	CURTIN
Deposited Plan Number	2102
Volume/Folio	3016: 54
Class of Units (A or B)	B

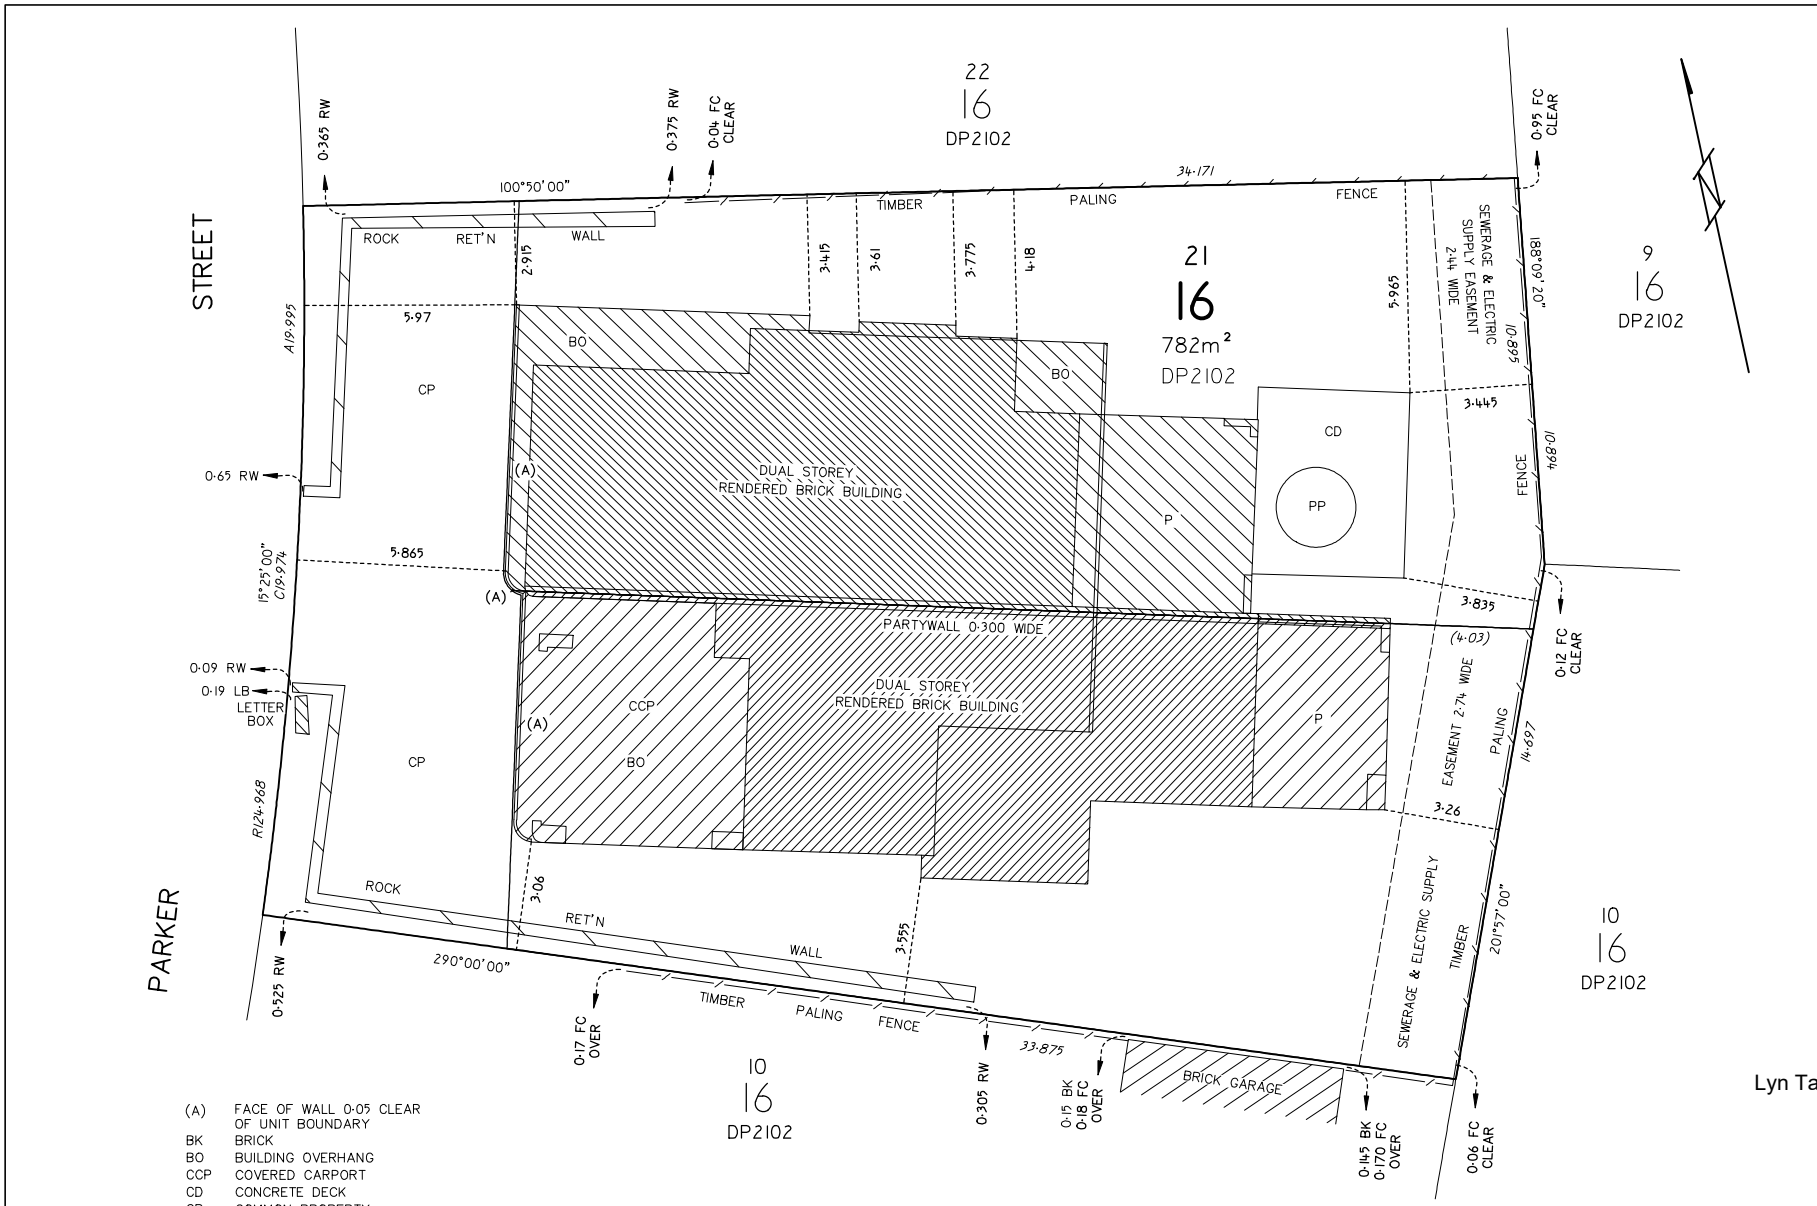

- (A) FACE OF WALL 0.05 CLEAR OF UNIT BOUNDARY
- BK BRICK
- BO BUILDING OVERHANG
- CCP COVERED CARPORT
- CD CONCRETE DECK
- CP COMMON PROPERTY
- FC FENCE
- P COVERED PORCH
- PP PLUNG POOL
- RW ROCK RETAINING WALL

Form 1
Form 088 - SP
Graphic bar scale - 1:100

Units and Subsidiaries are subject to the provisions of Section 34 of the Unit Titles Act 2001, where applicable.

SURVEYORS DECLARATION
I, Jason Peter Steger of Steger & Associates Registered Land Surveyors
A surveyor registered under the Surveyors Act 2007, hereby certify that:
1. The survey represented by the diagrams on forms 1 and 3 of this plan are accurate and was completed on 08/06/2022.
2. The survey is in accordance with the following Acts:
• Unit Titles Act 2001;
• Land Titles (Unit Titles) Act 1970;
• Land Titles Act 1925; and
• any other Regulation made under those Acts and in accordance with the Surveyors Practice Directions.

Signature of Registered Surveyor
06/02/2023
Dated

CROSS OUT EITHER OF ITEM 3 OR 3(a)-3(c), WHICHEVER DOES NOT APPLY — 3(a)(c) CANNOT APPLY IF AN ENCROACHMENT OCCURS OVER A ROAD OR PUBLIC PLACE UNLESS THE ENCROACHMENT IS AN ATTACHMENT AS DEFINED BY THE UNIT TITLES ACT 2001.
3. Each building (including anything attached to it) or building in the course of erection on the parcel is wholly within the parcel.
OR
a) All units and unit subsidiaries shown in the diagrams are wholly within the parcel;
b) The diagram clearly indicates the existence, nature and extent of any encroachment by a building (including anything attached to it), beyond the boundaries of the parcel; and
c) The diagrams clearly indicate the existence, nature and extent of any easement granted and registered, or to be granted and registered upon registration of this proposed plan, pertaining to the parcel.
Unit 4, 21 Napier Close Deakin ACT 2600
Address for Service of Notice
Signature Strata
Name of Manager / Owners Corporation

Signature of Lessee

Lyn Tankey 2nd March 2023
Delegate of the ACT Planning and Land Authority

APPROVED UNDER THE UNIT TITLES ACT 2001, AS THE UNITS PLAN FOR THE SUBDIVISION OF THE ABOVE MENTIONED PARCEL OF LAND

Deposited in the office of the Registrar of Titles at Canberra in the Australian Capital Territory at 3:33 pm, 13/04/2023
Approved David Pryce Registrar-General

UNITS PLAN No. 15791



Identification Report

Anthony Bailey
Parliament Constructions
PO Box 127
FYSHWICK ACT 2609

Dear Anthony,

Land in the Division of CURTIN, District of WODEN VALLEY, being BLOCK 21 within SECTION 16 as shown on DEPOSITED PLAN 2102 in the Australian Capital Territory containing an AREA OF 774m² and being the land shown edged red on the sketch.

.....

As instructed by you, we have surveyed the boundaries of the land described above located at No.23 Parker Street and have investigated a newly constructed multi storey class B units development located at the property as shown within the accompanying sketch as hatched and have made the following determination;

- A newly constructed, two storey units development sit wholly within the subject land and clear of existing drainage & electrical easement. Floor levels and perpendicular offsets to adjacent boundaries have been shown on the accompanying sketch.
- Building parapets, as constructed, have been identified at the front and rear of the building with location and Top-of-Parapet reduced levels shown on the accompanying sketch.
- A new timber paling fence has been constructed along the side and rear boundaries with offsets to boundary as shown on the accompanying sketch
- Two newly constructed, rock retaining walls sits at the font and runs alongside of the property is wholly within the subject block with perpendicular offsets to adjacent boundaries shown on the accompanying sketch.

The dimensions and perpendicular offsets of shown improvements, being adjacent to nearest boundary as shown in red, are expressed in metre units with cadastral boundary determination using title diagram DP2102.

This survey only relates to the above-mentioned features.

Yours faithfully,

Jason Steger
Registered Surveyor under the ACT Surveyors Act 2007

NB. A copy of this report has been sent to the Surveyor-General of the ACT




Section: 16
Division: CURTIN
District: WODEN VALLEY
Plan: DP2102

SKETCH
SCALE 1:250

10

9

SEWERAGE & ELECTRIC
SUPPLY EASEMENT
2.74 WIDE

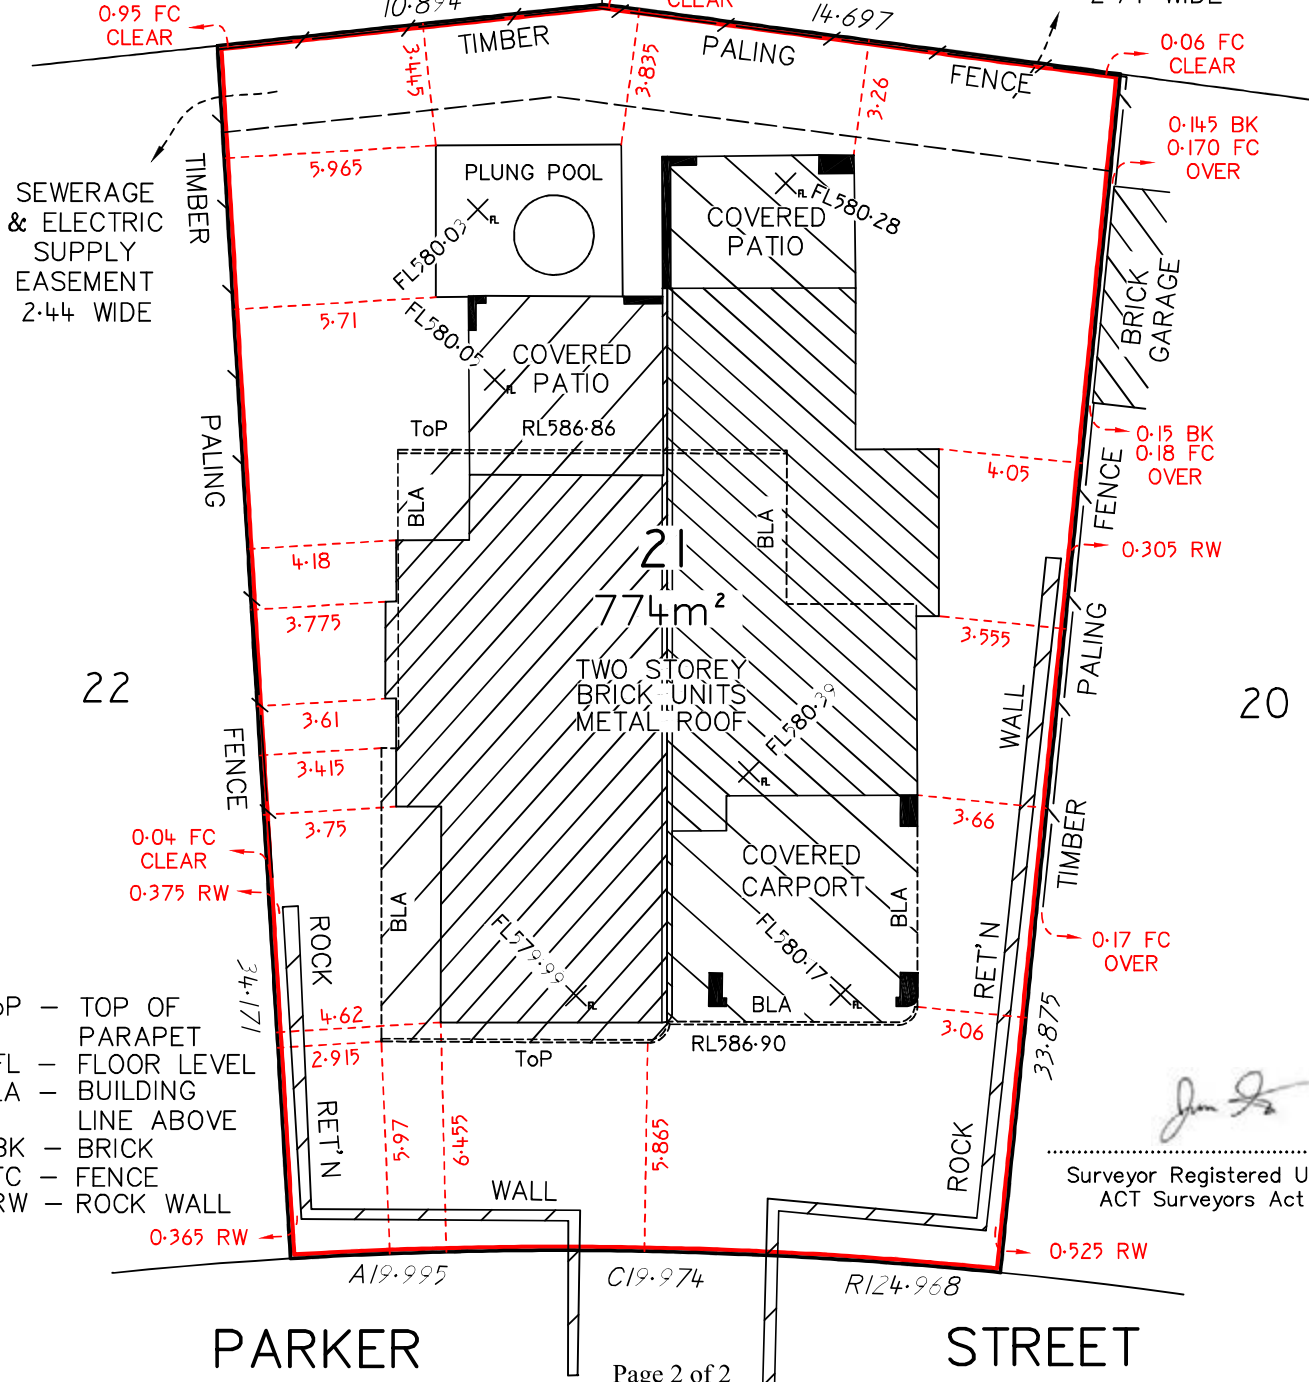

- ToP - TOP OF PARAPET
- FL - FLOOR LEVEL
- BLA - BUILDING LINE ABOVE
- BK - BRICK
- FC - FENCE
- RW - ROCK WALL

Jim Steger
 Surveyor Registered Under the
 ACT Surveyors Act 2007

PARKER

STREET



Certificate of Completion of Demolition

Certificate No.: **B20202843C1**

**Access Canberra Land, Planning and
Building Services**

ABN 16 479 763 216
8 Darling Street Mitchell
GPO Box 158 ACT 2601
www.act.gov.au/accesscbr

This Certificate is issued in accordance with Section 71 (2) of the Building Act 2004.

The demolition of the building works listed on this certificate has been completed in accordance with the prescribed requirements.

Unit	Block	Section	Division (Suburb)	District	Jurisdiction
	21	16	CURTIN	WODEN VALLEY	Australian Capital Territory

Plans
B20202843/A
B20202843/B
B20202843/C

Building Works

Class of Occupancy	Nature of Work	Project Item Description	Other Description	Type Of Const.	Unit	BCN ID	Builder
1a(l)	Demolition	RESIDENCE	demolition of existing residence	NA		B20202843N2	ANDREW JOHN IRWIN

Comments

Important Note:

The issue, under this Part, of a certificate in respect of a building or portion of a building does not affect the liability of a person to comply with the provisions of a law of the territory (including this Act) relating to the building or portion of the building.

Issued by: Shama Gunaratne
Delegate of the ACT Construction
Occupations Registrar.

Issued on: 17/01/2023



Certificate of Completion of Demolition

Certificate No.: **B20202843C3**

**Access Canberra Land, Planning and
Building Services**

ABN 16 479 763 216
8 Darling Street Mitchell
GPO Box 158 ACT 2601
www.act.gov.au/accesscbr

This Certificate is issued in accordance with Section 71 (2) of the Building Act 2004.

The demolition of the building works listed on this certificate has been completed in accordance with the prescribed requirements.

Unit	Block	Section	Division (Suburb)	District	Jurisdiction
	21	16	CURTIN	WODEN VALLEY	Australian Capital Territory

Plans
B20202843/A
B20202843/B
B20202843/C

Building Works

Class of Occupancy	Nature of Work	Project Item Description	Other Description	Type Of Const.	Unit	BCN ID	Builder
1a(l)	Other	SEE DESCRIPTION	Asbestos removal - FRIABLE - JESCO ASBESTOS REMOVAL PTY LTD	NA		B20202843N1	ASBESTOS REMOVALIST

Comments

Important Note:

The issue, under this Part, of a certificate in respect of a building or portion of a building does not affect the liability of a person to comply with the provisions of a law of the territory (including this Act) relating to the building or portion of the building.

Issued by: Shama Gunaratne

Issued on: 17/01/2023

Delegate of the ACT Construction
Occupations Registrar.



Certificate of Occupancy and Use

Certificate No.: **B20202843C2**

Access Canberra Land, Planning and Building Services

ABN 16 479 763 216
8 Darling Street Mitchell
GPO Box 158 ACT 2601
www.act.gov.au/accesscbr

This Certificate is issued in accordance with Section 69 (2) of the Building Act 2004.

The building work listed on this certificate has been completed substantially in accordance with the prescribed requirements and is considered fit for occupation and use.

Unit	Block	Section	Division (Suburb)	District	Jurisdiction
	21	16	CURTIN	WODEN VALLEY	Australian Capital Territory

Plans
B20202843/A
B20202843/B
B20202843/C

Building Works

Class of Occupancy	Nature of Work	Project Item Description	Other Description	Type Of Const.	Unit	BCN ID	Builder
1a(II)	New Standard	DUAL OCCUPANCY	Residence Unit 1	NA	1	B20202843N3	PARLIAMENT CONSTRUCTIONS PTY LTD
1a(II)	New Standard	DUAL OCCUPANCY	Residence Unit 2	NA	2	B20202843N3	PARLIAMENT CONSTRUCTIONS PTY LTD
10a	New	GARAGE	Garage Unit 1	NA	1	B20202843N3	PARLIAMENT CONSTRUCTIONS PTY LTD
10a	New	CARPORT	Carport Unit 2	NA	2	B20202843N3	PARLIAMENT CONSTRUCTIONS PTY LTD
10a	Other	SEE DESCRIPTION	Alfresco - Unit 1	NA	1	B20202843N3	PARLIAMENT CONSTRUCTIONS PTY LTD
10a	Other	SEE DESCRIPTION	Alfresco - Unit 2	NA	2	B20202843N3	PARLIAMENT CONSTRUCTIONS PTY LTD
10a	Other	SEE DESCRIPTION	Porch - Unit 1	NA	1	B20202843N3	PARLIAMENT CONSTRUCTIONS PTY LTD
10a	Other	SEE DESCRIPTION	Porch - Unit 2	NA	2	B20202843N3	PARLIAMENT CONSTRUCTIONS PTY LTD
10b	New	WALL	Retaining wall	NA		B20202843N3	PARLIAMENT CONSTRUCTIONS PTY LTD
10b	Other	SEE DESCRIPTION	water tank Unit 1 & 2	NA		B20202843N3	PARLIAMENT CONSTRUCTIONS PTY LTD

Comments

Important Note:

The issue, under this Part, of a certificate in respect of a building or portion of a building does not affect the liability of a person to comply with the provisions of a law of the territory (including this Act) relating to the building or portion of the building.

Issued by: Shama Gunaratne
Delegate of the ACT Construction
Occupations Registrar.

Issued on: 17/01/2023

PROCEDURES FOR DEMOLITION

Power supply to be disconnected
 Asbestos sheets to be removed by licensed remover
 Sewer to be capped off and inspected
 Water to be disconnected at meter

METHOD OF DEMOLITION

Strip by hand all materials to be salvaged
 Using a hydraulic excavator, fold to the middle
 Load any rubble onto a tip truck to be recycled
 if possible or otherwise, tipped at an approved
 site. Remove footing and clean site on completion

PROCEDURES FOR DEMOLITION

Power supply to be disconnected
 Asbestos sheets to be removed by licensed remover
 Sewer to be capped off and inspected
 Water to be disconnected at meter


METHOD OF DEMOLITION

Strip by hand all materials to be salvaged
 Using a hydraulic excavator, fold to the middle
 Load any rubble onto a tip truck to be recycled
 if possible or otherwise, tipped at an approved
 site. Remove footing and clean site on completion

INSULATION
 Walls R 2.0
 Ceiling R 5.0

SELECT STRUCTURE 
 BUILDING CERTIFICATION **BUILDING DESIGNERS ASSOCIATION OF AUSTRALIA**

Building Approval REQUIREMENTS
 Section 2 of Buildings Act 2004
 ACCORDANCE WITH THE NATIONAL CONSTRUCTION CODE (NCC) OR AS NOTED ON THE RELEVANT ENGINEERING DOCUMENTATION INCLUDING DRAWINGS PREPARED BY THE SUITABLY QUALIFIED ENGINEER ENGAGED FOR THE PROJECT
 NCC Occupancy Class: **1a(1), 10a, 10b**
 WALL AND ROOF FRAMING INCLUDING TRUSSES TO BE FIXED IN ACCORDANCE WITH MANUFACTURER'S SPECIFICATIONS AND THE NCC AND IN ACCORDANCE WITH RELEVANT AUSTRALIAN STANDARDS
 Date: **24/06/2020**
 LIGHTING TO COMPLY WITH CLAUSE 3.12.5.5. ARTIFICIAL LIGHTING OF THE NCC.
 WATER HEATERS TO BE INSTALLED IN ACCORDANCE WITH REQUIREMENTS OF CLAUSE 3.12.5.6 OF THE NCC.
 DATE: **20/06/2020**
 L. J. KRENTZ

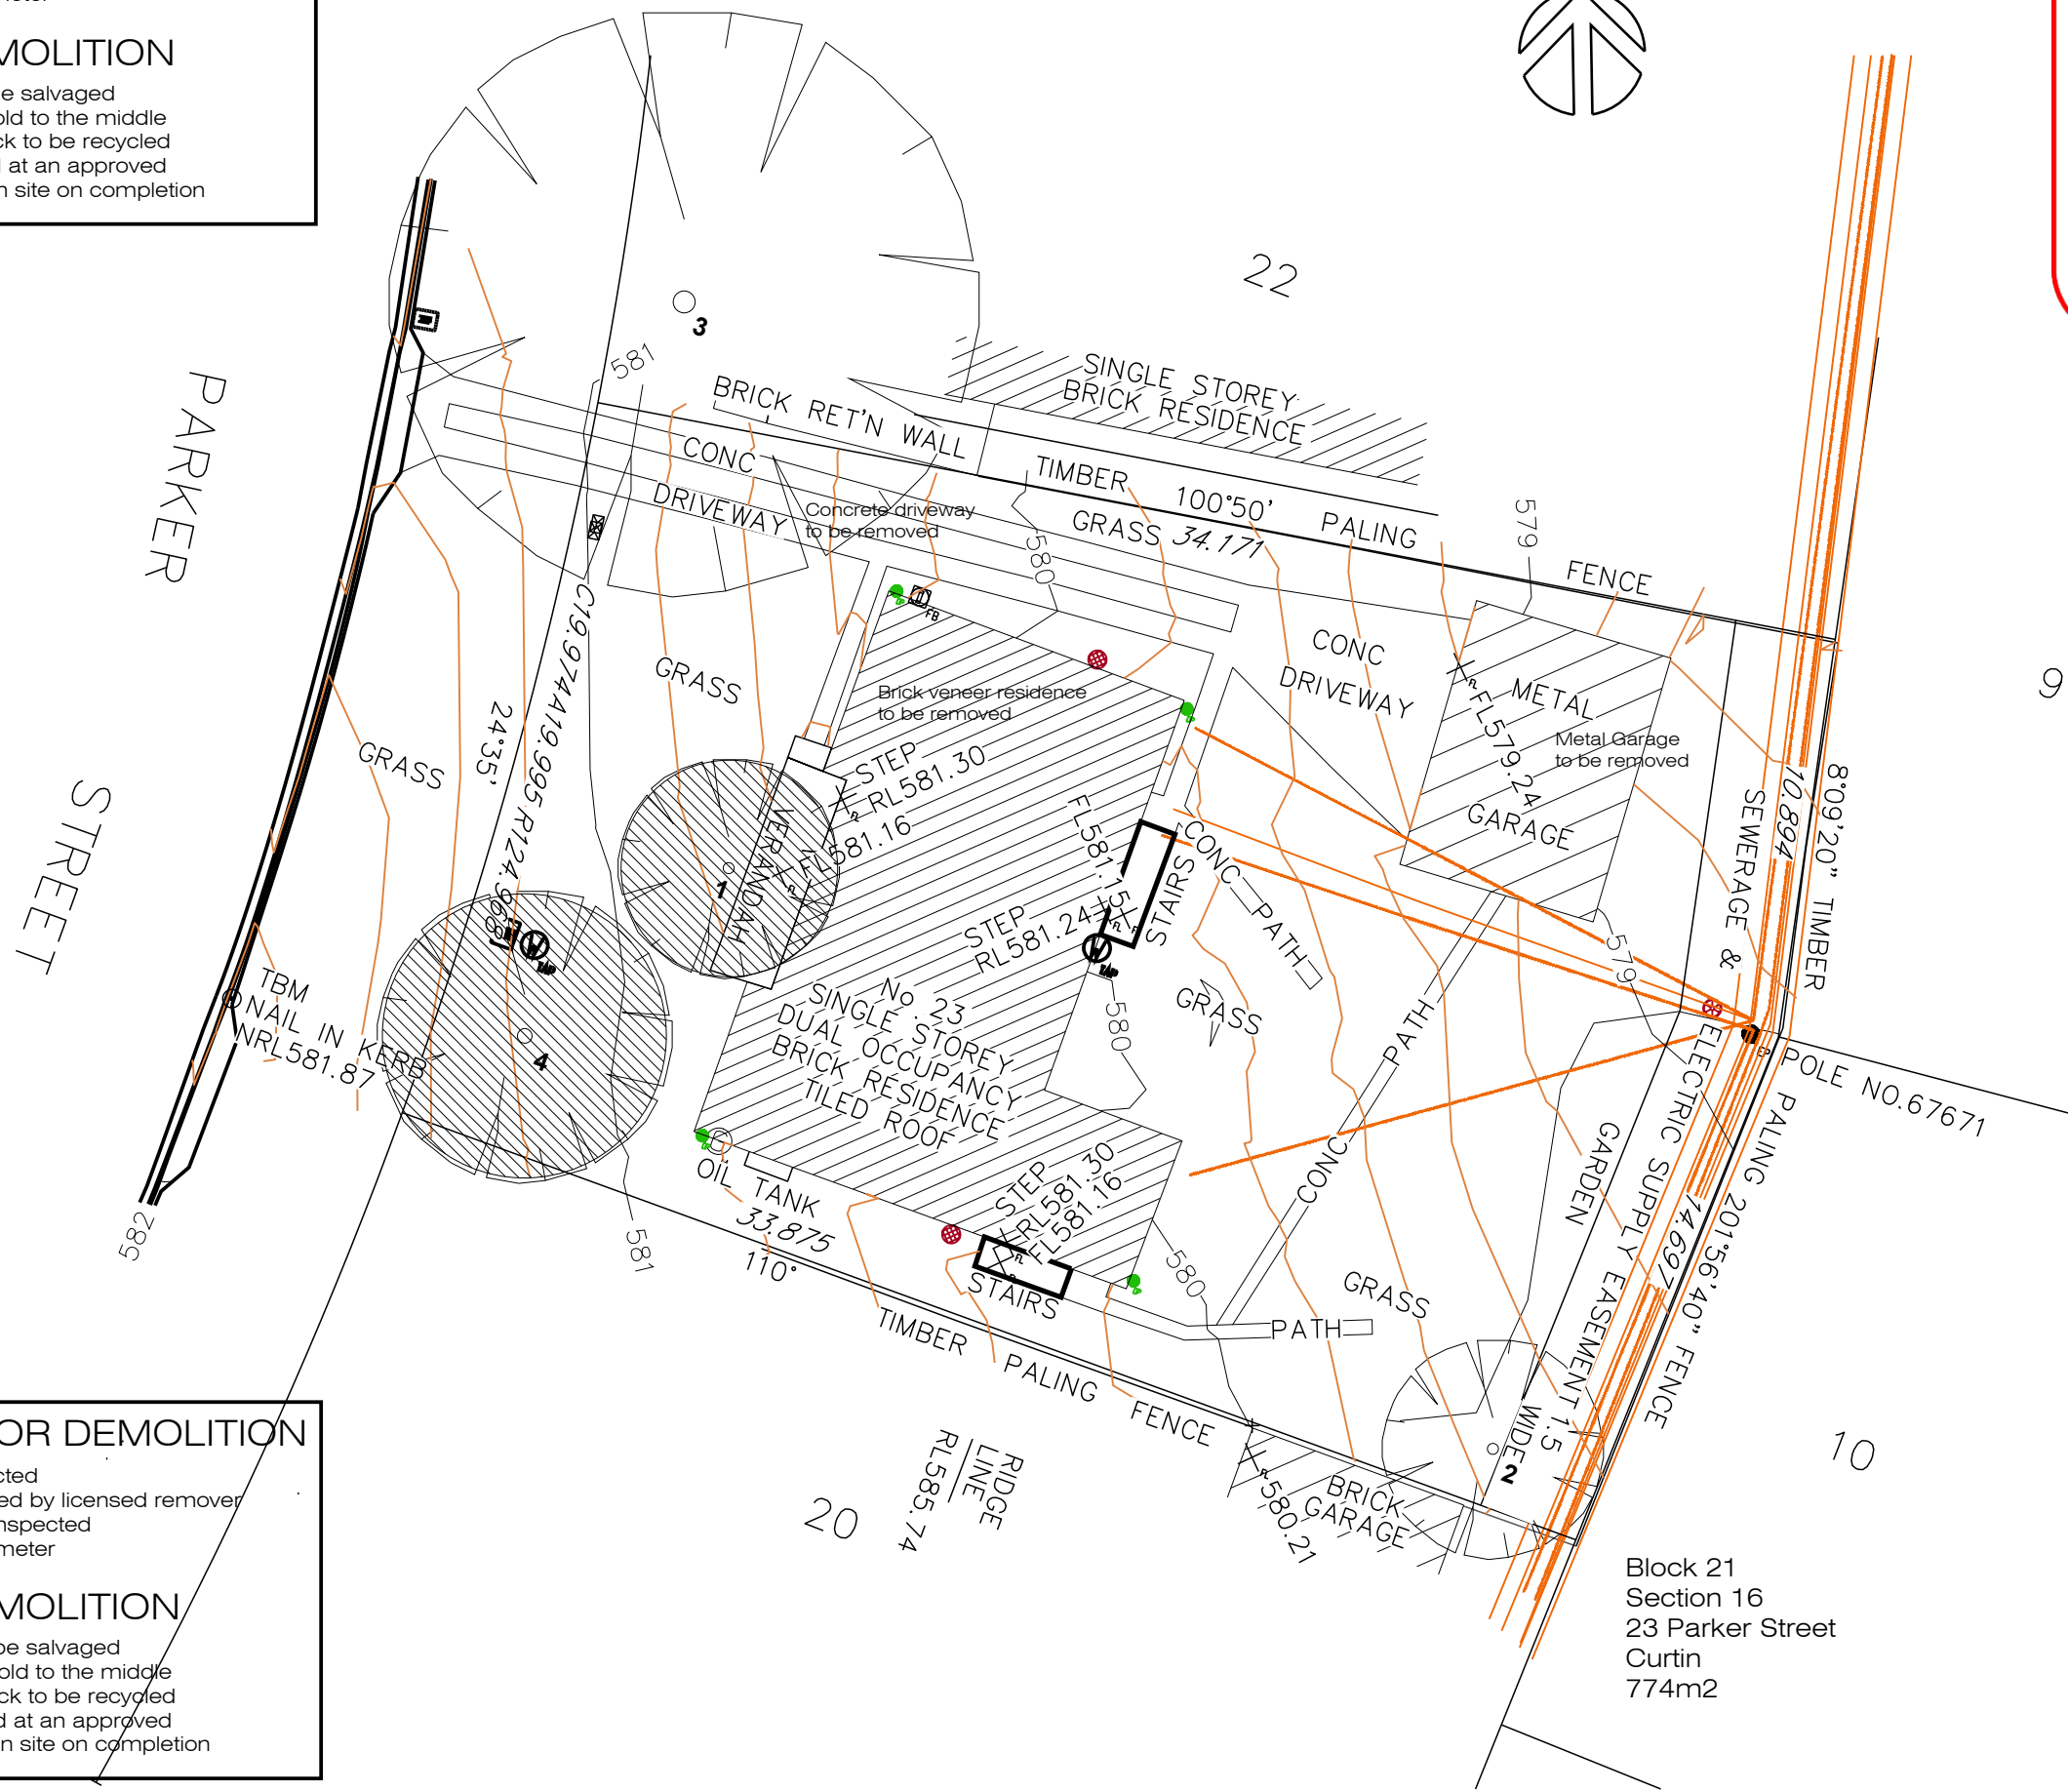

General Notes

Drawings are to be read in conjunction with the relevant
 Tender prepared by Designs by Mahony.
 In the event that there are omissions or ambiguity between
 the tender and the drawings, manufacturer and builders
 specifications and Tender documentation will take
 precedence over drawings. All dimensions are to be
 checked on site prior to manufacture of frames and trusses
 and preparation of building setout by the site supervisor.

D.A. LODGEMENT

Copyright © Febule Pty Ltd T/A Designs by Mahony
 Copying all or part of this design or
 drawing is in breach of copyright law. This document remains the
 property of Designs by Mahony

No.	Description	Date
A	DA LODGEMENT	21/9/2018

Designs by Mahony
 Copyright **BAILLIE RESIDENCE**
 Block 21 Section 16
 23 Parker Street
 CURTIN

Drawing Name:
DEMOLITION PLAN

Project number		008
Date	21/9/2018	
Drawn by	gm	
Checked by		
Scale		1:200

ASBESTOS ASSESSMENTS

ACT Pty Limited

ABN 73 606 057 041 Lic No AA00010

PO Box 122
Kippax ACT 2615
0412 633 487

Asbestos Clearance Inspection Certificate

Date of Inspection: 10/5/2021

Asbestos Removalist: Jesco Asbestos Removal

Site Address: 23 Parker St Curtin ACT

Asbestos Removal Work Completed: Laundry, bathroom & Ensuite pipe lagging, house eaves, electrical switchboard

This clearance certificate covers the works specified above only. Peter Hengst Asbestos Assessor of Asbestos Assessments ACT Pty Ltd visually inspected the area described above following the removal of asbestos containing materials.

The removal has been completed to industry standards and may be reoccupied as the inspection found that there was no visible or accessible asbestos identified from the removal.

All control & clearance Air Monitoring was below the minimum practical detection limit of 0.01 fibers per ml. See result sheet attached.

The area can now be occupied and building works may continue.

Authorized by



Peter Hengst
Asbestos Assessor (Lic No AA00010)
p.hengst@bigpond.com

Area Schedule

Lower floor living Unit 1	64.051m ²
Upper floor living Unit 1	100.800m ²
Garage Unit 1	35.000m ²
GFA Unit 1	200.851m ²
Lower floor living Unit 2	64.810m ²
Upper floor living Unit 2	79.372m ²
Carport Unit 2 (part)	15.000m ²
(Carport area)	(33.190m ²)
GFA Unit 2	173.042m ²
TOTAL GFA	374.829m ²
Affresco Unit 1	27.293m ²
Affresco Unit 2	19.359m ²
Porch Unit 1	7.575m ²
Porch Unit 2	7.254m ²
Lightwell Unit 2	7.559m ²
Additional areas	89.040m ²
TOTAL AREA	463.930m ²
Site Area	774.000m ²
Site Coverage	48.42%

PLANNING AND DEVELOPMENT ACT 2007
APPROVAL GRANTED
 SUBJECT TO THE CONDITIONS SET OUT IN THE
 NOTICE OF DECISION
 PURSUANT TO SECTION 162
 Delegate name **Fawzia Majid**
 Date **28/11/2019**

INSULATION
 Walls R 2.0
 Ceiling R 5.0

SELECT STRUCTURE
BUILDING CERTIFICATION


BUILDING DESIGNERS
 ASSOCIATION OF AUSTRALIA

Building Approval issued under
 Section 28 of Building Act 2004

NCC Occupancy Class: **1a(ii), 10a, 10b**
 NCC Construction Type: **N/A**
 Date: **24/06/2020**

Livij Krenovin
 ACT Lic No. 2010979

GENERAL CONSTRUCTION REQUIREMENTS
 ALL CONSTRUCTION WORKS TO BE CONSTRUCTED IN ACCORDANCE WITH THE NATIONAL CONSTRUCTION CODE (NCC) OR AS SPECIFIED BY THE PART ENGINEERING DOCUMENTATION PREPARED BY THE SUITABLY QUALIFIED ENGINEER ENGAGED FOR THE PROJECT
 WALL AND ROOF FRAMING INCLUDING TRUSSES TO BE FIXED IN ACCORDANCE WITH MANUFACTURERS SPECIFICATIONS AND THE NCC REQUIREMENTS FOR RELEVANT AUSTRALIAN STANDARDS
 LIGHTING TO COMPLY WITH CLAUSE 3.12.5.1. ARTIFICIAL LIGHTING OF THE NCC
 WATER HEATERS TO BE INSTALLED IN ACCORDANCE WITH REQUIREMENTS OF CLAUSE 3.12.5.6 OF THE NCC
 1. DRIVEWAYS OVER GOVT NATURE STRIPS MUST BE PREPARED AND CONSTRUCTED BY A GOVT APPROVED DRIVEWAY CONTRACTOR
 2. A DRIVEWAY CONSTRUCTION APPLICATION FORM MUST BE COMPLETED AND SUBMITTED TO GOVT FOR APPROVAL PRIOR TO COMMENCEMENT OF WORK
 3. MAINLINE DRIVEWAY STANDARDS SHALL BE CONCRETE SLAB 100mm THICK F22 STEEL REINFORCED GENERALLY PLACED OFF STREET PARKING SHALL BE DESIGNED IN ACCORDANCE WITH AS 4586-2012
 FACILITIES PARKING PART 1 OFF STREET PARKING
 ENERGY EFFICIENCY REQUIREMENTS
 PROVIDE AND INSTALL WEATHER STRIPS TO ALL EXTERNAL DOORS
 EXHAUST FANS TO INC LID SELF SEALING DAMPERS

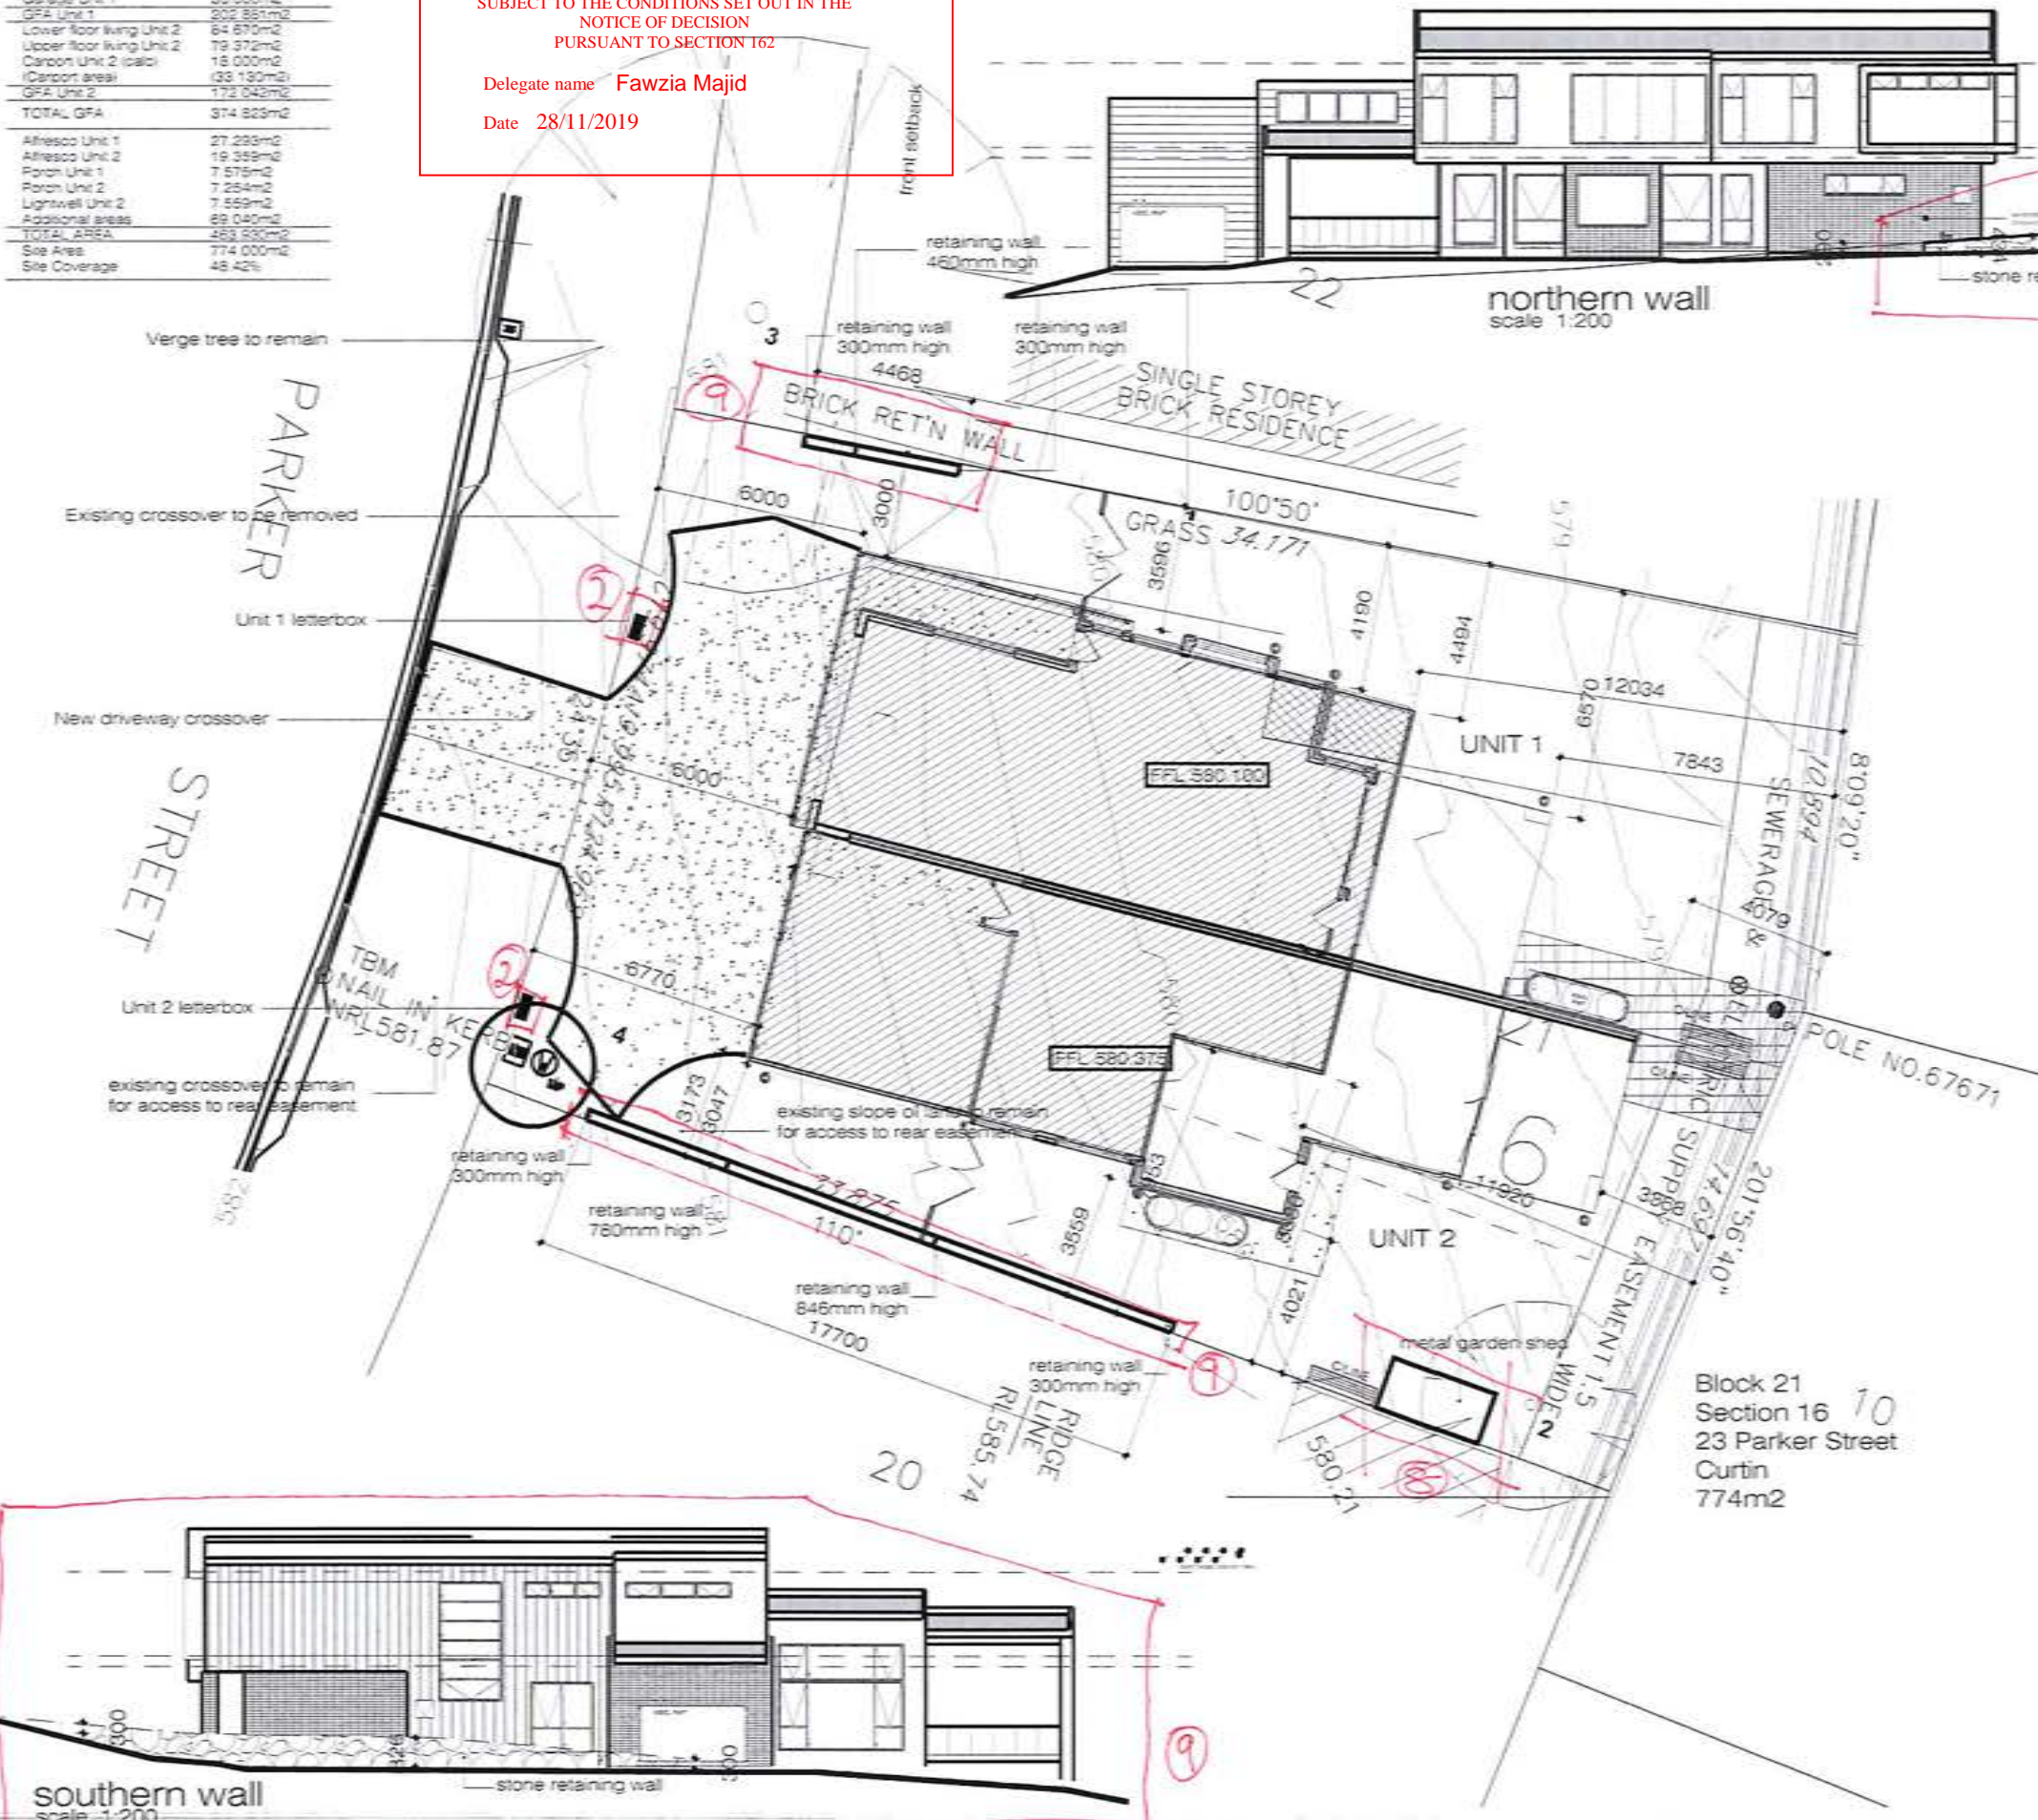

MIN. 50% OF THE ROOF CATCHMENT TO BE CONNECTED TO THE 5000L RAINWATER TANK FOR EACH UNIT
 GENERAL MATERIALS AND FINISHES
 EXTERNAL WALLS TO BE FINISHED IN FACE BRICKWORK, 100 THICK NRG CLADDING RENDERED AND PAINTED AS ILLUSTRATED ON RESPECTIVE ELEVATIONS
 WINDOWS TO BE ALUMINIUM FRAMED DOUBLE GLAZED UNITS - WINDOW SELECTION TO ACCORD WITH WINDOW SCHEDULE QUOTE PREPARED BY DESIGNER BY MAHONY AND APPROVED BY THE CLIENT. ALL COLOURS AS STATED IN BUILDING CONTRACT OR FINISHES SCHEDULE
 ROOF TO BE FINISHED IN COLORBOND ROOFINGS AS SPECIFIED IN BUILDING CONTRACT. COLOUR AS STATED IN BUILDING CONTRACT. FASCIA AND GUTTER TO BE COLORBOND - COLOUR IN ACCORDANCE WITH BUILDING CONTRACT. DOWNPIPES AS SPECIFIED WITHIN THE BUILDING CONTRACT.

General Notes
 Drawings are to be read in conjunction with the relevant Tender prepared by Design by Mahony
 In the event that there are omissions or ambiguity between the tender and the drawings, manufacturer and builders specifications and Tender documentation will take precedence over drawings. All dimensions are to be checked on site prior to manufacture of frames and trusses and preparation of building setout by the site supervisor.

D.A. LODGEMENT

Copyright © Febule Pty Ltd TIA Designs by Mahony
 Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Design by Mahony

No.	Description	Date
	Amendments 10/10/2019	
	1- turning circles	
	2- mailbox	
	3- site lines	
	4- shadow diagram	
	5- solar access to unit 2	
	6- perspectives	
	7- wsud	
	8- storage shed unit 2	
	9- retaining walls	
	10- screened windows	
	11- height of balustrade	
	12- cross section location	
	13- entry advice	
B	DA ADDITIONAL INFO	10/10/2019
A	DA LODGEMENT	21/9/2018

Designs by Mahony
 Copyright **BAILLIE RESIDENCE**
 Block 21 Section 16
 23 Parker Street
 CURTIN

Drawing Name: **RETAINING WALLS**

Project number: **1/2019**

Date: **1/2019**

Drawn by: **gm**

Checked by: **gm**

Scale: **1:200**

030

PLANNING AND DEVELOPMENT ACT 2007
APPROVAL GRANTED
 SUBJECT TO THE CONDITIONS SET OUT IN THE
 NOTICE OF DECISION
 PURSUANT TO SECTION 162

Delegate name Fawzia Majid
 Date 28/11/2019

INSULATION
 Walls R 2.0
 Ceiling R 5.0



SELECT STRUCTURE
BUILDING CERTIFICATION
 Building Approval issued under
 Section 28 of Building Act 2004

NCC Occupancy Class: **1a(ii), 10a, 10b**

NCC Construction Type: **N/A**

Date: **24/06/2020**

Livij Kravtsov

ACT Lic No. 2010979

GENERAL CONSTRUCTION REQUIREMENTS
 WALLS AND ROOF FRAMING INCLUDING TRUSSES TO BE FIXED IN ACCORDANCE WITH MANUFACTURERS SPECIFICATIONS AND THE NCC RELEVANT TO THIS PROJECT.
 LIGHTING TO COMPLY WITH CLAUSE 3.12.5.5 ARTIFICIAL LIGHTING OF THE NCC.
 WATER HEATERS TO BE INSTALLED IN ACCORDANCE WITH REQUIREMENTS OF CLAUSE 3.12.5.6 OF THE NCC.
 DRIVEWAY NOTES
 1. DRIVEWAYS OVER GOVT NATURE STRIPS MUST BE PREPARED AND CONSTRUCTED BY A GOVT APPROVED DRIVEWAY CONTRACTOR.
 2. A DRIVEWAY CONSTRUCTION APPLICATION FORM MUST BE COMPLETED AND SUBMITTED TO GOVT FOR APPROVAL PRIOR TO COMMENCEMENT OF WORK.
 3. MINIMUM DRIVEWAY STANDARDS SHALL BE CONCRETE SLAB 100mm THICK F82 STEEL REINFORCED CENTRALLY PLACED OFF STREET PARKING SHALL BE DESIGNED IN ACCORDANCE WITH AS 4586 SCHEDULE 4.
 FACILITIES PARKING, PART 1: OFF STREET PARKING
 ENERGY EFFICIENCY REQUIREMENTS
 PROVIDE AND INSTALL WEATHER STRIPS TO ALL EXTERNAL DOORS ALL EXHAUST FANS TO INCLUDE SELF SEALING DAMPERS
 MIN. 50% OF THE ROOF CATCHMENT TO BE CONNECTED TO THE 500L RAINWATER TANK FOR EACH UNIT.
 GENERAL MATERIALS AND FINISHES
 EXTERNAL WALLS TO BE FINISHED IN FACE BRICKWORK, 100 THICK NRG CLADDING RENDERED AND PAINTED AS ILLUSTRATED ON RESPECTIVE ELEVATIONS.
 WINDOWS TO BE ALUMINIUM FRAMED DOUBLE GLAZED UNITS - WINDOW SELECTION TO ACCORD WITH WINDOW SCHEDULE QUOTE PREPARED BY DESIGNS BY MAHONY AND APPROVED BY THE CLIENT. ALL COLOURS AS STATED IN BUILDING CONTRACT OR FINISHES SCHEDULE.
 ROOF TO BE FINISHED IN COLORBOND ROOFINGS AS SPECIFIED IN BUILDING CONTRACT - COLOUR AS STATED IN BUILDING CONTRACT FASCIA AND GUTTER TO BE COLORBOND - COLOUR IN ACCORDANCE WITH BUILDING CONTRACT. DOWNPIPES AS SPECIFIED WITHIN THE BUILDING CONTRACT.

General Notes
 Drawings are to be read in conjunction with the relevant Tender prepared by Designs by Mahony.
 In the event that there are omissions or ambiguity between the Tender and the drawings, manufacturer and builders specifications and Tender documentation will take precedence over drawings. All dimensions are to be checked on site prior to manufacture of frames and trusses and preparation of building setback by the site supervisor.


D.A. LODGEMENT

Copyright © Febule Pty Ltd TIA Designs by Mahony
 Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

No.	Description	Date
B	DA ADDITIONAL INFO	10/10/2019
A	DA LODGEMENT	21/9/2018
Designs by Mahony Copyright BAILLIE RESIDENCE Block 21 Section 16 23 Parker Street CURTIN		
Drawing Name: LOWER FLOOR PLAN		
Project number: 15-2019		
Date: 15/2019	015	
Drawn by: gm		
Checked by:	Scale 1:100	

- Amendments 10/10/2019
- 1- turning circles
 - 2- mailbox
 - 3- site lines
 - 4- shadow diagram
 - 5- solar access to unit 2
 - 6- perspectives
 - 7- wsud
 - 8- storage shed unit 2
 - 9- retaining walls
 - 10- screened windows
 - 11- height of balustrade
 - 12- cross section location
 - 13- entry advice

The carport openings for Unit 2 must remain open. No roller door or similar shall be installed in the future

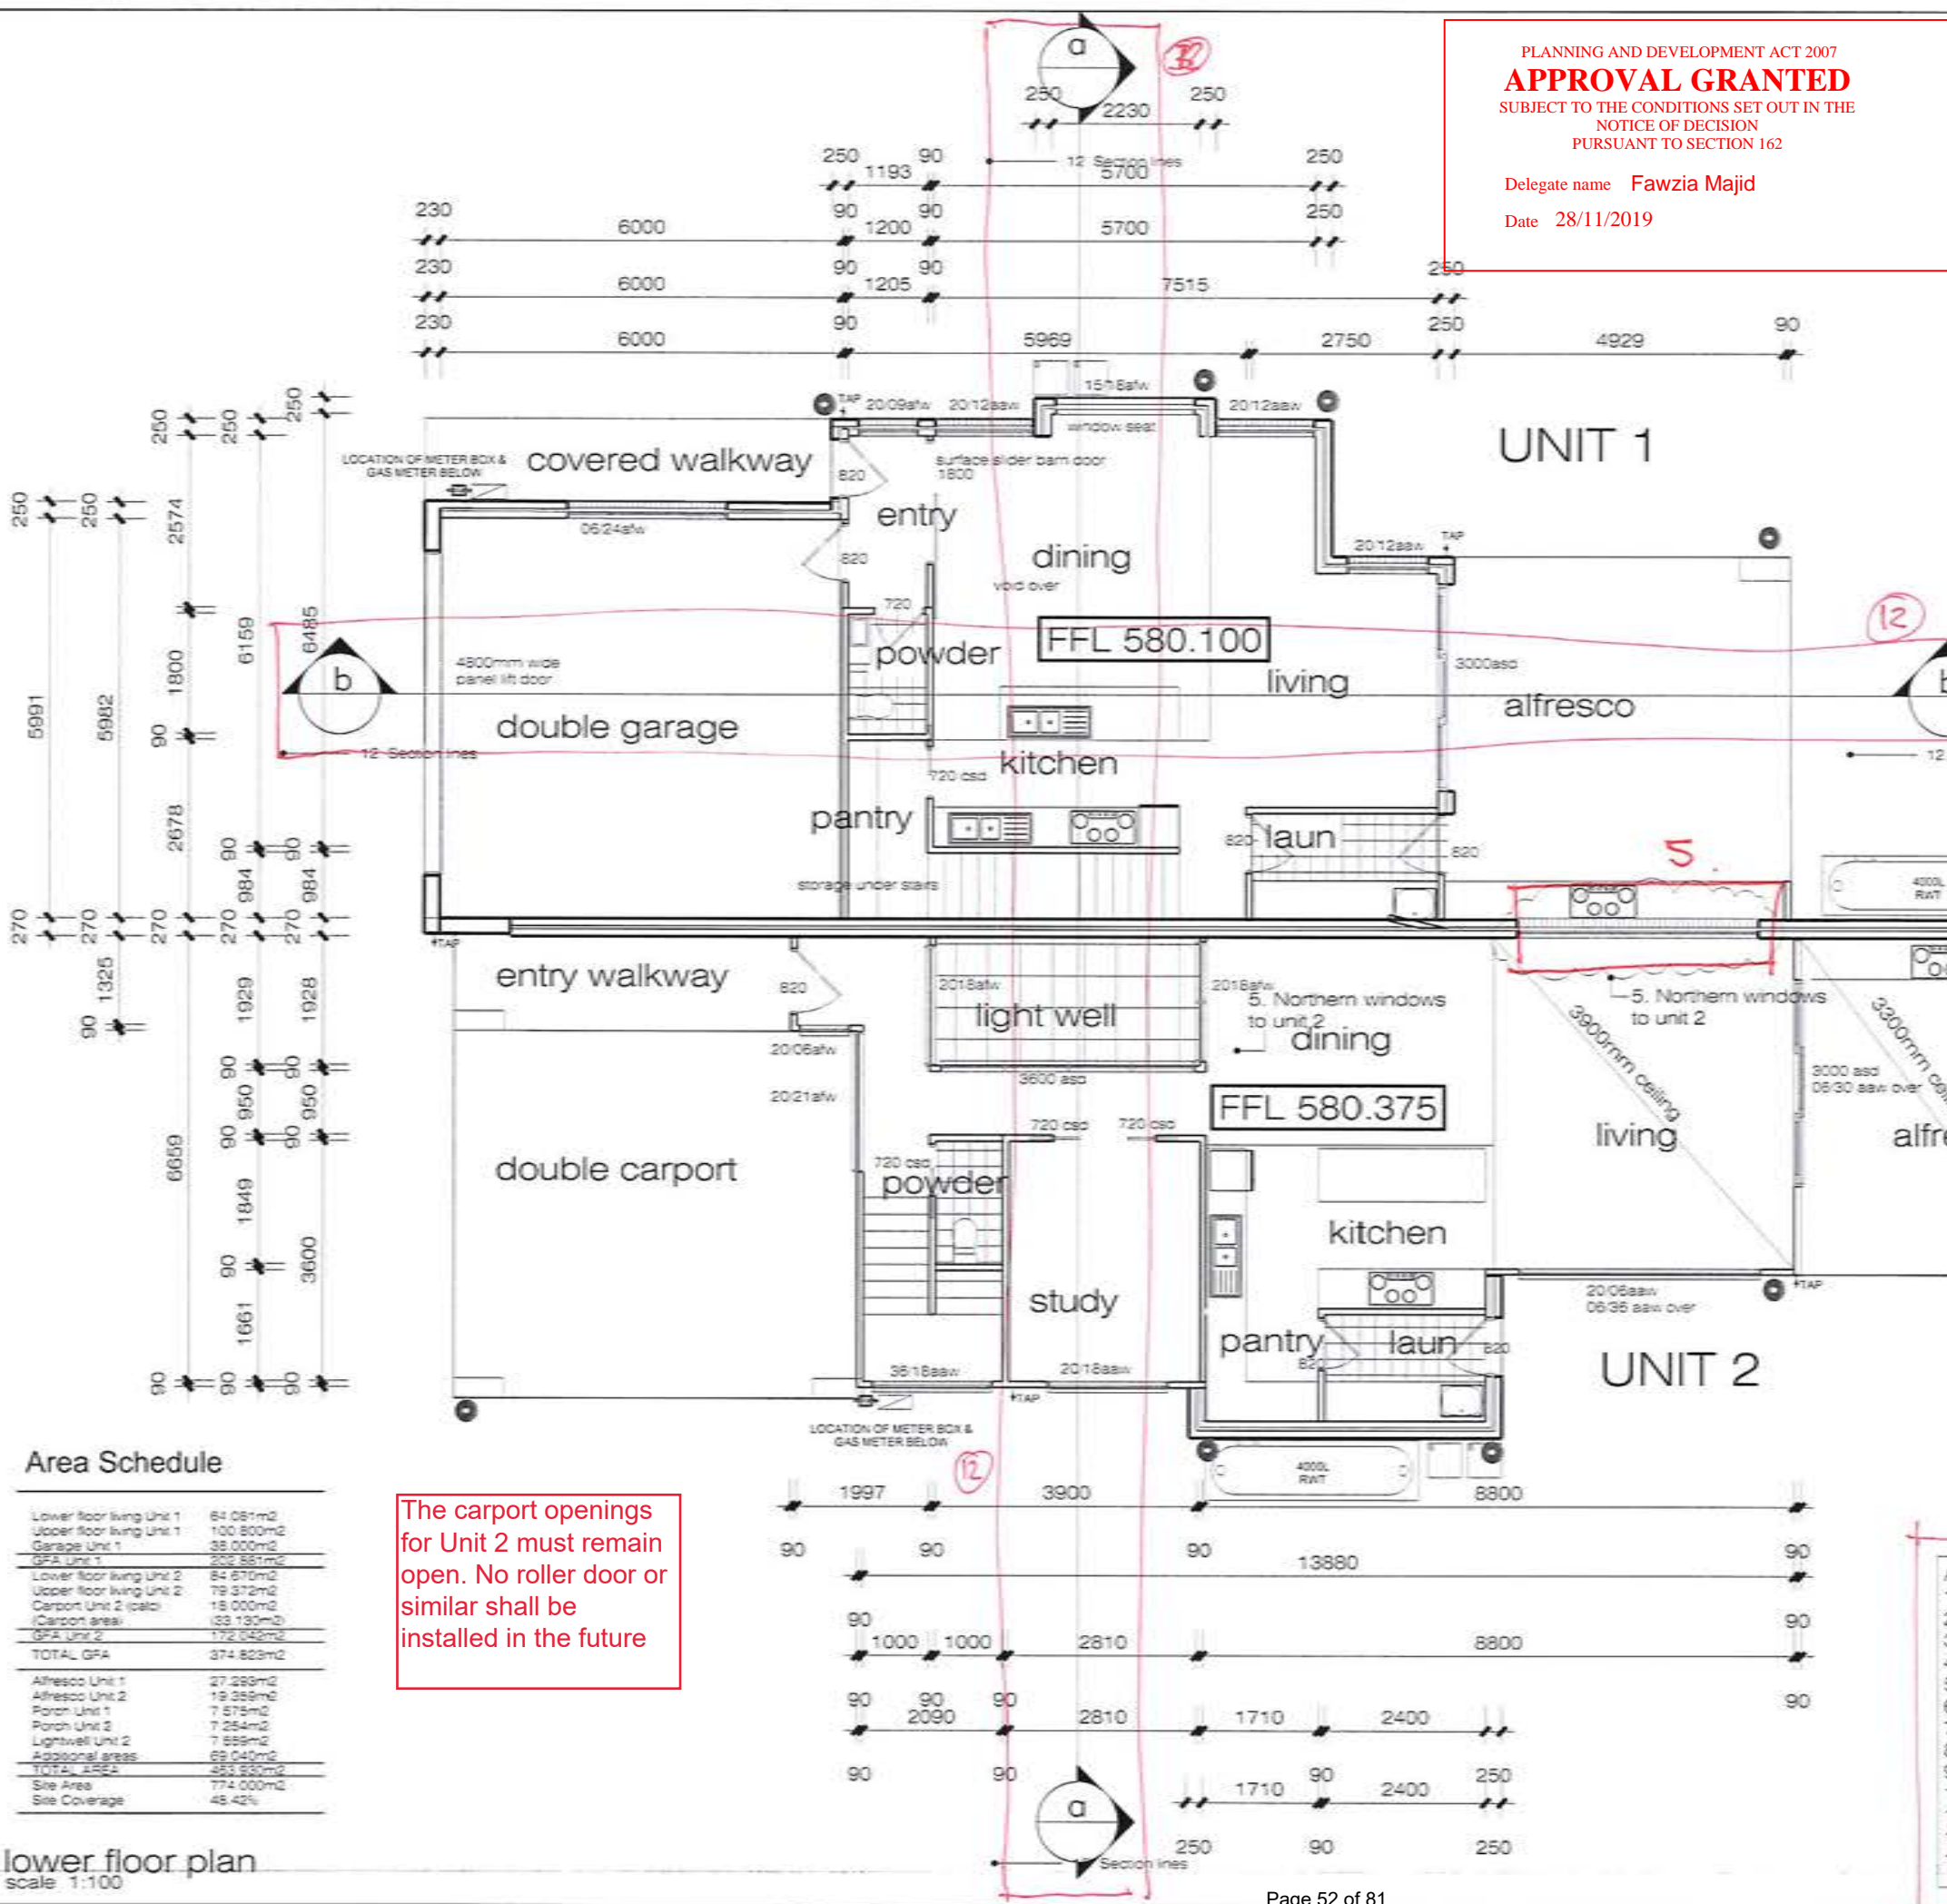

Area Schedule

Lower floor living Unit 1	64.061m ²
Upper floor living Unit 1	100.800m ²
Garage Unit 1	35.000m ²
GFA Unit 1	202.861m ²
Lower floor living Unit 2	84.570m ²
Upper floor living Unit 2	79.372m ²
Carport Unit 2 (pale)	19.000m ²
Carport area	133.130m ²
GFA Unit 2	172.942m ²
TOTAL GFA	374.803m ²
Alfresco Unit 1	27.289m ²
Alfresco Unit 2	19.389m ²
Porch Unit 1	7.579m ²
Porch Unit 2	7.254m ²
Lightwell Unit 2	7.889m ²
Additional areas	69.040m ²
TOTAL AREA	453.930m ²
Site Area	774.000m ²
Site Coverage	48.42%

lower floor plan
 scale 1:100

PLANNING AND DEVELOPMENT ACT 2007
APPROVAL GRANTED
 SUBJECT TO THE CONDITIONS SET OUT IN THE
 NOTICE OF DECISION
 PURSUANT TO SECTION 162

Delegate name **Fawzia Majid**

Date **28/11/2019**

INSULATION
 Walls R 2.0
 Ceiling R 5.0

Area Schedule

Lower floor Living Unit 1	84.00m ²
Upper floor Living Unit 1	10.00m ²
Garage Unit	35.00m ²
GFA Unit 1	229.00m ²
Lower floor Living Unit 2	84.00m ²
Upper floor Living Unit 2	10.00m ²
Carport area (1 road)	19.00m ²
GFA Unit 2	113.00m ²
TOTAL GFA	342.00m ²
Alfresco Unit 1	27.00m ²
Alfresco Unit 2	19.00m ²
Porch Unit 1	7.50m ²
Porch Unit 2	7.50m ²
Lightwell Unit 1	1.00m ²
Lightwell Unit 2	1.00m ²
Additional area	60.00m ²
TOTAL AREA	500.00m ²
Site Area	7.70m ²
Site Coverage	48.42%

SELECT STRUCTURE

BUILDING CERTIFICATION

Building Approval issued under
 Section 28 of Building Act 2004

NCC Occupancy Class **1a(ii), 10a, 10b**

NCC Construction Type: **N/A**

Date: **24/06/2020**

Livij Krawatin

ACT Lic No. **2010979**

GENERAL CONSTRUCTION REQUIREMENTS
 ALL LABS TO BE CONSTRUCTED IN ACCORDANCE WITH THE NATIONAL CONSTRUCTION CODE (NCC) OR ACCORDANCE WITH THE PART ENGINEERING DOCUMENTATION PREPARED BY THE SUITABLY QUALIFIED ENGINEER ENGAGED FOR THE PROJECT

WALL AND ROOF FRAMING INCLUDING TRUSSES TO BE FIXED IN ACCORDANCE WITH MANUFACTURERS SPECIFICATIONS AND THE NCC. ALL STRUCTURAL WORK TO BE DONE IN ACCORDANCE WITH RELEVANT AUSTRALIAN STANDARDS.

LIGHTING TO COMPLY WITH CLAUSE 3.12.5.5 ARTIFICIAL LIGHTING OF THE NCC.
 WATER HEATERS TO BE INSTALLED IN ACCORDANCE WITH REQUIREMENTS OF CLAUSE 3.12.5.6 OF THE NCC.

ENERGY EFFICIENCY REQUIREMENTS

1. DRIVEWAYS OVER GOVT NATURE STRIPS MUST BE PREPARED AND CONSTRUCTED BY A GOVT APPROVED DRIVEWAY CONTRACTOR.
 2. A DRIVEWAY CONSTRUCTION APPLICATION FORM MUST BE COMPLETED AND SUBMITTED TO GOVT FOR APPROVAL PRIOR TO COMMENCEMENT OF WORK.
 3. MINIMUM DRIVEWAY STANDARDS SHALL BE CONCRETE SLAB 100mm THICK F20 STEEL REINFORCED CENTRALLY PLACED OFF STREET PARKING SHALL BE DESIGNED IN ACCORDANCE WITH AS/NZS 4586.

FACILITIES PARKING, PART 1 OFF STREET PARKING

ENERGY EFFICIENCY REQUIREMENTS

PROVIDE AND INSTALL WEATHER STRIPS TO ALL EXTERNAL DOORS ALL EXHAUST FANS TO INCLUDE SELF SEALING DAMPERS

MIN. 50% OF THE ROOF CATCHMENT TO BE CONNECTED TO THE 500L RAINWATER TANK FOR EACH UNIT

GENERAL MATERIALS AND FINISHES

EXTERNAL WALLS TO BE FINISHED IN FACE BRICKWORK, 100 THICK. BRG CLADDING RENDERED AND PAINTED AS ILLUSTRATED ON RESPECTIVE ELEVATIONS

WINDOWS TO BE ALUMINIUM FRAMED DOUBLE GLAZED UNITS - WINDOW SELECTION TO ACCORD WITH WINDOW SCHEDULE QUOTE PREPARED BY DESIGNER BY MAHONY AND APPROVED BY THE CLIENT. ALL COLOURS AS STATED IN BUILDING CONTRACT OR FINISHES SCHEDULE

ROOF TO BE FINISHED IN COLORBOND ROOFINGS AS SPECIFIED IN BUILDING CONTRACT - COLOUR AS STATED IN BUILDING CONTRACT FASCIA AND GUTTER TO BE COLORBOND - COLOUR IN ACCORDANCE WITH BUILDING CONTRACT DOWNPIPES AS SPECIFIED WITHIN THE BUILDING CONTRACT

General Notes

Drawings are to be read in conjunction with the relevant Tender prepared by Designs by Mahony

In the event that there are omissions or ambiguity between the tender and the drawings, manufacturer and builders specifications and Tender documentation will take precedence over drawings. All dimensions are to be checked on site prior to manufacture of frames and trusses and preparation of building setout by the site supervisor.

D.A. LODGEMENT

Copyright © Febule Pty Ltd T/A Designs by Mahony

Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

Copyright © Febule Pty Ltd T/A Designs by Mahony

Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

Copyright © Febule Pty Ltd T/A Designs by Mahony

Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

Copyright © Febule Pty Ltd T/A Designs by Mahony

Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

Copyright © Febule Pty Ltd T/A Designs by Mahony

Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

Copyright © Febule Pty Ltd T/A Designs by Mahony

Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

Copyright © Febule Pty Ltd T/A Designs by Mahony

Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

Copyright © Febule Pty Ltd T/A Designs by Mahony

Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

Copyright © Febule Pty Ltd T/A Designs by Mahony

Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

Copyright © Febule Pty Ltd T/A Designs by Mahony

Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

Copyright © Febule Pty Ltd T/A Designs by Mahony

Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

No.	Description	Date
B	DA ADDITIONAL INFO	10/10/2019
A	DA LODGEMENT	21/9/2018

Designs by Mahony
 Copyright **BAILLIE RESIDENCE**
 Block 21 Section 16
 23 Parker Street
 CURTIN

Drawing Name:
UPPER FLOOR PLAN

Project number:
016


Date: **16/11/2019**

Drawn by: **gm**

Checked by: **gm**

Scale: **1:100**

- Amendments 10/10/2019
- 1- turning circles
 - 2- mailbox
 - 3- site lines
 - 4- shadow diagram
 - 5- solar access to unit 2
 - 6- perspectives
 - 7- wsud
 - 8- storage shed unit 2
 - 9- retaining walls
 - 10- screened windows
 - 11- height of balustrade
 - 12- cross section location
 - 13- entity advice

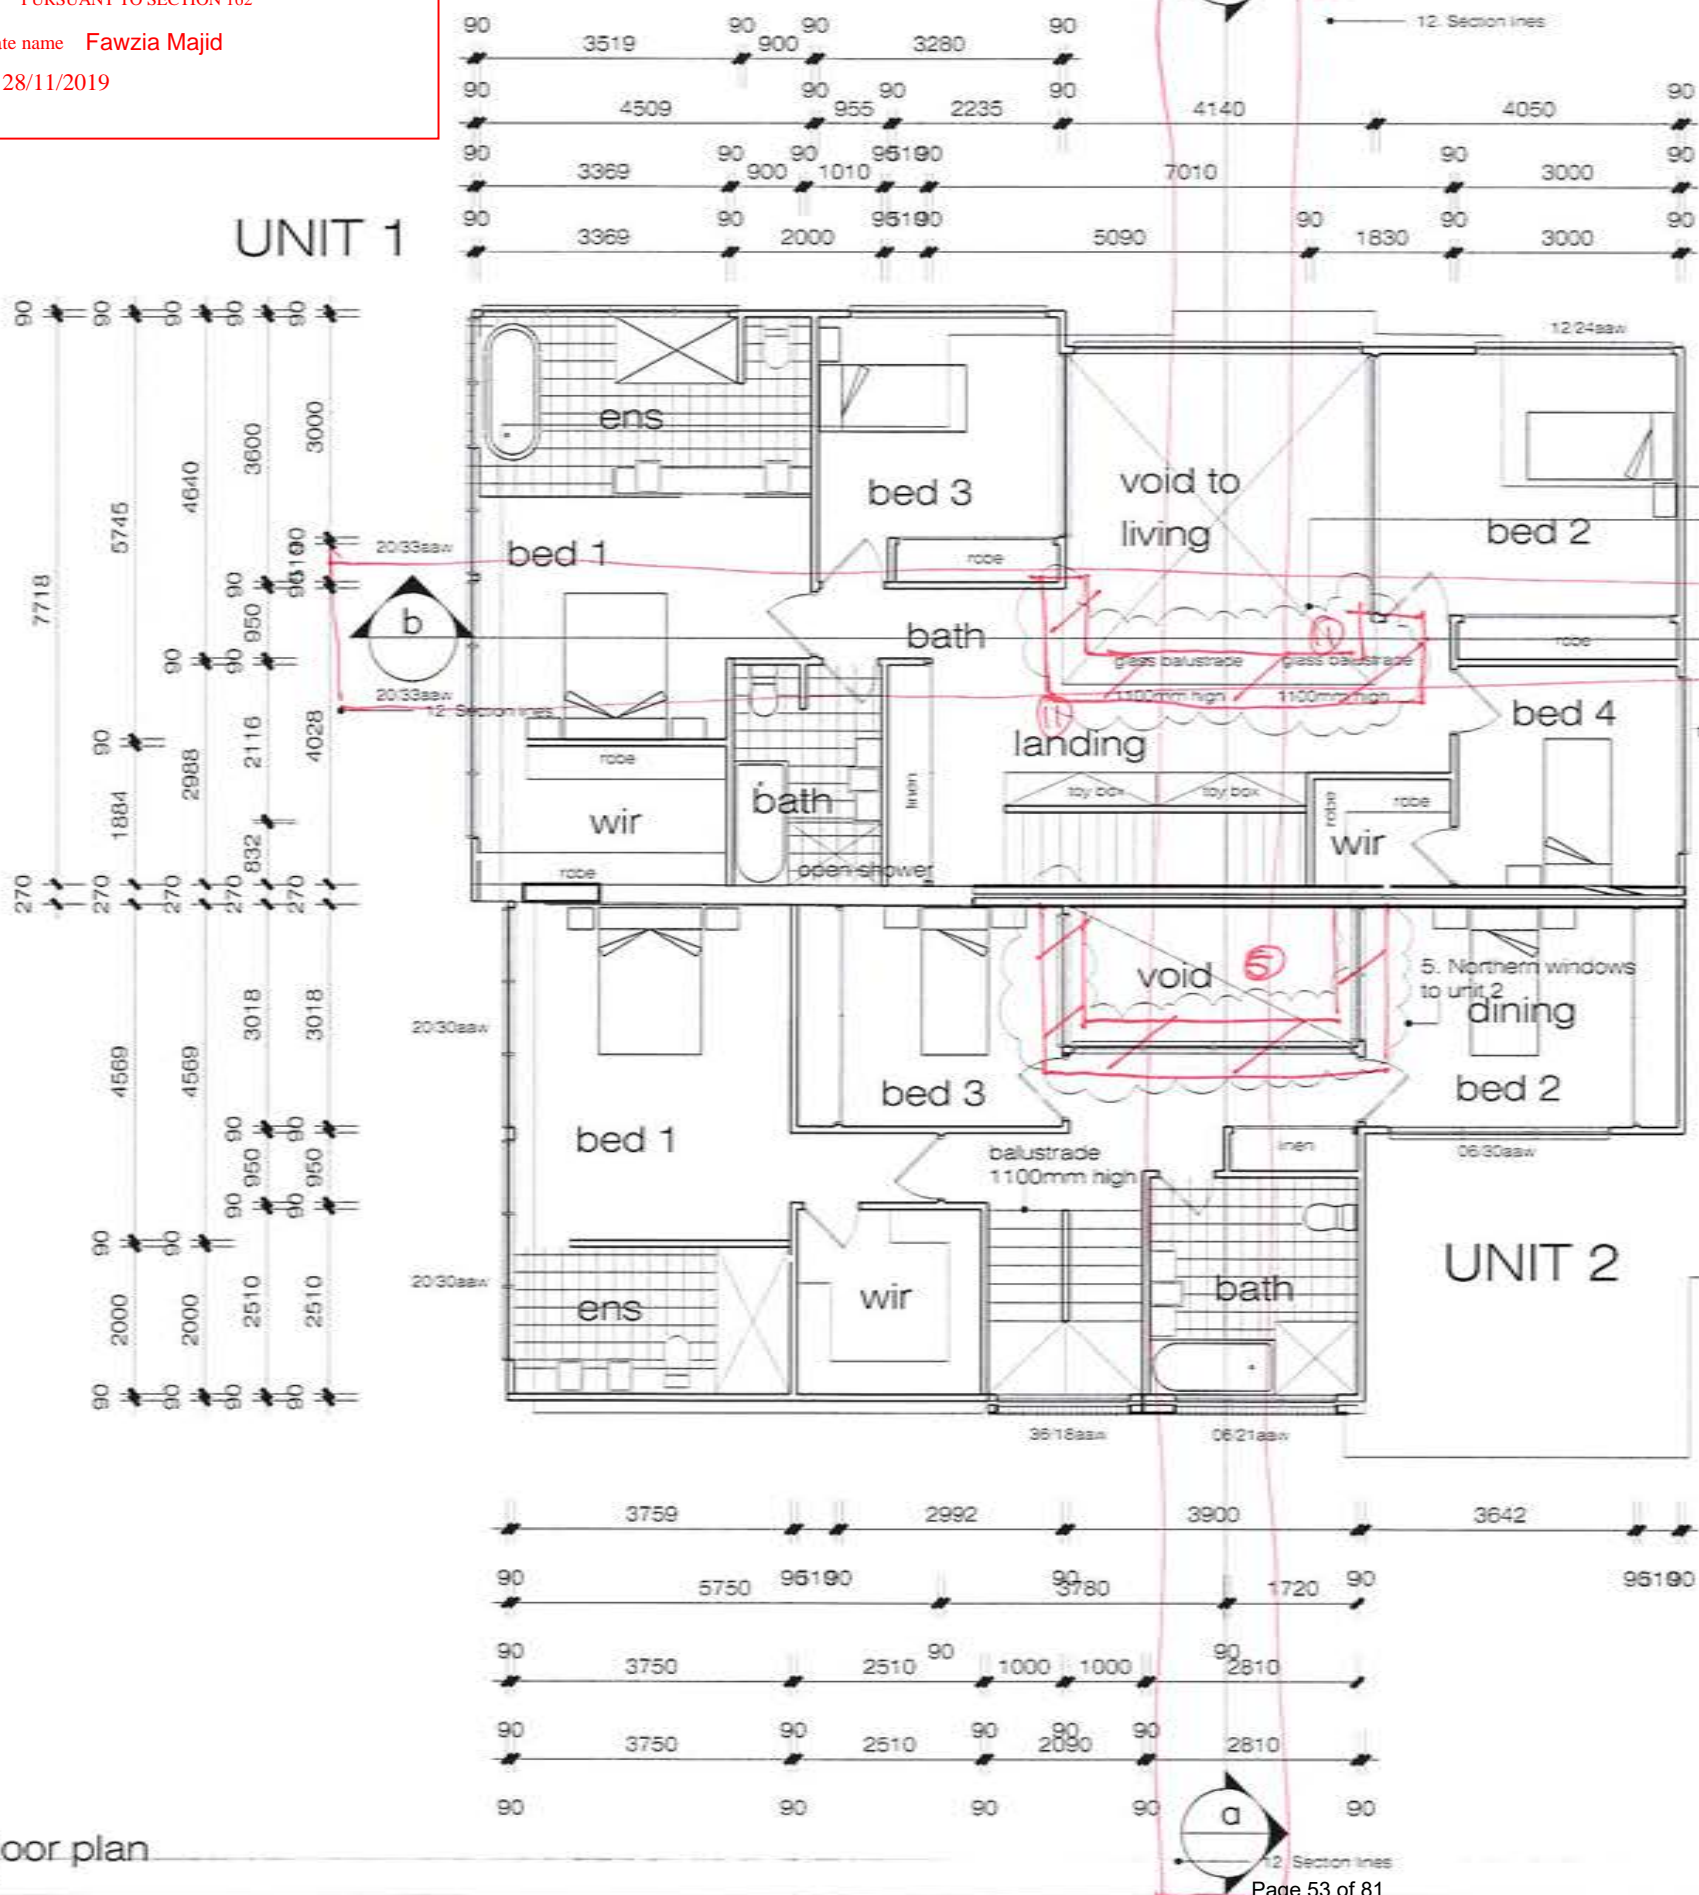

upper floor plan
 scale 1:100

INSULATION
Walls R 2.0
Ceiling R 5.0

Area Schedule

SELECT STRUCTURE

BUILDING CERTIFICATION

Building Approval issued under
Section 28 of Building Act 2014

NCC Occupancy Class: 1a(ii), 10a, 10b

NCC Construction Type: N/A

Date: 24/06/2020

ACT Lic No. 2010979

GENERAL CONSTRUCTION REQUIREMENTS
WALL AND ROOF FRAMING INCLUDING TRUSSES TO BE FIXED IN ACCORDANCE WITH MANUFACTURERS SPECIFICATIONS AND THE NCC...
LIGHTING TO COMPLY WITH CLAUSE 3.12.5. ARTIFICIAL LIGHTING OF THE NCC...
WATER HEATERS TO BE INSTALLED IN ACCORDANCE WITH REQUIREMENTS OF CLAUSE 3.12.5.6 OF THE NCC.
1. DRIVEWAYS OVER GOVT NATURE STRIPS MUST BE PREPARED AND CONSTRUCTED BY A GOVT APPROVED DRIVEWAY CONTRACTOR.
2. A DRIVEWAY CONSTRUCTION APPLICATION FORM MUST BE COMPLETED AND SUBMITTED TO GOVT FOR APPROVAL PRIOR TO COMMENCEMENT OF WORK.
3. MINIMUM DRIVEWAY STANDARDS SHALL BE CONCRETE SLAB 100mm THICK F22 STEEL REINFORCED GENERALLY PLACED OFF STREET PARKING SHALL BE DESIGNED IN ACCORDANCE WITH AS 4586-2012.
FACILITIES PARKING, PART 1: OFF STREET PARKING
ENERGY EFFICIENCY REQUIREMENTS
PROVIDE AND INSTALL WEATHER STRIPS TO ALL EXTERNAL DOORS
ALL EXHAUST FANS TO INCLUDE SEALING DAMPERS

MIN. 50% OF THE ROOF CATCHMENT TO BE CONNECTED TO THE 500L RAINWATER TANK FOR EACH UNIT
GENERAL MATERIALS AND FINISHES
EXTERNAL WALLS TO BE FINISHED IN FACE BRICKWORK, 100THICK NRG CLADDING RENDERED AND PAINTED AS ILLUSTRATED ON RESPECTIVE ELEVATIONS
WINDOWS TO BE ALUMINIUM FRAMED DOUBLE GLAZED UNITS - WINDOW SELECTION TO ACCORD WITH WINDOW SCHEDULE QUOTE PREPARED BY DESIGNER AND APPROVED BY THE CLIENT. ALL COLOURS AS STATED IN BUILDING CONTRACT OR FINISHES SCHEDULE.
ROOF TO BE FINISHED IN COLORBOND ROOFINGS AS SPECIFIED IN BUILDING CONTRACT - COLOUR AS STATED IN BUILDING CONTRACT FASCIA AND GUTTER TO BE COLORBOND - COLOUR IN ACCORDANCE WITH BUILDING CONTRACT. DOWNPIPES AS SPECIFIED WITHIN THE BUILDING CONTRACT.

General Notes

Drawings are to be read in conjunction with the relevant Tender prepared by Designs by Mahony
In the event that there are omissions or ambiguity between the tender and the drawings, manufacturer and builders specifications and Tender documentation will take precedence over drawings. All dimensions are to be checked on site prior to manufacture of frames and trusses and preparation of building setout by the site supervisor.

D.A. LODGEMENT

Copyright © Febule Pty Ltd TIA Designs by Mahony
Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

No.	Description	Date
B	DA ADDITIONAL INFO	10/10/2019
A	DA LODGEMENT	21/9/2018

Designs by Mahony
Copyright BAILLIE RESIDENCE
Block 21 Section 16
23 Parker Street
CURTIN

Drawing Name: ELEVATIONS	
Project number	017
Date	10/2019
Drawn by	gm
Checked by	Scale 1:100

western elevation
scale 1:100

UNIT 1

UNIT 2

PLANNING AND DEVELOPMENT ACT 2007
APPROVAL GRANTED
SUBJECT TO THE CONDITIONS SET OUT IN THE NOTICE OF DECISION PURSUANT TO SECTION 162
Delegate name Fawzia Majid
Date 28/11/2019

EXTERNAL WALL CLADDING SYSTEM
Cladding System to be compliant and installed with all relevant provisions of:
the National Construction Code;
the building code of Australia;
Australian standards;
approved condition of use or application; or any other applicable law or regulation.


- Amendments 10/10/2019
- 1- turning circles
 - 2- mailbox
 - 3- site lines
 - 4- shadow diagram
 - 5- solar access to unit 2
 - 6- perspectives
 - 7- wsud
 - 8- storage shed unit 2
 - 9- retaining walls
 - 10- screened windows
 - 11- height of balustrade
 - 12- cross section location
 - 13- entry advice

eastern elevation
scale 1:100

UNIT 2

UNIT 1

INSULATION
Walls R 2.0
Ceiling R 5.0

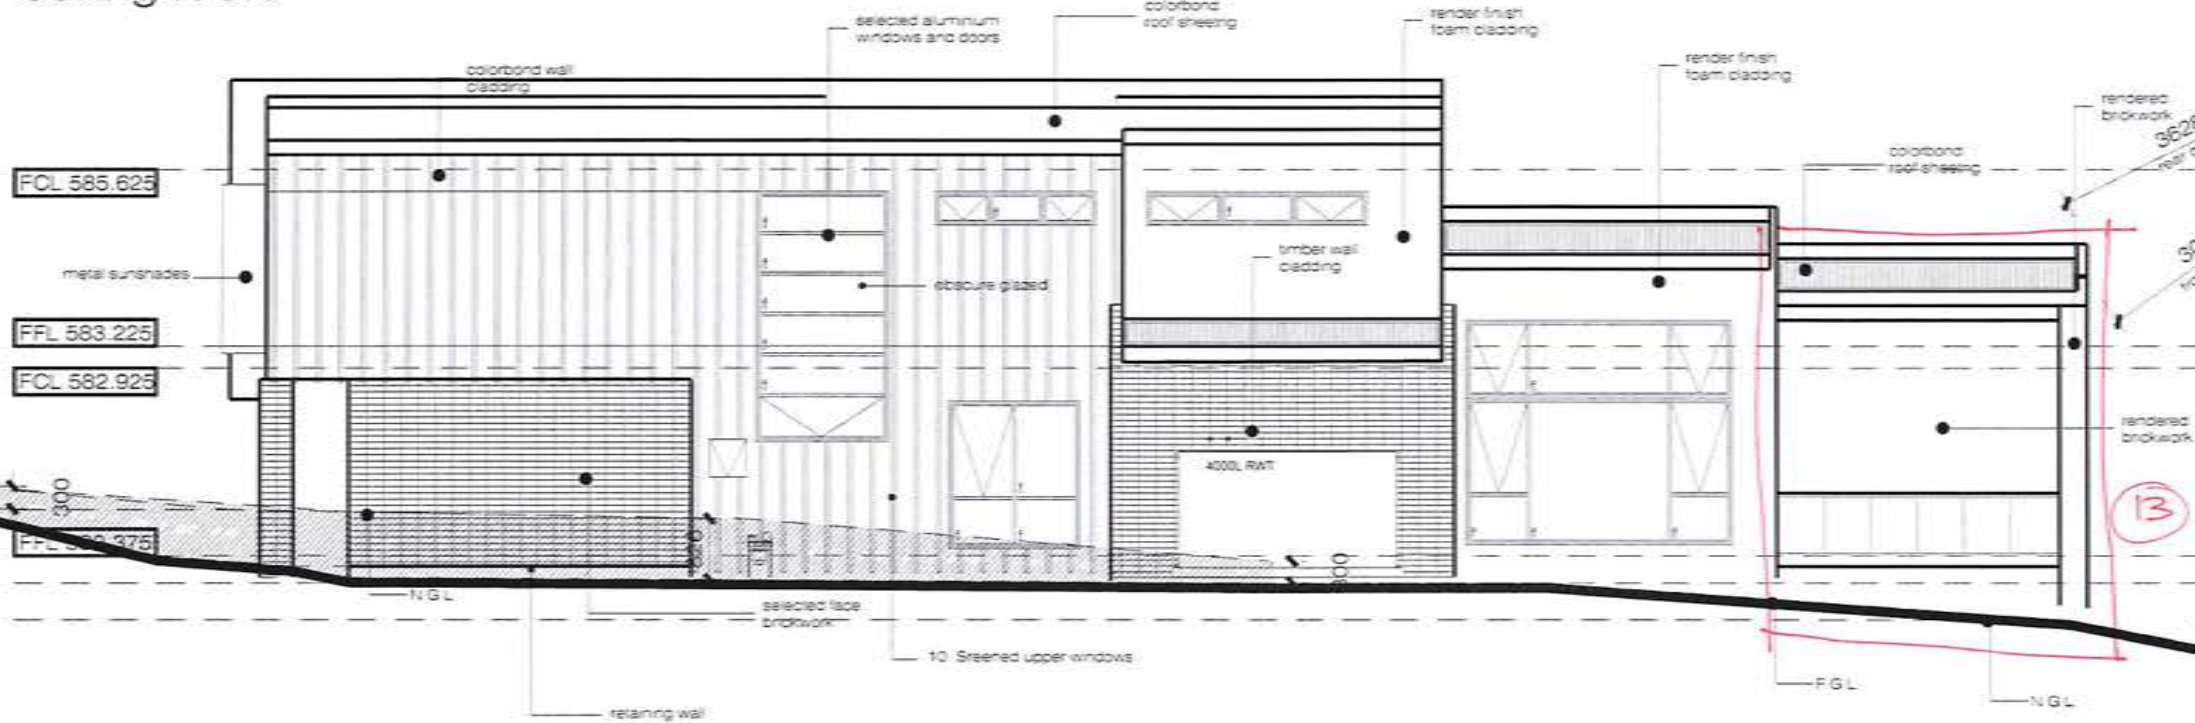

southern elevation
scale 1:100

SELECT STRUCTURE

BUILDING CERTIFICATION

Building Approval issued under
Section 28 of Building Act 2004

NCC Occupancy Class: 1a(ii), 10a, 10b

NCC Construction Type: N/A

Date: 24/06/2020

Livij Krapotic

ACT Lic No 2010979

GENERAL CONSTRUCTION REQUIREMENTS
1. DRIVEWAYS OVER GOVT NATURE STRIPS MUST BE PREPARED AND CONSTRUCTED BY A GOVT APPROVED DRIVEWAY CONTRACTOR.
2. A DRIVEWAY CONSTRUCTION APPLICATION FORM MUST BE COMPLETED AND SUBMITTED TO GOVT FOR APPROVAL PRIOR TO COMMENCEMENT OF WORK.
3. MINIMUM DRIVEWAY STANDARDS SHALL BE CONCRETE SLAB 100mm THICK F82 STEEL REINFORCED GENERALLY PLACED OFF STREET PARKING SHALL BE DESIGNED IN ACCORDANCE WITH AS 4586-2004.
FACILITIES PARKING, PART 1 OFF STREET PARKING
ENERGY EFFICIENCY REQUIREMENTS
PROVIDE AND INSTALL WEATHER STRIPS TO ALL EXTERNAL DOORS
ALL EXHAUST FANS TO INCLUDE WIND SEALING DAMPERS

MIN. 50% OF THE ROOF CATCHMENT TO BE CONNECTED TO THE 5000L RAINWATER TANK FOR EACH UNIT
GENERAL MATERIALS AND FINISHES
EXTERNAL WALLS TO BE FINISHED IN FACE BRICKWORK, 100 THICK WIG CLADDING RENDERED AND PAINTED AS ILLUSTRATED ON RESPECTIVE ELEVATIONS
WINDOWS TO BE ALUMINIUM FRAMED DOUBLE GLAZED UNITS - WINDOW SELECTION TO ACCORD WITH WINDOW SCHEDULE QUOTE PREPARED BY DESIGNS BY MAHONY AND APPROVED BY THE CLIENT. ALL COLOURS AS STATED IN BUILDING CONTRACT OR FINISHES SCHEDULE.
ROOF TO BE FINISHED IN COLORBOND ROOFINGS AS SPECIFIED IN BUILDING CONTRACT - COLOUR AS STATED IN BUILDING CONTRACT. FASCIA AND GUTTER TO BE COLORBOND - COLOUR IN ACCORDANCE WITH BUILDING CONTRACT. DOWNPIPES AS SPECIFIED WITHIN THE BUILDING CONTRACT.

Area Schedule

Lower floor living Unit 1	84.081m ²
Upper floor living Unit 1	100.800m ²
Garage Unit 1	38.000m ²
GFA Unit 1	202.881m ²
Lower floor living Unit 2	84.670m ²
Upper floor living Unit 2	79.372m ²
Carport Unit 2 (carp)	18.000m ²
(Carport area)	(33.130m ²)
GFA Unit 2	172.042m ²
TOTAL GFA	374.823m ²
Alfresco Unit 1	27.293m ²
Alfresco Unit 2	19.359m ²
Porch Unit 1	7.575m ²
Porch Unit 2	7.254m ²
Additional areas	69.040m ²
TOTAL AREA	483.530m ²
Site Area	174.000m ²
Site Coverage	48.42%

General Notes

Drawings are to be read in conjunction with the relevant Tender prepared by Designs by Mahony.
In the event that there are omissions or ambiguity between the tender and the drawings, manufacturer and builders specifications and Tender documentation will take precedence over drawings. All dimensions are to be checked on site prior to manufacture of frames and trusses and preparation of building setout by the site supervisor.

D.A. LODGEMENT

Copyright © Febule Pty Ltd TIA Designs by Mahony
Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony.

No.	Description	Date
B	DA ADDITIONAL INFO	10/10/2019
A	DA LODGEMENT	21/9/2018

Designs by Mahony
Copyright
BAILLIE RESIDENCE
Block 21 Section 16
23 Parker Street
CURTIN

Drawing Name:
ELEVATIONS


Project number:
Date: 15/2019
Drawn by: gm
Checked by:

018
Scale: 1:100

EXTERNAL WALL CLADDING SYSTEM
Cladding System to be compliant and installed with all relevant provisions of:
the National Construction Code;
the building code of Australia;
Australian standards;
approved condition of use or application; or any other applicable law or regulation.

PLANNING AND DEVELOPMENT ACT 2007
APPROVAL GRANTED
SUBJECT TO THE CONDITIONS SET OUT IN THE NOTICE OF DECISION PURSUANT TO SECTION 162
Delegate name Fawzia Majid
Date 28/11/2019

Window to comply with 60/60/60 fire separation requirements

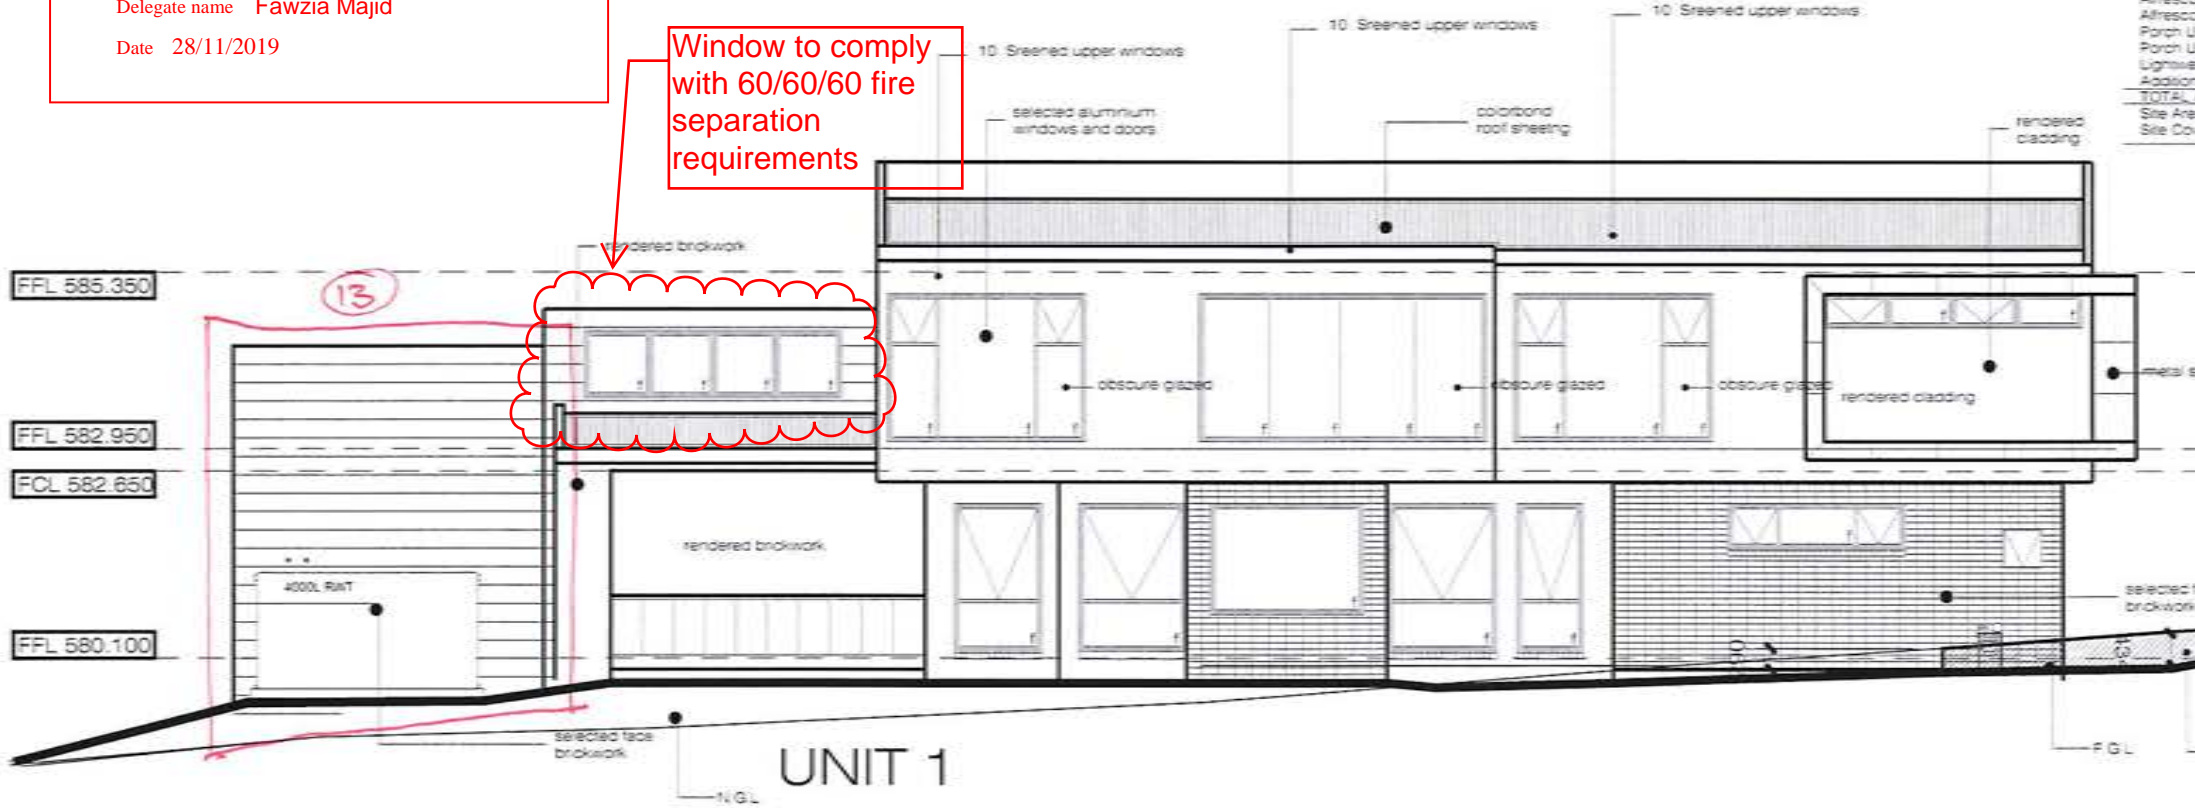

northern elevation
scale 1:100

Area Schedule

Lower floor living Unit 1	84.081m ²
Upper floor living Unit 1	100.800m ²
Garage Unit 1	36.000m ²
GFA Unit 1	202.881m ²
Lower floor living Unit 2	84.670m ²
Upper floor living Unit 2	79.372m ²
Carport Unit 2 (cold)	18.000m ²
Carport area	(33.180m ²)
GFA Unit 2	172.042m ²
TOTAL GFA	374.823m ²
Al fresco Unit 1	27.293m ²
Al fresco Unit 2	19.359m ²
Porch Unit 1	7.575m ²
Porch Unit 2	7.254m ²
Lightsell Unit 2	7.559m ²
Additional areas	69.040m ²
TOTAL AREA	453.830m ²
Site Area	774.000m ²
Site Coverage	48.42%

PLANNING AND DEVELOPMENT ACT 2007
APPROVAL GRANTED
 SUBJECT TO THE CONDITIONS SET OUT IN THE
 NOTICE OF DECISION
 PURSUANT TO SECTION 162

Delegate name **Fawzia Majid**
 Date **28/11/2019**

EXTERNAL WALL CLADDING SYSTEM
 Cladding System to be compliant and installed with all relevant provisions of:
 # the National Construction Code;
 # the building code of Australia;
 # Australian standards;
 # approved condition of use or application; or any other applicable law or regulation.

INSULATION
 Walls R 2.0
 Ceiling R 5.0



SELECT STRUCTURE
BUILDING CERTIFICATION
 Building Approval issued under
 Section 28 of Building Act 2004

NCC Occupancy Class: **1a(ii), 10a, 10b**
 NCC Construction Type: **N/A**
 Date: **24/06/2020**

FCL 585.625

FCL 582.925

FCL 582.925

FCL 580.375

Livij Krcatin
 AS 116 No. 2010979

GENERAL CONSTRUCTION REQUIREMENTS
 WALLS TO BE CONSTRUCTED IN ACCORDANCE WITH THE NATIONAL CONSTRUCTION CODE (NCC) OR ACCORDANCE WITH MANUFACTURERS SPECIFICATIONS AND THE NCC. ALL CONSTRUCTION TO BE PREPARED BY THE SUITABLY QUALIFIED ENGINEER ENGAGED FOR THE PROJECT.
 WALL AND ROOF FRAMING INCLUDING TRUSSES TO BE FIXED IN ACCORDANCE WITH MANUFACTURERS SPECIFICATIONS AND THE NCC. ALL CONSTRUCTION TO BE PREPARED BY THE SUITABLY QUALIFIED ENGINEER ENGAGED FOR THE PROJECT.
 LIGHTING TO COMPLY WITH CLAUSE 3.12.5. ARTIFICIAL LIGHTING OF THE NCC.
 WATER HEATERS TO BE INSTALLED IN ACCORDANCE WITH REQUIREMENTS OF CLAUSE 3.12.5.6 OF THE NCC.
 GENERAL NOTES
 1. DRIVEWAYS OVER GOVT NATURE STRIPS MUST BE PREPARED AND CONSTRUCTED BY A GOVT APPROVED DRIVEWAY CONTRACTOR
 2. A DRIVEWAY CONSTRUCTION APPLICATION FORM MUST BE COMPLETED AND SUBMITTED TO GOVT FOR APPROVAL PRIOR TO COMMENCEMENT OF WORK
 3. MINIMUM DRIVEWAY STANDARDS SHALL BE CONCRETE SLAB 100mm THICK F82 STEEL REINFORCED CONCRETE PLACED OFF STREET PARKING SHALL BE DESIGNED IN ACCORDANCE WITH AS 1169-2014
 FACILITIES PARKING, PART 1: OFF STREET PARKING
 ENERGY EFFICIENCY REQUIREMENTS
 PROVIDE AND INSTALL WEATHER STRIPS TO ALL EXTERNAL DOORS AND EXHAUST FANS TO INCLUDE SELF SEALING DAMPERS.
 MIN. 5% OF THE ROOF CATCHMENT TO BE CONNECTED TO THE 500L RAINWATER TANK FOR EACH UNIT
 GENERAL MATERIALS AND FINISHES
 EXTERNAL WALLS TO BE FINISHED IN FACE BRICKWORK. 100 THICK NRC CLADDING RENDERED AND PAINTED AS ILLUSTRATED ON RESPECTIVE ELEVATIONS.
 WINDOWS TO BE ALUMINIUM FRAMED DOUBLE GLAZED UNITS - WINDOW SELECTION TO ACCORD WITH WINDOW SCHEDULE QUOTE PREPARED BY DESIGNS BY MAHONY AND APPROVED BY THE CLIENT. ALL COLOURS AS STATED IN BUILDING CONTRACT OR FINISHES SCHEDULE.
 ROOF TO BE FINISHED IN COLORBOND ROOFINGS AS SPECIFIED IN BUILDING CONTRACT - COLOUR AS STATED IN BUILDING CONTRACT FASCIA AND GUTTER TO BE COLORBOND - COLOUR IN ACCORDANCE WITH BUILDING CONTRACT. DOWNPIPES AS SPECIFIED WITHIN THE BUILDING CONTRACT.

- Amendments 10/10/2019**
- 1- turning circles
 - 2- mailbox
 - 3- site lines
 - 4- shadow diagram
 - 5- solar access to unit 2
 - 6- perspectives
 - 7- wsud
 - 8- storage shed unit 2
 - 9- retaining walls
 - 10- screened windows
 - 11- height of balustrade
 - 12- cross section location
 - 13- entity advice

General Notes
 Drawings are to be read in conjunction with the relevant Tender prepared by Designs by Mahony.
 In the event that there are omissions or ambiguity between the tender and the drawings, manufacturer and builders specifications and Tender documentation will take precedence over drawings. All dimensions are to be checked on site prior to manufacture of frames and trusses and preparation of building setout by the site supervisor.

D.A. LODGEMENT

Copyright © Febule Pty Ltd TIA Designs by Mahony
 Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

No.	Description	Date
B	DA ADDITIONAL INFO	10/10/2019
A	DA LODGEMENT	21/9/2018

Designs by Mahony
 Copyright **BAILLIE RESIDENCE**
 Block 21 Section 16
 23 Parker Street
 CURTIN


Drawing Name: **SECTIONS**

Project number: _____



Date: **11/5/2019** **019**

Drawn by: **gm**

Checked by: _____ Scale: **1:100**

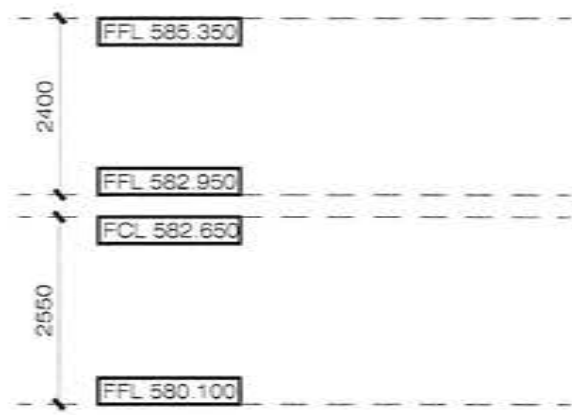

section a a
 scale 1:100

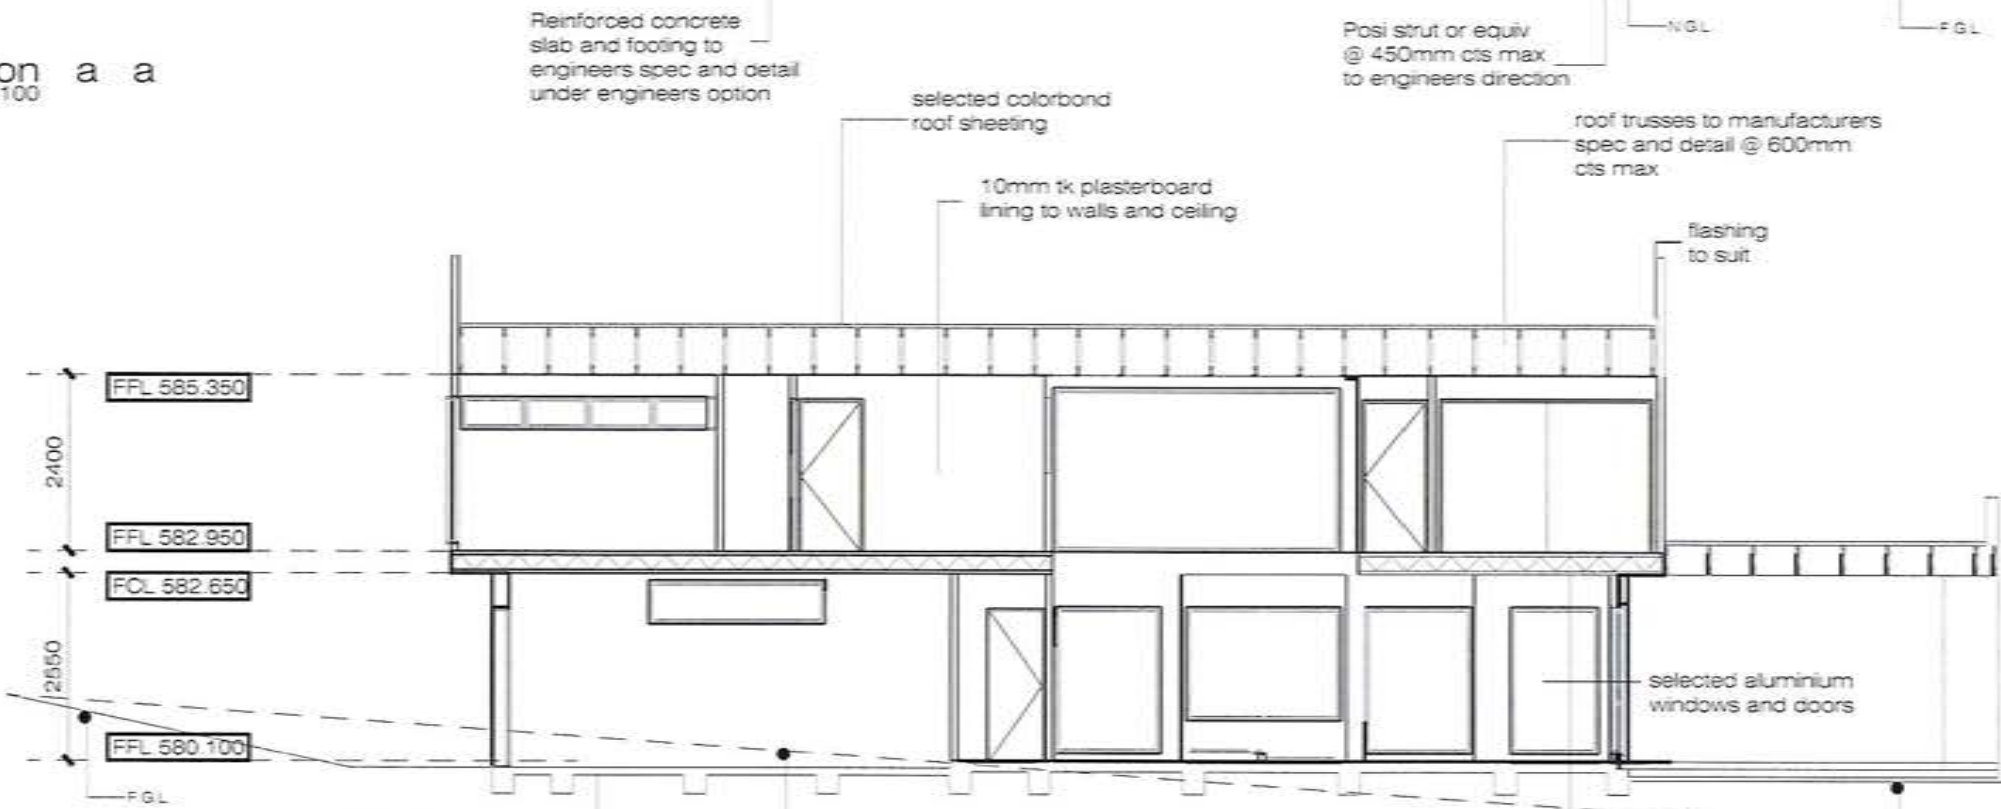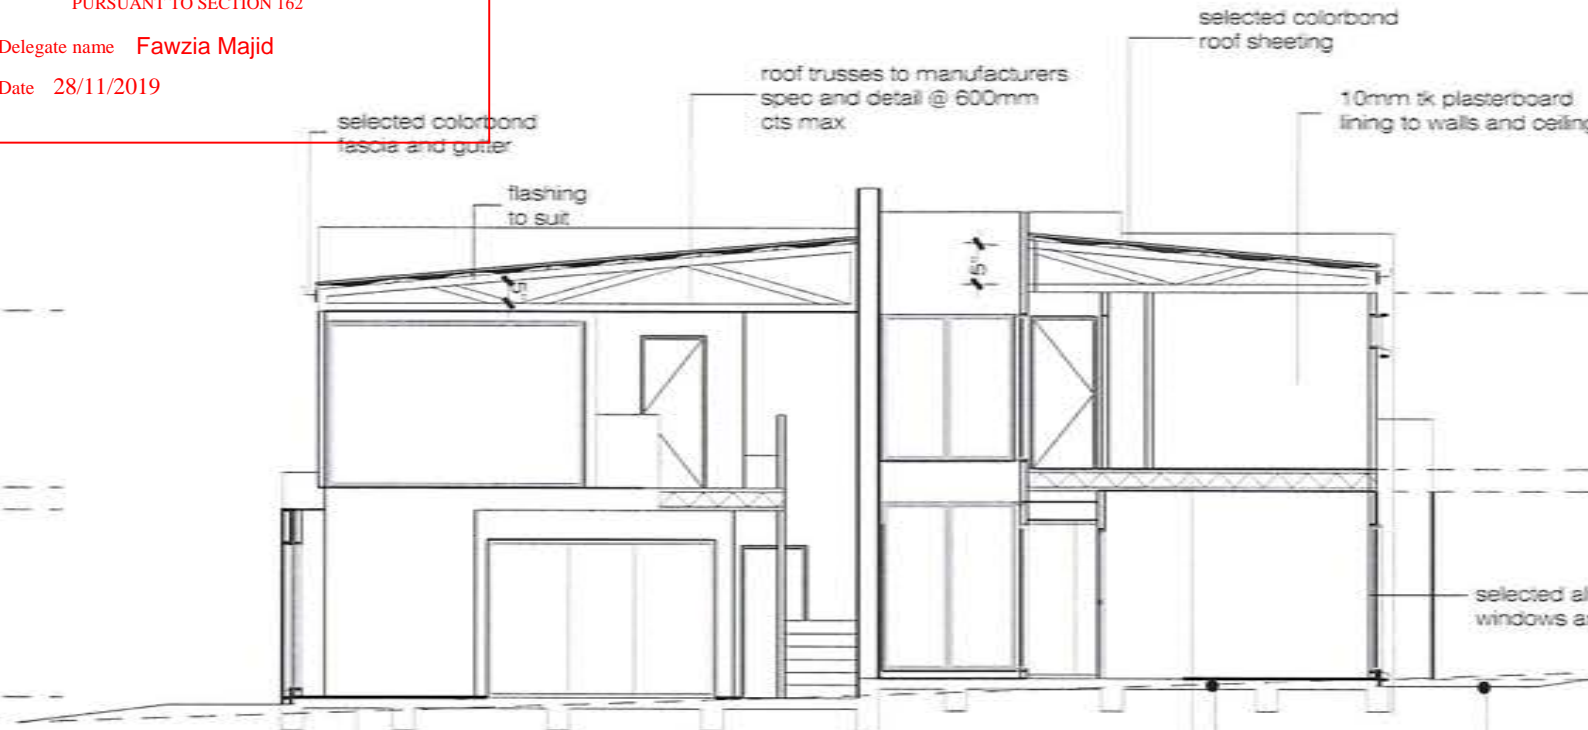

section b b
 scale 1:100

EER REQUIREMENT
 UNIT 1
 R 5.0 CEILING INSUL
 R 2.0 WALL INSULAT
 R 2.0 INSULATION T
 UPPER LEVEL
 WAFFLE SLAB TO B
 DOUBLE GLAZED W

Feralyne Finish (Colour - Vivid White)
 Standard Flat Render (Colour - Vivid White)
 Face Brick - Austral 'Symmetry Portland'
 Painted Vivid White) with deep mortar joints

to be used for patterning in entryway
 pattern bricks - 'Bowral Chillingham White' Solids - Painted Vivid White

INSULATION
Walls R 2.0
Ceiling R 5.0



SELECT STRUCTURE
BUILDING CERTIFICATION
Building Approval model
 under Section 32 of Building Act 2004
 Date: 21/09/2019
 Livij Krevatin
 ACT Lic. No. 2010979

GENERAL CONSTRUCTION REQUIREMENTS
 ALL CONCRETE FOOTINGS AND SLABS TO BE CONSTRUCTED IN ACCORDANCE WITH THE NATIONAL CONSTRUCTION CODE (NCC) OR AS NOTED ON THE RELEVANT ENGINEERING DOCUMENTATION INCLUDING DRAWINGS PREPARED BY THE SUITABLY QUALIFIED ENGINEER ENGAGED FOR THE PROJECT.

WALL AND ROOF FRAMING INCLUDING TRUSSES TO BE FIXED IN ACCORDANCE WITH MANUFACTURERS SPECIFICATIONS AND THE NCC AND IN ACCORDANCE WITH RELEVANT AUSTRALIAN STANDARDS.

LIGHTING TO COMPLY WITH CLAUSE 3.12.5.5. ARTIFICIAL LIGHTING OF THE NCC.

WATER HEATERS TO BE INSTALLED IN ACCORDANCE WITH REQUIREMENTS OF CLAUSE 3.12.5.6 OF THE NCC.

DRIVEWAY NOTES

1. DRIVEWAYS OVER GOVT NATURE STRIPS MUST BE PREPARED AND CONSTRUCTED BY A GOVT APPROVED DRIVEWAY CONTRACTOR.
2. A DRIVEWAY CONSTRUCTION APPLICATION FORM MUST BE COMPLETED AND SUBMITTED TO GOVT FOR APPROVAL PRIOR TO THE COMMENCEMENT OF WORK.
3. MINIMUM DRIVEWAY STANDARDS SHALL BE CONCRETE SLAB 100mm THICK F62 STEEL REINFORCED CENTRALLY PLACED. OFF STREET PARKING SHALL BE DESIGNED IN ACCORDANCE WITH AS/NZS 2890.1-2004.

FACILITIES PARKING, PART 1: OFF STREET PARKING.

ENERGY EFFICIENCY REQUIREMENTS

PROVIDE AND INSTALL WEATHER STRIPS TO ALL EXTERNAL DOORS. ALL EXHAUST FANS TO INCLUDE SELF SEALING DAMPERS.

MIN. 50% OF THE ROOF CATCHMENT TO BE CONNECTED TO THE 5000L RAINWATER TANK FOR EACH UNIT

GENERAL MATERIALS AND FINISHES

EXTERNAL WALLS TO BE FINISHED IN FACE BRICKWORK, 100 THICK NRG CLADDING RENDERED AND PAINTED AS ILLUSTRATED ON RESPECTIVE ELEVATIONS.
 WINDOWS TO BE ALUMINIUM FRAMED DOUBLE GLAZED UNITS - WINDOW SELECTION TO ACCORD WITH WINDOW SCHEDULE QUOTE PREPARED BY DESIGNS BY MAHONY AND APPROVED BY THE CLIENT. ALL COLOURS AS STATED IN BUILDING CONTRACT OR FINISHES SCHEDULE.
 ROOF TO BE FINISHED IN COLORBOND ROOFINGS AS SPECIFIED IN BUILDING CONTRACT - COLOUR AS STATED IN BUILDING CONTRACT. FASCIA AND GUTTER TO BE COLORBOND - COLOUR IN ACCORDANCE WITH BUILDING CONTRACT. DOWNPIPES AS SPECIFIED WITHIN THE BUILDING CONTRACT.




General Notes

Drawings are to be read in conjunction with the relevant Tender prepared by Designs by Mahony.
 In the event that there are omissions or ambiguity between the tender and the drawings, manufacturer and builders specifications and Tender documentation will take precedence over drawings. All dimensions are to be checked on site prior to manufacture of frames and trusses and preparation of building setout by the site supervisor.

D.A. LODGEMENT

Copyright © Febule Pty Ltd T/A Designs by Mahony

Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

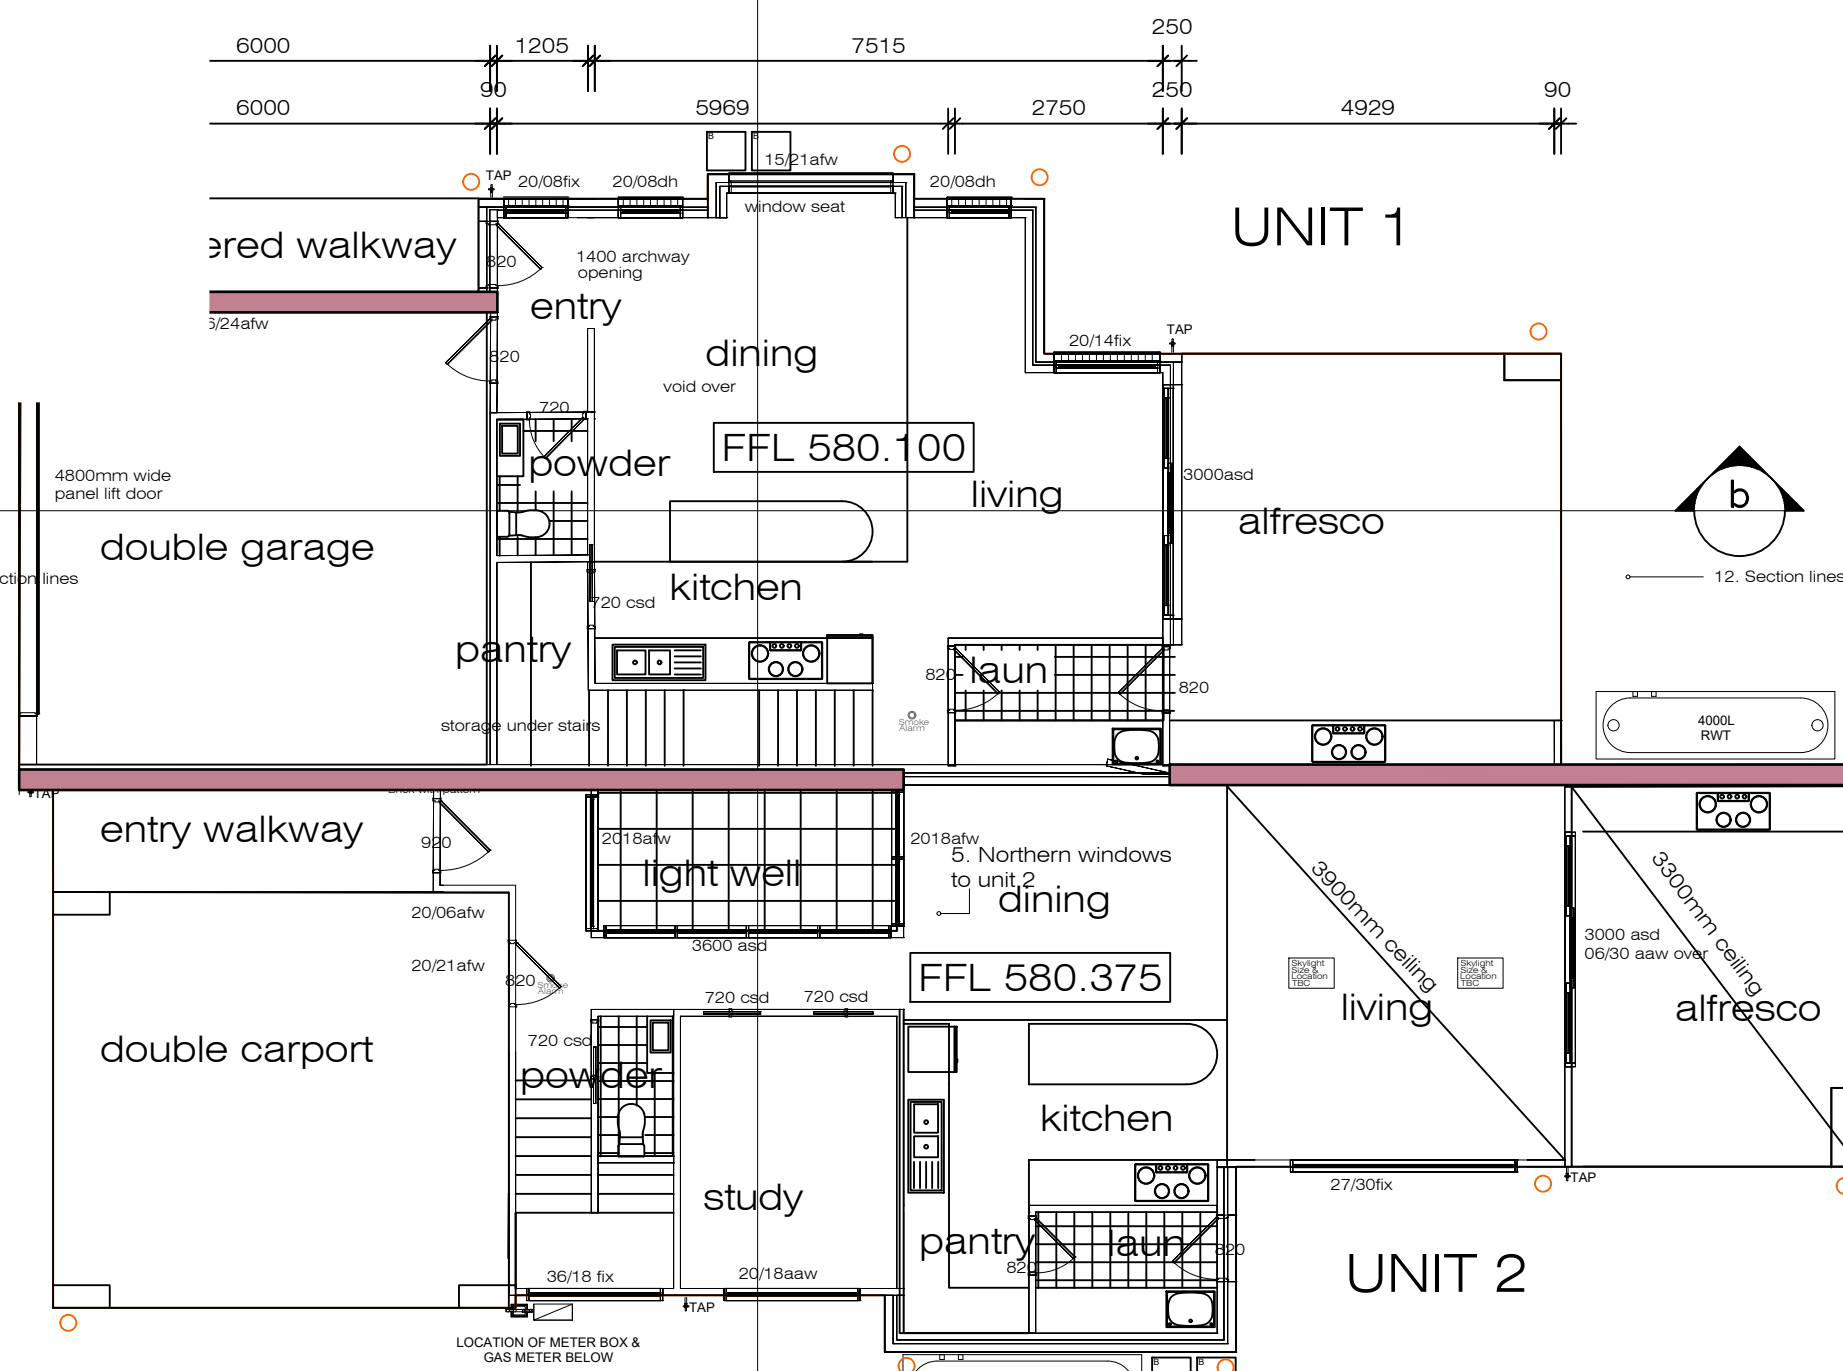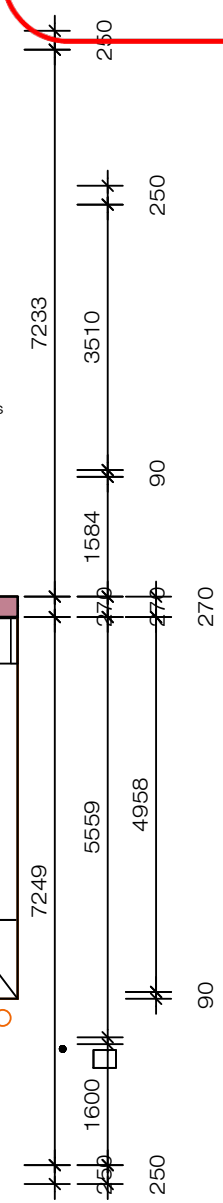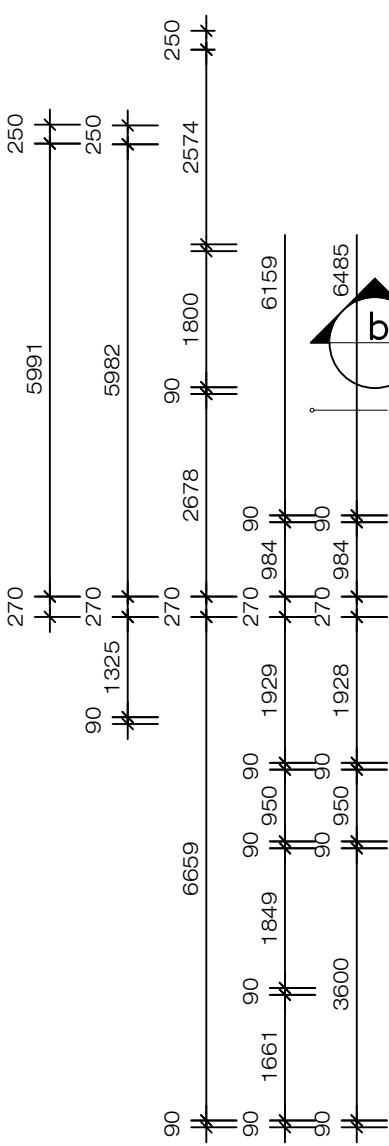

Area Schedule

Lower floor living Unit 1	64.081m ²
Upper floor living Unit 1	100.800m ²
Garage Unit 1	38.000m ²
GFA Unit 1	202.881m ²
Lower floor living Unit 2	84.670m ²
Upper floor living Unit 2	79.372m ²
Carport Unit 2 (calc)	18.000m ²
(Carport area)	(33.130m ²)
GFA Unit 2	172.042m ²
TOTAL GFA	374.823m ²
Alfresco Unit 1	27.293m ²
Alfresco Unit 2	19.359m ²
Porch Unit 1	7.575m ²
Porch Unit 2	7.254m ²
Lightwell Unit 2	7.559m ²
Additional areas	69.040m ²
TOTAL AREA	463.930m ²
Site Area	774.000m ²
Site Coverage	48.42%

UNIT 2
 R 5.0 CEILING INSULATION + R 1.3 ANTICON
 R 2.0 WALL INSULATION + SARKING
 R 2.0 INSULATION TO UNDERSIDE EXPOSED UPPER LEVEL
 WAFFLE SLAB TO BE USED
 DOUBLE GLAZED WINDOWS THROUGHOUT
 "LIGHTBRIDGE GLASS OR OTHER
 MANUFACTURER EQV U 3.5 SHGC 0.46"

lower floor plan
 scale 1:100

- Amendments 10/10/2019
- 1- turning circles
 - 2- mailbox
 - 3- site lines
 - 4- shadow diagram
 - 5- solar access to unit 2
 - 6- perspectives
 - 7- wsud
 - 8- storage shed unit 2
 - 9- retaining walls
 - 10- screened windows
 - 11- height of balustrade
 - 12- cross section location
 - 13- entry advice

EER REQUIREMENTS
 UNIT 1
 R 5.0 CEILING INS
 R 2.0 WALL INSUL
 R 2.0 INSULATION
 UPPER LEVEL
 WAFFLE SLAB TO
 DOUBLE GLAZED

Teralyne Finish (Colour - Vivid White)
 Standard Flat Render (Colour - Vivid White)
 Face Brick - Austral 'Symmetry Portland'
 (Painted Vivid White) with deep mortar joints
 s to be used for patterning in entryway
 pattern bricks - 'Bowral Chillingham White' Solids - Painted Vivid White

INSULATION
 Walls R 2.0
 Ceiling R 5.0

Area Schedule

Lower floor living Unit 1	64.83m ²
Upper floor living Unit 1	100.80m ²
Garage Unit 1	38.00m ²
GFA Unit 1	202.88m ²
Lower floor living Unit 2	84.17m ²
Upper floor living Unit 2	193.72m ²
Carport Unit 2 (calo)	19.00m ²
(Carport area)	(33.130m ²)
GFA Unit 2	172.04m ²
TOTAL GFA	374.82m ²
Alfresco Unit 1	27.293m ²
Alfresco Unit 2	19.359m ²
Porch Unit 1	7.575m ²
Porch Unit 2	7.254m ²
Lightwell Unit 2	7.559m ²
Additional areas	69.040m ²
TOTAL AREA	463.930m ²
Site Area	774.00m ²
Site Coverage	48.42%

SELECT STRUCTURE

BUILDING CERTIFICATION

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004

Building Approval needed under Section 32 of Building Act 2004



BUILDING DESIGNERS
 ASSOCIATION OF AUSTRALIA

GENERAL CONSTRUCTION REQUIREMENTS

CONCRETE FOOTINGS AND SLABS TO BE CONSTRUCTED IN ACCORDANCE WITH THE NATIONAL CONSTRUCTION CODE (NCC) OR AS NOTED ON THE RELEVANT ENGINEERING DOCUMENTATION INCLUDING DRAWINGS PREPARED BY THE SUITABLY QUALIFIED ENGINEER ENGAGED FOR THE PROJECT.

WALL AND ROOF FRAMING INCLUDING TRUSSES TO BE FIXED IN ACCORDANCE WITH MANUFACTURERS SPECIFICATIONS AND THE NCC AND IN ACCORDANCE WITH RELEVANT AUSTRALIAN STANDARDS.

LIGHTING TO COMPLY WITH CLAUSE 3.12.5.5. ARTIFICIAL LIGHTING OF THE NCC.

WATER HEATERS TO BE INSTALLED IN ACCORDANCE WITH REQUIREMENTS OF CLAUSE 3.12.5.6 OF THE NCC.

DRIVEWAY NOTES

- DRIVEWAYS OVER GOVT NATURE STRIPS MUST BE PREPARED AND CONSTRUCTED BY A GOVT APPROVED DRIVEWAY CONTRACTOR.
- A DRIVEWAY CONSTRUCTION APPLICATION FORM MUST BE COMPLETED AND SUBMITTED TO GOVT FOR APPROVAL PRIOR TO THE COMMENCEMENT OF WORK.
- MINIMUM DRIVEWAY STANDARDS SHALL BE CONCRETE SLAB 100mm THICK F62 STEEL REINFORCED CENTRALLY PLACED. OFF STREET PARKING SHALL BE DESIGNED IN ACCORDANCE WITH AS/NZS 2890.1-2004.

FACILITIES PARKING, PART 1: OFF STREET PARKING.

ENERGY EFFICIENCY REQUIREMENTS

PROVIDE AND INSTALL WEATHER STRIPS TO ALL EXTERNAL DOORS. ALL EXHAUST FANS TO INCLUDE SELF SEALING DAMPERS.

MIN. 50% OF THE ROOF CATCHMENT TO BE CONNECTED TO THE 500L RAINWATER TANK FOR EACH UNIT

GENERAL MATERIALS AND FINISHES

EXTERNAL WALLS TO BE FINISHED IN FACE BRICKWORK, 100 THICK NRG CLADDING RENDERED AND PAINTED AS ILLUSTRATED ON RESPECTIVE ELEVATIONS.
 WINDOWS TO BE ALUMINIUM FRAMED DOUBLE GLAZED UNITS - WINDOW SELECTION TO ACCORD WITH WINDOW SCHEDULE QUOTE PREPARED BY DESIGNS BY MAHONY AND APPROVED BY THE CLIENT. ALL COLOURS AS STATED IN BUILDING CONTRACT OR FINISHES SCHEDULE.
 ROOF TO BE FINISHED IN COLORBOND ROOFINGS AS SPECIFIED IN BUILDING CONTRACT - COLOUR AS STATED IN BUILDING CONTRACT. FASCIA AND GUTTER TO BE COLORBOND - COLOUR IN ACCORDANCE WITH BUILDING CONTRACT. DOWNPIPES AS SPECIFIED WITHIN THE BUILDING CONTRACT.

General Notes

- Drawings are to be read in conjunction with the relevant Tender prepared by Designs by Mahony.
- In the event that there are omissions or ambiguity between the tender and the drawings, manufacturer and builders specifications and Tender documentation will take precedence over drawings. All dimensions are to be checked on site prior to manufacture of frames and trusses and preparation of building setout by the site supervisor.

D.A. LODGEMENT

Copyright © Febule Pty Ltd T/A Designs by Mahony

Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

No.	Description	Date
C		
B	DA ADDITIONAL INFO	10/10/2019
A	DA LODGEMENT	21/9/2018





Designs by Mahony
 Copyright © BAILLIE RESIDENCE
 Block 21 Section 16
 23 Parker Street
 CURTIN

Drawing Name:
 UPPER FLOOR PLAN

Project number		016
Date	1/5/2019	
Drawn by	gm	
Checked by		
Scale		1:100

UNIT 2
 R 5.0 CEILING INSULATION + R 1.3 ANTICON
 R 2.0 WALL INSULATION + SARKING
 R 2.0 INSULATION TO UNDERSIDE EXPOSED UPPER LEVEL
 WAFFLE SLAB TO BE USED
 DOUBLE GLAZED WINDOWS THROUGHOUT
 "LIGHTBRIDGE GLASS OR OTHER
 MANUFACTURER EQV U 3.5 SHGC 0.46"

upper floor plan
 scale 1:100

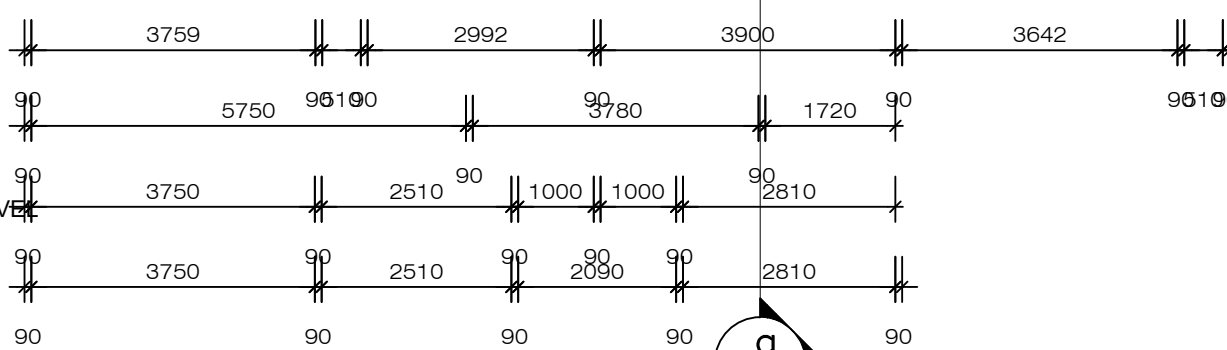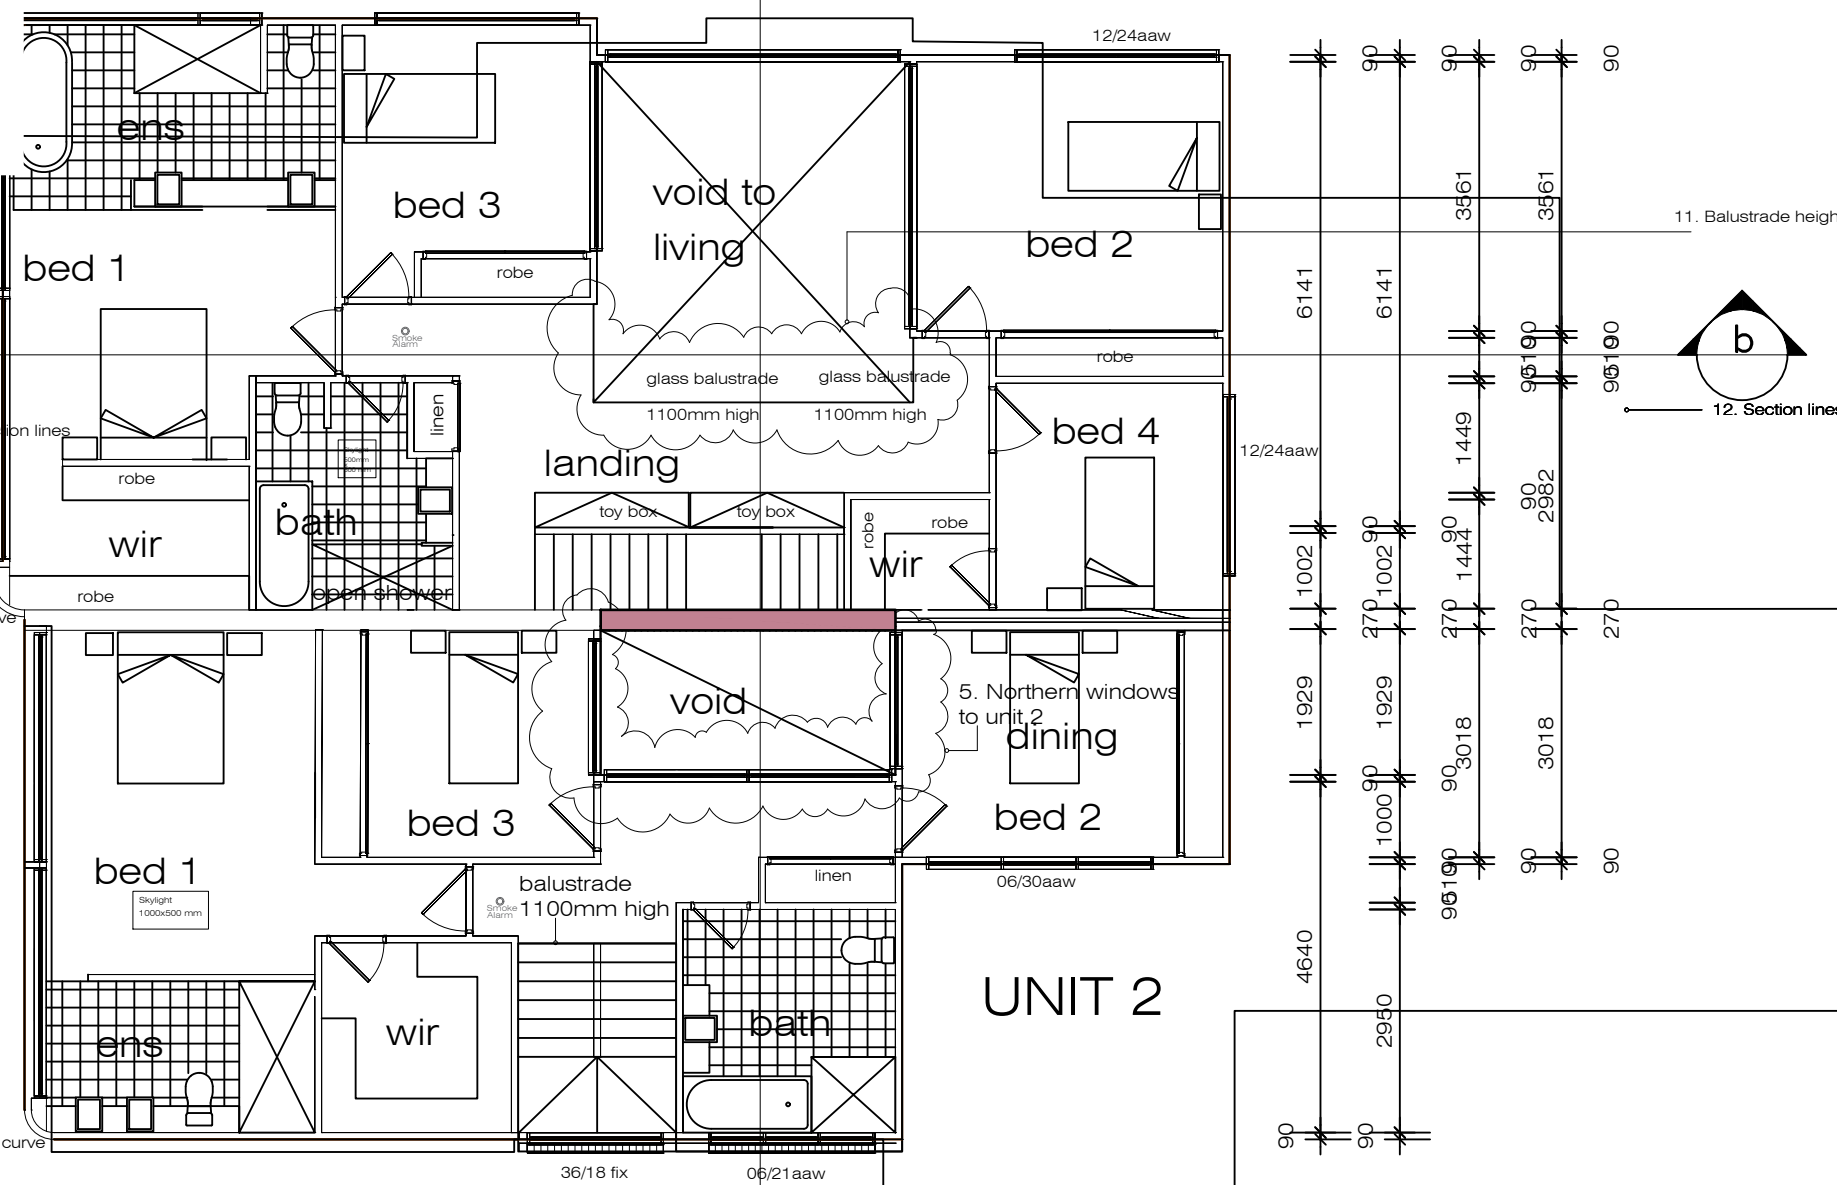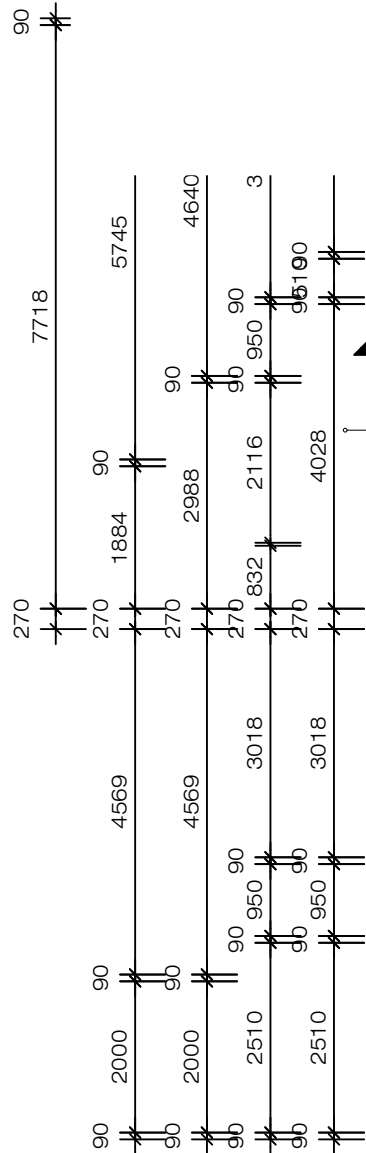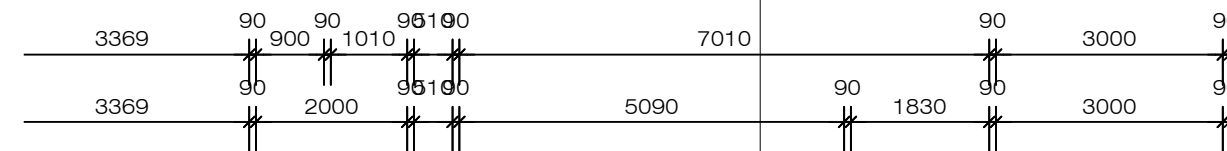

- Amendments 10/10/2019
- turning circles
 - mailbox
 - site lines
 - shadow diagram
 - solar access to unit 2
 - perspectives
 - wsud
 - storage shed unit 2
 - retaining walls
 - screened windows
 - height of balustrade
 - cross section location
 - entity advice

INSULATI
Walls R 2
Ceiling R 5

SELECT STRUCTURE
BUILDING CERTIFICATION

Building Approval
under Section 32 of Building Act 2004

Date: 21/09/2019

Livij Krevatin

ACT Lic. No. 2010979

GENERAL CONSTRUCTION REQUIREMENTS
ALL CONCRETE FOOTINGS AND SLABS TO BE CONSTRUCTED IN ACCORDANCE WITH THE NATIONAL CONSTRUCTION CODE (NCC) OR AS NOTED ON THE RELEVANT ENGINEERING DOCUMENTATION INCLUDING DRAWINGS PREPARED BY THE SUITABLY QUALIFIED ENGINEER ENGAGED FOR THE PROJECT.

WALL AND ROOF FRAMING INCLUDING TRUSSES TO BE FIXED IN ACCORDANCE WITH MANUFACTURERS SPECIFICATIONS AND THE NCC AND IN ACCORDANCE WITH RELEVANT AUSTRALIAN STANDARDS.

LIGHTING TO COMPLY WITH CLAUSE 3.12.5.5. ARTIFICIAL LIGHTING OF THE NCC.

WATER HEATERS TO BE INSTALLED IN ACCORDANCE WITH REQUIREMENTS OF CLAUSE 3.12.5.6 OF THE NCC.

DRIVEWAY NOTES

1. DRIVEWAYS OVER GOVT NATURE STRIPS MUST BE PREPARED AND CONSTRUCTED BY A GOVT APPROVED DRIVEWAY CONTRACTOR.
2. A DRIVEWAY CONSTRUCTION APPLICATION FORM MUST BE COMPLETED AND SUBMITTED TO GOVT FOR APPROVAL PRIOR TO THE COMMENCEMENT OF WORK.
3. MINIMUM DRIVEWAY STANDARDS SHALL BE CONCRETE SLAB 100mm THICK F62 STEEL REINFORCED CENTRALLY PLACED. OFF STREET PARKING SHALL BE DESIGNED IN ACCORDANCE WITH AS/NZS 2890.1:2004 -

FACILITIES PARKING, PART 1: OFF STREET PARKING.

ENERGY EFFICIENCY REQUIREMENTS

PROVIDE AND INSTALL WEATHER STRIPS TO ALL EXTERNAL DOORS. ALL EXHAUST FANS TO INCLUDE SELF SEALING DAMPERS.

MIN. 50% OF THE ROOF CATCHMENT TO BE CONNECTED TO THE 5000L RAINWATER TANK FOR EACH UNIT

GENERAL MATERIALS AND FINISHES

EXTERNAL WALLS TO BE FINISHED IN FACE BRICKWORK, 100 THICK NRG CLADDING RENDERED AND PAINTED AS ILLUSTRATED ON RESPECTIVE ELEVATIONS.
WINDOWS TO BE ALUMINIUM FRAMED DOUBLE GLAZED UNITS - WINDOW SELECTION TO ACCORD WITH WINDOW SCHEDULE QUOTE PREPARED BY DESIGNS BY MAHONY AND APPROVED BY THE CLIENT. ALL COLOURS AS STATED IN BUILDING CONTRACT OR FINISHES SCHEDULE.
ROOF TO BE FINISHED IN COLORBOND ROOFINGS AS SPECIFIED IN BUILDING CONTRACT - COLOUR AS STATED IN BUILDING CONTRACT. FASCIA AND GUTTER TO BE COLORBOND - COLOUR IN ACCORDANCE WITH BUILDING CONTRACT. DOWNPIPES AS SPECIFIED WITHIN THE BUILDING CONTRACT.

General Notes

Drawings are to be read in conjunction with the relevant Tender prepared by Designs by Mahony.
In the event that there are omissions or ambiguity between the tender and the drawings, manufacturer and builders specifications and Tender documentation will take precedence over drawings. All dimensions are to be checked on site prior to manufacture of frames and trusses and preparation of building set out by the site supervisor.

D.A. LODGEMENT

Copyright © Febule Pty Ltd T/A Designs by Mahony

Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

No.	Description	Date
C		
B	DA ADDITIONAL INFO	10/10/2019
A	DA LODGEMENT	21/9/2018

Designs by Mahony
Copyright © BAILLIE RESIDENCE
Block 21 Section 16
23 Parker Street
CURTIN

Drawing Name:

ELEVATIONS

Project number

Date 1/5/2019

Drawn by gm

Checked by

018

Scale 1:100

FCL 585.625

FFL 583.225

FCL 582.925

FFL 580.375

southern elevation
scale 1:100

- Teralyne Finish (Colour - Vivid White)
- Standard Flat Render (Colour - Vivid White)
- Face Brick - Austral 'Symmetry Portland' (Painted Vivid White) with deep mortar joints

*Note - Bricks to be used for patterning in entryway
Face Brick Pattern bricks - 'Bowral Chillingham White' Solids - Painted Vivid White

1. Remove the high level window in the tenancy firewall which views into the unit 2 living area void
2. Cladding details changed as indicated. Cladding types foam render, brick render, brick feature wall, decorative timber look aluminium battens.
3. Revised EER
4. Sunshade removed
5. Front façade windows stepped in to façade with false wall.
6. Added external door to carport.

Area Schedule

Lower floor living Unit 1	64.081m2
Upper floor living Unit 1	100.800m2
Garage Unit 1	38.000m2
GFA Unit 1	202.881m2
Lower floor living Unit 2	84.670m2
Upper floor living Unit 2	79.372m2
Carport Unit 2 (calc)	18.000m2
(Carport area)	(33.130m2)
GFA Unit 2	172.042m2
TOTAL GFA	374.823m2
Alfresco Unit 1	27.293m2
Alfresco Unit 2	19.359m2
Porch Unit 1	7.575m2
Porch Unit 2	7.254m2
Lightwell Unit 2	7.559m2
Additional areas	69.040m2
TOTAL AREA	463.930m2
Site Area	774.000m2
Site Coverage	48.42%

FFL 585.350


FFL 582.950

FCL 582.650

FFL 580.100

northern elevation
scale 1:100


INSULAT
Walls R:
Ceiling R

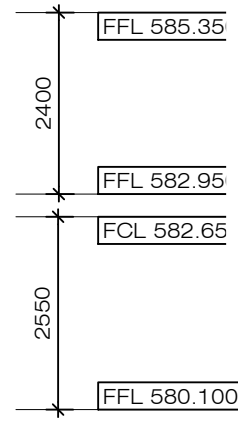

western elevation
scale 1:100

- Teralyne Finish (Colour - Vivid White)
- Standard Flat Render (Colour - Vivid White)
- Face Brick - Austral 'Symmetry Portland' (Painted Vivid White) with deep mortar joints

*Note - Bricks to be used for patterning in entryway
Face Brick Pattern bricks - 'Bowral Chillingham White' Solids - Painted Vivid White

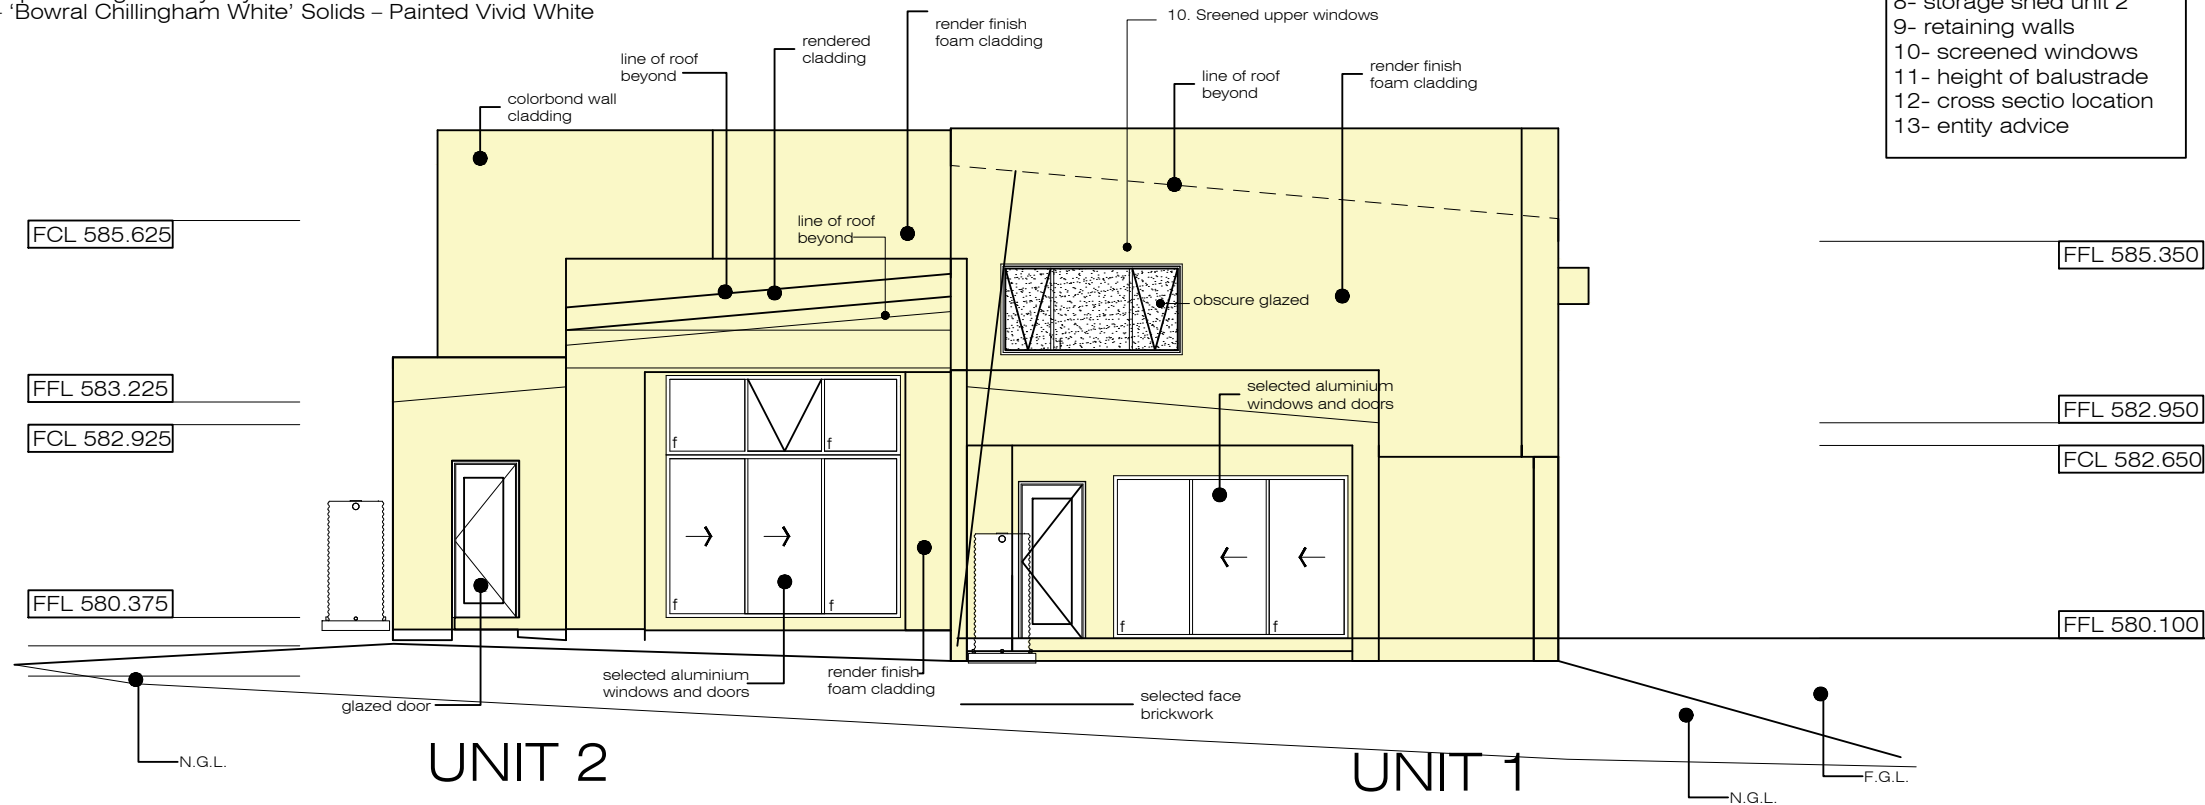

eastern elevation
scale 1:100

Area Schedule **SELECT STRUCTURE**

Lower floor living Unit 1	64.800m ²
Upper floor living Unit 1	100.800m ²
Garage Unit 1	38.000m ²
GFA Unit 1	202.881m ²
Lower floor living Unit 2	69.372m ²
Upper floor living Unit 2	79.372m ²
Carport Unit 2 (calc) (Carport area)	(33.130m ²)
GFA Unit 2	172.042m ²
TOTAL GFA	374.823m ²
Alfresco Unit 1	27.293m ²
Alfresco Unit 2	19.359m ²
Porch Unit 1	7.575m ²
Porch Unit 2	7.254m ²
Lightwell Unit 2	7.559m ²
Additional areas	69.040m ²
TOTAL AREA	463.930m ²
Site Area	774.000m ²
Site Coverage	48.42%

BUILDING CERTIFICATION
Building Approval model
under section 32 of Building Act 2004
Date: 21/09/2019
Livij Krevatin
Lic. No. 2010979



GENERAL CONSTRUCTION REQUIREMENTS
ALL CONCRETE FOOTINGS AND SLABS TO BE CONSTRUCTED IN ACCORDANCE WITH THE NATIONAL CONSTRUCTION CODE (NCC) OR AS NOTED ON THE RELEVANT ENGINEERING DOCUMENTATION INCLUDING DRAWINGS PREPARED BY THE SUITABLY QUALIFIED ENGINEER ENGAGED FOR THE PROJECT.

WALL AND ROOF FRAMING INCLUDING TRUSSES TO BE FIXED IN ACCORDANCE WITH MANUFACTURERS SPECIFICATIONS AND THE NCC AND IN ACCORDANCE WITH RELEVANT AUSTRALIAN STANDARDS.

LIGHTING TO COMPLY WITH CLAUSE 3.12.5.5. ARTIFICIAL LIGHTING OF THE NCC.

WATER HEATERS TO BE INSTALLED IN ACCORDANCE WITH REQUIREMENTS OF CLAUSE 3.12.5.6 OF THE NCC.

- DRIVEWAY NOTES
1. DRIVEWAYS OVER GOVT NATURE STRIPS MUST BE PREPARED AND CONSTRUCTED BY A GOVT APPROVED DRIVEWAY CONTRACTOR.
 2. A DRIVEWAY CONSTRUCTION APPLICATION FORM MUST BE COMPLETED AND SUBMITTED TO GOVT FOR APPROVAL PRIOR TO THE COMMENCEMENT OF WORK.
 3. MINIMUM DRIVEWAY STANDARDS SHALL BE CONCRETE SLAB 100mm THICK F62 STEEL REINFORCED CENTRALLY PLACED. OFF STREET PARKING SHALL BE DESIGNED IN ACCORDANCE WITH AS/NZS 2890.1:2004 -

FACILITIES PARKING, PART 1: OFF STREET PARKING.

ENERGY EFFICIENCY REQUIREMENTS
PROVIDE AND INSTALL WEATHER STRIPS TO ALL EXTERNAL DOORS. ALL EXHAUST FANS TO INCLUDE SELF SEALING DAMPERS.

MIN. 50% OF THE ROOF CATCHMENT TO BE CONNECTED TO THE 5000L RAINWATER TANK FOR EACH UNIT

GENERAL MATERIALS AND FINISHES
EXTERNAL WALLS TO BE FINISHED IN FACE BRICKWORK, 100 THICK NRG CLADDING RENDERED AND PAINTED AS ILLUSTRATED ON RESPECTIVE ELEVATIONS.
WINDOWS TO BE ALUMINIUM FRAMED DOUBLE GLAZED UNITS - WINDOW SELECTION TO ACCORD WITH WINDOW SCHEDULE QUOTE PREPARED BY DESIGNS BY MAHONY AND APPROVED BY THE CLIENT. ALL COLOURS AS STATED IN BUILDING CONTRACT OR FINISHES SCHEDULE.
ROOF TO BE FINISHED IN COLORBOND ROOFINGS AS SPECIFIED IN BUILDING CONTRACT - COLOUR AS STATED IN BUILDING CONTRACT. FASCIA AND GUTTER TO BE COLORBOND - COLOUR IN ACCORDANCE WITH BUILDING CONTRACT. DOWNPIPES AS SPECIFIED WITHIN THE BUILDING CONTRACT.

- Amendments 10/10/2019
- 1- turning circles
 - 2- mailbox
 - 3- site lines
 - 4- shadow diagram
 - 5- solar access to unit 2
 - 6- perspectives
 - 7- wsud
 - 8- storage shed unit 2
 - 9- retaining walls
 - 10- screened windows
 - 11- height of balustrade
 - 12- cross section location
 - 13- entity advice

General Notes
Drawings are to be read in conjunction with the relevant Tender prepared by Designs by Mahony.
In the event that there are omissions or ambiguity between the tender and the drawings, manufacturer and builders specifications and Tender documentation will take precedence over drawings. All dimensions are to be checked on site prior to manufacture of frames and trusses and preparation of building setout by the site supervisor.

D.A. LODGEMENT

Copyright © Febule Pty Ltd T/A Designs by Mahony
Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

No.	Description	Date
C		
B	DA ADDITIONAL INFO	10/10/2019
A	DA LODGEMENT	21/9/2018

Designs by Mahony
Copyright **BAILLIE RESIDENCE**
Block 21 Section 16
23 Parker Street
CURTIN

Drawing Name:
ELEVATIONS

Project number	017	
Date		1/5/2019
Drawn by		gm
Checked by		
Scale	1:100	

Area Schedule

Lower floor living Unit 1	64.081m ²
Upper floor living Unit 1	100.800m ²
Garage Unit 1	38.000m ²
GFA Unit 1	202.881m ²
Lower floor living Unit 2	84.670m ²
Upper floor living Unit 2	79.372m ²
Carport Unit 2 (calc)	18.000m ²
(Carport area)	(33.130m ²)
GFA Unit 2	172.042m ²
TOTAL GFA	374.823m ²
Alfresco Unit 1	27.293m ²
Alfresco Unit 2	19.359m ²
Porch Unit 1	7.575m ²
Porch Unit 2	7.254m ²
Lightwell Unit 2	7.559m ²
Additional areas	69.040m ²
TOTAL AREA	463.930m ²
Site Area	774.000m ²
Site Coverage	48.42%

Amendment

FFL as per survey ID

- UNIT 1
- R 5.0 CEILING INSULATION + R 1.3 ANTICON
- R 2.0 WALL INSULATION + SARKING
- R 2.0 INSULATION TO UNDERSIDE EXPOSED UPPER LEVEL
- WAFFLE SLAB TO BE USED
- DOUBLE GLAZED WINDOWS THROUGHOUT

HOUSE ENERGY RATING

110.3 MJ/m² / ANNUM 7.3 STARS

20-10-2018

SULAIMAN AKBARI

SULAKBARI

ASSESSOR

INSULATION SELECT STRUCTURE

Walls R 2.0

Ceiling R 5.0

BUILDING CERTIFICATION

Building Approval needs

under Section 32 of Building Act 2000

Date: 19/12/2018

Livij Krevatin

ACT Lic. No. 2010979



GENERAL CONSTRUCTION REQUIREMENTS

ALL CONCRETE FOOTINGS AND SLABS TO BE CONSTRUCTED IN ACCORDANCE WITH THE NATIONAL CONSTRUCTION CODE (NCC) OR AS NOTED ON THE RELEVANT ENGINEERING DOCUMENTATION INCLUDING DRAWINGS PREPARED BY THE SUITABLY QUALIFIED ENGINEER ENGAGED FOR THE PROJECT.

WALL AND ROOF FRAMING INCLUDING TRUSSES TO BE FIXED IN ACCORDANCE WITH MANUFACTURERS SPECIFICATIONS AND THE NCC AND IN ACCORDANCE WITH RELEVANT AUSTRALIAN STANDARDS.

LIGHTING TO COMPLY WITH CLAUSE 3.12.5.5. ARTIFICIAL LIGHTING OF THE NCC.

WATER HEATERS TO BE INSTALLED IN ACCORDANCE WITH REQUIREMENTS OF CLAUSE 3.12.5.6 OF THE NCC.

DRIVEWAY NOTES

- DRIVEWAYS OVER GOVT NATURE STRIPS MUST BE PREPARED AND CONSTRUCTED BY A GOVT APPROVED DRIVEWAY CONTRACTOR.
- A DRIVEWAY CONSTRUCTION APPLICATION FORM MUST BE COMPLETED AND SUBMITTED TO GOVT FOR APPROVAL PRIOR TO THE COMMENCEMENT OF WORK.
- MINIMUM DRIVEWAY STANDARDS SHALL BE CONCRETE SLAB 100mm THICK F62 STEEL REINFORCED CENTRALLY PLACED. OFF STREET PARKING SHALL BE DESIGNED IN ACCORDANCE WITH AS/NZS 2890.1-2004 -

FACILITIES PARKING, PART 1: OFF STREET PARKING.

ENERGY EFFICIENCY REQUIREMENTS

PROVIDE AND INSTALL WEATHER STRIPS TO ALL EXTERNAL DOORS. ALL EXHAUST FANS TO INCLUDE SELF SEALING DAMPERS.

MIN. 50% OF THE ROOF CATCHMENT TO BE CONNECTED TO THE 5000L RAINWATER TANK FOR EACH UNIT

GENERAL MATERIALS AND FINISHES

EXTERNAL WALLS TO BE FINISHED IN FACE BRICKWORK. 100 THICK NRG CLADDING RENDERED AND PAINTED AS ILLUSTRATED ON RESPECTIVE ELEVATIONS.

WINDOWS TO BE ALUMINIUM FRAMED DOUBLE GLAZED UNITS - WINDOW SELECTION TO ACCORD WITH WINDOW SCHEDULE QUOTE PREPARED BY DESIGNS BY MAHONY AND APPROVED BY THE CLIENT. ALL COLOURS AS STATED IN BUILDING CONTRACT OR FINISHES SCHEDULE.

ROOF TO BE FINISHED IN COLORBOND ROOFINGS AS SPECIFIED IN BUILDING CONTRACT - COLOUR AS STATED IN BUILDING CONTRACT. FASCIA AND GUTTER TO BE COLORBOND - COLOUR IN ACCORDANCE WITH BUILDING CONTRACT. DOWNPIPES AS SPECIFIED WITHIN THE BUILDING CONTRACT.

General Notes

Drawings are to be read in conjunction with the relevant Tender prepared by Designs by Mahony.

In the event that there are omissions or ambiguity between the tender and the drawings, manufacturer and builders specifications and Tender documentation will take precedence over drawings. All dimensions are to be checked on site prior to manufacture of frames and trusses and preparation of building setout by the site supervisor.

D.A. LODGEMENT

Copyright © Febule Pty Ltd T/A Designs by Mahony


Copying all or part of this design or drawing is in breach of copyright law. This document remains the property of Designs by Mahony

No.	Description	Date
A	DA LODGEMENT	21/9/2018

Designs by Mahony
Copyright BAILLIE RESIDENCE
Block 21 Section 16
23 Parker Street
CURTIN

Drawing Name:
SITE PLAN

Project number	009	
Date		21/9/2018
Drawn by		gm
Checked by		
Scale		1:200

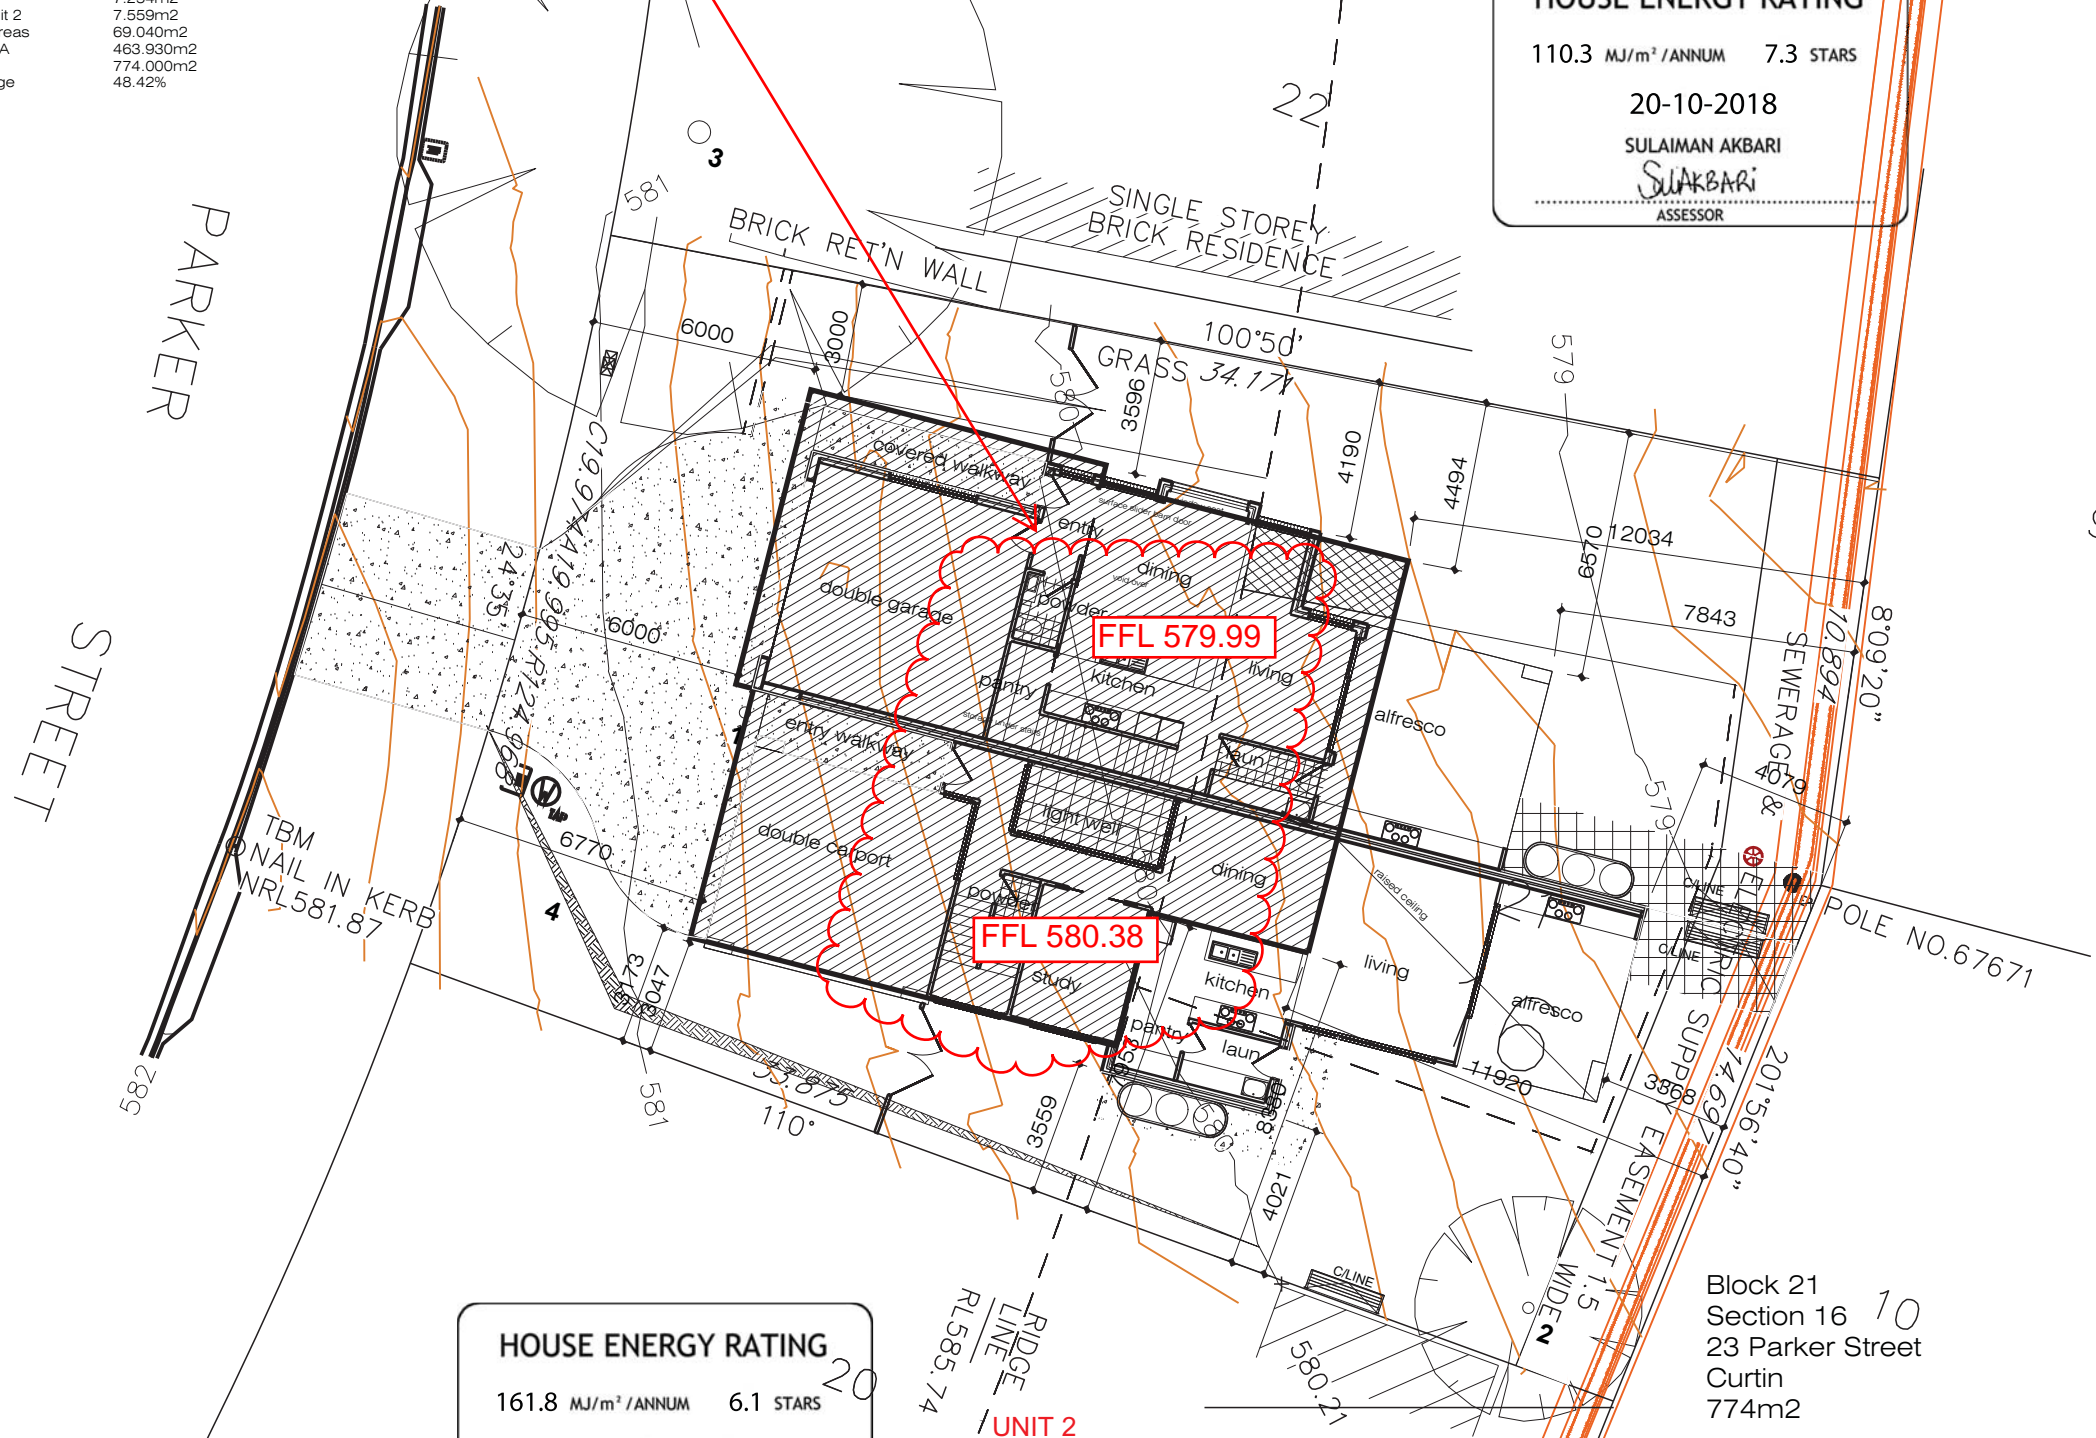

HOUSE ENERGY RATING

161.8 MJ/m² / ANNUM 6.1 STARS

20-10-2018

SULAIMAN AKBARI

SULAKBARI

ASSESSOR

- UNIT 2
- R 5.0 CEILING INSULATION + R 1.3 ANTICON
- R 2.0 WALL INSULATION + SARKING
- R 2.0 INSULATION TO UNDERSIDE EXPOSED UPPER LEVEL
- WAFFLE SLAB TO BE USED
- DOUBLE GLAZED WINDOWS THROUGHOUT
- THERMALLY BROKEN FRAMES TO BE USED FOR LIGHT WELL WINDOWS

Block 21
Section 16
23 Parker Street
Curtin
774m²



Certificate of Occupancy and Use

Certificate No.: **B20215484C1**

Access Canberra Land, Planning and Building Services

ABN 16 479 763 216
8 Darling Street Mitchell
GPO Box 158 ACT 2601
www.act.gov.au/accesscbr

This Certificate is issued in accordance with Section 69 (2) of the Building Act 2004.

The building work listed on this certificate has been completed substantially in accordance with the prescribed requirements and is considered fit for occupation and use.

Unit	Block	Section	Division (Suburb)	District	Jurisdiction
	21	16	CURTIN	WODEN VALLEY	Australian Capital Territory

Plans
B20215484/A
B20215484/B

Building Works

Class of Occupancy	Nature of Work	Project Item Description	Other Description	Type Of Const.	Unit	BCN ID	Builder
10b	New	DA EXEMPT-SWIMMING POOL	Pool Safety Barrier	NA		B20215484N1	PARLIAMENT CONSTRUCTIONS PTY LTD
10a	Other	DA EXEMPT-SEE DESCRIPTION	Swimming pool associated deck (Unit 1 only)	NA	1	B20215484N1	PARLIAMENT CONSTRUCTIONS PTY LTD

Comments

Important Note:

The issue, under this Part, of a certificate in respect of a building or portion of a building does not affect the liability of a person to comply with the provisions of a law of the territory (including this Act) relating to the building or portion of the building.


Issued by: Sian OSullivan

Issued on: 23/02/2023

Delegate of the ACT Construction Occupations Registrar.

SELECT STRUCTURE
BUILDING CERTIFICATION
Building Approval issued under
Section 28 of Building Act 2004
NCC Occupancy Class: **10a, 10b**
NCC Construction Type: **N/A**
Date: **27/10/2021**
and
VERIFICATION OF
DA EXEMPT STATUS
Linj Kraonlin
ACT Lic. No. 2010979

This Approval is related to the
Plunge pool and its associated
deck

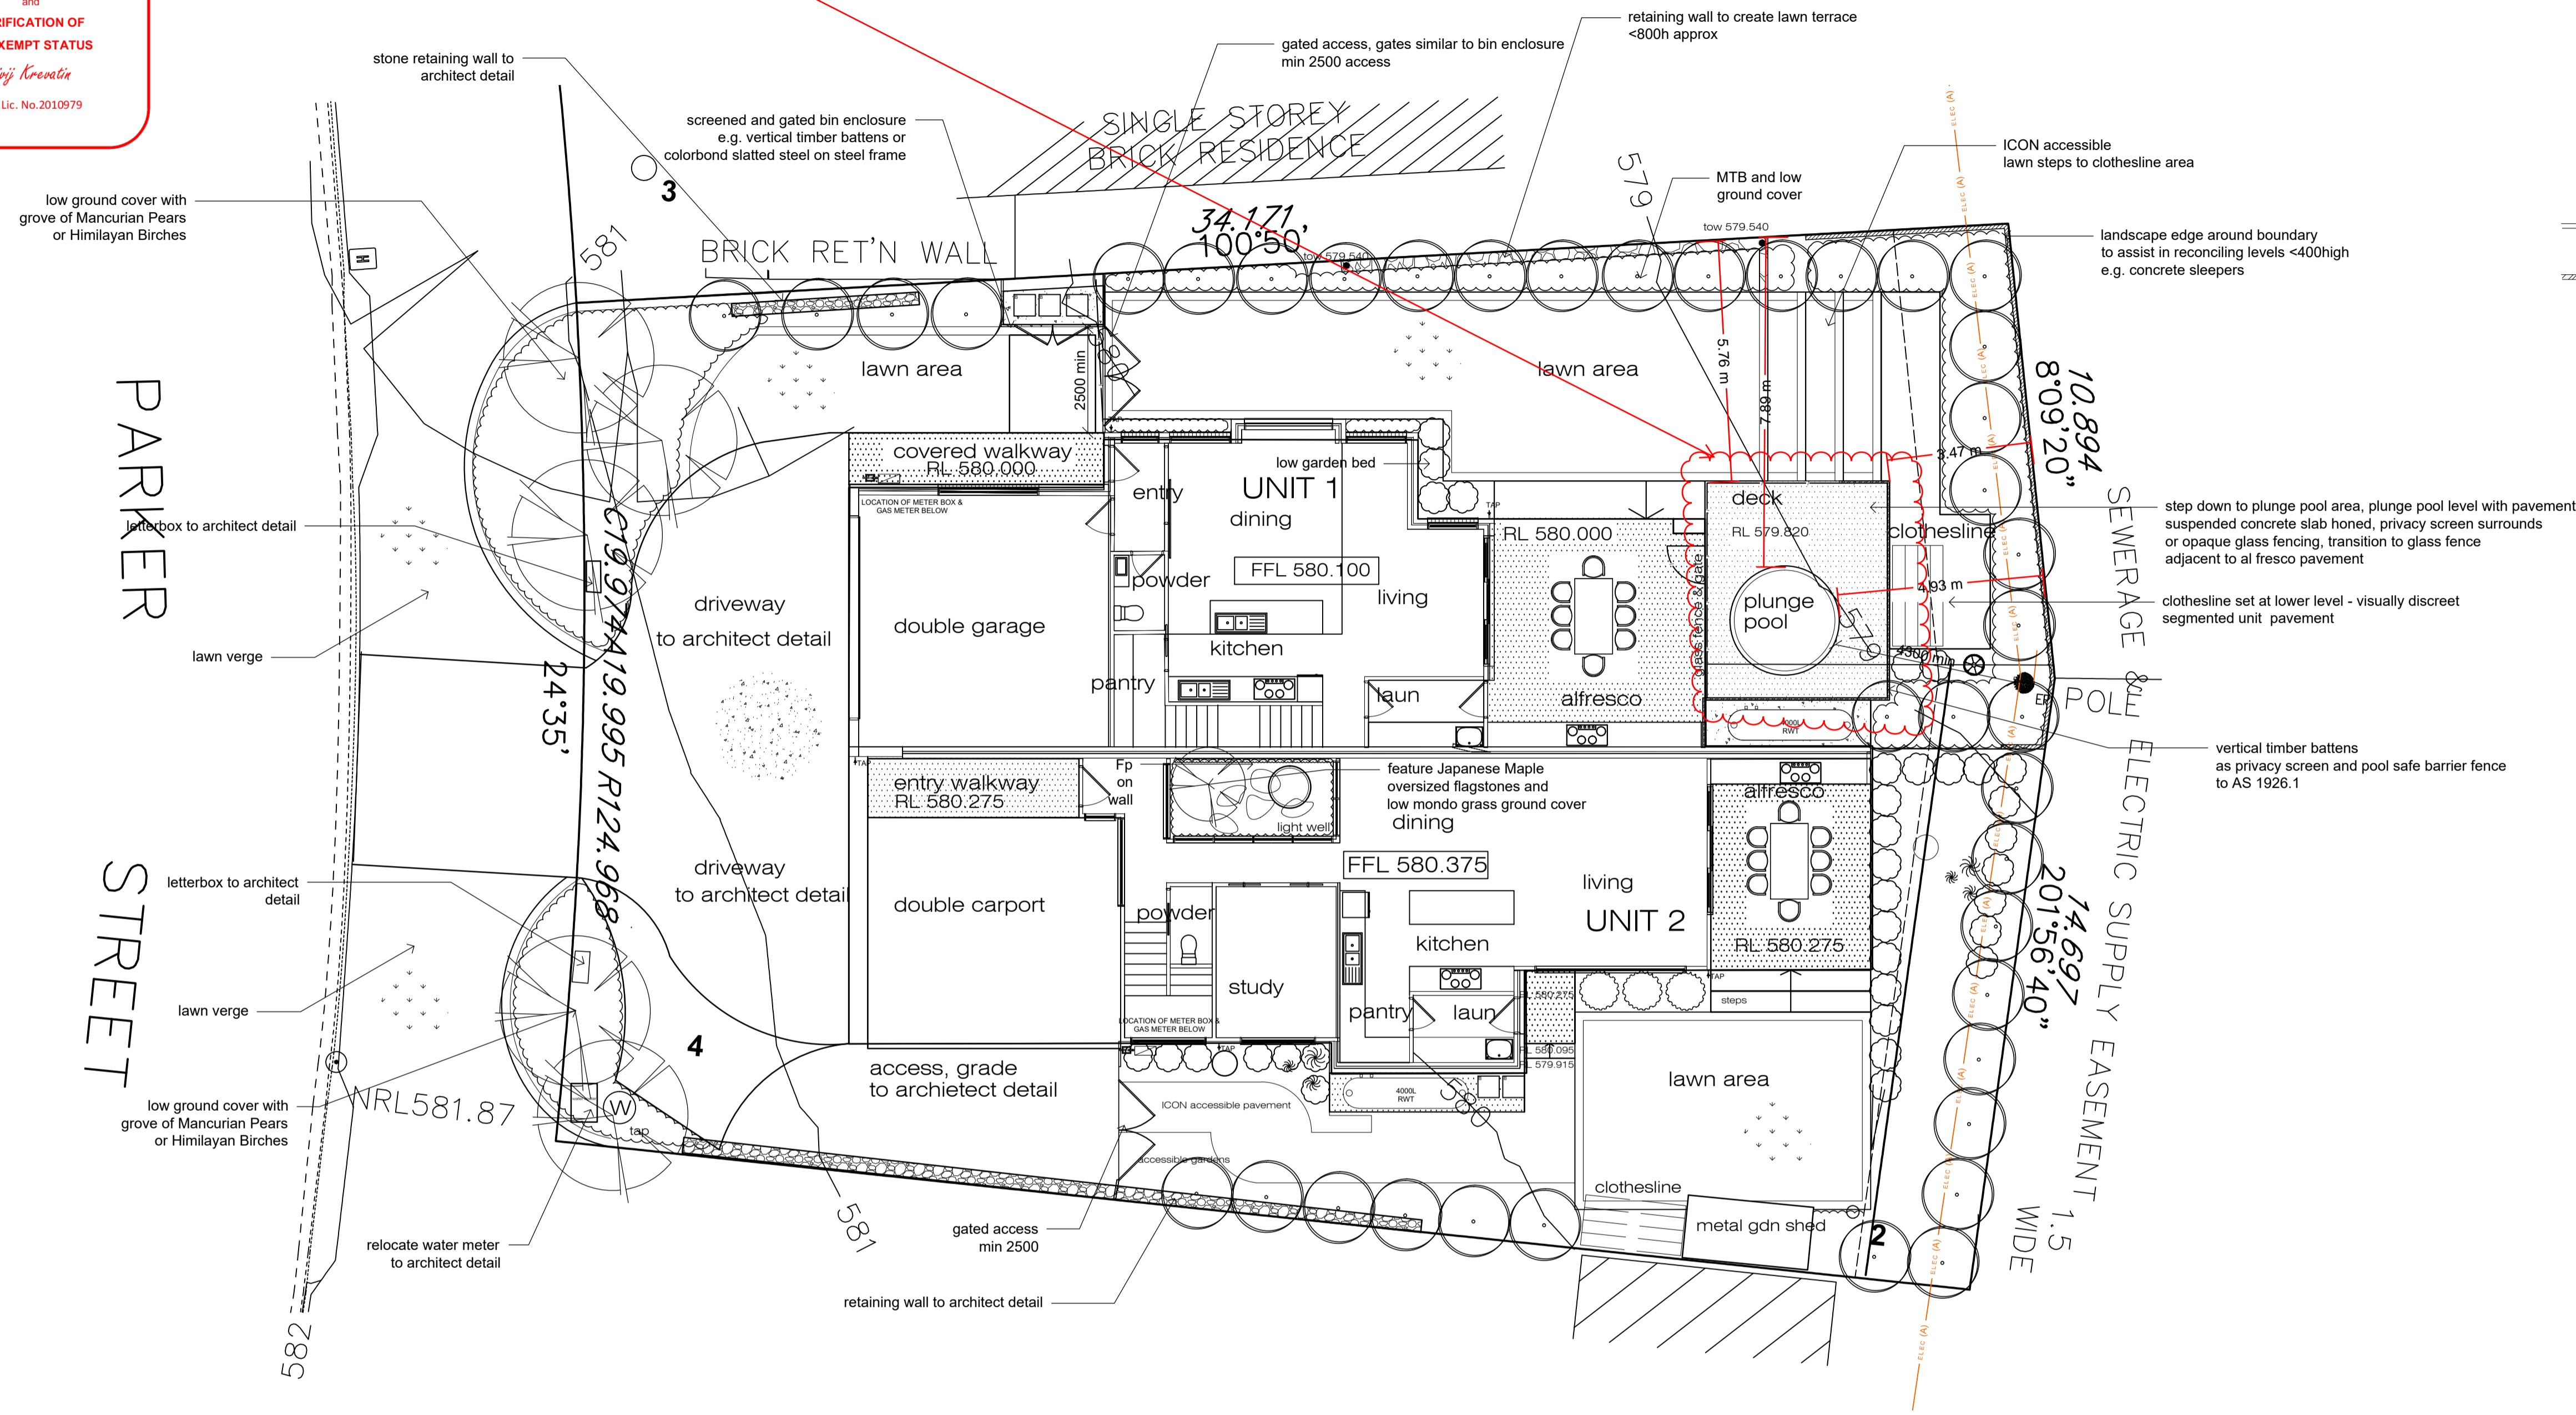

legend

- concrete driveway e.g. exposed aggregate nimitabel bluestone or concrete with oxide & cove finish
- honed concrete pavement
- large format tiles/ pavers 600x600 (alternative to honed concrete pavement)
- unit paving 230x110mm (path alternative or lawn edge)
- retaining wall to architect detail
- timber deck hardwood timber - wide boards
- wide mortared paver lawn edge
- landscape edge e.g. concrete sleepers
- Austral breeze block 'Flower Breeze' 10-908
- oversized steppers concrete poured in situ honed finish
- Eco Outdoor Pacific Bluestone Organic stepper
- plunge pool by Australian Plunge Pools 2400 diameter x 1350 depth
- lawn area
- existing tree
- shrubs - tall/ screening
- shrubs - medium
- shrubs - low
- ground covers & accent plants
- pot/ urn & potted plants
- small/ medium tree

planting palette

- trees**
- ApB Acer palamatumbloodgood
 - Buj Betula utilis jacquemontii (Himalayan Birch)
 - M.c Magnolia 'Little Gem'
 - M.tb Magnolia 'Teddy Bear'
 - Pc Pyrus calleryana 'Glens Form' Chanticleer (Ornamental Pear)

- screening shrubs**
- CsEP Camellia sasanqua 'Early Pearly'
 - Mf Michelia figo (Port Wine Magnolia)
 - MISP Michelia laevis (Scented Pearli)
 - Oe Olea europea (Olives)
 - Vo Viburnum odoratissimum 'Dense Fence'

- medium shrubs**
- Bj Buxus japonica (Japanese Box)
 - Ca Correa alba
 - Do Daphne odora
 - Gf Gardenia florida
 - Gm Gardenia augusta magnifica
 - ROP Raphiolepis 'Oriental Pearl/ Springtime'

- low shrubs**
- A.d Acacia cognata 'Dazzler'
 - B.mm Buxus microphylla Microphylla (Dwarf Japanese Box)
 - BsSBuxus sempervirens Suffruticosa (Dutch Box)
 - Gr Gardenia radicans
 - Ho Helleborus orientalis (Winter Rose)

- accent plants**
- LEG Liriope 'Evergreen Giant'
 - LT Lomandra tanika

- ground covers/ climbers**
- Fp Ficus pumila (creeping fig)
 - HP Hedera 'Pittsburgh' (recommend using only in contained garden beds as ivy is invasive - suggest Ta as substitute)
 - Mp Myoporum parvifolium 'Chunky'
 - O.ph Ophiopogon planiscapis 'Nana' (Dwarf Mondo Grass)
 - Ta Trachelospernum asiaticum
 - TJ Trachelospernum jasminoides (chinese star jasmine)




P: PO BOX 3911
Manuka, ACT 2603
M: 0413 517 926
E: design@thelivingroom.com.au
W: thelivingroom.com.au

project:
preliminary sketch plan
client:
the Baile's residence
0422 863 310 (Anthony)

drawing title:
preliminary sketch plan

scale: 1:100 @ A1
job no: 744
DWG no: L01
date: 27-4-2020
drawn: RS
issue: c

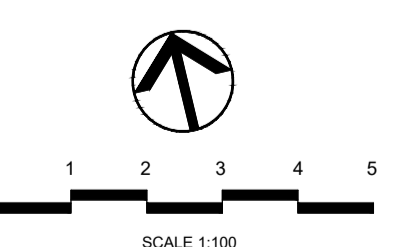

notes:
consultation plan - not for construction purposes.
This drawing is intended for information only and is not to be printed or used for construction.
All works to be in accordance with the relevant Australian construction standards.
All measurements to be checked on site and adjusted as required.
Check to verify for all necessary approvals.
© THE LIVING ROOM

SELECT STRUCTURE

BUILDING CERTIFICATION

Building Approval issued under
Section 28 of Building Act 2004

NCC Occupancy Class: **10a, 10b**

NCC Construction Type: **N/A**


Date: **27/10/2021**

and

**VERIFICATION OF
DA EXEMPT STATUS**

Livij Krevatin

ACT Lic. No.2010979

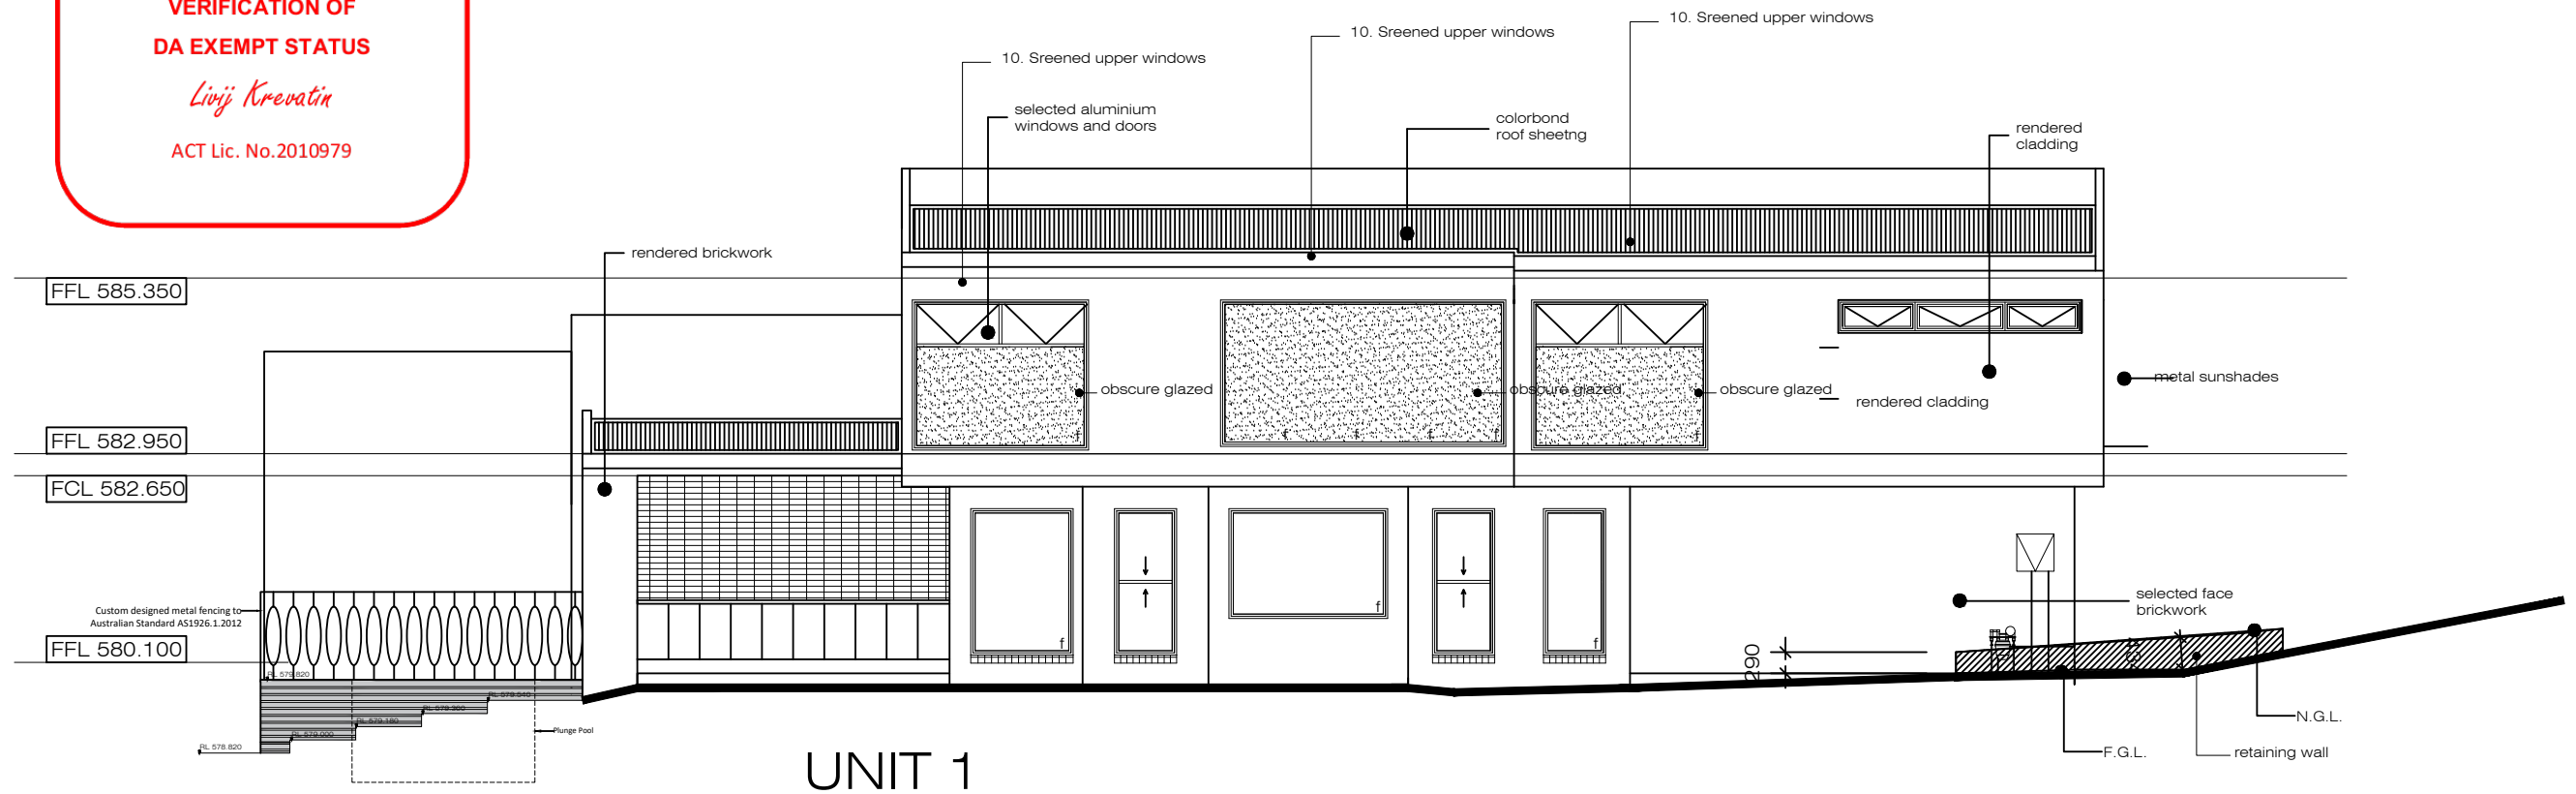

northern elevation
scale 1:100

SELECT STRUCTURE

BUILDING CERTIFICATION

Building Approval issued under
Section 28 of Building Act 2004

NCC Occupancy Class: **10a, 10b**

NCC Construction Type: **N/A**

Date: **27/10/2021**


and

**VERIFICATION OF
DA EXEMPT STATUS**

Livij Krevatin

ACT Lic. No.2010979


Custom designed metal fencing to
Australian Standard AS1926.1.2012

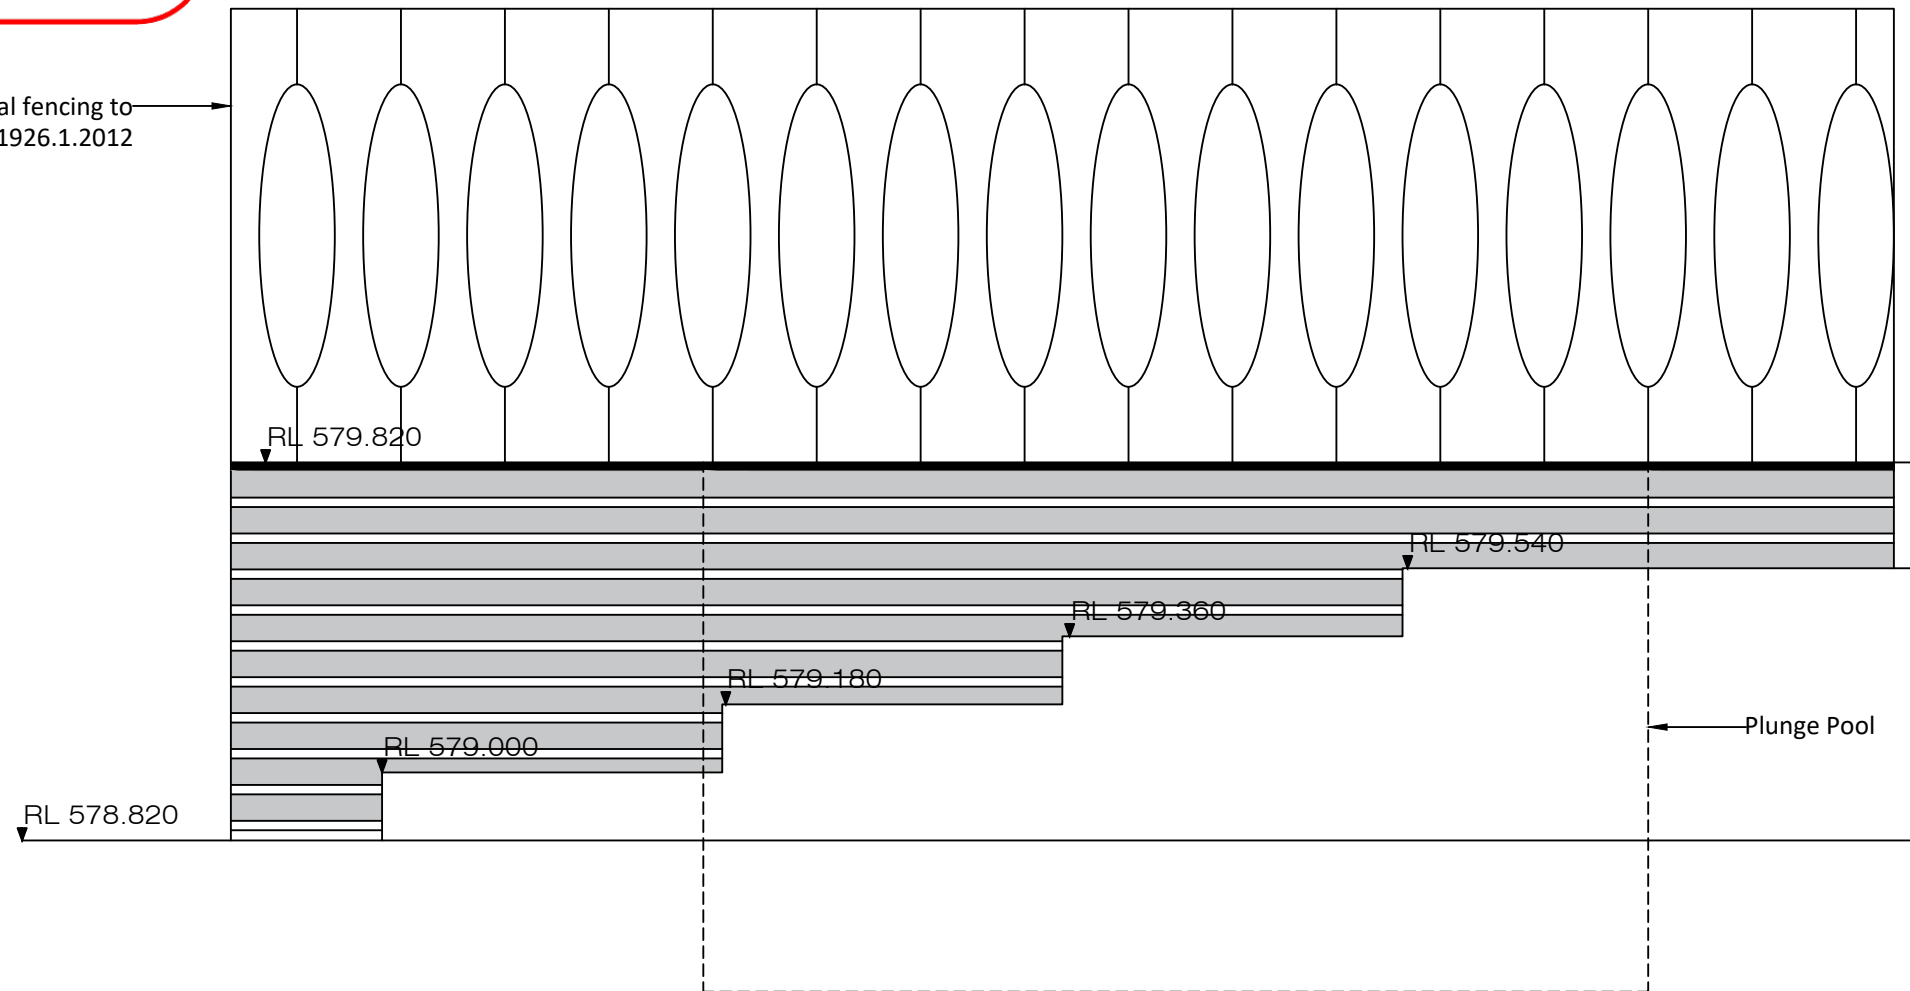

Deck and Plunge Pool Plan

preliminary sketch plan

option 2
 November 28th 2018
 revised January 7th 2019
 revised April 27th 2019
 revised December 20th 2022

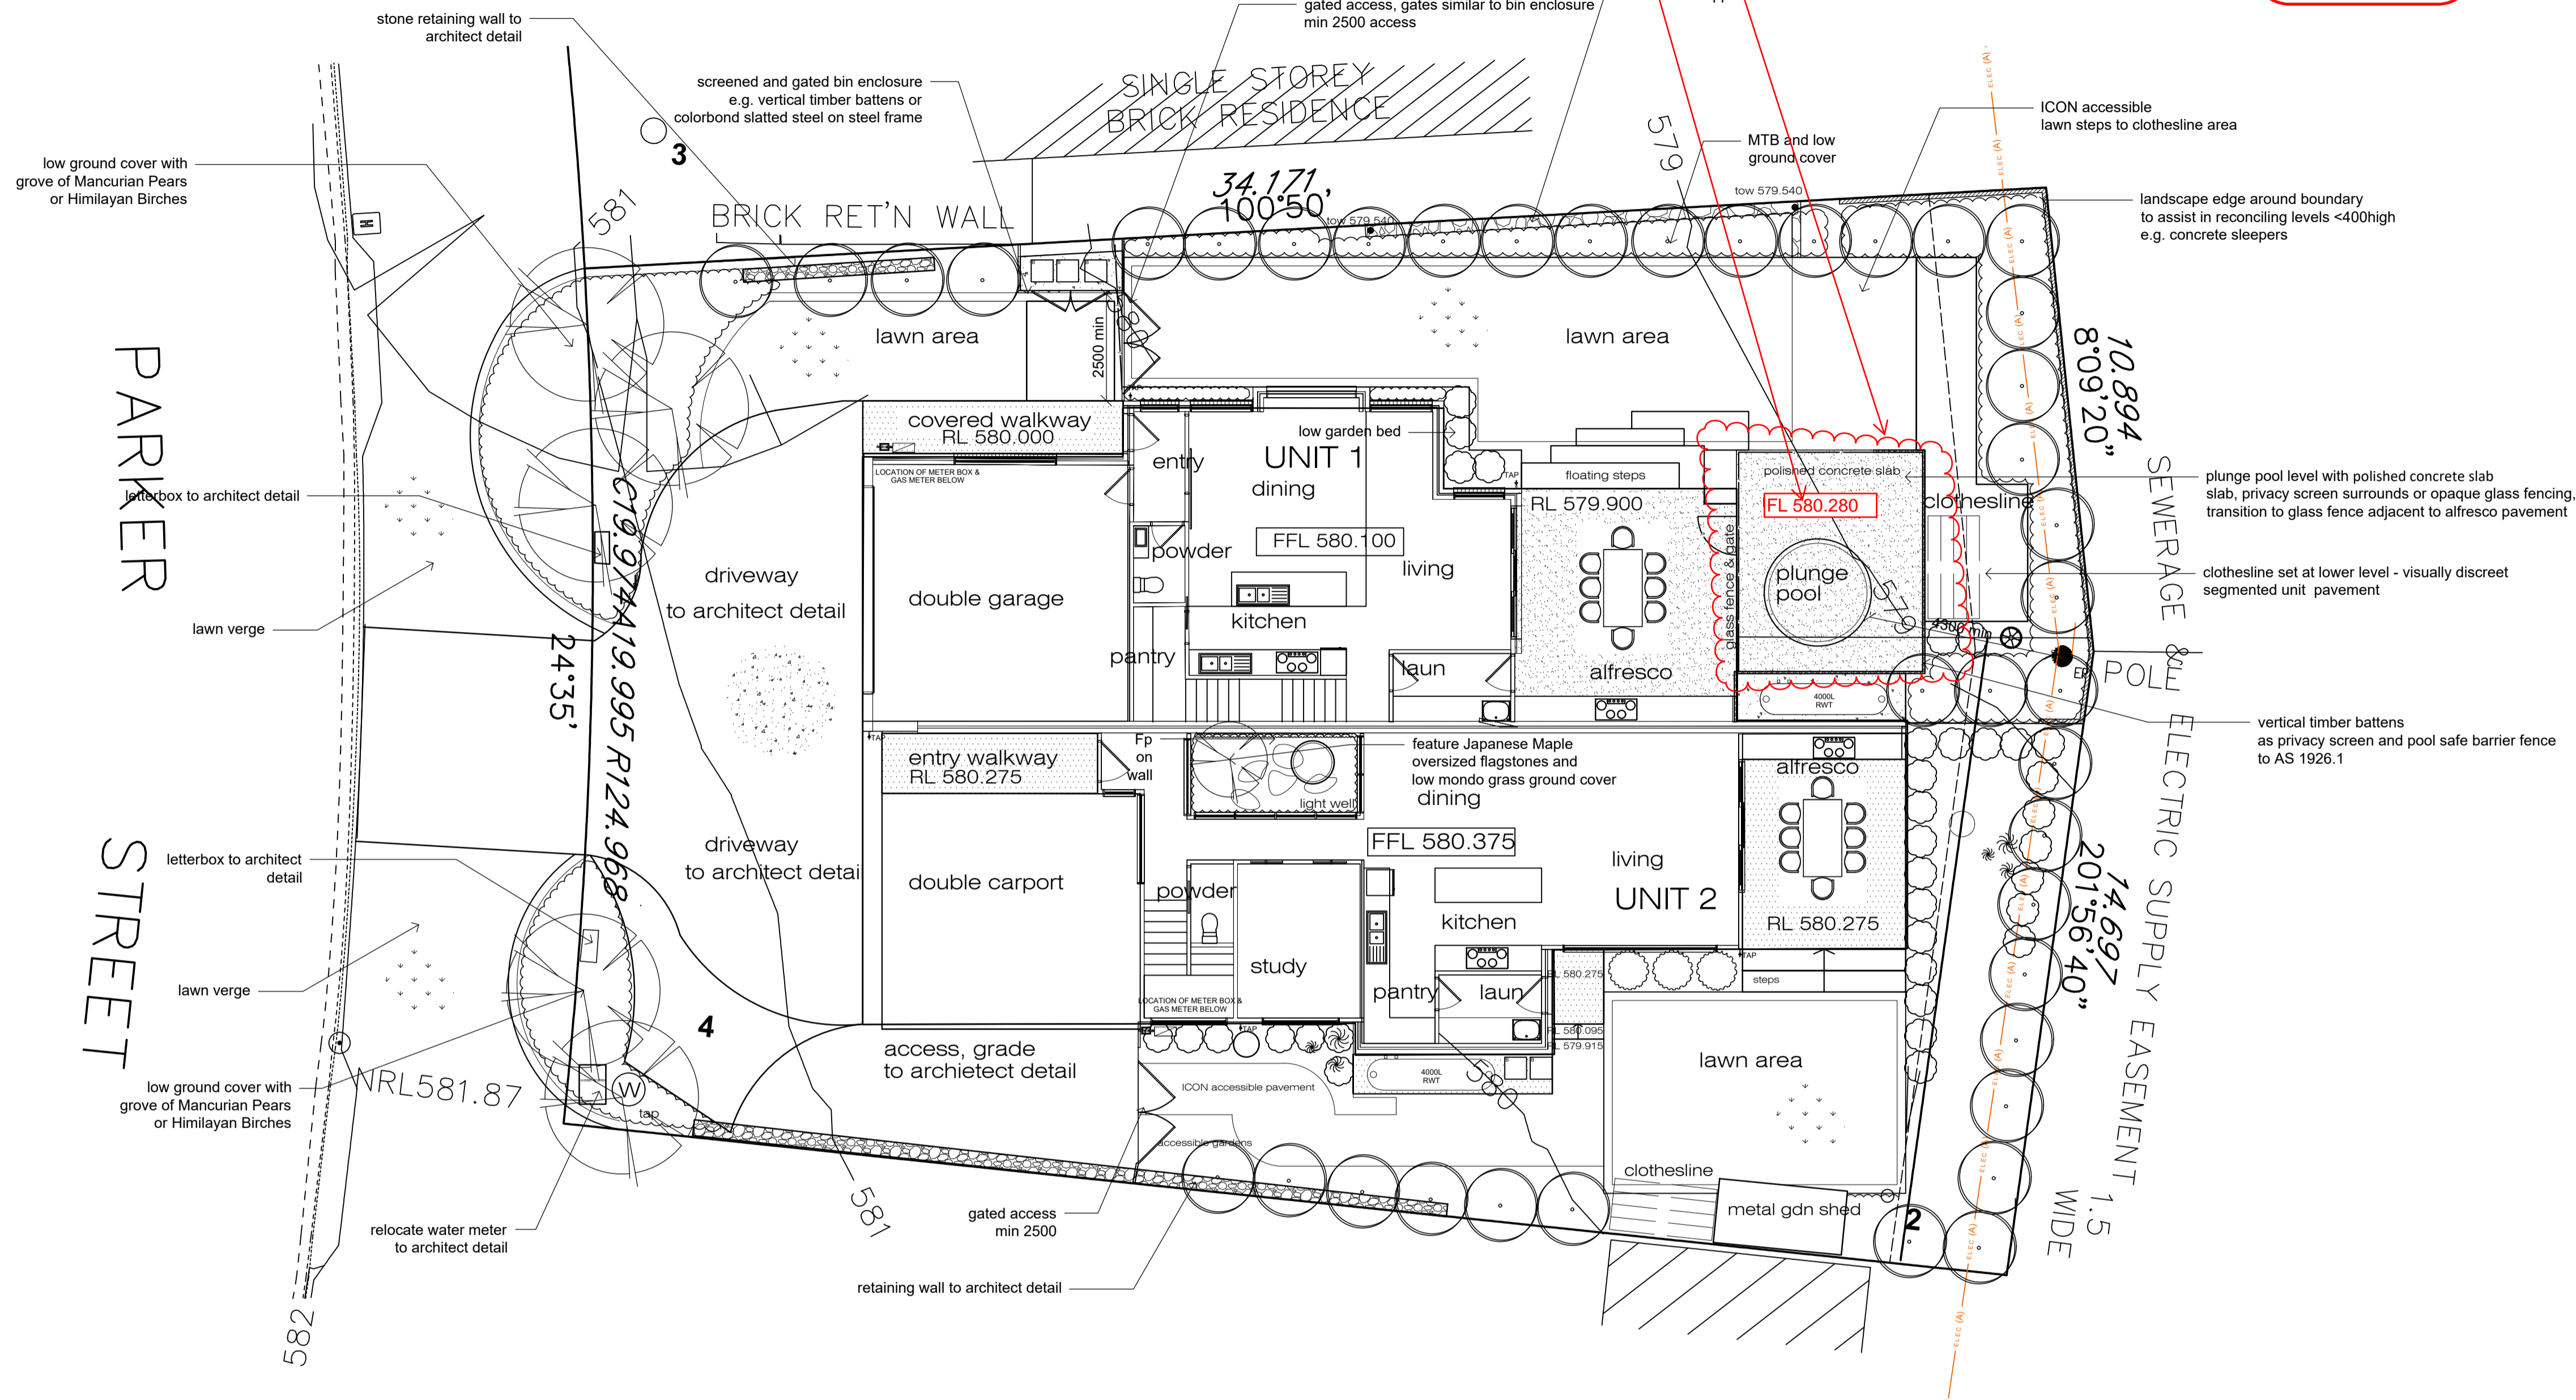

Amendment

Pool balustrade material change to glass
 FFL height change

SELECT STRUCTURE
 BUILDING CERTIFICATION
 Building Approval is amended under Section 32 of Building Act 2004
 Date: 31/01/2023
 Linzi Knevelin
 ACT Lic. No. 2010979

- legend
- concrete driveway e.g. exposed aggregate nimitabel bluestone or concrete with oxide & cove finish
 - polished concrete slab
 - honed concrete pavement
 - large format tiles/ pavers 600x600 (alternative to honed concrete pavement)
 - unit paving 230x110mm (path alternative or lawn edge)
 - retaining wall to architect detail
 - timber deck hardwood timber - wide boards
 - wide mortared paver lawn edge
 - landscape edge e.g. concrete sleepers
 - Austral breeze block 'Flower Breeze' 10-908
 - oversized steppers concrete poured in situ honed finish
 - Eco Outdoor Pacific Bluestone Organic stepper
 - plunge pool by Australian Plunge Pools 2400 diameter x 1350 depth
 - lawn area
 - existing tree
 - shrubs - tall/ screening
 - shrubs - medium
 - shrubs - low
 - ground covers & accent plants
 - pot/ urn & potted plants
 - small/ medium tree

planting palette

- trees**
- ApB Acer palatumatum Bloodgood
 - Buj Betula utilis jacquemontii (Himalayan Birch)
 - MlG Magnolia 'Little Gem'
 - Mtr Magnolia 'Teddy Bear'
 - Pc Pyrus calleryana 'Glens Form' Chanticleer (Ornamental Pear)

- screening shrubs**
- CsEP Camellia sasanqua 'Early Pearly'
 - MF Michelia figo (Port Wine Magnolia)
 - MISP Michelia laevifolia (Scented Pearl)
 - Oe Olea europea (Olives)
 - Vo Viburnum odoratissimum 'Dense Fence'

- medium shrubs**
- Bj Buxus japonica (Japanese Box)
 - Ca Correa alba
 - Do Daphne odora
 - Gf Gardenia florida
 - Gm Gardenia augusta magnifica
 - Rop Raphiolepis 'Oriental Pearl/ Springtime'

- low shrubs**
- Acd Acacia cognata 'Dazzler'
 - Bmm Buxus microphylla Microphylla (Dwarf Japanese Box)
 - BsSBuxus sempervirens Suffruticosa (Dutch Box)
 - Gr Gardenia radicans
 - Ho Helleborus orientalis (Winter Rose)

- accent plants**
- LEG Liriope 'Evergreen Giant'
 - Lt Lomandra tanika


- ground covers/ climbers**
- Fp Ficus pumila (creeping fig)
 - HP Hedera 'Pittsburgh' (recommend using only in contained garden beds as ivy is invasive - suggest Ta as substitute)
 - Mp Myoporum parvifolium 'Chunky'
 - Opn Ophiopogon planiscapis 'Nana' (Dwarf Mondo Grass)
 - Ta Trachelospermum asiaticum
 - TJ Trachelospermum jasminoides (chinese star jasmine)



P: PO BOX 3911
 Manuka, ACT 2603
 M: 0413 517 926
 E: design@thelivingroom.com.au
 W: thelivingroom.com.au

project:
 preliminary sketch plan
 client:
 the Baillie's residence
 0422 863 310 (Anthony)
 project address:
 23 Parker Street
 Curtin ACT 2605
 drawing title:
 preliminary sketch plan

scale:
 1:100 @ A1
 job no:
 744
 DWG no:
 L51
 date:
 17-01-2023
 drawn:
 RS
 issue:
 e

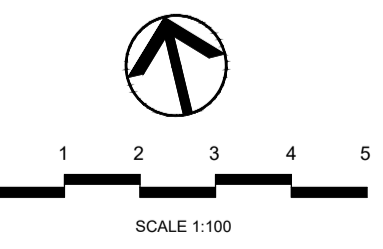

notes:
 conceptual plan - not for construction or approval purposes.
 if no survey plan is provided, all levels are indicative only and to be confirmed on site by owner/ builder/ contractor
 all works to be in accordance with the relevant Australian construction standards.
 all measurements to be checked on site and adjusted as required.
 client to apply for all necessary approvals
 © THE LIVING ROOM

SELECT STRUCTURE


BUILDING CERTIFICATION

Building Approval is amended
under Section 32 of Building Act 2004


Date: **31/01/2023**

Livij Krevatin


ACT Lic. No. 2010979

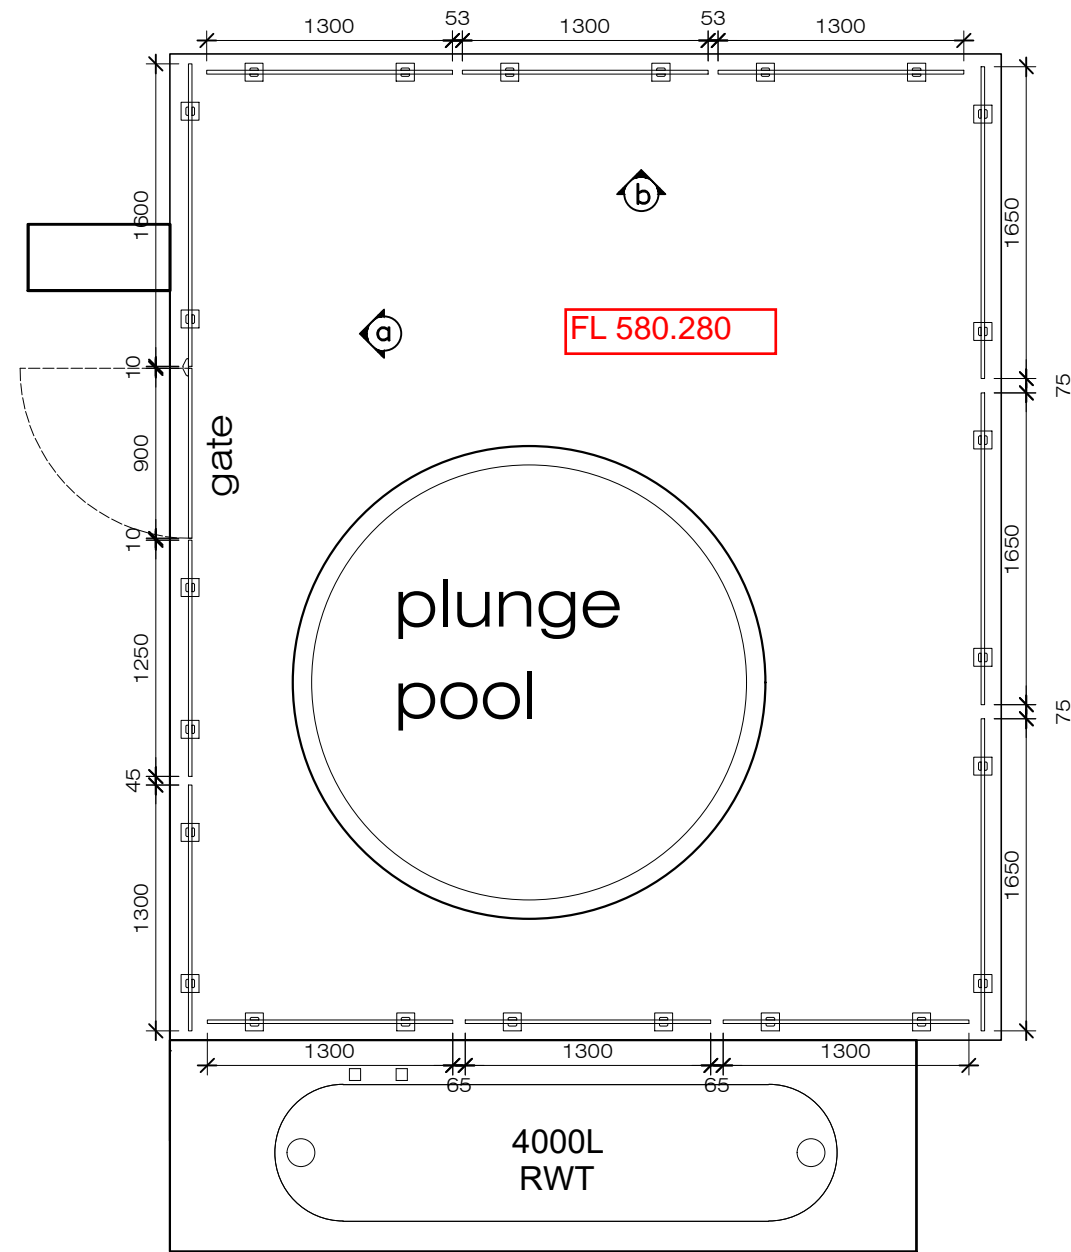

Plan

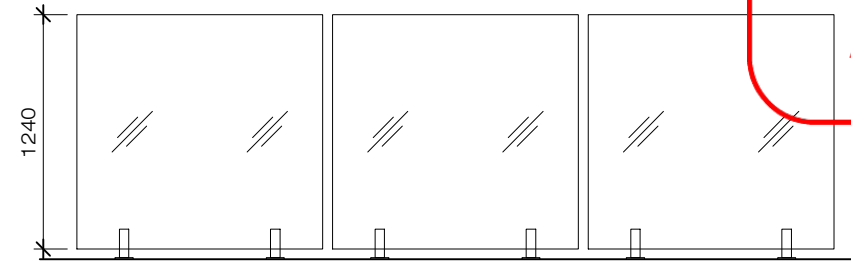

Elevation B

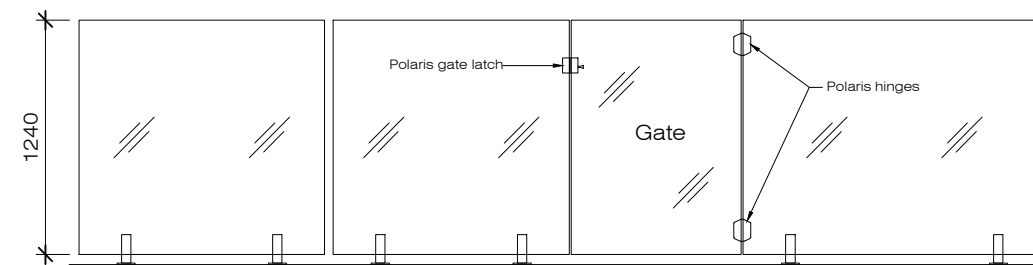

Elevation A



Plunge Pool Fence Details

PARLIAMENT
CONSTRUCTIONS

Project
BAILLIE RESIDENCE

Address
Block 21 Section 16
23 Parker Street
CURTIN

Scale
1:40

Date
17/01/2023


Drawn
SV

Checked
AB


Drawing
Plunge Pool Fence Details

Drawing No.
S01

Revision No.
C

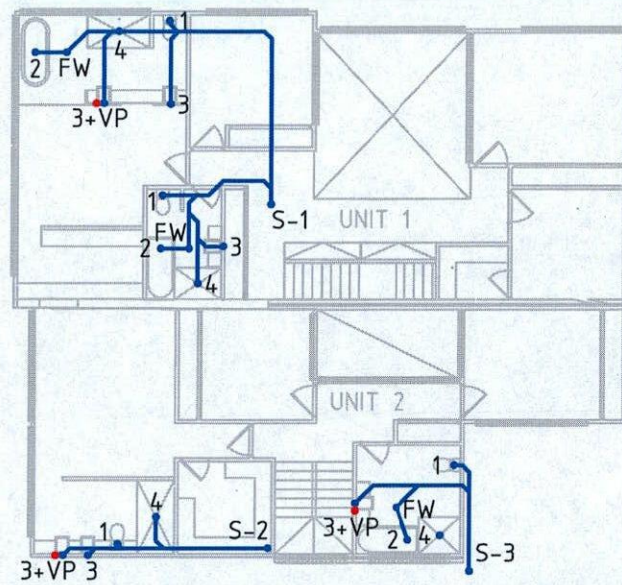

UPPER FLOOR PLAN

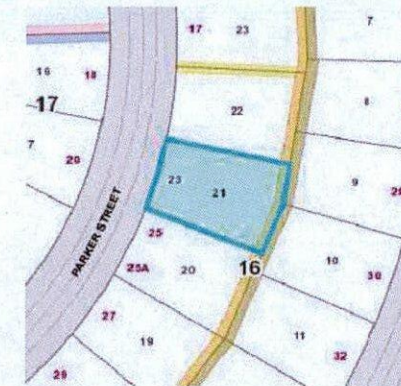

LOCALITY PLAN
GENERAL NOTES

- EXISTING SEWER LINES TO BE LOCATED ON SITE PRIOR TO COMMENCEMENT OF WORK.
- ALL PLUMBING AND DRAINAGE TO BE INSTALLED IN ACCORDANCE WITH AS3500.
- ALL WORK TO BE CARRIED OUT IN ACCORDANCE WITH THE CANBERRA SEWERAGE AND WATER SUPPLY REGULATIONS.
- THIS PLAN TO BE READ IN CONJUNCTION WITH APPROVED ARCHITECTURAL PLANS AND SPECIFICATIONS.
- INSPECTION SHAFT AT PROPERTY BOUNDARY TO BE IN ACCORDANCE WITH PLUMBING NOTE No3.
- ORG LEVELS TO BE IN ACCORDANCE WITH AS3500.2.2 CLAUSE 4.6.6.6 & 4.6.6.7 & PLUMBING NOTE 22.
- UNPLASTICISED POLYVINYL CHLORIDE PIPE DRAINS (UPVC) TO BE CONSTRUCTED IN ACCORDANCE WITH AS2032 AND THE CANBERRA SEWERAGE AND WATER SUPPLY REGULATIONS.
- TEMPERED HOT WATER REQUIRED AT ALL ABLUTION FIXTURES.
- PLUMBING AND DRAINAGE TO CONFORM TO ACTPLA PLUMBING NOTES 22 AND 23.
- SANITARY AND STORMWATER DRAINAGE SHALL BE SUPPORTED ON OR FROM SOLID GROUND IN ACCORDANCE WITH AS3500.


DRAINAGE PLAN
NUMBER: 15878

OWNER MR A. BAILIE
BLOCK 21 SECTION 16
SUBURB CURTIN A.C.T.

PLAN OF SANITARY DRAINAGE
DESIGNED TO AS3500

LEGEND

- SEWER MAIN
- STORMWATER MAIN
- WATER MAIN
- SEWER LINES
- VENT PIPE
- STORMWATER LINES
- AG LINES
- DOMESTIC WATER
- NON-POTABLE WATER
- 90Ø AG LINE WITH FILTER SOCK CONNECTION TO STORMWATER DRAINAGE
- 300X300 YARD SUMP. EXACT LOCATION TO BE DETERMINED ON SITE BY LANDSCAPE CONTRACTOR AND BUILDER
- STANDARD STREET HYDRANT
- STOP COCK
- WATER METER
- AAV AIR ADMITTANCE VALVE
- CO CLEAR OUT
- CWR/D COLD WATER RISER/DROPPER
- DT DISCONNECTOR TRAP
- FW FLOOR WASTE
- HDPE HEAVY DUTY POLYETHYLENE
- IO INSPECTION OPENING
- IS INSPECTION SHAFT
- O/F OVERFLOW
- ORG OVERFLOW RELIEF GULLY
- SC STOP COCK
- SMH SEWER MANHOLE
- ST SILT TRAP
- SVP SOIL VENT PIPE
- TD TUNDISH
- TG TEST GATE
- TTD TRAPPED TUNDISH
- UPVC UNPLASTICISED POLYVINYL CHLORIDE
- VP VENT PIPE
- WS WASTE STACK

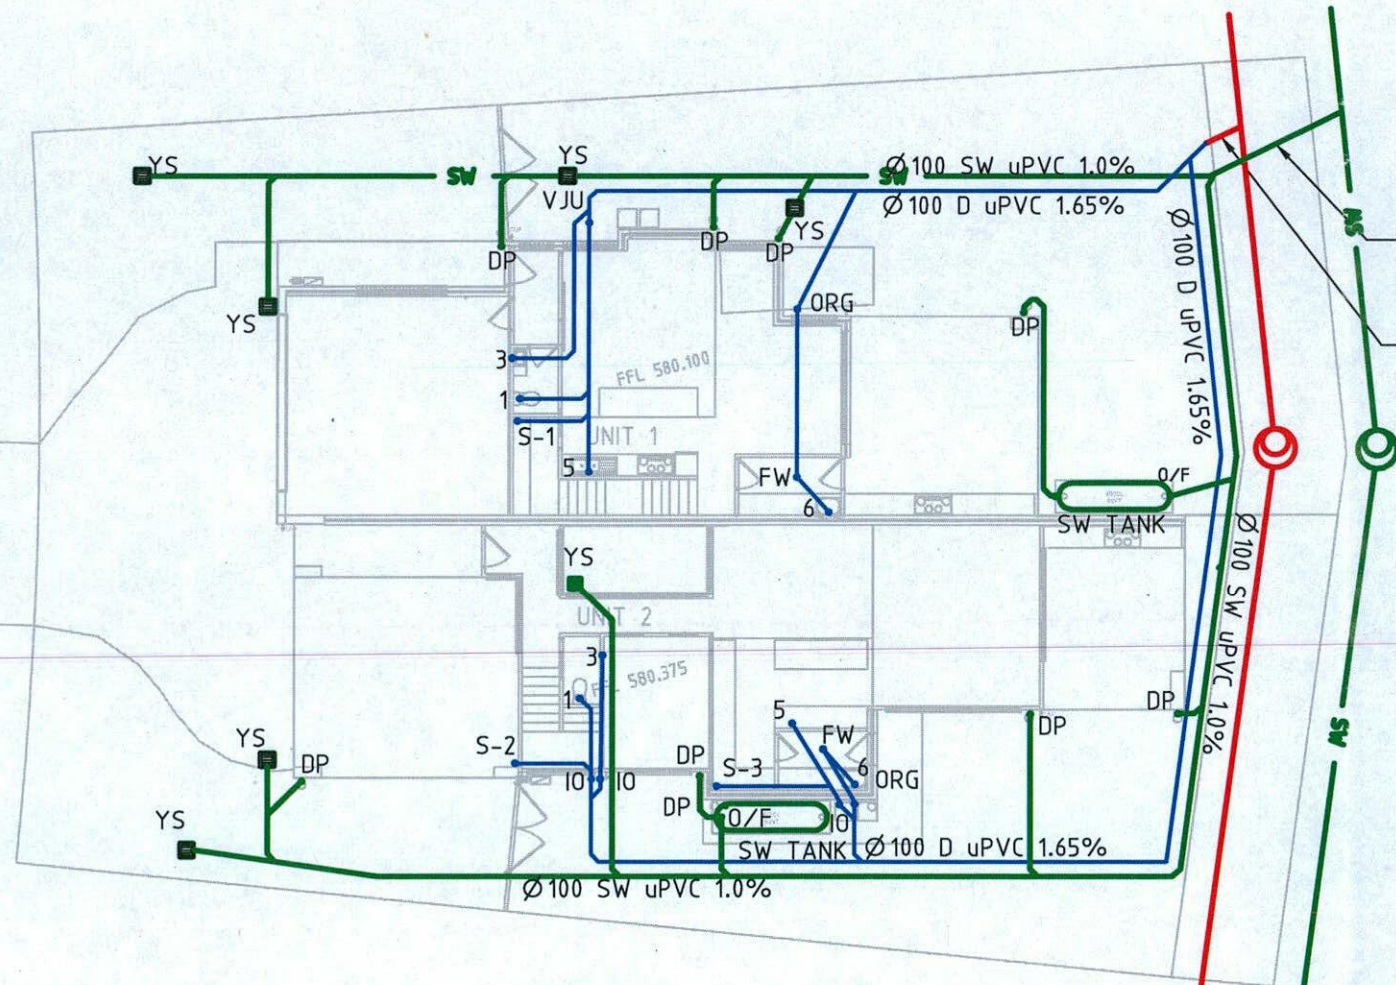

SWATER: LOCATE AND CONNECT TO EXISTING STORMWATER TIE
T:3.02m
D:1.01m

SEWER: LOCATE AND CONNECT TO EXISTING SEWER TIE
T:2.13m
D:1.52m


SANITARY FIXTURES

1 WC	6
2 BATH	3
3 BASIN	8
4 SHOWER	4
5 KITCHEN SINK	2
6 LAUNDRY TROUGH	2
TOTAL	24

MINIMUM INTERNAL DIMENSIONS STORMWATER AND INLET PITS

Depth to invert of outlet	Minimum internal dimensions		Circular Diameter
	Rectangular Width	Rectangular Length	
<600	450	450	600
>600 <900	600	600	900
>900 <1200	600	900	1000
>1200	900	900	1000

AS3500.3.2 Table 8.2



Scale 1:200

PLUMBING PLAN APPROVED
APPROVED BY
REG. NUMBER _____
DATE 22.11.2022

WORK AS EXECUTED GROUND FLOOR PLAN

ISSUE	AMEND	DESCRIPTION	DATE	DRAWN
B		WORK AS EXECUTED	4.11.22	JM
A-1		MINOR AMENDMENT	12.11.18	LH
A		INTERIM PLAN	24.10.18	LH



PROPOSED DUAL OCCUPANCY
23 PARKER STREET

CLIENT:
MR A. BAILIE

DESIGNED BY
LH
CHECKED BY
BW
AUTHORISED BY
DATE

DRAWING TITLE
HYDRAULIC SERVICES
GENERAL ARRANGEMENT

PROJECT LOCATION
BLOCK 21 SECTION 16 CURTIN A.C.T.

SCALE
1:200 @ A3
JOB NO.
181060
DRAWING NO.
H100

Energy Efficiency Rating



UNDERSTANDING YOUR ENERGY EFFICIENCY RATING (EER)

An energy efficiency rating (EER) is a rating used to identify the energy efficiency of homes in the ACT.

The Civil Law (Sale of Residential Property) Act 2003 requires all homes being sold in the ACT to carry an energy efficiency rating (EER). This enables owners and buyers to compare a home's passive energy performance characteristics with others for sale in the Territory.

In the ACT, established homes are assessed using 1st generation software, and can achieve **0 to 6 stars** in the rating scheme.

Houses with a higher EER are more cost and energy efficient, use less energy for heating and cooling, generate lower greenhouse gas emissions, and are more comfortable.

What information is taken into account when assessing my homes energy efficiency?

- Layout of the home
- Construction of its roof, walls, windows, and floor
- Wall, floor, and ceiling insulations
- Orientation of windows and shading of the sun's path and local breezes
- Influence of the local climate
- Air leakages

What information is not applicable when assessing my homes energy efficiency?

- Heating and cooling
- Hot water systems
- Lighting systems and appliances
- Solar panels

How can I improve my energy efficiency rating?

Your energy efficiency report will include a list of design options (unless it's already achieved the maximum rating of 6 stars). This will outline the improvements that can be made to gain additional points and increase the overall star rating of your home.

When I built my home, I was provided with a 10-star energy rating. Why has this decreased?

The ACT Government has two software systems in place to generate energy efficiency ratings:

1. Established homes: An on site assessment using 1st generation software. A maximum of 6 stars can be achieved.
2. Brand new homes: A computer based assessment using 2nd generation software. A maximum of 10 stars can be achieved.

If you hold an energy efficiency rating that exceeds 6 stars, it is a 2nd generation EER and would have been provided when your home was brand new.

When assessing a home's energy efficiency for the purpose of sale, property inspection companies are required to use 1st generation software, which will achieve a maximum of 6 stars.

FirstRate Report



YOUR HOUSE ENERGY RATING IS: ★★☆☆☆☆ **6 STARS**
in Climate: 24 **SCORE: 19 POINTS**


Name: Roach

Ref No: 65568

House Title: Unit 1 Block 21 Section 16 CURTIN

Date: 26-09-2025

Address: 23A Parker Street, Curtin ACT 2605

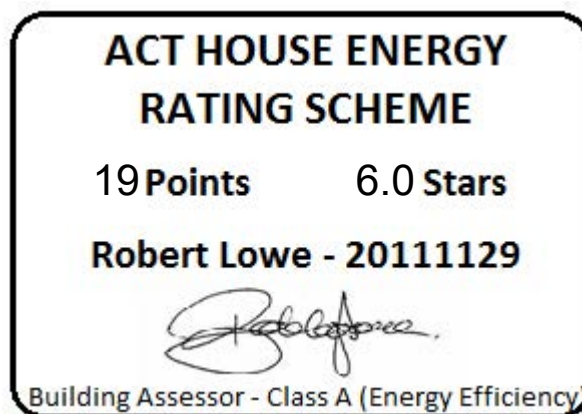

This rating only applies to the floor plan, construction details, orientation and climate as submitted and included in the attached Rating Summary. Changes to any of these could affect the rating.

IMPROVING YOUR RATING

The table below shows the current rating of your house and its potential for improvement.

Star Rating	POOR			AVERAGE				GOOD			V. GOOD	
	0 Star	★	★★	★★★	★★★★	★★★★★	★★★★★★	★★★★★★★	★★★★★★★★	★★★★★★★★★		
Point Score	-71	-70	-46	-45	-26	-25	-11	-10	4	5	16	17

Current	19	<div style="background-color: #cccccc; height: 20px; width: 100%;"></div>										
Potential	19	<div style="background-color: #cccccc; height: 20px; width: 100%;"></div>										

Incorporating these design options will add the additional points required to achieve the potential rating shown in the table. Each point represents about a 1% change in energy efficiency. This list is only a guide to the range of options that could be used.

Design options

Additional points

ORIENTATION

Orientation is one of the key factors which influences energy efficiency. This dwelling will achieve different scores and star ratings for different orientations.

Current Rating	19	★★★★★★
-----------------------	-----------	---------------

Largest windows in the dwelling;

Direction : NNE

Area : 29 m²

The table below shows the total score for the dwelling when these windows face the direction indicated.

Note that obstructions overshadowing windows have been removed from all windows in these ratings to allow better comparisons to be made between orientations.

ORIENTATION	POINT SCORE	STAR RATING
1. North	18	★★★★★★
2. North East	21	★★★★★★
3. East	23	★★★★★★
4. South East	18	★★★★★★
5. South	12	★★★★★☆
6. South West	2	★★★★☆
7. West	0	★★★★☆
8. North West	6	★★★★★

FirstRate Mode
Climate: 24

RATING SUMMARY for: Unit 1 Block 21 Section 16 CURTIN, 23A Parker Street, Curtin ACT 2605

Assessor's Name:

Net Conditioned Floor Area: 174.0 m²

Feature			Points			
			Winter	Summer	Total	
CEILING			13	0	13	
Surface Area:	3	Insulation:	11			
WALL			9	-2	7	
Surface Area:	1	Insulation:	8	Mass:	-1	
FLOOR			12	-2	10	
Surface Area:	2	Insulation:	4	Mass:	4	
AIR LEAKAGE (Percentage of score shown for each element)			7	0	7	
Fire Place	0 %	Vented Skylights	0 %			
Fixed Vents	0 %	Windows	42 %			
Exhaust Fans	19 %	Doors	22 %			
Down Lights	0 %	Gaps (around frames)	17 %			
DESIGN FEATURES			0	1	1	
Cross Ventilation	1					
ROOF GLAZING			0	0	0	
Winter Gain	0	Winter Loss	0			
WINDOWS			6	-28	-22	
Window Direction	Area		Point Scores			
	m2	%NCFA	Winter* Loss	Winter Gain	Summer Gain	Total
NNE	29	17%	-21	31	-16	-7
ESE	12	7%	-8	2	-1	-8
WNW	13	8%	-10	13	-11	-8
Total	54	31%	-40	46	-28	-22

* Air movement over glazing can significantly increase winter heat losses. SEAV recommends heating/cooling duct outlets be positioned to avoid air movement across glass or use deflectors to direct air away from glass.

The contribution of heavyweight materials to the window score is 4 points

		Winter	Summer	Total
RATING	★ ★ ★ ★ ★ ★	47	-31	19*

* includes 3 points from Area Adjustment

Detailed House Data

House Details

ClientName Roach
HouseTitle Unit 1 Block 21 Section 16 CURTIN
StreetAddress 23A Parker Street, Curtin ACT 2605
FileCreated 26-09-2025

Climate Details

State
Town Canberra
Postcode 2600
Zone 24

Floor Details

ID	Construction	Sub Floor	Upper	Shared	Foil	Carpet	Ins RValue	Area
1	Concrete Slab on ground	No Subfloor	No	No	No	Float Timb	R1.0	56.8m ²
2	Concrete Slab on ground	No Subfloor	No	No	No	Tiles	R1.0	2.0m ²
3	Timber	NA	Yes	No	No	Carp	R0.0	76.6m ²
4	Timber	Enclosed	No	No	No	Carp	R5.0	25.3m ²
5	Timber	Enclosed	No	No	No	Tiles	R5.0	9.0m ²
6	Timber	Elevated	No	No	No	Tiles	R2.0	9.0m ²
7	Timber	Elevated	No	No	No	Carp	R2.0	4.0m ²

Wall Details

ID	Construction	Shared	Ins RValue	Length	Height
1	Brick Veneer	No	R2.9	16.6m	2.6m
2	Weatherboard	No	R2.5	6.2m	2.6m
3	Framed: FC Sheet Clad	Yes	R0.0	5.5m	2.6m
4	Weatherboard	No	R4.9	31.8m	2.4m
5	Framed: FC Sheet Clad	Yes	R0.0	15.9m	2.4m

Ceiling Details

ID	Construction	Shared	Foil	Ins RValue	Area
1	Attic - Low Ventilation	No	Yes	R6.3	106.1m ²

Window Details

ID	Dir	Height	Width	Utility	Glass	Frame	Curtain	Blind	Fixed & Adj Eave	Fixed Eave	Head to Eave
1	WNW	2.0m	3.3m	No	DG	ALIMPR	HB	No	0.0m	0.0m	0.0m
2	WNW	2.0m	3.3m	No	DG	ALIMPR	HB	No	0.0m	0.0m	0.0m
3	NNE	0.4m	3.0m	No	DG	ALIMPR	NC	No	0.2m	0.2m	0.0m
4	NNE	2.0m	2.4m	No	DGT	ALIMPR	HB	No	0.0m	0.0m	0.0m
5	NNE	2.0m	3.8m	No	DGT	ALIMPR	NC	No	0.0m	0.0m	0.0m
6	NNE	2.0m	2.4m	No	DGT	ALIMPR	HB	No	0.0m	0.0m	0.0m
7	ESE	1.2m	2.4m	No	DG	ALIMPR	HB	No	0.0m	0.0m	0.0m
8	NNE	2.0m	0.8m	No	DG	ALIMPR	HB	No	0.2m	0.2m	0.1m
9	NNE	2.0m	0.8m	No	DG	ALIMPR	HB	No	0.0m	0.0m	0.0m
10	NNE	1.5m	2.1m	No	DG	ALIMPR	HB	No	0.0m	0.0m	0.0m
11	NNE	2.0m	0.8m	No	DG	ALIMPR	HB	No	0.0m	0.0m	0.0m
12	NNE	2.0m	1.4m	No	DG	ALIMPR	HB	No	2.0m	2.0m	0.2m
13	ESE	2.4m	3.0m	No	DG	ALIMPR	HB	No	5.0m	5.0m	0.0m
14	ESE	2.2m	0.8m	Yes	DG	ALIMPR	NC	No	5.0m	5.0m	0.0m

Window Shading Details

ID	Dir	Height	Width	Obst Height	Obst Dist	Obst Width	Obst Offset	LShape Left Fin	LShape Left Off	LShape Right Fin	LShape Right Off
7	ESE	1.2m	2.4m	0.0m	0.0m	0.0m	0.0m	0.0m	0.0m	4.0m	0.4m
12	NNE	2.0m	1.4m	0.0m	0.0m	0.0m	0.0m	2.0m	0.0m	0.0m	0.0m

Insurance Certificates & Tax Invoice




If a home was built before 1990 it may contain dangerous asbestos material

Identify where asbestos materials might be. Five common places are:



- 1.** Exterior
roof sheeting, gutters, downpipes,
ridge capping, eaves, cladding,
electrical switchboards

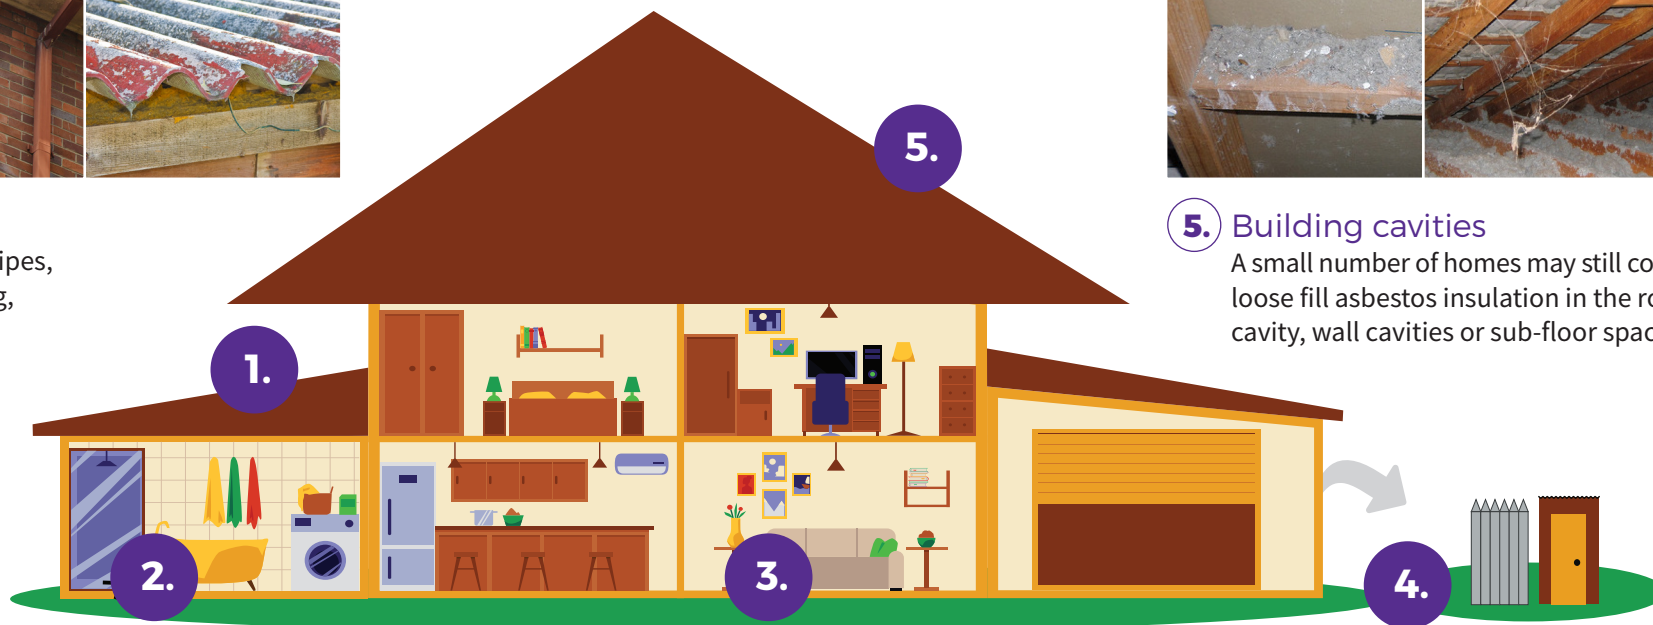

- 5.** Building cavities
A small number of homes may still contain
loose fill asbestos insulation in the roof
cavity, wall cavities or sub-floor space



- 2.** Wet areas - bathroom, laundry and kitchen
wall and ceiling panels, vinyl floor tiles, backing for wall tiles
and splashbacks, hot water pipe insulation



- 3.** Internal areas
wall and ceiling panels, carpet underlay,
textured panels, insulation in domestic
heaters



- 4.** Backyard
fences, sheds, garages, carports, dog kennels, buried or
dumped waste, letterboxes, swimming pools

If a home was built before 1990 it may contain dangerous asbestos material

Assess the risk

A licensed asbestos assessor can help identify asbestos in your home and its condition.

Asbestos materials become dangerous when:



Broken or in poor condition



Damaged accidentally



Disturbed during renovation or repairs



Loose fill asbestos insulation



Manage asbestos safely

- Monitor the condition of asbestos in your home
- Inform tradespeople of locations of asbestos in your home
- Avoid disturbing or damaging asbestos if working on your home
- Engage a licensed asbestos removalist to remove asbestos

If you suspect your home contains loose fill asbestos insulation, contact Access Canberra

Pest Controllers Combined Liability Certificate of Currency

The Policy below is current until 4.00pm on the expiry date shown below

INSURED:	ACT Property Inspections Pty Ltd
BUSINESS DESCRIPTION:	General Pest & Weed Control Timber Pest Inspections Termite Barrier Installations Pre-Purchase House Pest Inspections Building Inspections (Non Pest Related) Energy Efficiency Ratings Compliance Reports
POLICY REFERENCE:	09A349653PLB
PERIOD OF INSURANCE:	From: 4.00pm on 30/03/2025 To: 4.00pm on 30/03/2026
POLICY CLASS:	Pest Controllers Combined Liability
SUMS INSURED:	Section 1: General Public & Products Liability \$20,000,000 Our maximum liability in respect of any claim or series of claims for Personal Injury, Property Damage or Advertising Liability caused by or arising out of any one occurrence; and \$20,000,000 Our total aggregate liability during any one period of insurance for all claims arising out of Your Product Section 2: Professional Indemnity \$5,000,000 Our maximum liability in respect of any Claim or any series of Claims inclusive of costs and expenses. \$10,000,000 Our total aggregate liability for all Claims inclusive of costs and expenses.

This Certificate of Currency is subject to the Policy Documentation to be read in conjunction with the Definitions, Conditions and Exclusions in the Pest Controllers Combined Liability Insurance Policy.

Date Issued: 28 March 2025



**ACT
PROPERTY
INSPECTIONS**

TAX INVOICE

Melissa Anne Roach
23A Parker St
CURTIN ACT 2605
AUSTRALIA

Invoice Date
23 Sep 2025

Invoice Number
INV-65568

ACT Property Inspections
(02) 6232 4540
Unit 1, 33 Altree Ct
PHILLIP ACT 2606
ABN: 33 600 397 466

Description	Quantity	Unit Price	GST	Amount AUD
ACTPLA Fees - No GST	1.00	186.70	GST Free	186.70
Property Report	1.00	1,475.73	10%	1,475.73
Energy Efficiency Report (Complimentary)	1.00	0.00		0.00
Deferred Payment (Complimentary)	1.00	0.00		0.00
			Subtotal	1,662.43
			TOTAL GST 10%	147.57
			TOTAL AUD	1,810.00

Due Date: 22 Mar 2026

Payment terms – Deferred payment account. This account should be paid in full within 14 days on the earlier of:

- (a) Settlement of the property
- (b) If the Property has not been listed for sale within 3 months of the Property Inspection Date
- (c) If the property is no longer listed for sale
- (d) 180 days after the Property Inspection Date

Please pay within the payment terms to avoid the Deferred Payment Fee. Note: all bank/legal fees incurred in obtaining payment will be the customer's responsibility

Payment Options

Pexa : please quote the invoice number as the reference

Direct Deposit : BSB: 012084 Account Number: 194679655

Account Name: ACT Property Inspections Pty Ltd

Please reference your name and invoice number

Cheques : please make payable to ACT Property Inspections Pty Ltd

[View and pay online now](#)